Letter of Notification for the Van Wert – Haviland 138 kV Transmission Line Adjustment Project

AEP OHIO TRANSMISSION COMPANY™

An AEP Company

BOUNDLESS ENERGY™

PUCO Case No. 26-0729-EL-BLN

Submitted to:
The Ohio Power Siting Board
Pursuant to Ohio Administrative Code
Section 4906-6-05

Submitted by:
AEP Ohio Transmission Company, Inc.

July 27, 2026

LETTER OF NOTIFICATION

AEP Ohio Transmission Company, Inc.

Letter of Notification for the Van Wert – Haviland 138 kV Transmission Line Adjustment Project

4906-6-05 Accelerated Application Requirements

AEP Ohio Transmission Company, Inc. (the Company) provides the following information to the Ohio Power Siting Board (OPSB) in accordance with the accelerated application requirements of Ohio Administrative Code Section 4906-6-05.

On August 25, 2025, AEP submitted a Letter of Notification (LON) to OPSB for the Van Wert–Haviland 138 Kilovolt (kV) Transmission Line Project (Project), which involves rebuilding the existing single circuit Van Wert–Haviland 69 kV Transmission Line as a double circuit transmission line designed at 138 kV and initially operated at 69 kV, replacing wood monopoles with steel monopoles. The total length of the proposed Project is approximately 10.9 miles. Approximately 8.7 miles will be rebuilt within the existing ROW, but requiring 40 to 50 feet of supplemental easement, while approximately 2.2 miles will be built within a new ROW with varying widths up to 100 feet. The Project was approved by OPSB on November 21, 2025 (OPSB Case No. 25-0697-EL-BLN) but has yet to be constructed.

This LON is being submitted to document several minor adjustments to the centerline and ROW of the Project. The information provided below is specific to the adjustments and immediately surrounding area. For clarity, the minor adjustments to the Project that are the subject of this LON are referenced as the Van Wert–Haviland 138 kV Transmission Line Adjustment Project (Adjustment Project).

4906-6-05(B) General Information

B (1) Project Description

Provide the name of the project and applicant's reference number, names and reference number(s) of resulting circuits, a brief description of the project, and why the project meets the requirements for a letter of notification or construction notice application.

The Company proposes the Adjustment Project in the city of Van Wert, and portions of Ridge and Pleasant Townships, all of which are in Van Wert County, Ohio. The Adjustment Project consists of minor modifications to the previously approved centerline and ROW for the Project and involves shifts of approximately 10 to 60 feet in three distinct locations. The adjustments are necessary because of continued coordination with affected landowners and stakeholders, and ongoing engineering and design refinements.

The first adjustment to the approved centerline occurs just outside the Van Wert Substation (Appendix A, Exhibit 3). At the request of the property owner located north of the substation, the approved centerline and ROW were realigned to the southeast and east of the station. This adjustment increases

the impact to a landowner impacted by the original Project but would accommodate future land use development proposed by the owner of the parcel where the approved ROW is located. Agreements are being secured with the impacted landowner to accommodate the additional ROW on their property.

The second adjustment was made in response to the Ohio Department of Transportation's (ODOT's) denial of the originally proposed crossing of U.S. Highway 30, approximately 0.5-mile northeast of the Van Wert Substation. ODOT requested that the crossing be relocated farther east. To accommodate this request, the centerline and ROW were realigned eastward, affecting approximately 0.3 mile of the proposed route south of U.S. Highway 30, while staying west of the solar farm fence line. In this area, the centerline and ROW were shifted between 10 and 50 feet necessitating the acquisition of additional ROW.

The third adjustment is east of the intersection of State Route 127 and a railroad, approximately 0.5 mile north of U.S. Highway 30. The originally approved ROW traversed the City of Van Wert recycling center. However, planned expansion of the recycling facility would have conflicted with the initial ROW placement. To avoid this conflict, the centerline and ROW were realigned approximately 60 feet to the southeast necessitating the acquisition of additional ROW.

Exhibits in **Appendix A** show the OPSB approved Van Wert-Haviland 138 kV Transmission Line, as well as the proposed adjustment areas. **Appendix A Exhibit 1** depicts the overall project area. **Appendix A Exhibit 2** provides an overview of the project on a 1:24,000 scale and has been updated to reflect the Adjustment Project (adjusted areas are visible on page 3). Additionally, **Appendix A Exhibit 3** has been revised to provide a detailed illustration of the adjusted areas (adjusted areas visible on pages 13 to 15).

The Adjustment Project meets the requirement for a LON as defined by item (1)(d)(ii) of Appendix A to Ohio Administrative Code Section 4906-1-01, *Application Requirement Matrix for Electric Power Transmission Lines*:

> (1) New construction, extension, or relocation of single or multiple circuit electric power transmission line(s), or upgrading existing transmission or distribution line(s) for operation at a higher transmission voltage, as follows:
>
> > (d) Line(s) primarily needed to attract or meet the requirements of a specific customer or customers, as follows:
> >
> > > (ii) Any portion of the line is on property owned by someone other than the specific customer or applicant.

The Adjustment Project has been assigned Case No. 26-0729-EL-BLN.

B (2) Statement of Need

If the proposed project is an electric power transmission line or gas pipeline, the applicant provides a statement explaining the need for the proposed facility.

The Adjustment Project involves adjusting approximately 0.6 mile of the Van Wert–Haviland 138 kV Transmission Line. The need for the overall Project remains the same as reported in OPSB Case No. 25-0697-EL-BLN, as described below.

The existing Van Wert–Haviland 69 kV Transmission line is approximately 11 miles long and consists of wooden monopoles, originally installed in 1926, although approximately 4.7 miles of the line were rebuilt in 1974. The conductor on the line was also primarily installed in 1926. The single circuit 69 kV line connects the Company's Haviland 138/69 kV Station to the Van Wert 69 kV Station in Paulding and Van Wert Counties, Ohio.

The Project (b3359) is required to address baseline thermal criteria violations identified by PJM Interconnection, LLC (PJM) in the 2026 Regional Transmission Expansion Plan summer model, on approximately 1.7 miles of the existing single circuit Van Wert–Haviland 69 kV Transmission Line from the North Van Wert Switch to a structure just north of U.S. Highway 30. The specific violation identified by PJM in the 2026 Regional Transmission Expansion Plan modeling from the loss of Haviland–South Van Wert 69 kV line and the North Delphos 138/69 kV transformer #1 scenario, which causes an overload on the Van Wert–North Van Wert 69 kV single circuit line.

The Van Wert Mega Site, an industrial site north of Van Wert, has seen a significant increase in requests for service over the past several years, with 30 requests for transmission service received in the past year. Many of the prospective customers cannot be served by the existing Van Wert area 69 kV network because the load request is too large and would require significant upgrades to the network area. In addition, the site has been certified in Ohio's Job Ready program and has been aggressively marketed. The Project will enable the Company to provide greater flexibility to serve identified load growth at the site.

In addition to alleviating thermal issues identified by PJM, the Project will address numerous asset renewal concerns on the transmission line. Existing facilities exhibit signs of deterioration, including structures with broken ground lead wires, broken insulators, and broken shield wires. Furthermore, the existing structures do not meet National Electric Safety Code Grade B loading criteria, current AEP structural strength requirements, or current American Society of Civil Engineers structural strength requirements. The Project will replace these worn and damaged components and upgrade the line to current design and reliability standards.

Since 2015, one momentary and two permanent outages have occurred on the Haviland–Van Wert 69 kV circuit. The two permanent outages, both due to weather events, caused approximately 66,624 minutes of interruption to an estimated 416 customers served from a wholesale delivery point at the Van Wert Co-op substation.

Without the Project, significant load shedding may be required to maintain safe and reliable operation of the transmission and distribution system under the identified thermal overload conditions. Although load shedding is an approved PJM operational procedure to control thermal overloads, load shedding is not acceptable from the Company's perspective and directly impacts both large commercial and residential customers in the area. The Project is necessary to ensure continued safe and reliable service for customers. Furthermore, upgrading the Haviland–Van Wert 69 kV Line will provide greater flexibility in serving the high-priority Van Wert Mega Site and will help draw customers to the Van Wert area.

The need and solution for rebuilding the entire asset was submitted to PJM as the Haviland–Van Wert 69 kV Transmission Line Rebuild Project. The baseline portion of the Rebuild Project was presented to PJM on October 15, 2021, then subsequently assigned a PJM number of b3359. The supplemental portions (need and solution) were presented to PJM on July 22, 2022, and October 20, 2023, respectively, then subsequently assigned a PJM number of s3142. This Project was included in the Company's 2025 Long-Term Forecast Report on pages 49 (b3359), 76 (s3142), and 77 (s3142) (**Appendix B**).

B (3) Project Location

Provide the location of the project in relation to existing or proposed lines and substations shown on an area system map of sufficient scale and size to show existing and proposed transmission facilities in the project area.

Appendix A Exhibit 1 depicts the overall project area. **Appendix A Exhibit 2** provides an overview of the project on a different scale and has been updated to reflect the Adjustment Project.

B (4) Alternatives Considered

Describe the alternatives considered and reasons why the proposed location or route is best suited for the proposed facility, including but not be limited to, impacts associated with socioeconomic, ecological, construction, or engineering aspects of the project.

Since the filing and approval of the Van Wert–Haviland 138 kV Transmission Line (Case No. 25-0697-EL-BLN), ongoing engineering design efforts and continued coordination with landowners have resulted in three minor adjustments to the OPSB-approved centerline.

Two of these adjustments were requested by landowners to minimize impacts on existing and planned land uses and operations. The third adjustment was a revised crossing of U.S. Highway 30, as requested by ODOT.

No alternative route corridors were evaluated for the Adjustment Project because these three minor adjustments are only refinements to the previously approved alignment. The adjusted route continues to meet all engineering and constructability requirements while reducing potential conflicts. The modifications are illustrated in **Appendix A Exhibit 3**.

Development of alternative route corridors beyond these refinements would require additional line length and could increase impacts on a greater number of property owners. Furthermore, the proposed adjustments avoid impacts on sensitive resources, including wetlands, streams, and known cultural resources eligible for listing on the National Register of Historic Places.

B (5) Public Information Program

Describe its public information program to inform affected property owners and residents of the nature of the project and the proposed timeframe for project construction and restoration activities.

The Company will inform affected property owners and tenants about this Adjustment Project in several ways. Within 7 days of filing this LON, the Company will issue a public notice in a newspaper of general circulation in the Adjustment Project area. The notice will comply with all requirements of Ohio Administrative Code Section 4906-6-08(A) (1-6). Further, the Company will mail a letter by first class mail to affected landowners, tenants, contiguous owners, and any other landowner the Company may approach for an easement necessary for the construction, operation, or maintenance of the Project. The letter will comply with all requirements of Ohio Administrative Code Section 4906-6-08(B). The Company maintains a website (http://aeptransmission.com/ohio/) that provides public access to an electronic copy of this LON and the public notice. An electronic copy of the LON will be provided to the public library in each political subdivision for this Adjustment Project. The Company retains ROW land agents that will discuss Project timelines, construction, and restoration activities, and will convey information to affected owners and tenants during Project development and construction.

B (6) Construction Schedule

Provide an anticipated construction schedule and proposed in-service date of the project.

Construction of the Project is planned to begin in October 2026, with an anticipated in-service date of March 2028.

B (7) Area Map

Provide a map of at least 1:24,000 scale clearly depicting the facility and proposed limits of disturbance with clearly marked streets, roads, and highways, and an aerial image.

Appendix A Exhibit 2 shows the Project area on the U.S. Geological Survey, Latty and Scott quadrangle maps at a 1:24,000 scale. **Appendix A Exhibit 3** shows the imagery from the Esri aerial imagery service dated June 5, 2026, at a scale of 1:6,000.

B (8) Property Agreements

Provide a list of properties for which the applicant has obtained easements, options, and/or land use agreements necessary to construct and operate the facility and a list of the additional properties for which such agreements have not been obtained.

A list of properties affected by the Adjustment Project is provided in **Table 1**. The shift at State Route 127, meant to avoid the City of Van Wert recycling center, will affect one new property owner (parcel 120344527803) who was not affected by the previously approved Van Wert–Haviland 138 kV Transmission Line Project (Case No. 25-0697-EL-BLN). Parcel 120314680000 is newly affected; however, the owner has other property affected by the Project.

Table 1 – Parcels Affected by the Adjustment Project

Property Parcel Number	Agreement Type	Easement or Option Obtained (Yes/No)
120314600000	Existing Rights Adequate	Yes
120314680000	New Easement	No
Parcel with no Parcel Identification Number	New Easement*	Yes
120344520200	Supplemental Easement*	No
120344520202	New Easement*	Yes
120344520100	New Easement*	Yes
170347180000	New Easement*	Yes
120344527803	New Easement	Yes

*Included in approved OPSB filling application Case No. 26-0729-EL-BLN

The easement form exhibits provided in **Appendix C** indicate the minimum rights the Company would require to construct, operate, and maintain these facilities.

B (9) Technical Features

Describe the following information regarding the technical features of the project:

B(9)(a) Operating characteristics estimated number and types of structures required, and right-of-way and/or land requirements.

Transmission Lines

The Adjusted Project is anticipated to include the following:

Voltage:	Designed for 138 kV operated at 69 kV
Conductors:	6, 1033 kcmil Curlew 54/7 ACSR
Static Wire:	2, 7#8 Alumoweld
Insulators:	Polymer
ROW Width:	100 feet
Structure Type:	Relative to the approved LON (OPSB Case No. 25-0697-EL-BLN), three new structures are required for the Project: one steel two-pole custom dead-end, one temporary steel monopole pre-engineered dead-end, and an existing steel monopole braced post (to be reused). The number of steel three-pole custom dead-end structures has been reduced from four to two.

B(9)(b) Electric and Magnetic Fields

For electric power transmission lines that are within one hundred feet of an occupied residence or institution, the production of electric and magnetic fields during the operation of the proposed electric power transmission line.

B(9)(b)(i) Calculated electric and magnetic field strength levels at one meter above ground under the lowest conductors and at the edge of the right-of-way for:

Not applicable. No occupied residences or institutions are within 100 feet of the route adjustments.

B(9)(b)(ii) Design Alternatives

The applicant's consideration of design alternatives with respect to electric and magnetic fields and their strength levels, including alternate conductor configuration and phasing, tower height, corridor location, and right-of-way width.

Not applicable. No occupied residences or institutions are within 100 feet of the route adjustments.

B(9)(c) Project Cost

The estimated capital cost of the project.

The cost estimate for the entire Project, including the Adjustment Project, is $45,877,232 using a Class 4 estimate. This amount is consistent with the estimate included in the original OPSB application. Pursuant to the PJM Open Access Transmission Tariffs, Project costs will be recovered in the Company's Federal Energy Regulatory Commission formula rate (Attachment H-20 to the PJM Open Access Transmission Tariffs) and allocated to the AEP Zone.

B (10) Social and Ecological Impacts

The applicant shall describe the social and ecological impacts of the project:

B(10)(a) Land Use

Provide a brief, general description of land use within the vicinity of the proposed project, including a list of municipalities, townships, and counties affected.

The Project location and vicinity have historically been primarily agricultural land with scattered woodlots and residences. An aerial photograph of the project vicinity is provided in **Appendix A Exhibit 3**. Land use in the vicinity of route adjustments consists primarily of agricultural land used for row crops, a solar facility, and a recycling facility. No forested land is within the adjusted alignment. As a result of these adjustments, the Project's impact on forested land has been reduced by 1.83 acres, to a total impact of 1.52 acres.

B(10)(b) Agricultural Land

Provide the acreage and a general description of all agricultural land, and separately all agricultural district land, existing at least sixty days prior to submission of the application within the potential disturbance area of the project.

The Adjusted Project area outside the Van Wert Substation where the first alignment shift occurs is characterized by agricultural land use. The dominant agricultural use is row crops.

Based on data received from the Van Wert County Auditor's Office on July 8, 2026, the Adjustment Project has no impact on agricultural district lands.

The Company will minimize impacts on agricultural land by placing structures beyond or at the edges of agricultural fields and will primarily install single tangent poles to support the transmission line.

B(10)(c) Archaeological and Cultural Resources

Provide a description of the applicant's investigation concerning the presence or absence of significant archaeological or cultural resources that may be located within the potential disturbance area of the project, a statement of the findings of the investigation, and a copy of any document produced as a result of the investigation.

A Phase 1 cultural resources survey and report were completed in October 2025, and June 2026 by the Company's consultant for the adjusted areas. The report was submitted to the State Historic Preservation Officer. No archaeological sites or historic structures were identified. Correspondence from the State Historic Preservation Office ("SHPO") was received in December 2025, and July 2026. The SHPO stated that the Project will have no adverse effect on historic properties and that no further archaeological work is necessary (**Appendix D**).

B(10)(d) Local, State, and Federal Agency Correspondence

Provide a list of the local, state, and federal governmental agencies known to have requirements that must be met in connection with the construction of the project, and a list of documents that have been or are being filed with those agencies in connection with siting and constructing the project.

A summary of anticipated permits and authorizations for the Adjustment Project is provided in **Table 2**. No other known local, state, or federal requirements must be met before construction begins.

Table 2 – Anticipated Permits for the Adjustment Project

Permit, Authorization, or Coordination	Agency	Date
Clean Water Act Section 404/401	U.S. Army Corps of Engineers Ohio Environmental Protection Agency	Not anticipated.
Archaeology/Architectural	Ohio Historic Preservation Office	Coordination completed in December 2025 and June 2026; no additional work required.
Threatened and Endangered Species	U.S. Fish and Wildlife Service	Consultation completed June 27, 2023.
Threatened and Endangered Species	Ohio Department of Natural Resources	Consultation completed July 19, 2023.
Notice Criteria	Federal Aviation Administration	Determination of No Hazard to Air Navigation letter for original alignment received August 27, 2025. Updated determination letter is anticipated August 2026.
Storm Water Pollution Prevention Plan/ Notice of Intent (for authorization of construction stormwater discharges under General Permit OHC00006)	Ohio Environmental Protection Agency	NOI was approved 10/01/2025 – will complete permit modification as needed.
Permit to Work Along County Roads	Paulding County	Anticipated filing in winter or spring of 2027.
Highway Crossing	ODOT	Crossing permit for U.S. Highway 30 has been approved and has an expiration date of January 1, 2027. Crossing permit for State Route 127 is pending approval from ODOT.
Floodplain	Van Wert County Paulding County	Floodplain Permits from Van Wert County were issued in November 2025. Coordination with the County Floodplain Administrator is currently in progress to confirm whether the permit applies to the adjusted project areas.

B(10)(e) Threatened, Endangered, and Rare Species

Provide a description of the applicant's investigation concerning the presence or absence of federal and state designated species (including endangered species, threatened species, rare species, species proposed for listing, species under review for listing, and species of special interest) that may be located within the potential disturbance area of the project, a statement of the findings of the investigation, and a copy of any document produced as a result of the investigation.

On June 20, 2023, coordination letters were submitted to the U.S. Fish and Wildlife Service and the Ohio Department of Natural Resources seeking an environmental review of the Project for potential impacts on state and federally protected species. The U.S. Fish and Wildlife Service and Ohio Department of Natural Resources provided responses on June 27, 2023, and on July 19, 2023, respectively. There are no records of state or federally listed plants or animals within 1 mile of the specified Project area. Copies of the agencies' responses are presented in **Appendix D**.

Appendix E Table 5 lists the federal and state threatened or endangered species in the Project area. Potentially suitable habitat for the pondhorn and pugnose minnow was observed within the Project area. However, no in-water work in perennial streams or open water features are proposed by the Company. Potentially suitable summer foraging and roosting habitat was observed within the Project area for the Indiana bat, northern long-eared bat, little brown bat, and tricolored bat. It is anticipated that the Company will conduct tree clearing for the Project between October 1 and March 31. No potentially suitable habitat for the northern harrier or upland sandpiper was observed within the Project area. Therefore, no impacts are anticipated, and avoidance dates are not applicable.

Based on the nature of the proposed Adjustment Project activities, timing of construction, and habitat characteristics of the surrounding vicinity, construction impacts on protected species are not anticipated.

B(10)(f) Areas of Ecological Concern

Provide a description of the applicant's investigation concerning the presence or absence of areas of ecological concern (including national and state forests and parks, floodplains, wetlands, designated or proposed wilderness areas, national and state wild and scenic rivers, wildlife areas, wildlife refuges, wildlife management areas, and wildlife sanctuaries) that may be located within the potential disturbance area of the project, a statement of the findings of the investigation, and a copy of any document produced as a result of the investigation.

The Company's consultant conducted a wetland and stream delineation survey in the Adjustment Project area on June 18, 2026, and prepared an Ecological Survey Report, which is provided in **Appendix E**. The survey of the Adjustment Project area identified no wetlands, streams, or open water features. The Adjustment Project construction activities will not result in discharge of fill in any delineated features.

Based on a review of the Protected Areas Database of the United States and the Conservation Easement Database, there are no state or national parks, forests, wildlife areas, or mapped conservation easements in the vicinity of the Adjustment Project.

The Federal Emergency Management Agency (FEMA) Flood Insurance Rate Map was reviewed to identify floodplains or flood hazard areas that have been mapped within the Adjustment Project area (specifically, map numbers 39125C0290E, 39125C0405E, 3907840002B, 39161C0055C, 39161C0065C). Based on this mapping, FEMA-designated 100-year floodplains associated with Prairie Creek, Hoaglin Creek, and Maddox Creek are not crossed by the proposed adjustments. Local floodplain permitting is not expected to be required for this scope of the Adjustment Project.

B(10)(g) Unusual Conditions

Provide any known additional information that will describe any unusual conditions resulting in significant environmental, social, health, or safety impacts.

To the best of the Company's knowledge, no unusual conditions exist that would result in significant environmental, social, health, or safety impacts.

Appendix A Project Exhibits

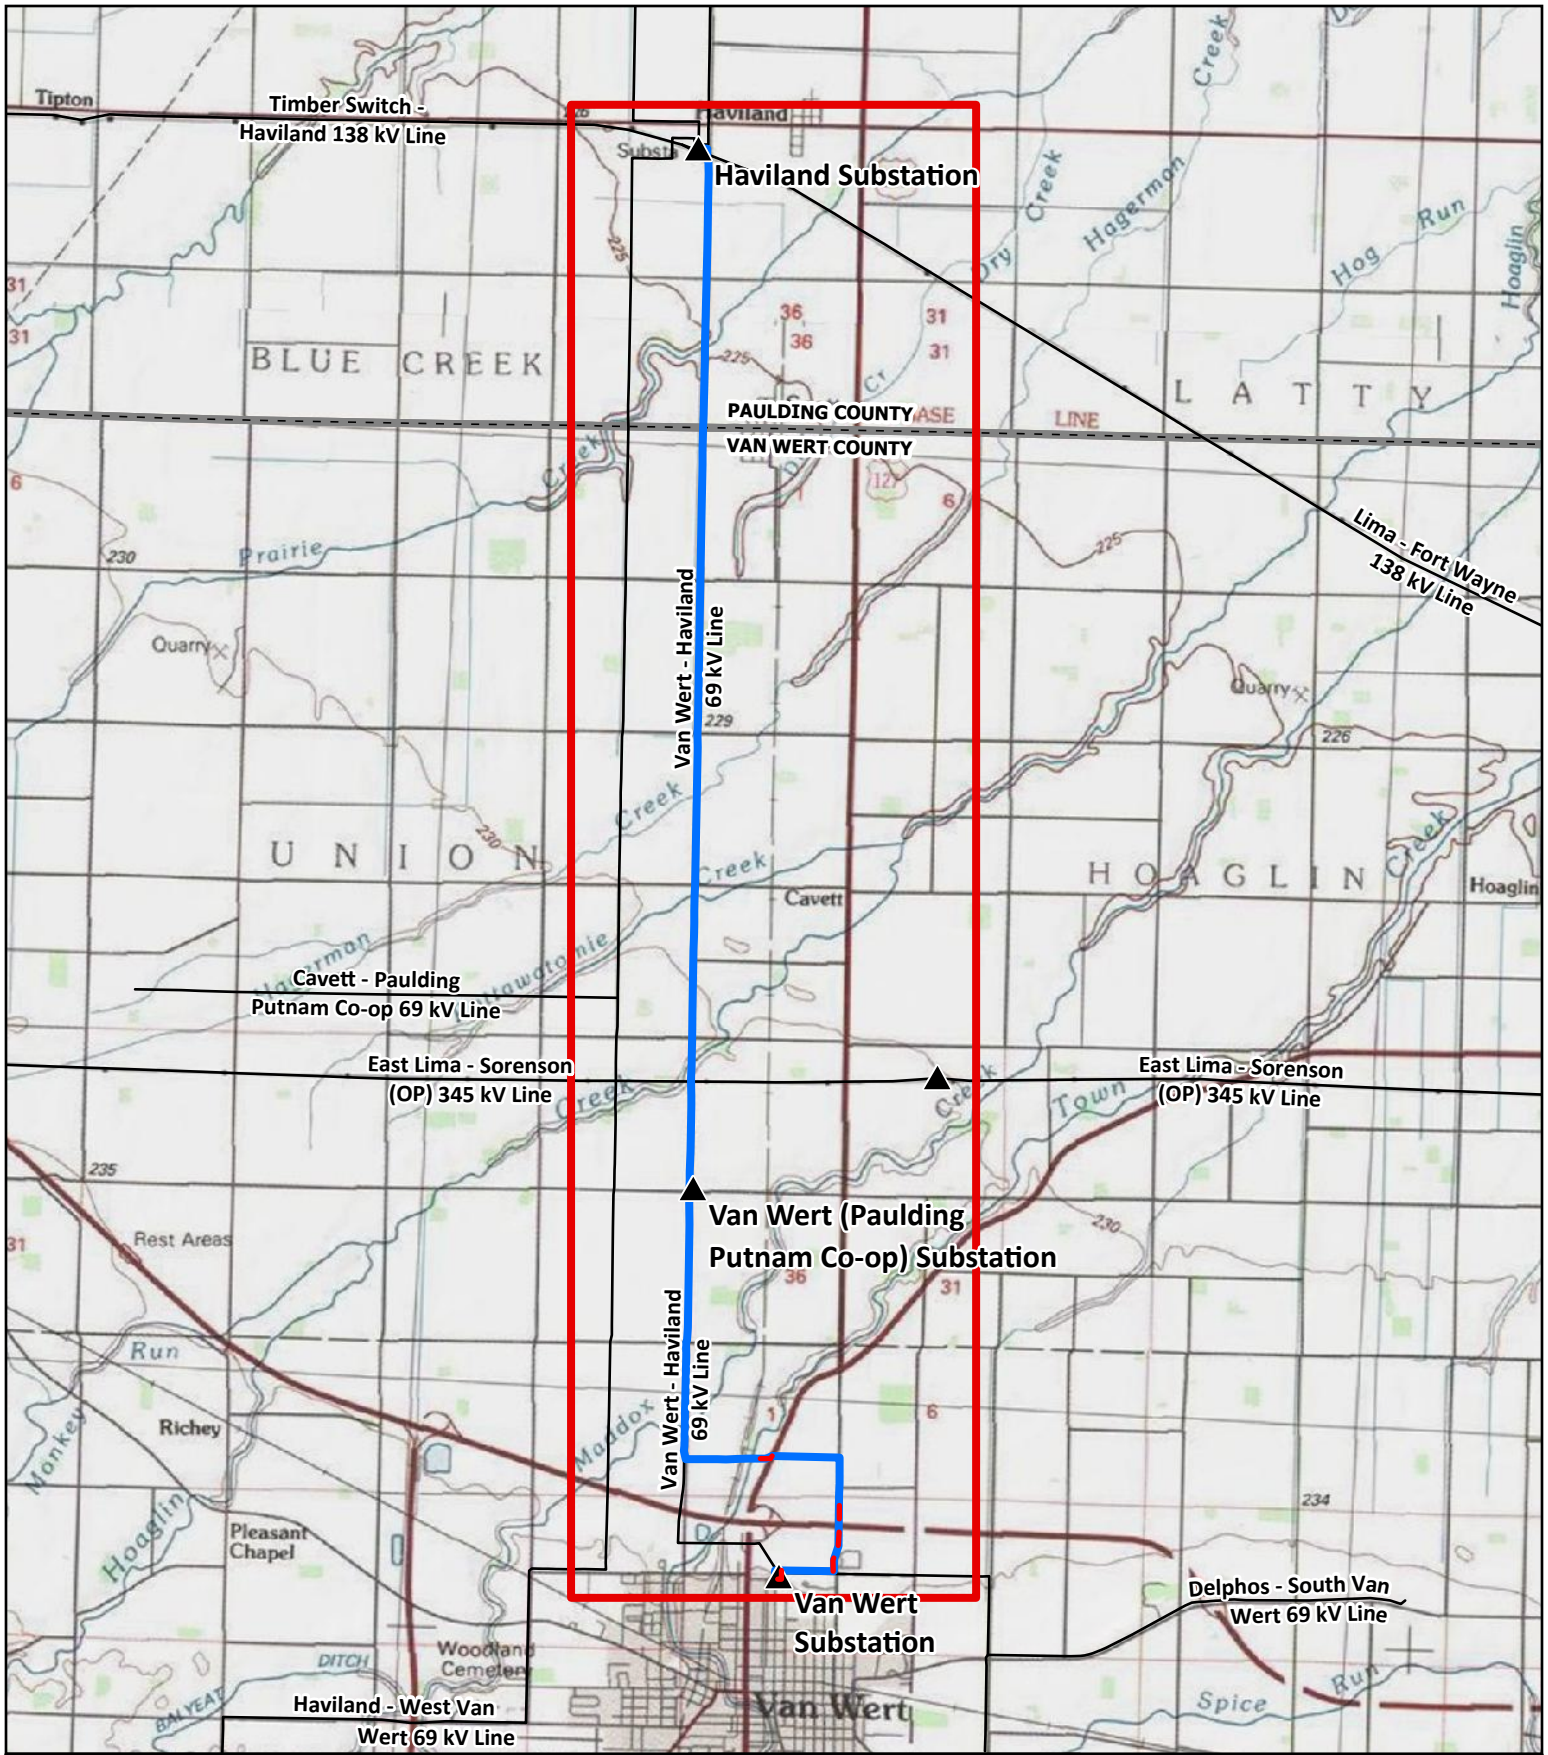

Counties
Existing Transmission Line
Proposed Adjustment
OPSB Approved Van Wert-Haviland 138 kV Transmission Line (Filed 8/25/2025)
Existing Substation
Study Area

Base Map Source:
USGS Topographic Map

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:80,000

N

7/21/2026

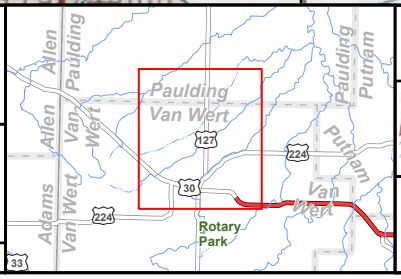

Exhibit 1
Topographic Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 5,000 10,000
Feet

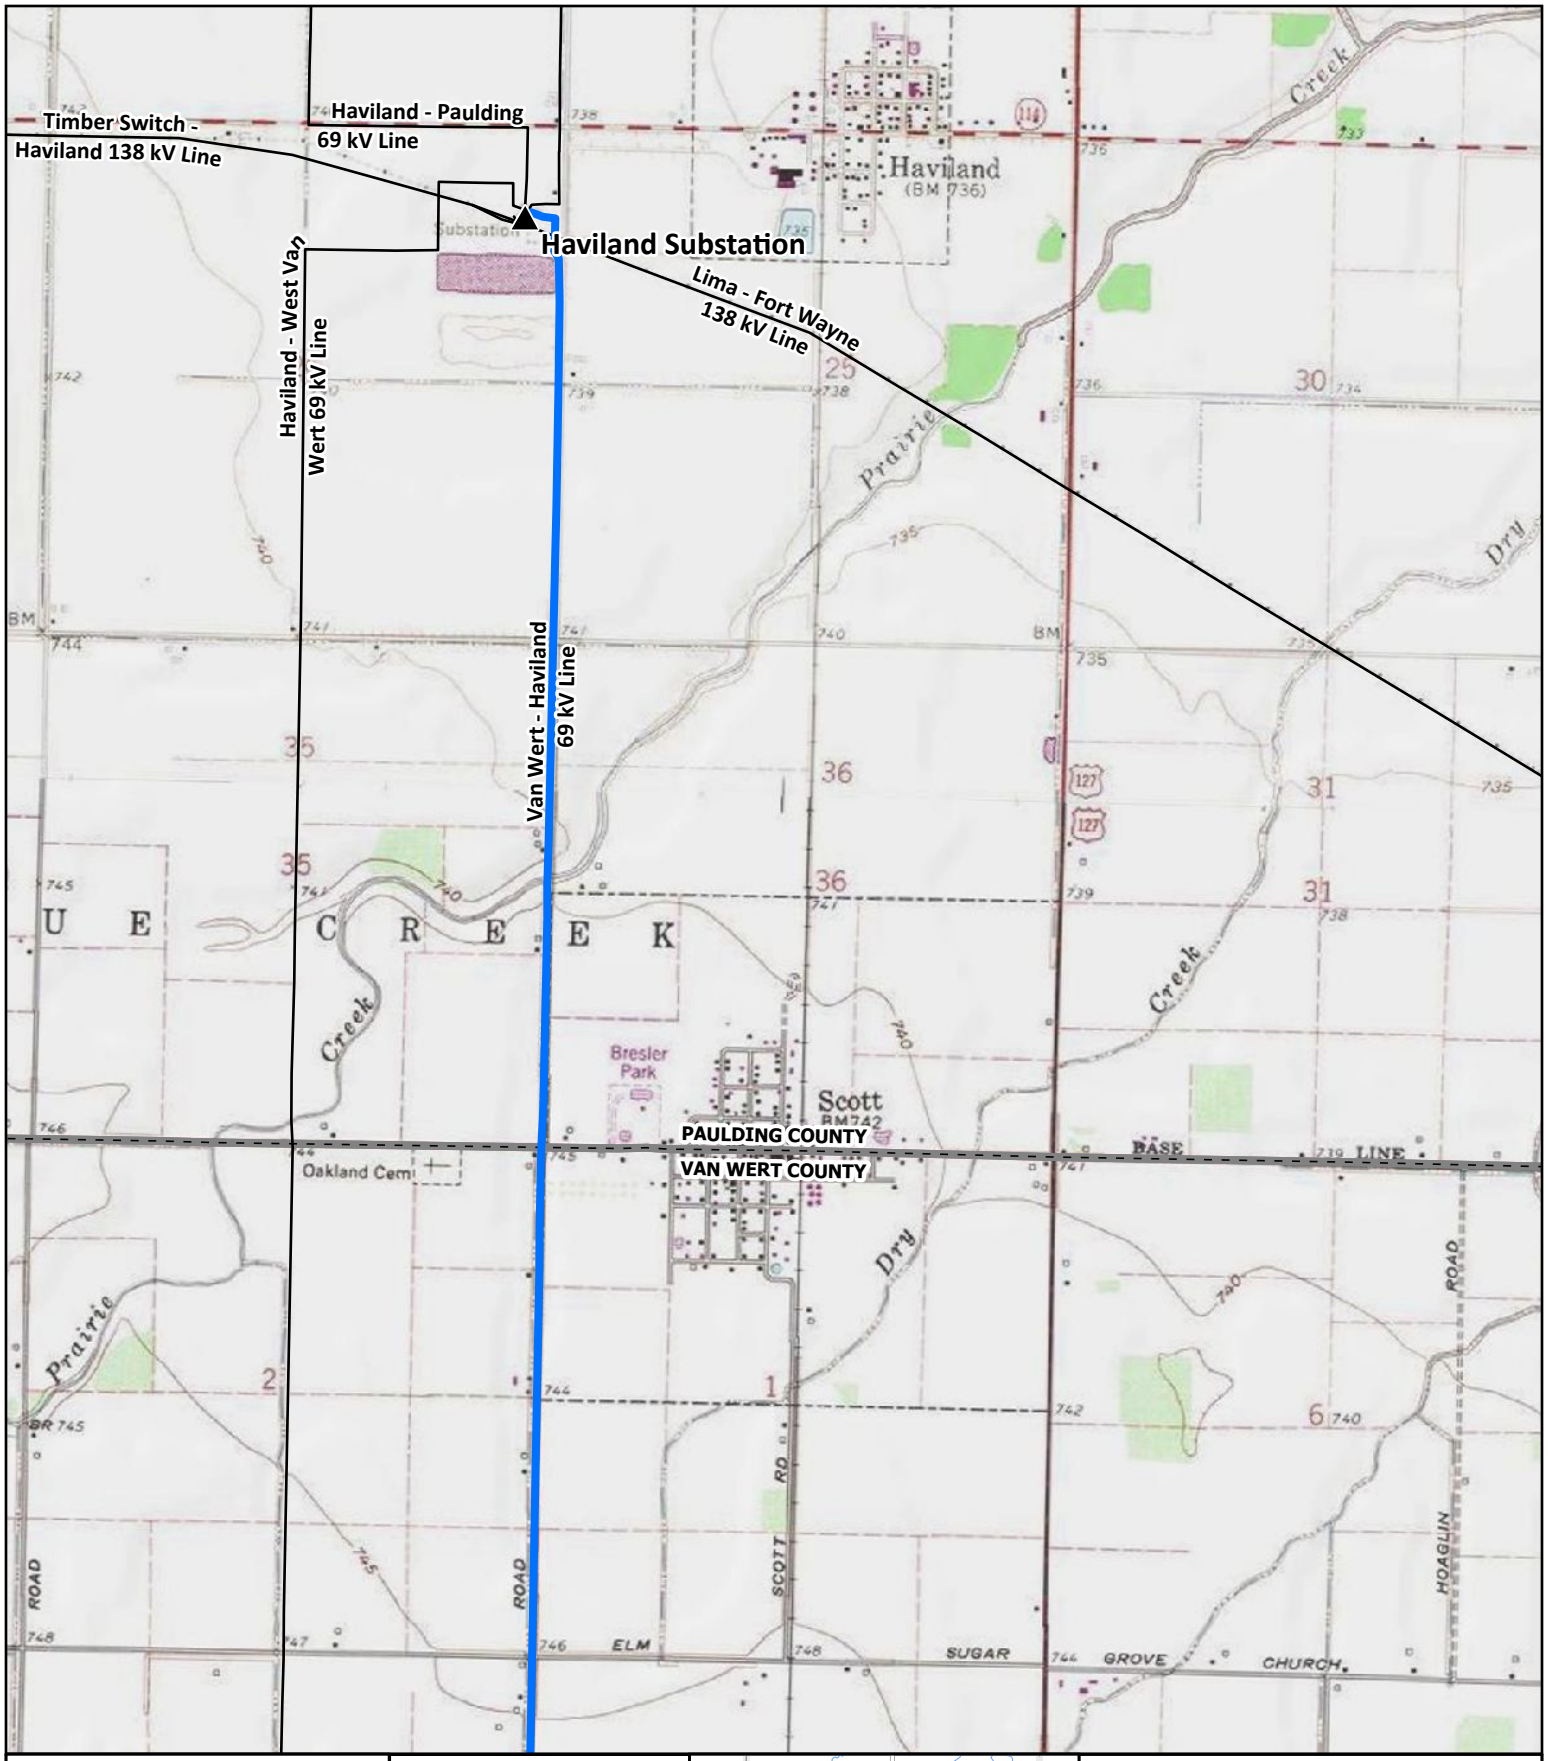
Timber Switch - Haviland 138 kV Line
Haviland - Paulding 69 kV Line
Haviland Substation
Haviland - West Van Wert 69 kV Line
Lima - Fort Wayne 138 kV Line
Van Wert - Haviland 69 kV Line
Haviland (BM 736)
Bresler Park
Scott BM 742
PAULDING COUNTY
VAN WERT COUNTY
Oakland Cem
Rotary Park
Counties
Existing Transmission Line
Proposed Adjustment
OPSB Approved Van Wert-Haviland 138 kV Transmission Line (Filed 8/25/2025)
Existing Substation
Base Map Source: USGS Topographic Map Latty and Scott Quadrangles
Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:24,000
N
7/21/2026
Exhibit 2
Topographic Map
AEP OHIO TRANSMISSION COMPANY
Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH
0
1,500
3,000
Feet

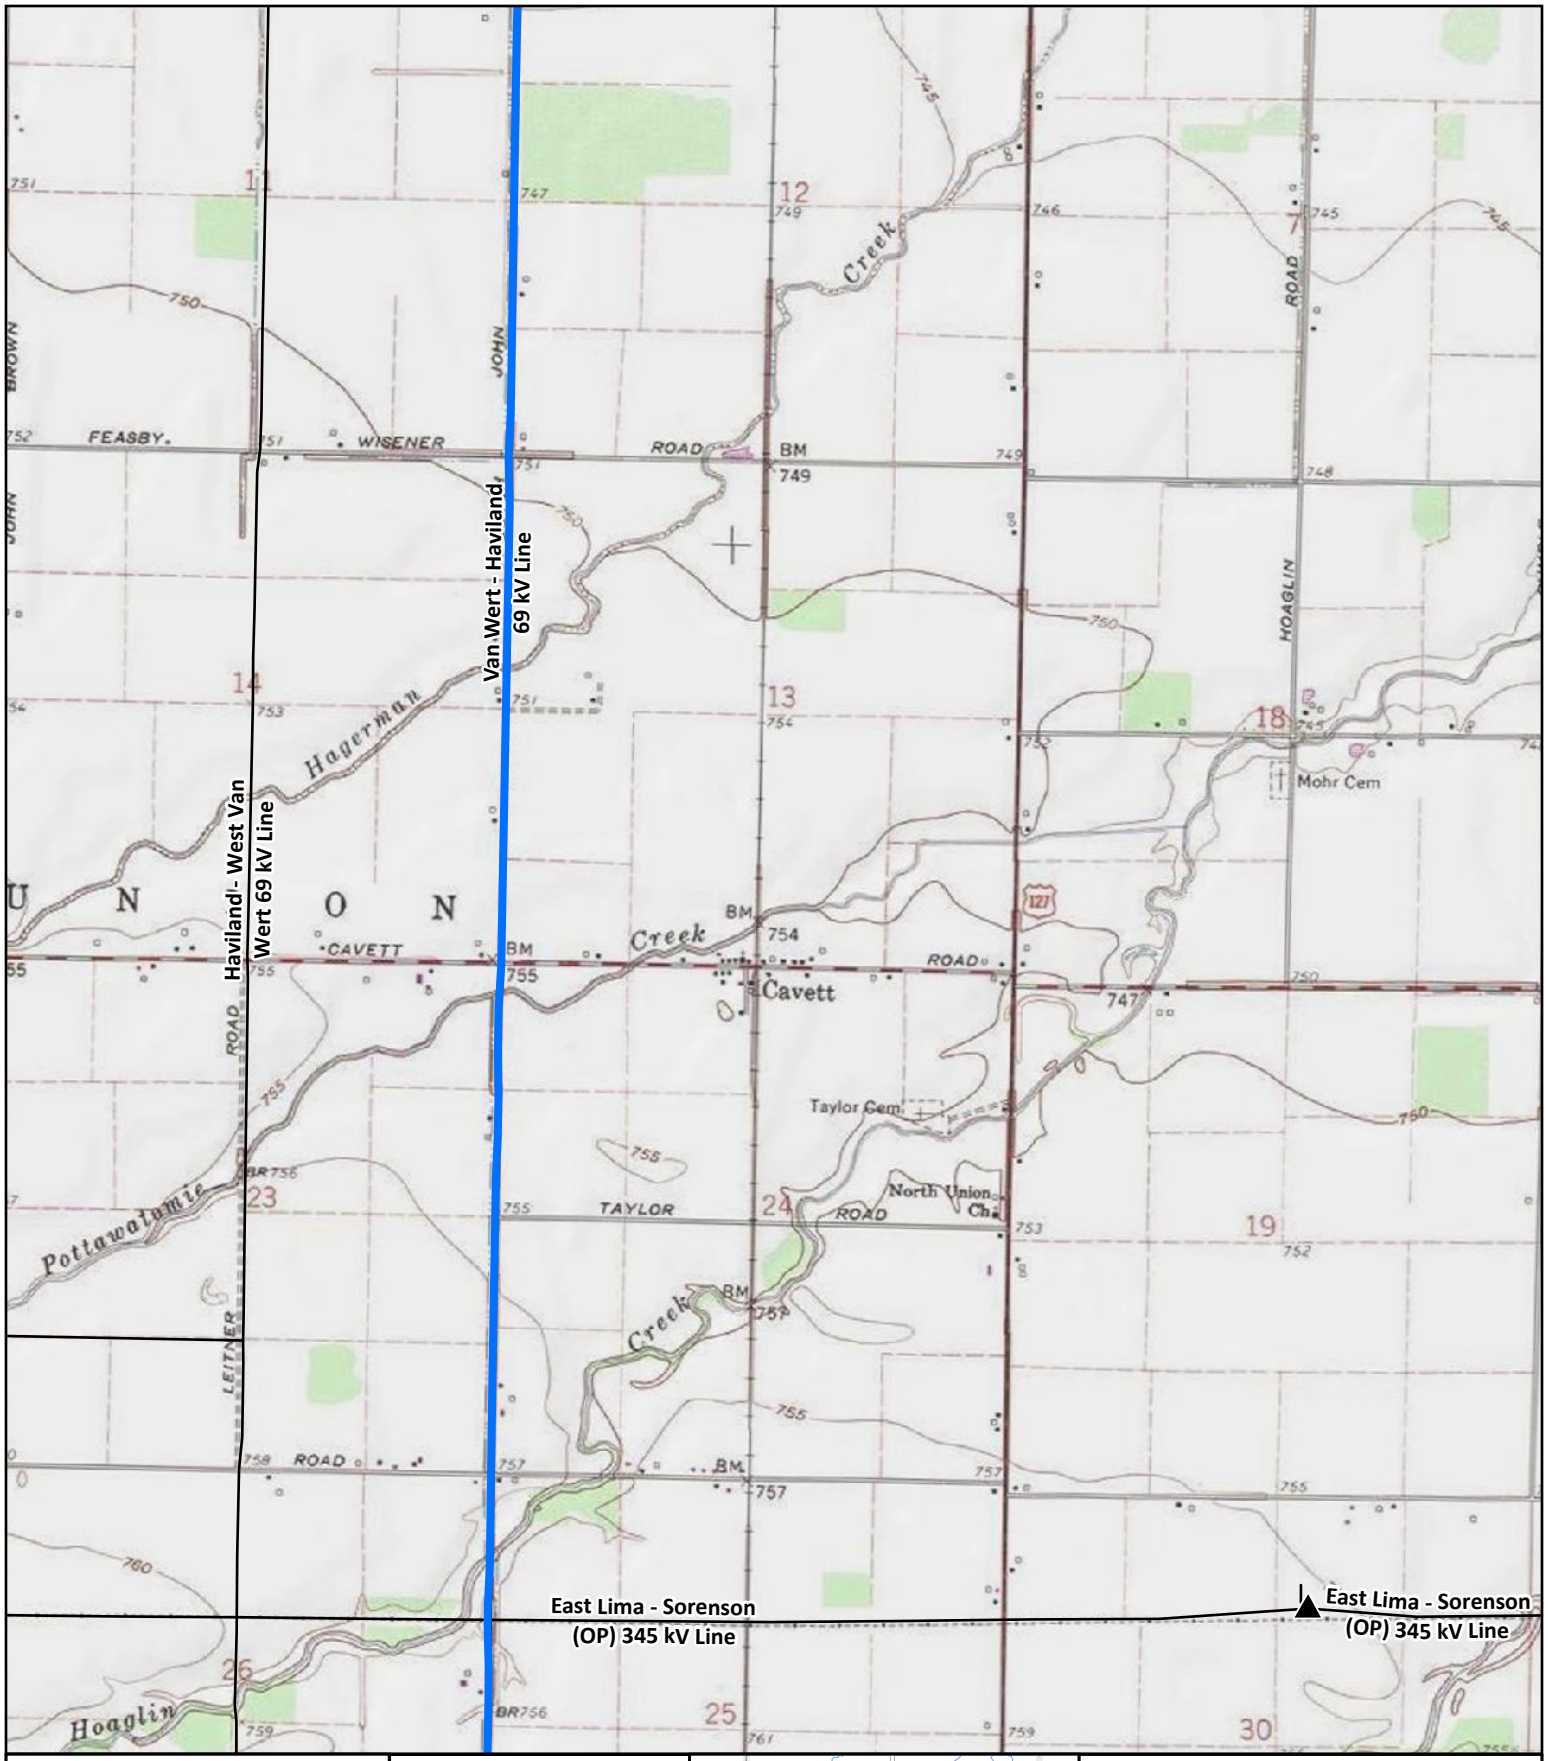
Van Wert - Haviland 69 kV Line
Haviland - West Van Wert 69 kV Line
East Lima - Sorenson (OP) 345 kV Line
East Lima - Sorenson (OP) 345 kV Line
FEASBY
WISENER
ROAD
CAVETT
TAYLOR
ROAD
Cavett
Mohr Cem
Taylor Cem
North Union Ch
Hagerman Creek
Pottawatomie Creek
Hoaglin
BM 749
BM 754
BM 755
BM 757
BR756
JOHN
BROWN
HOAGLIN
LEITNER
UNION
Counties
Existing Transmission Line
Proposed Adjustment
OPSB Approved Van Wert-Haviland 138 kV Transmission Line (Filed 8/25/2025)
Existing Substation
Base Map Source:
USGS Topographic Map
Latty and Scott Quadrangles
Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:24,000
N
7/21/2026
Allen
Paulding
Van Wert
Putnam
Adams
Rotary Park
Exhibit 2
Topographic Map
AEP OHIO TRANSMISSION COMPANY
Van Wert-Haviland 138 kV
Transmission Line Project
Van Wert and Pauling County, OH
0
1,500
3,000
Feet

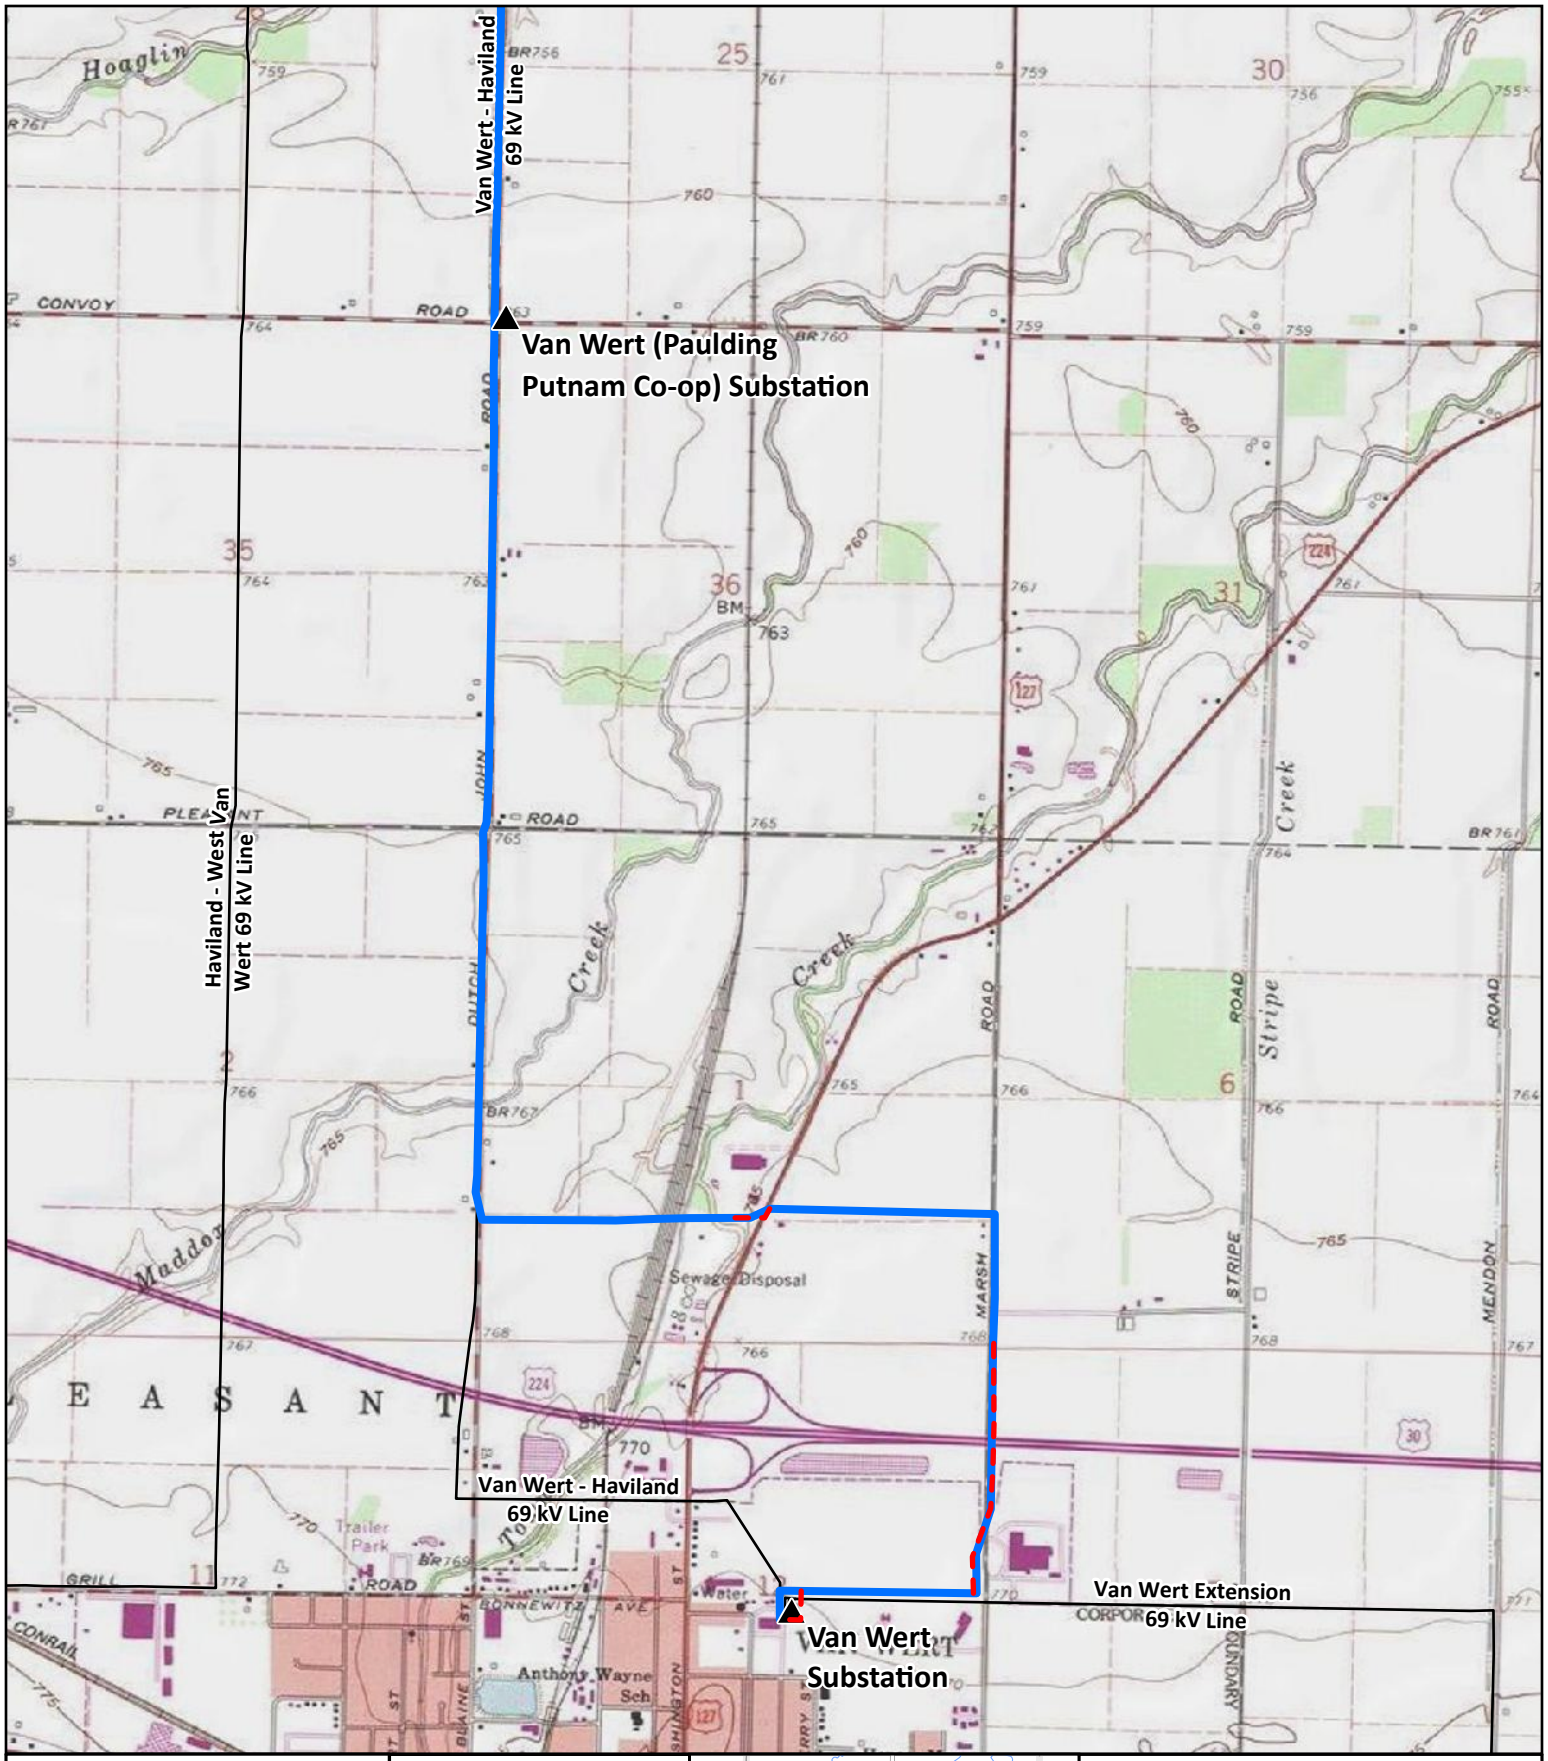

Counties
Existing Transmission Line
Proposed Adjustment
OPSB Approved Van Wert-Haviland 138 kV Transmission Line (Filed 8/25/2025)
Existing Substation

Base Map Source:
USGS Topographic Map
Latty and Scott Quadrangles

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:24,000

N

7/21/2026

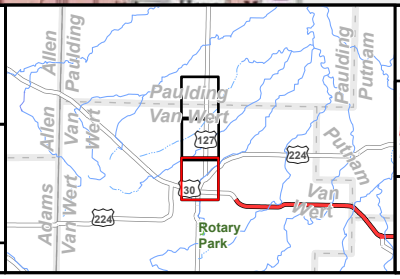

Exhibit 2
Topographic Map

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 1,500 3,000
Feet

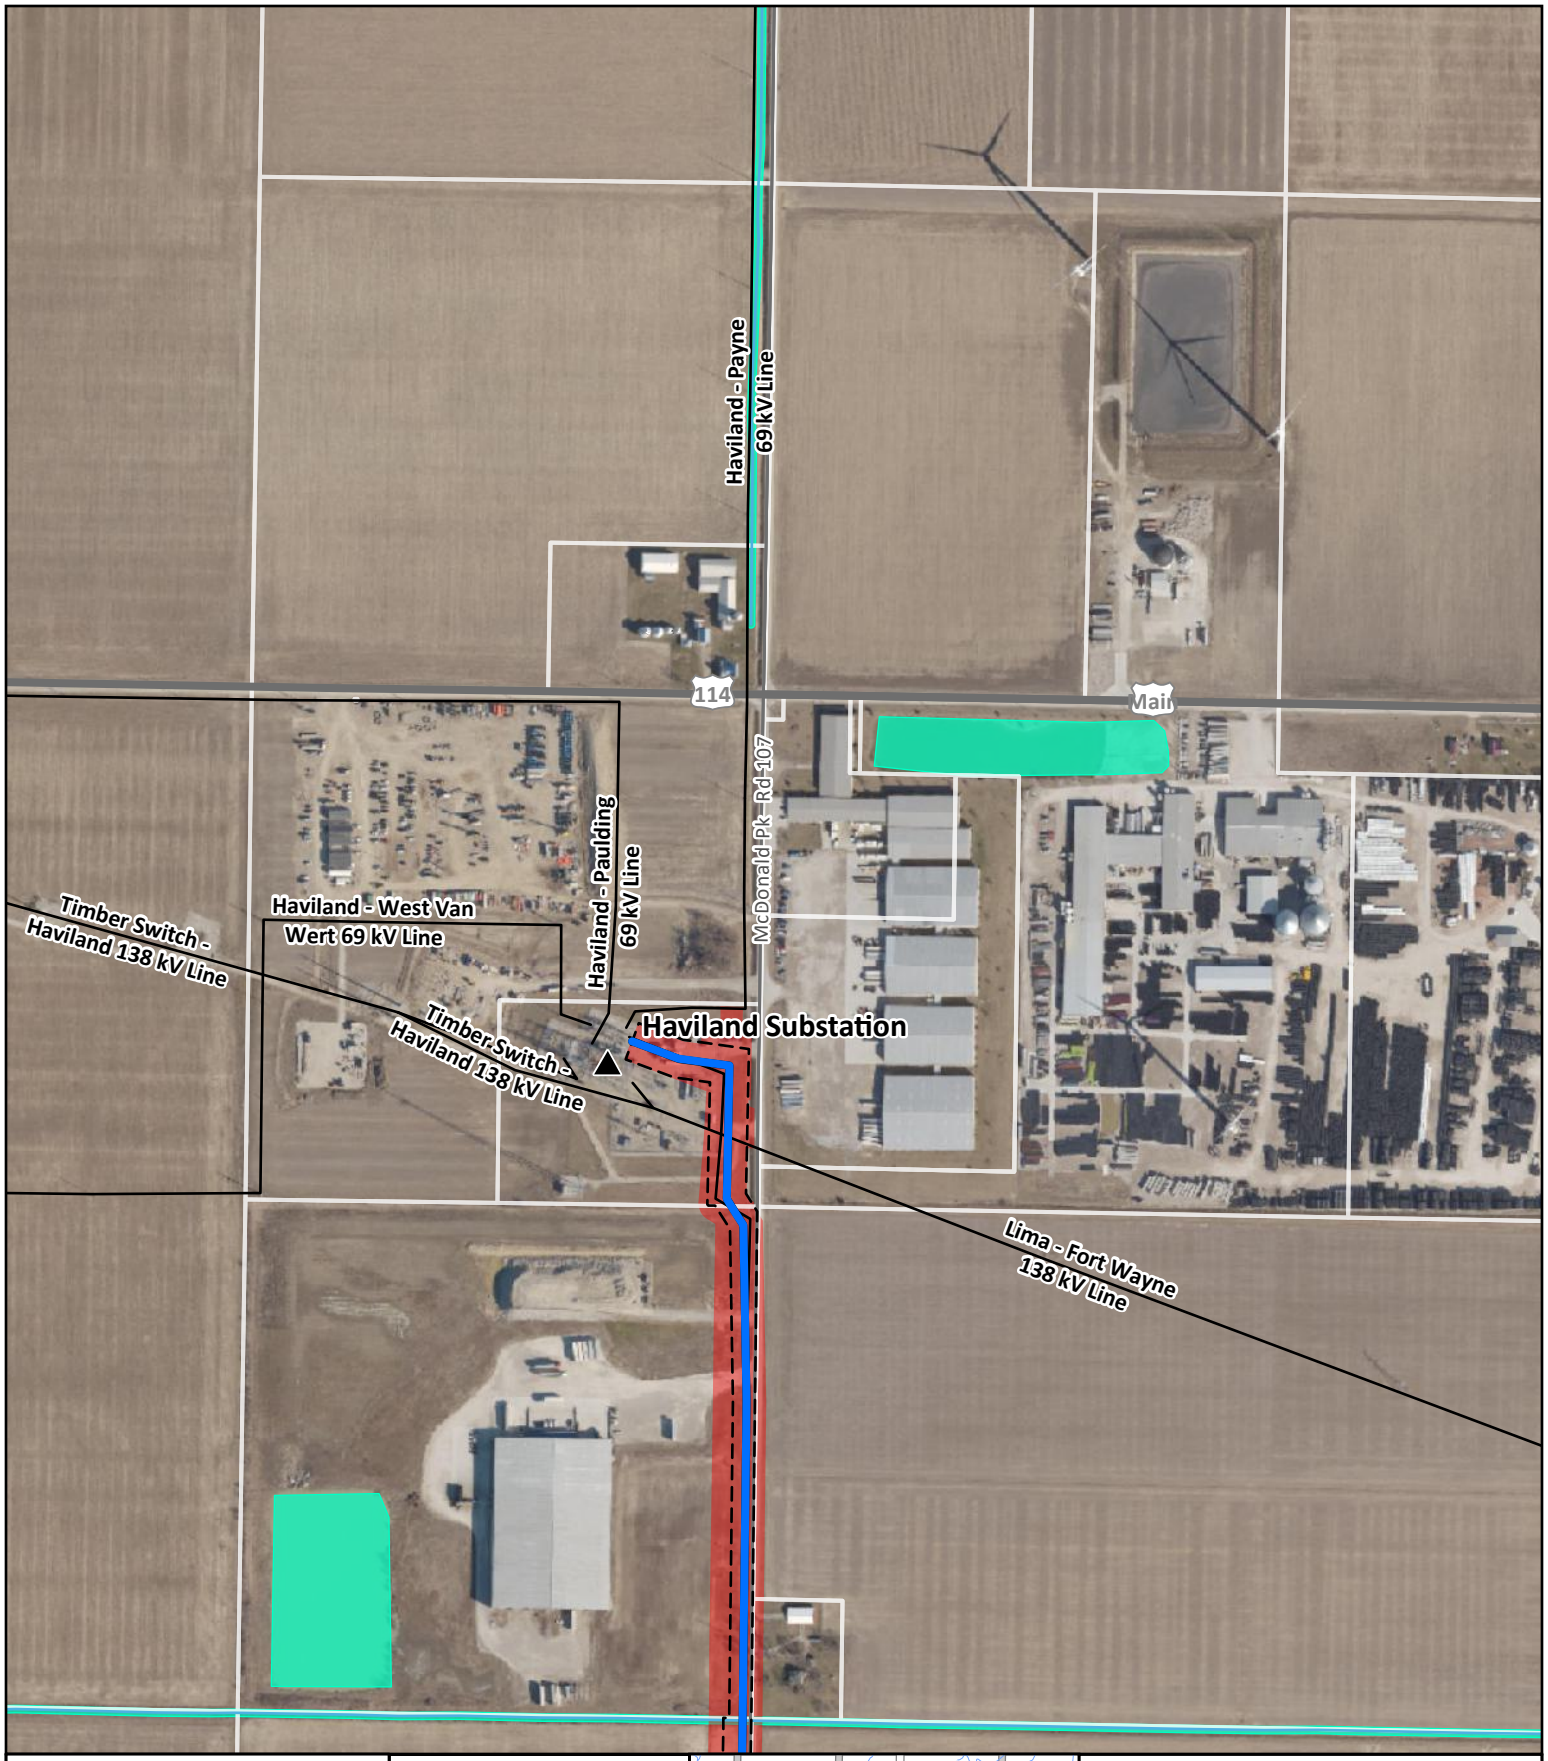

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

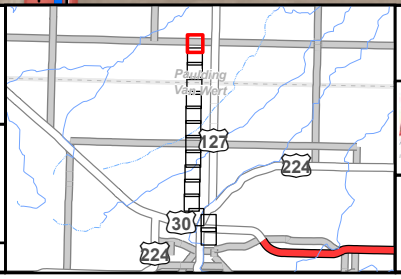

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

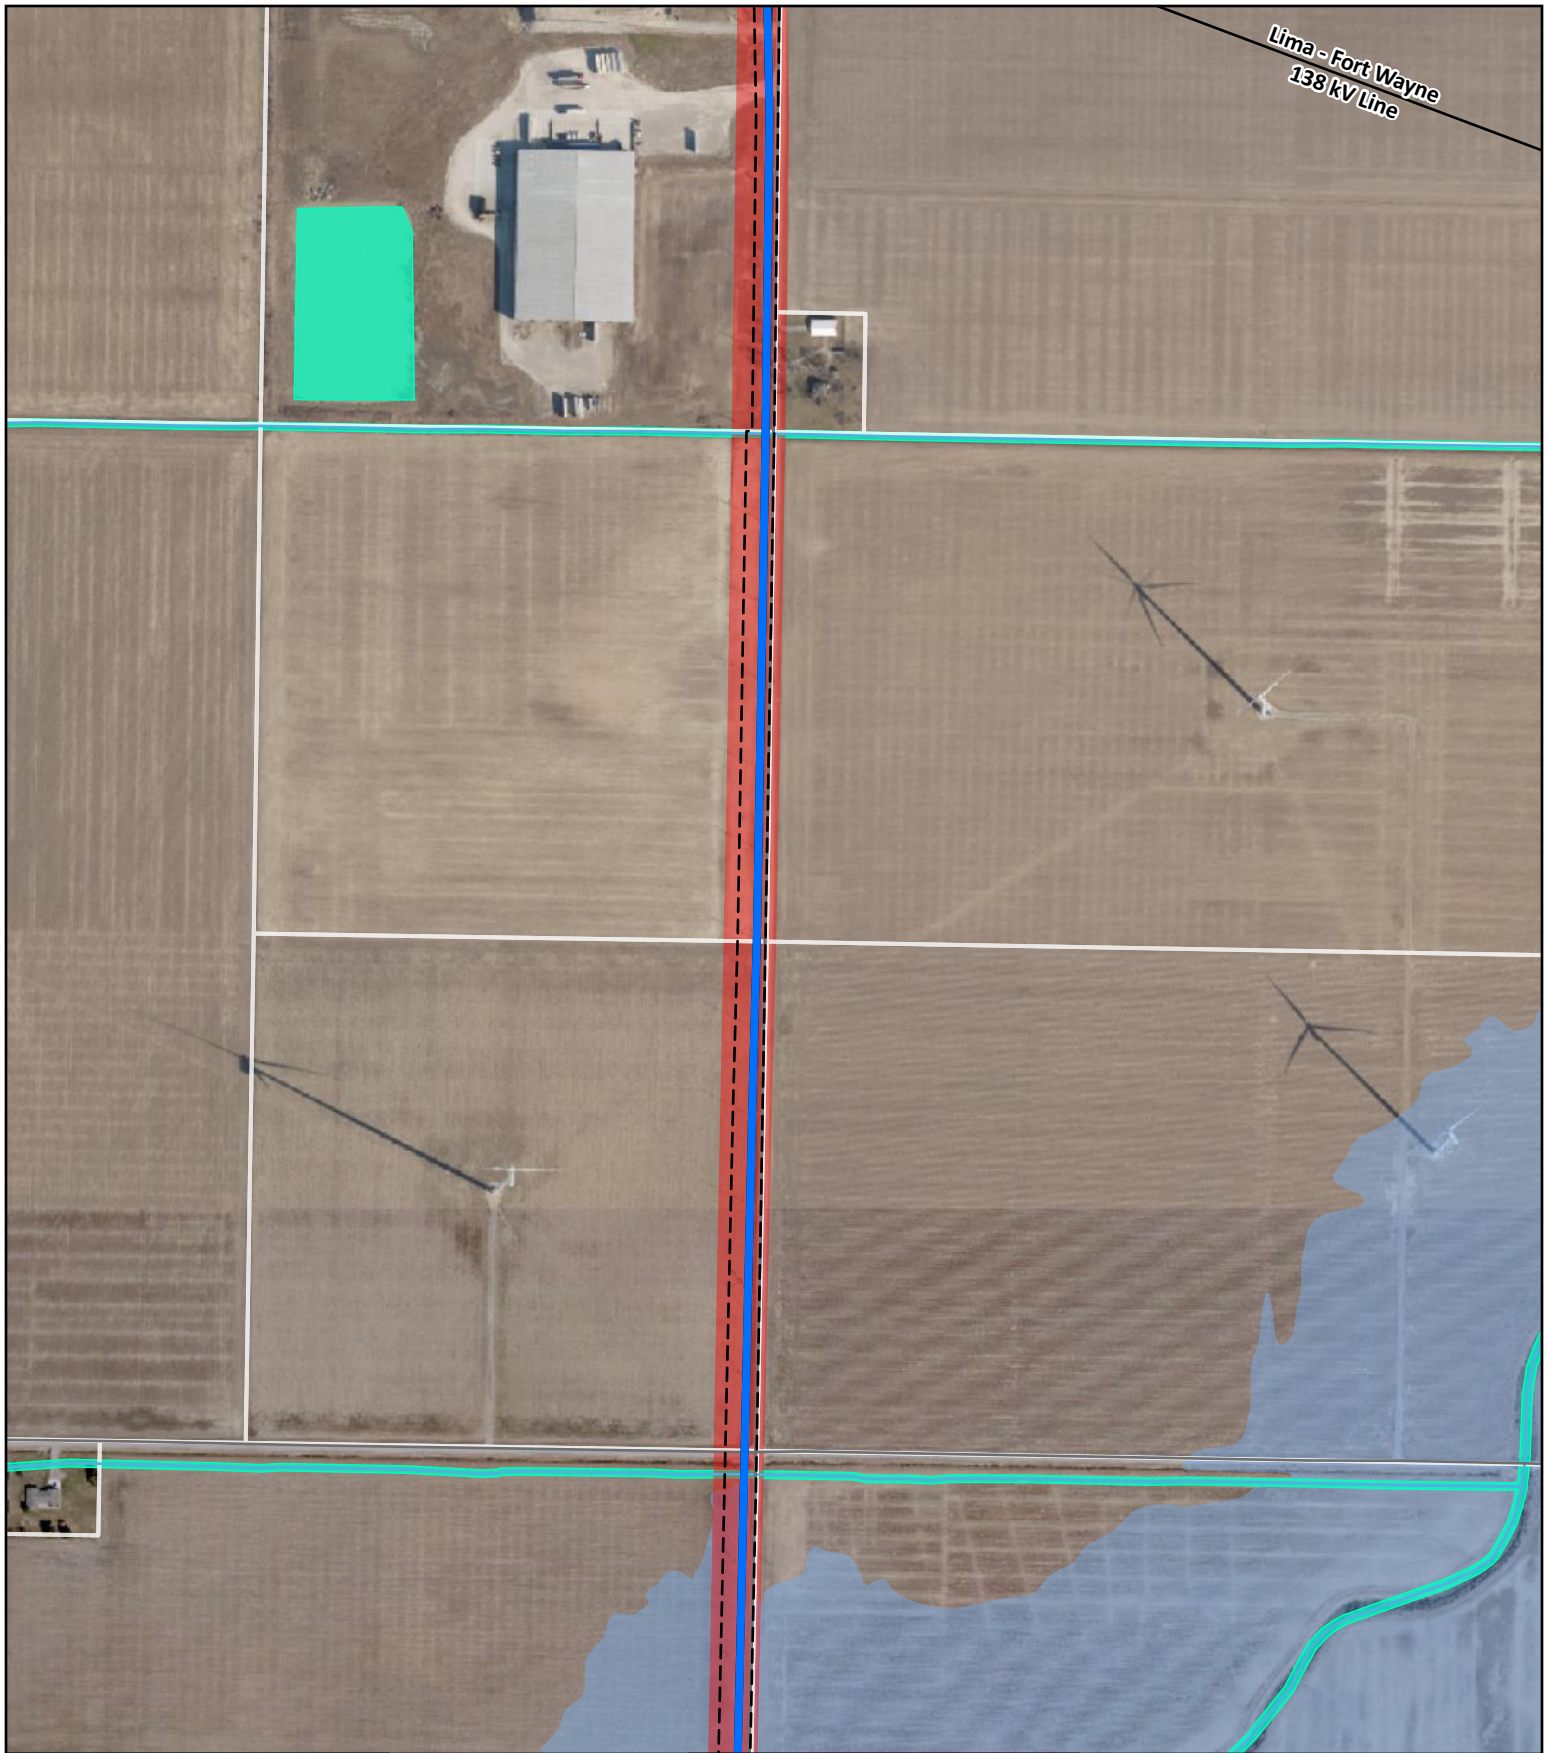

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

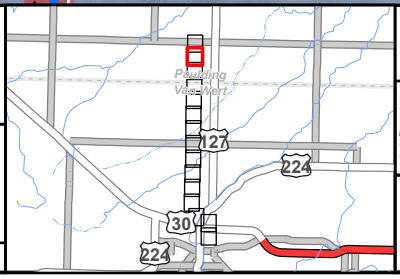

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

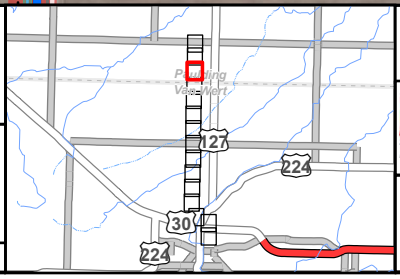

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

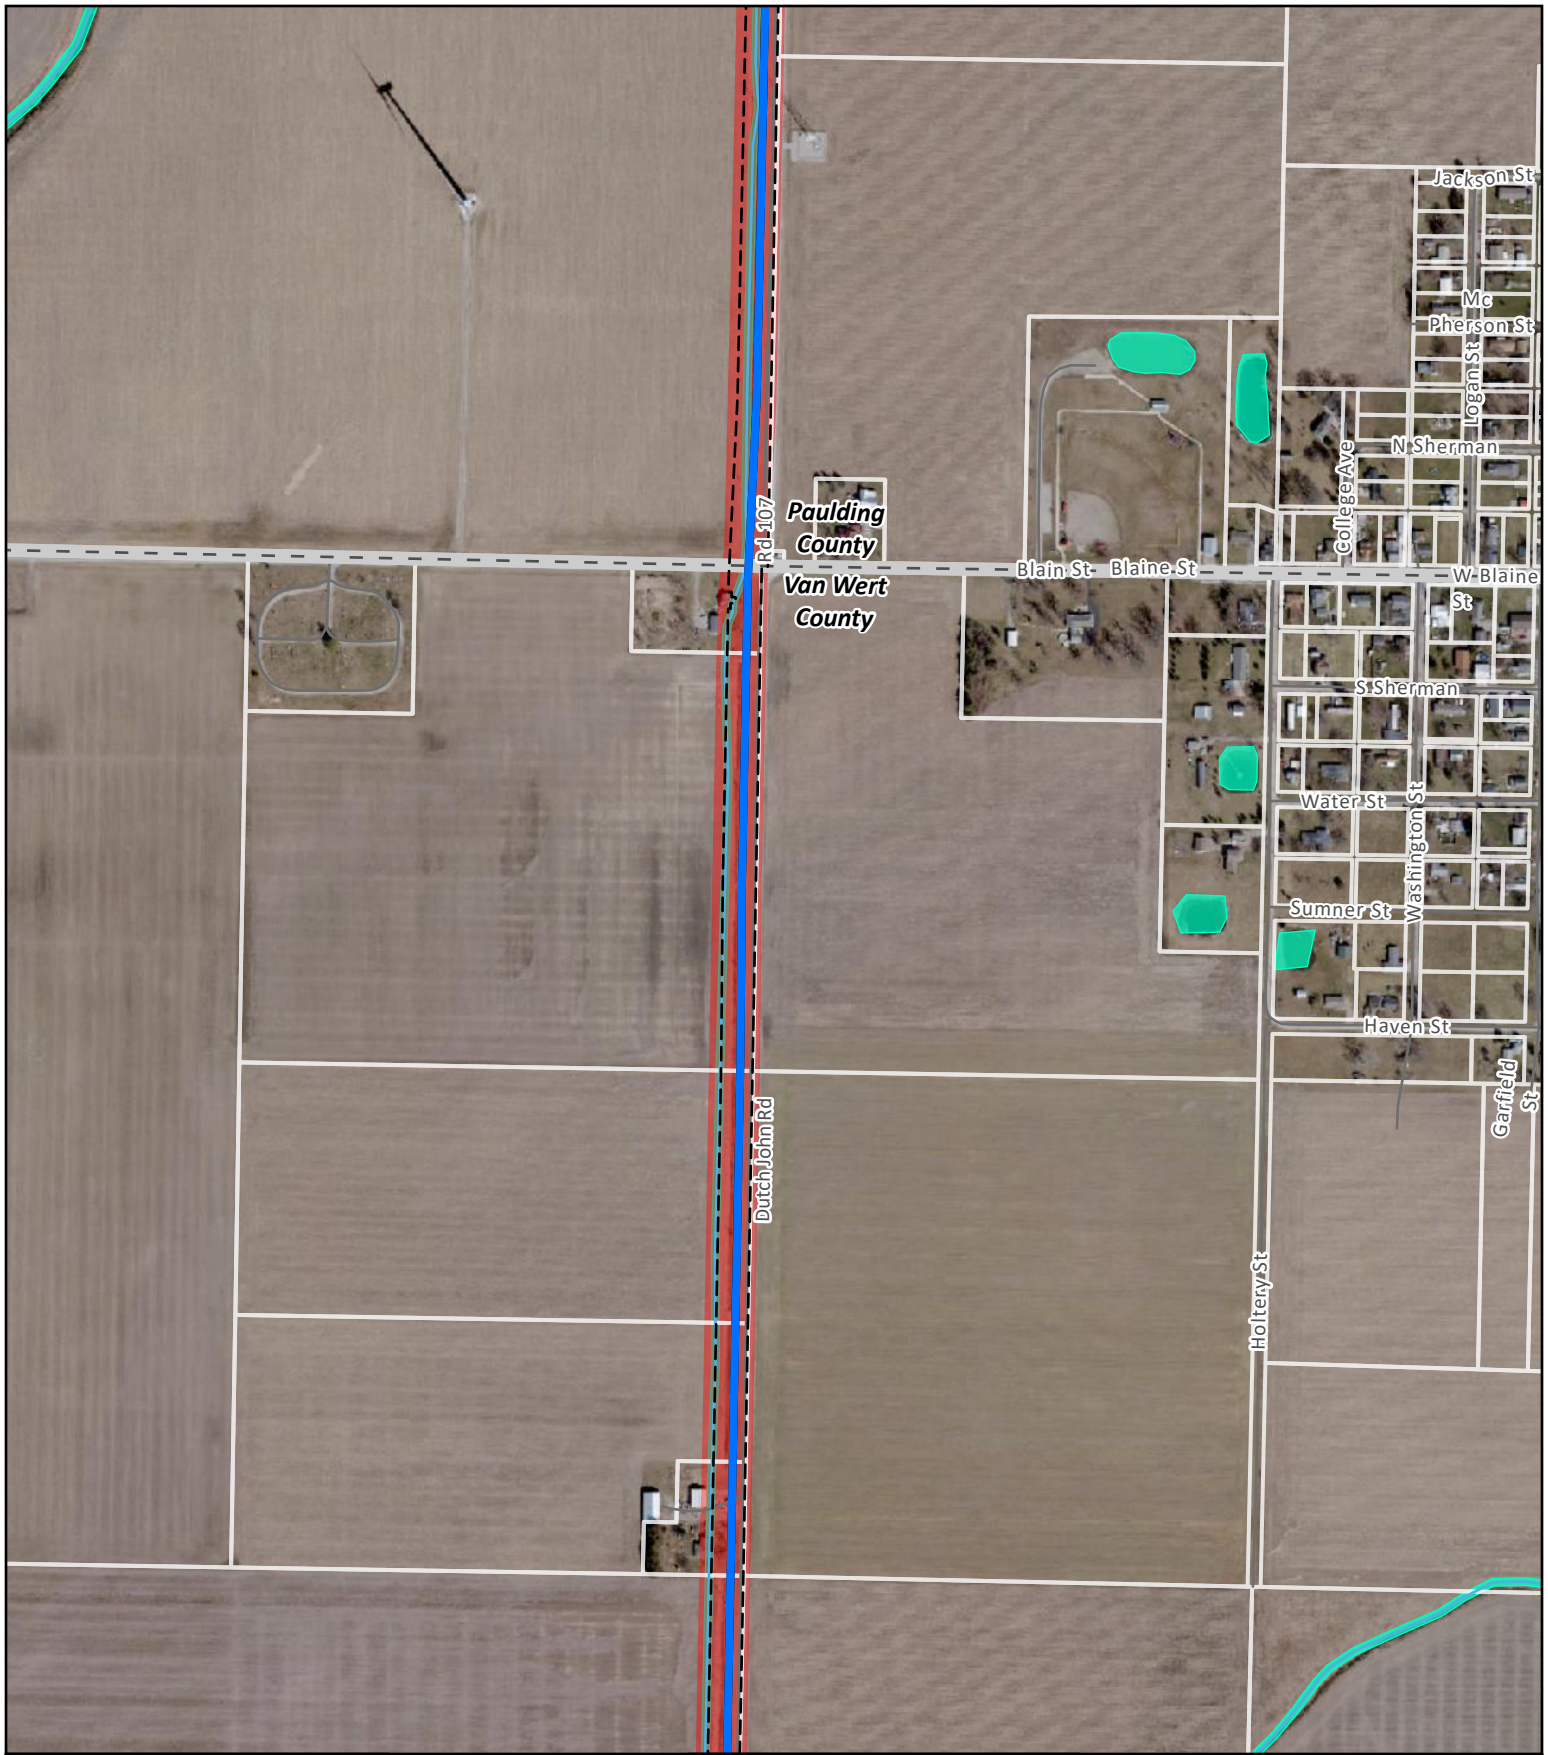

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

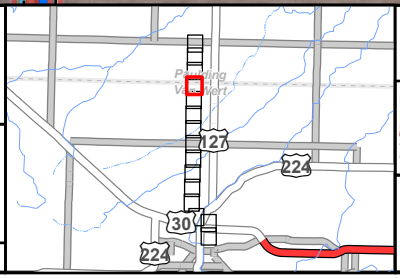

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

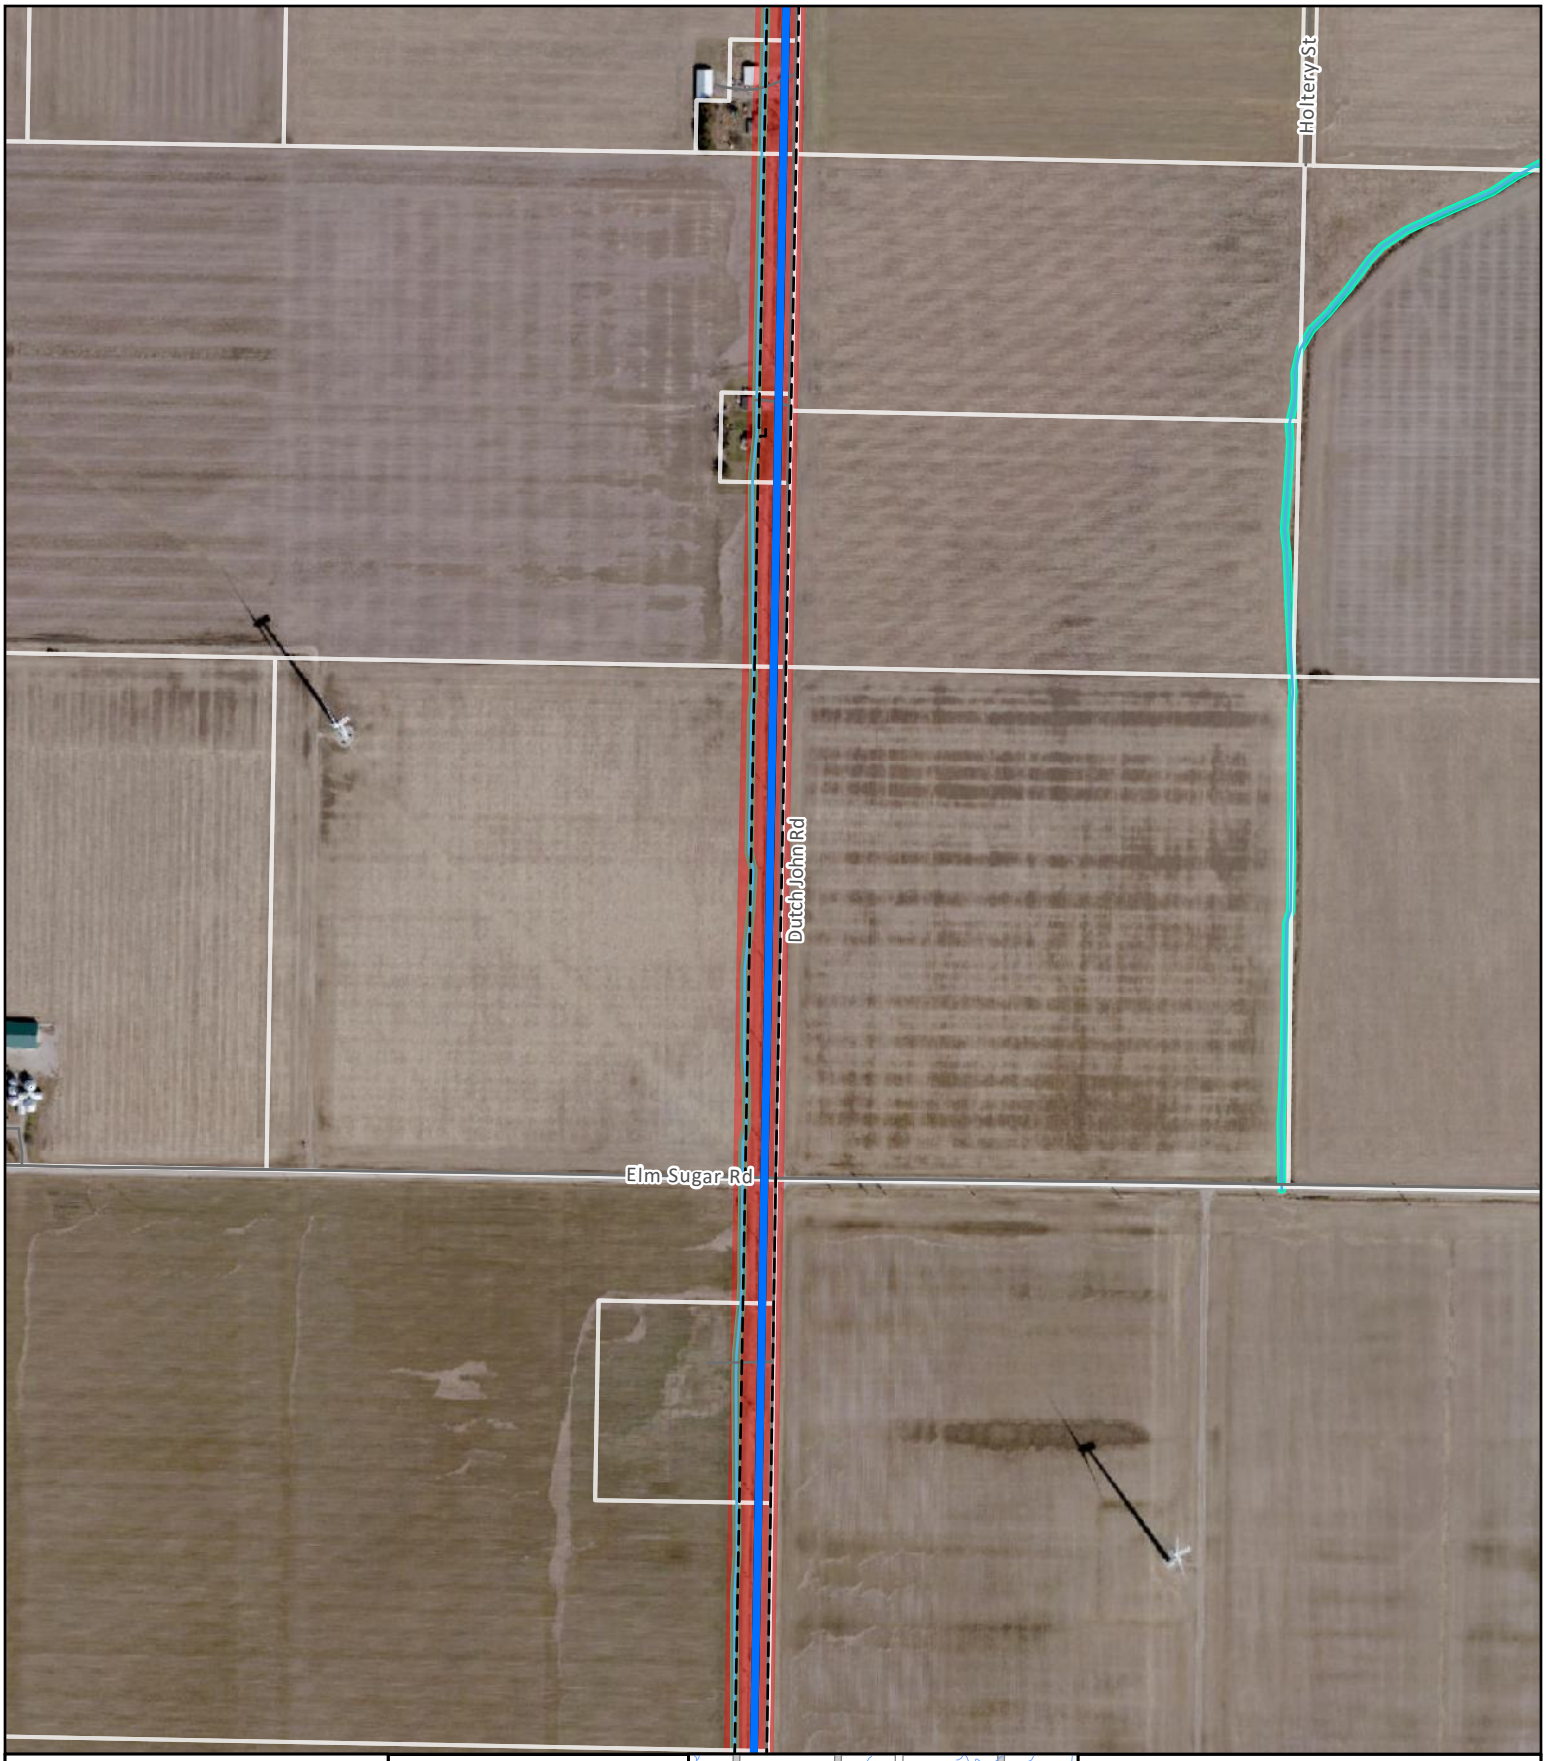

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

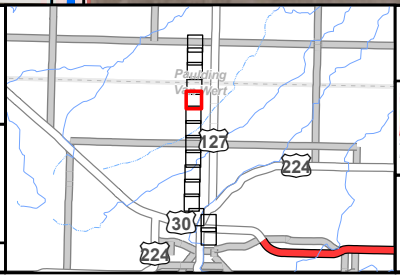

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

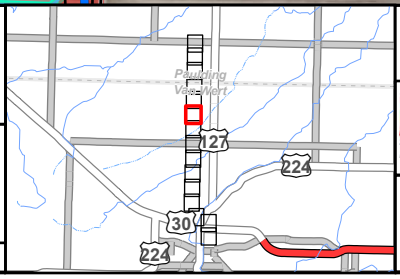

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

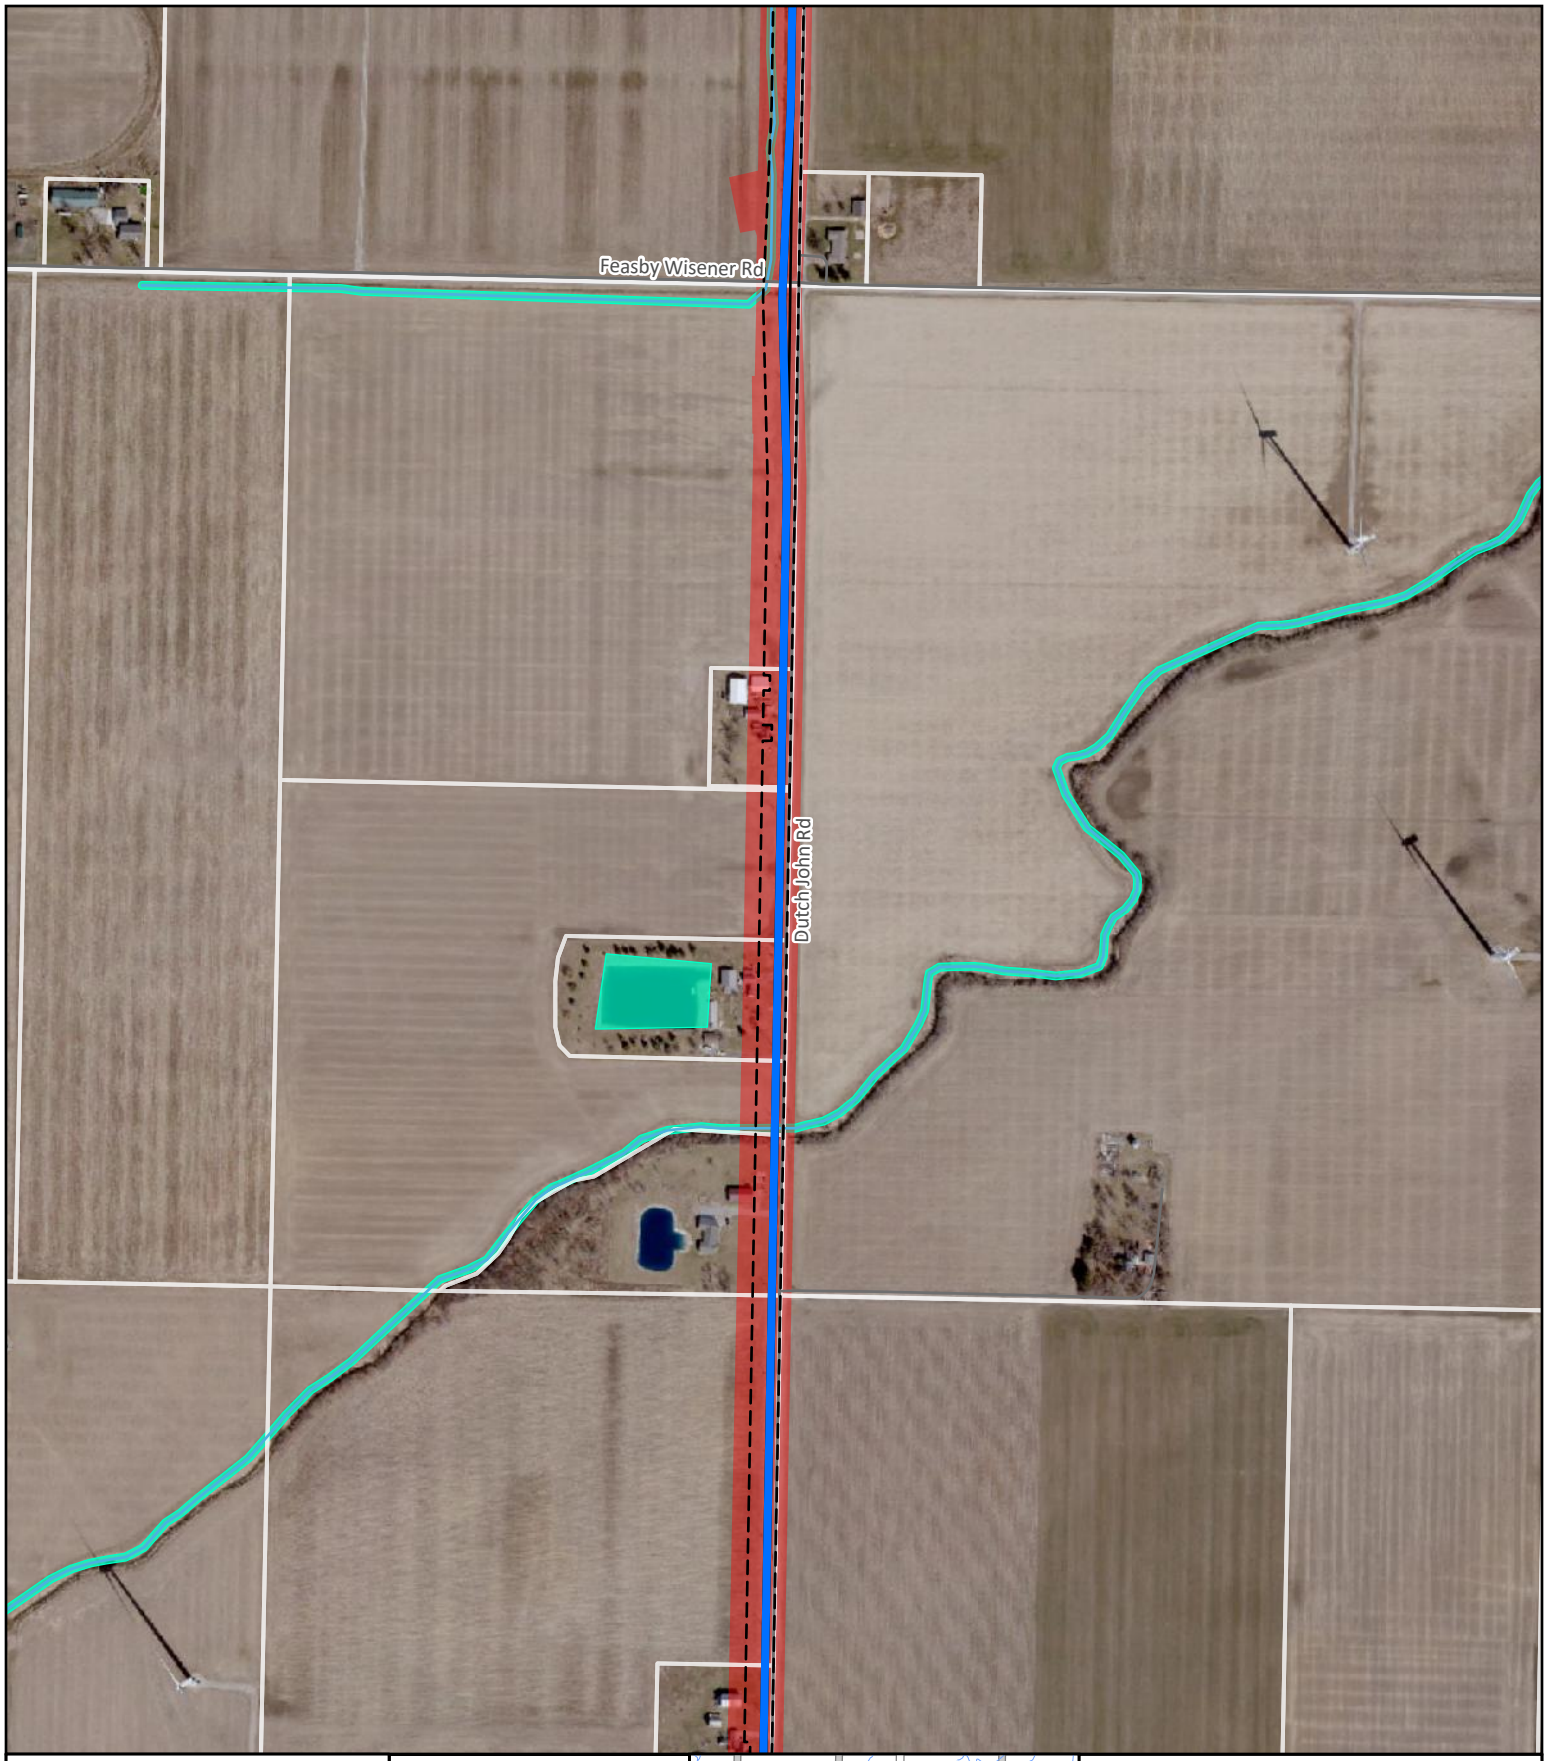

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

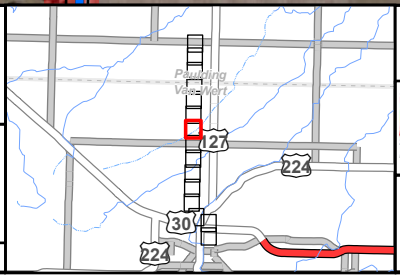

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

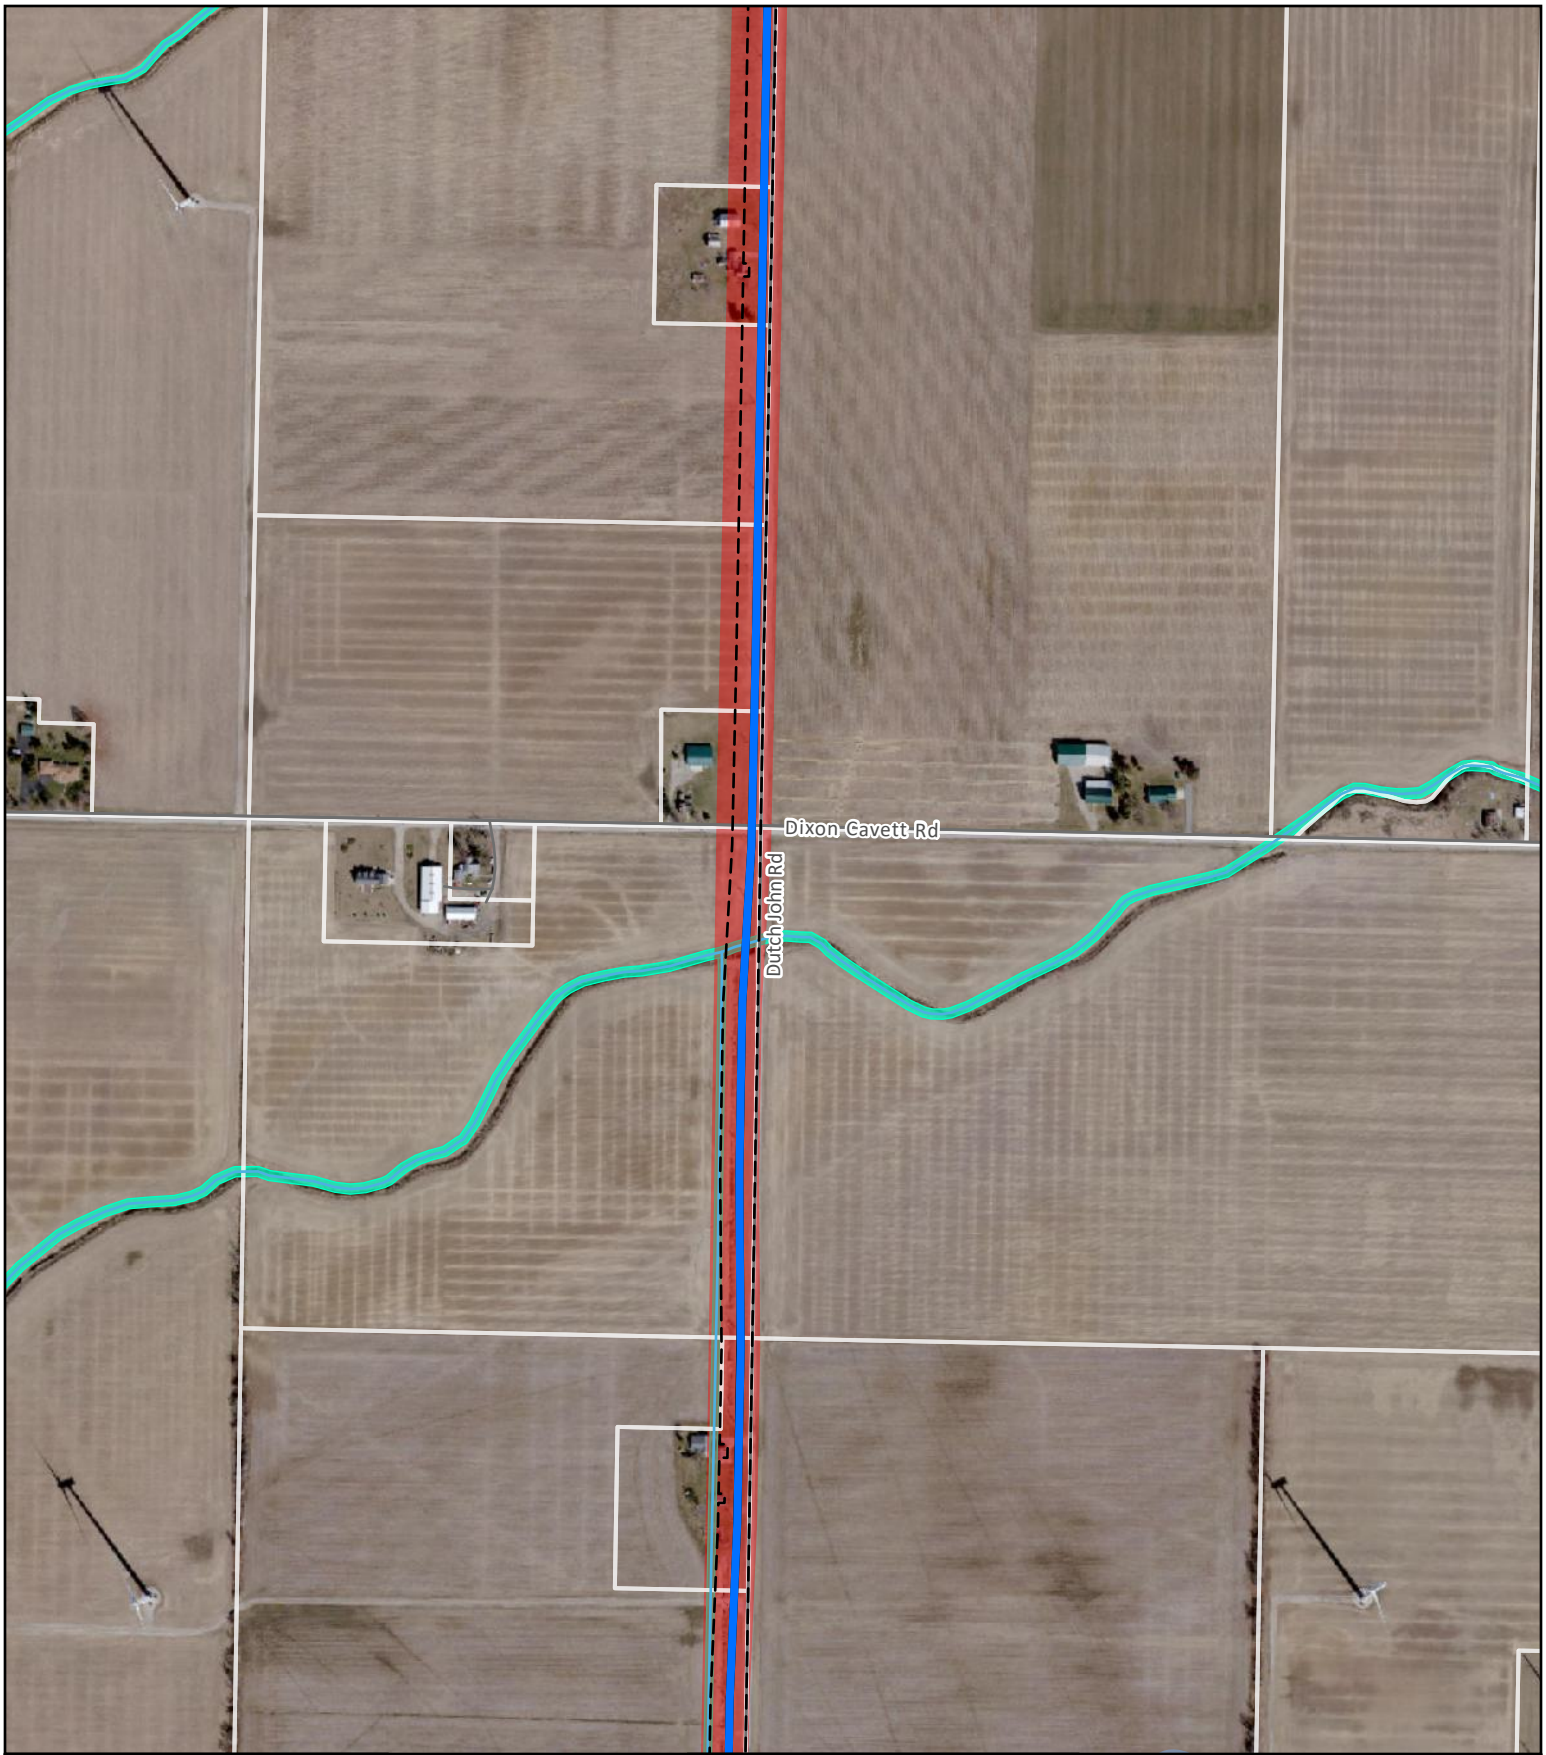

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

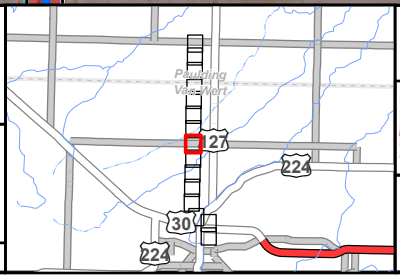

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

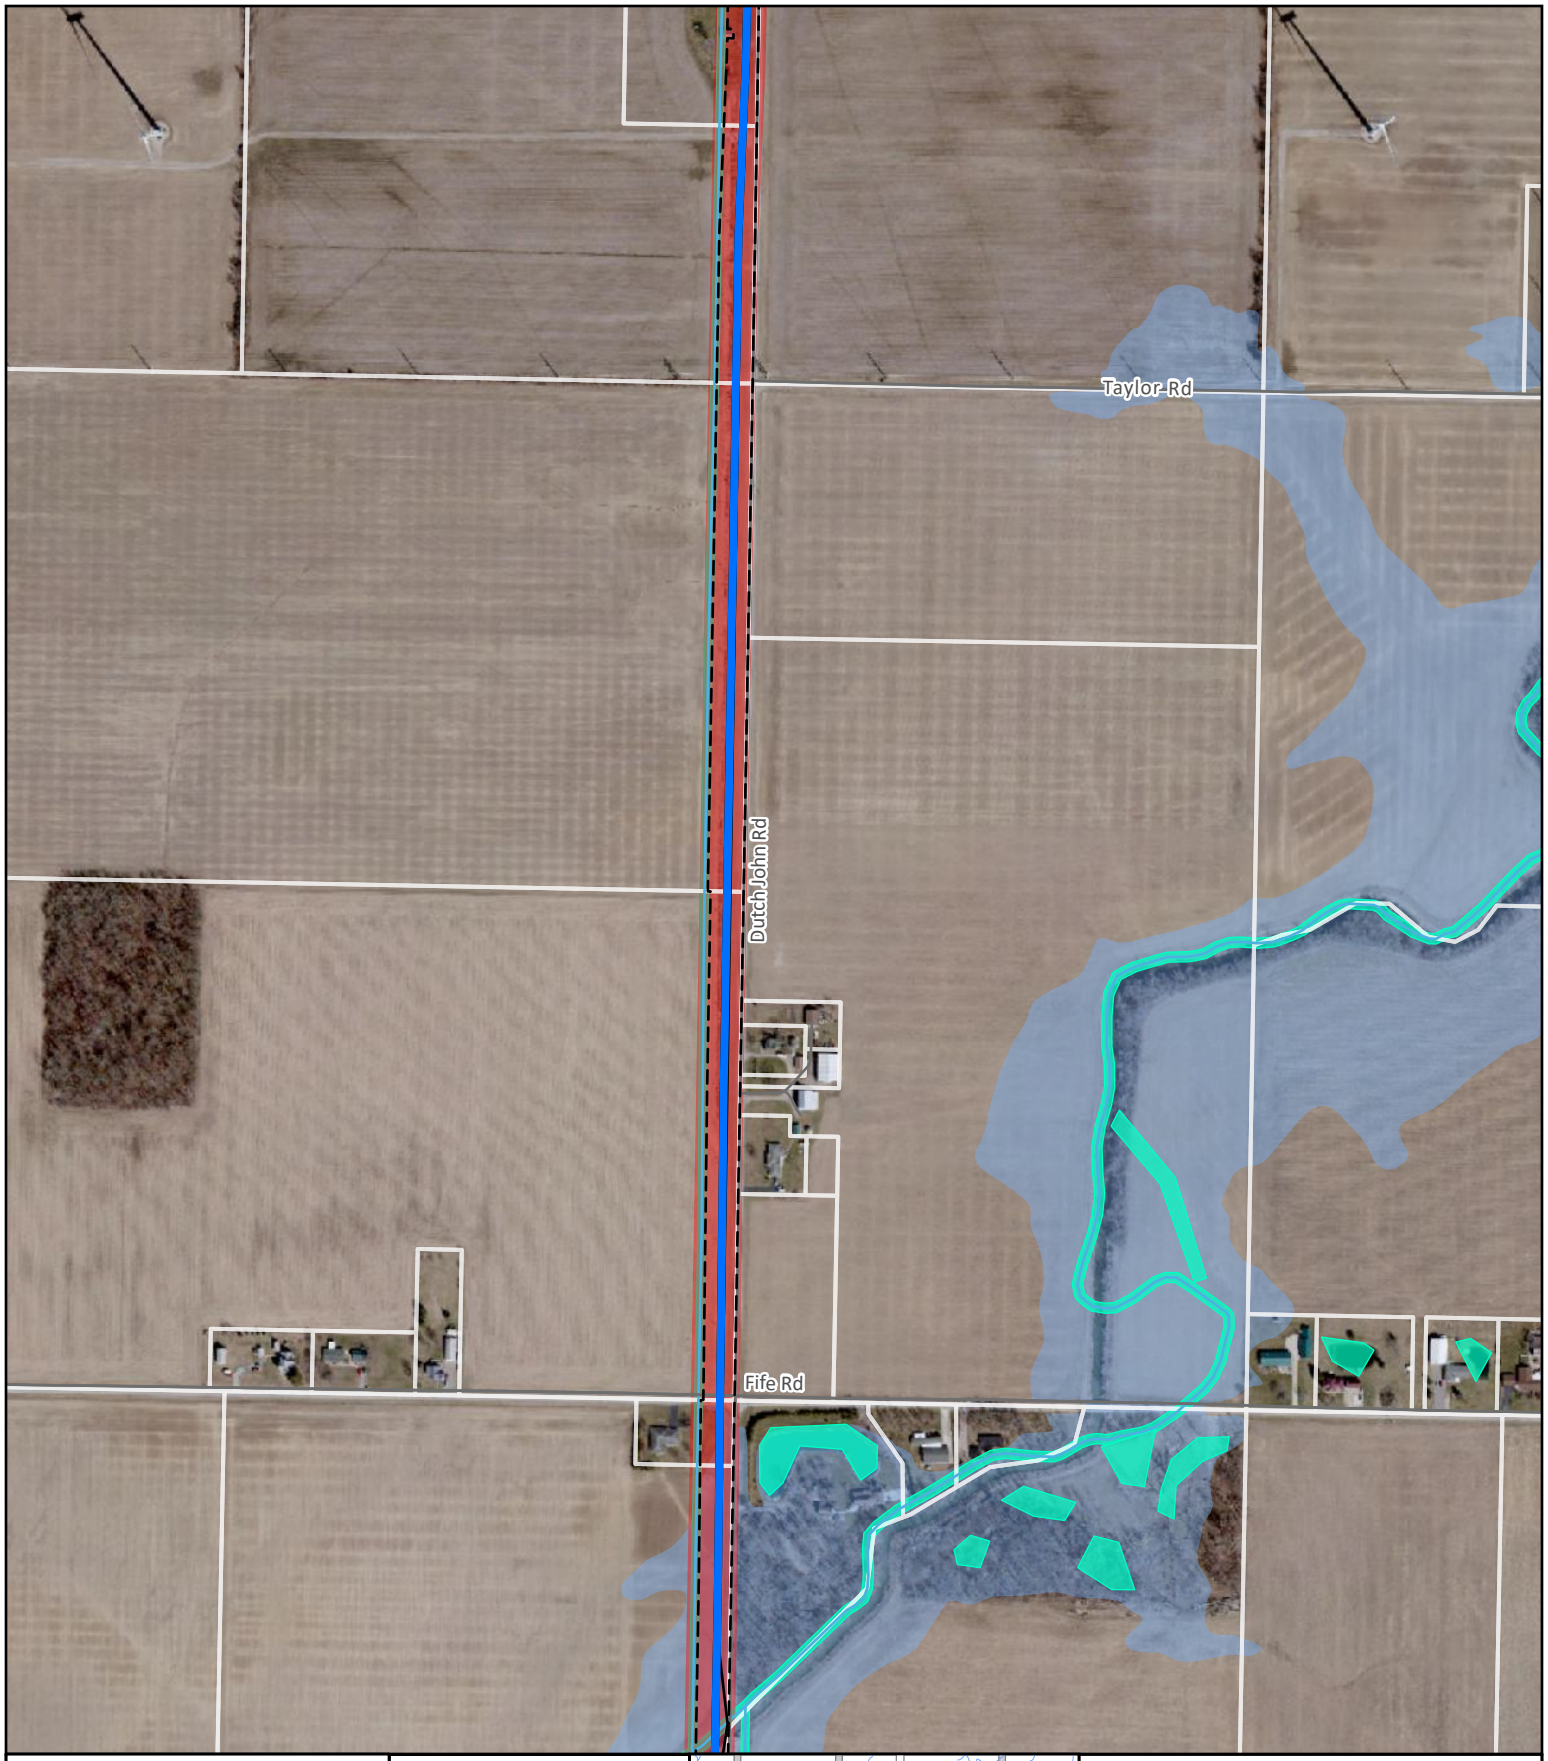

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

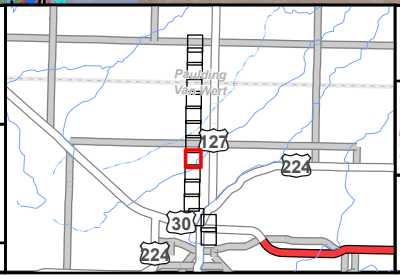

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

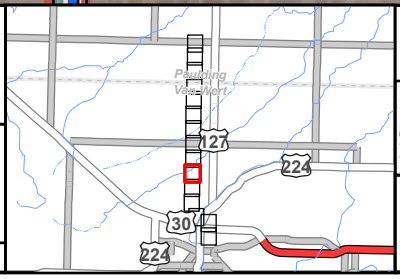

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

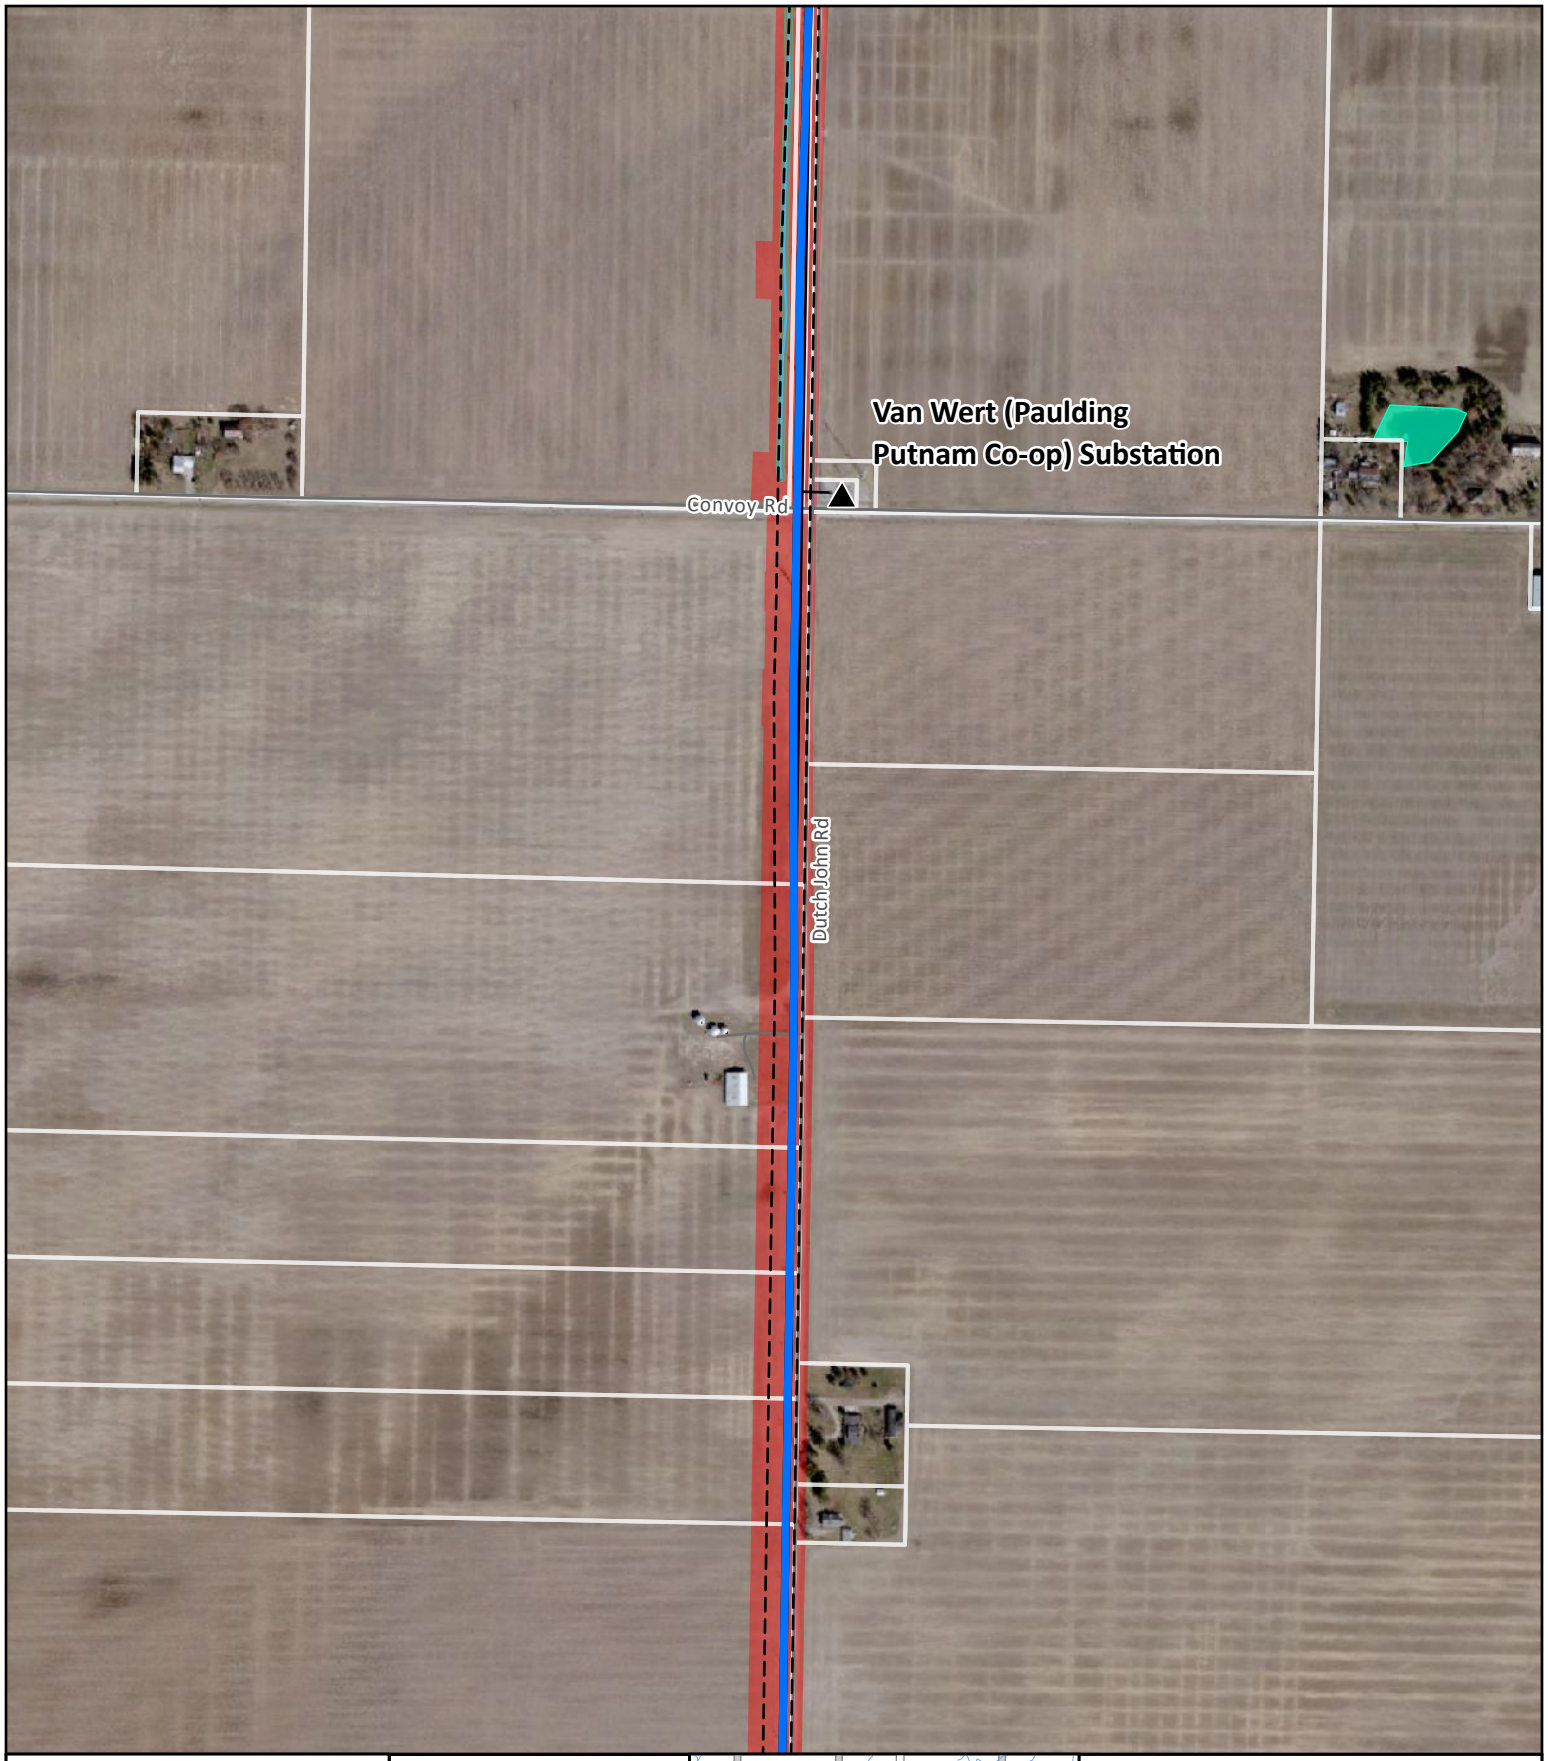

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

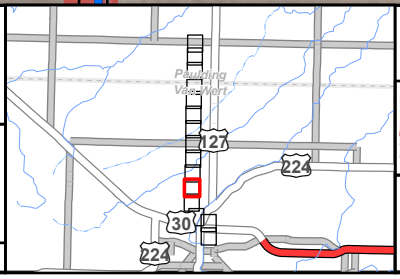

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

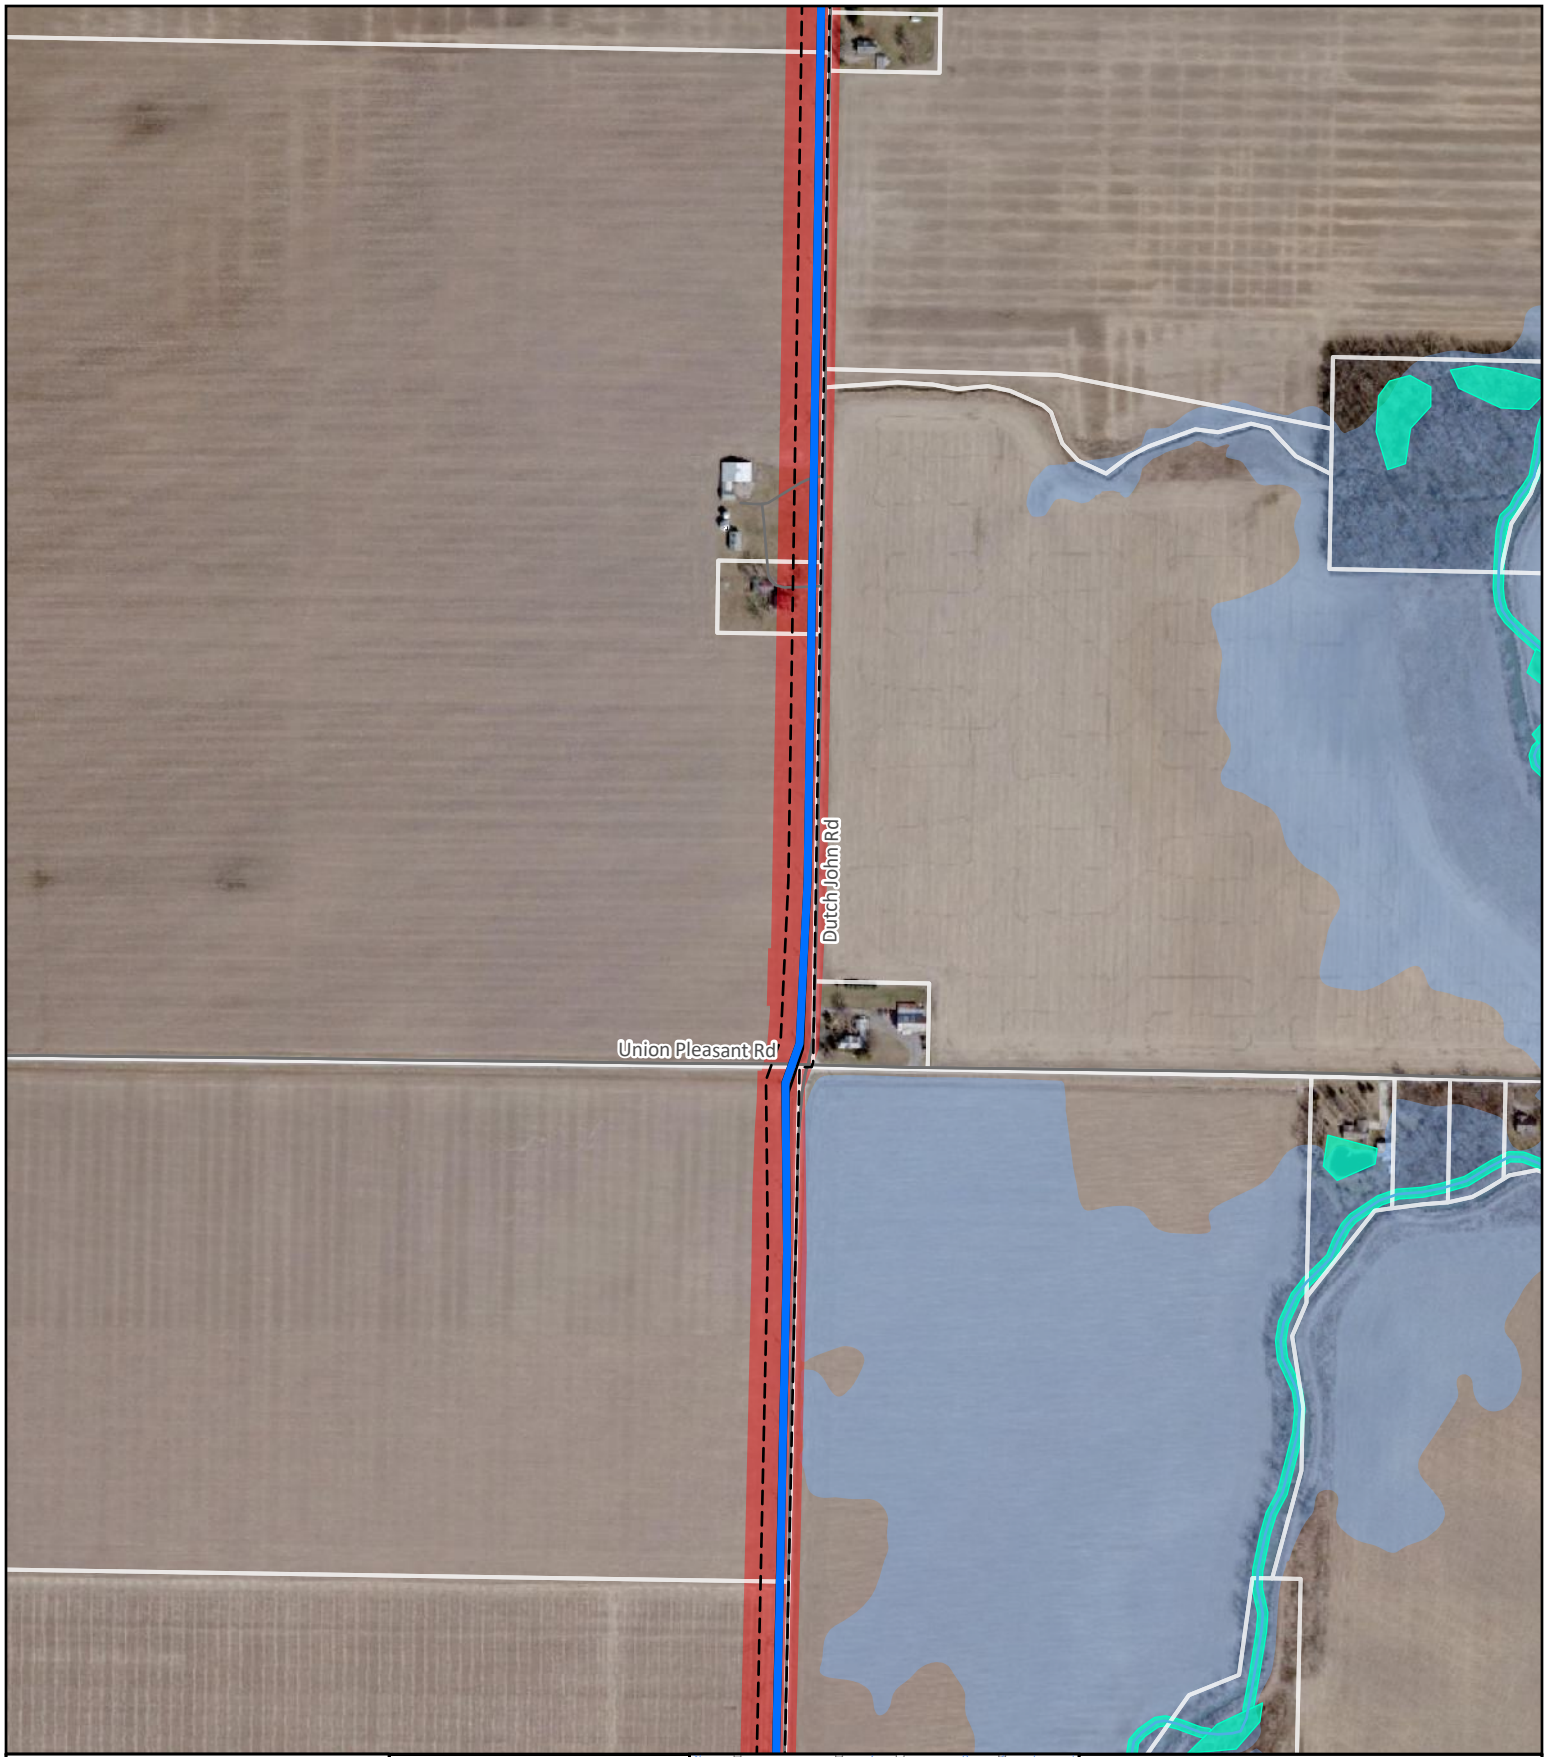

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

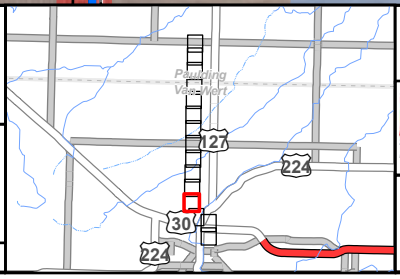

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

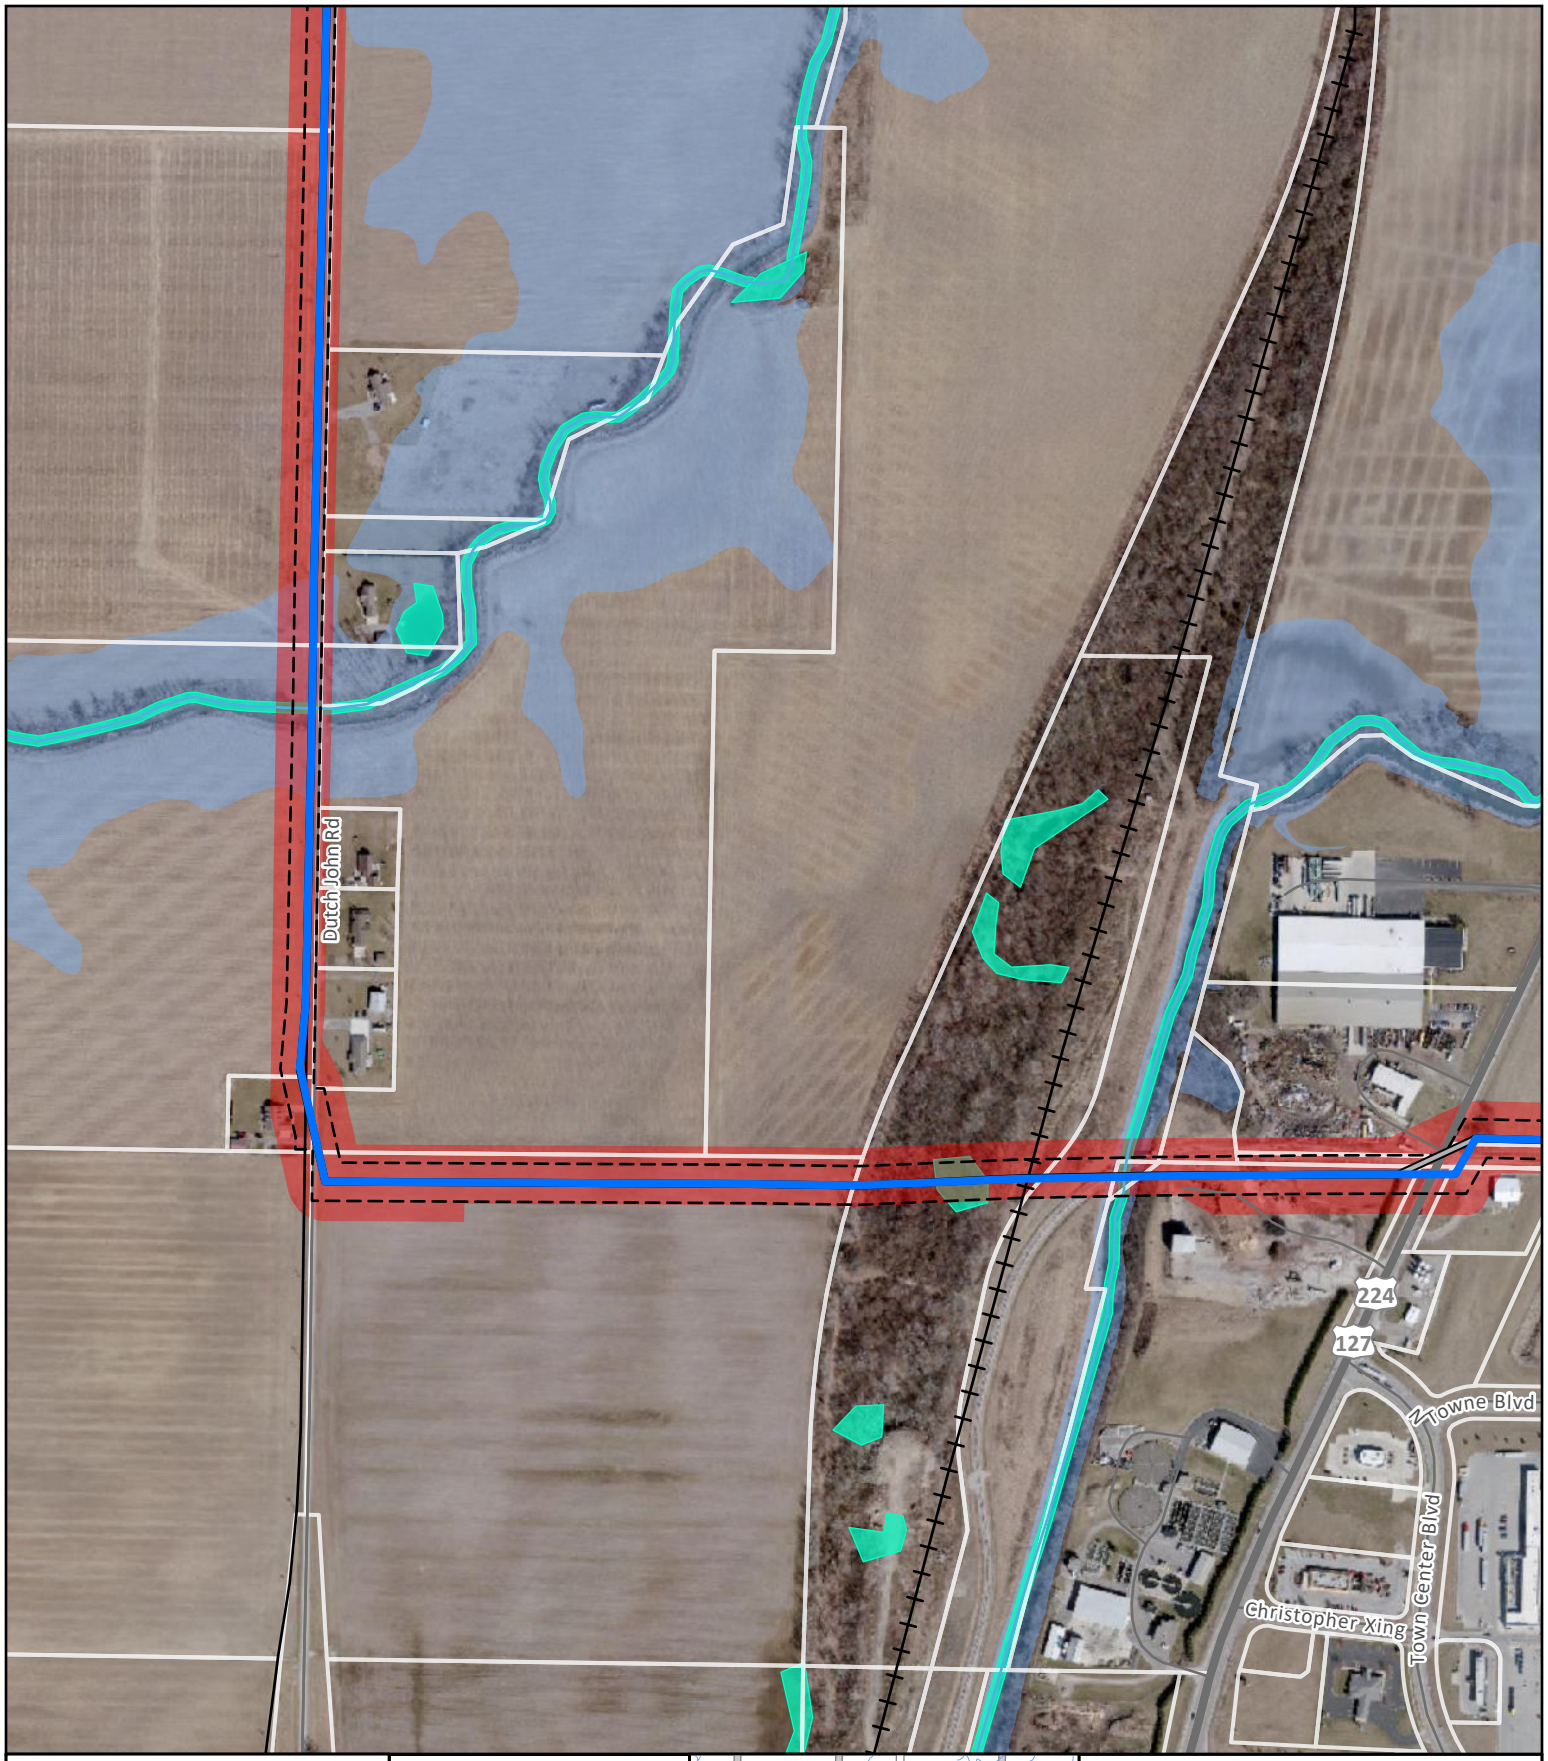

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

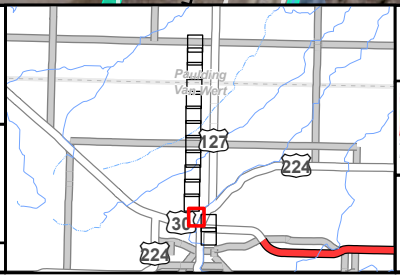

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

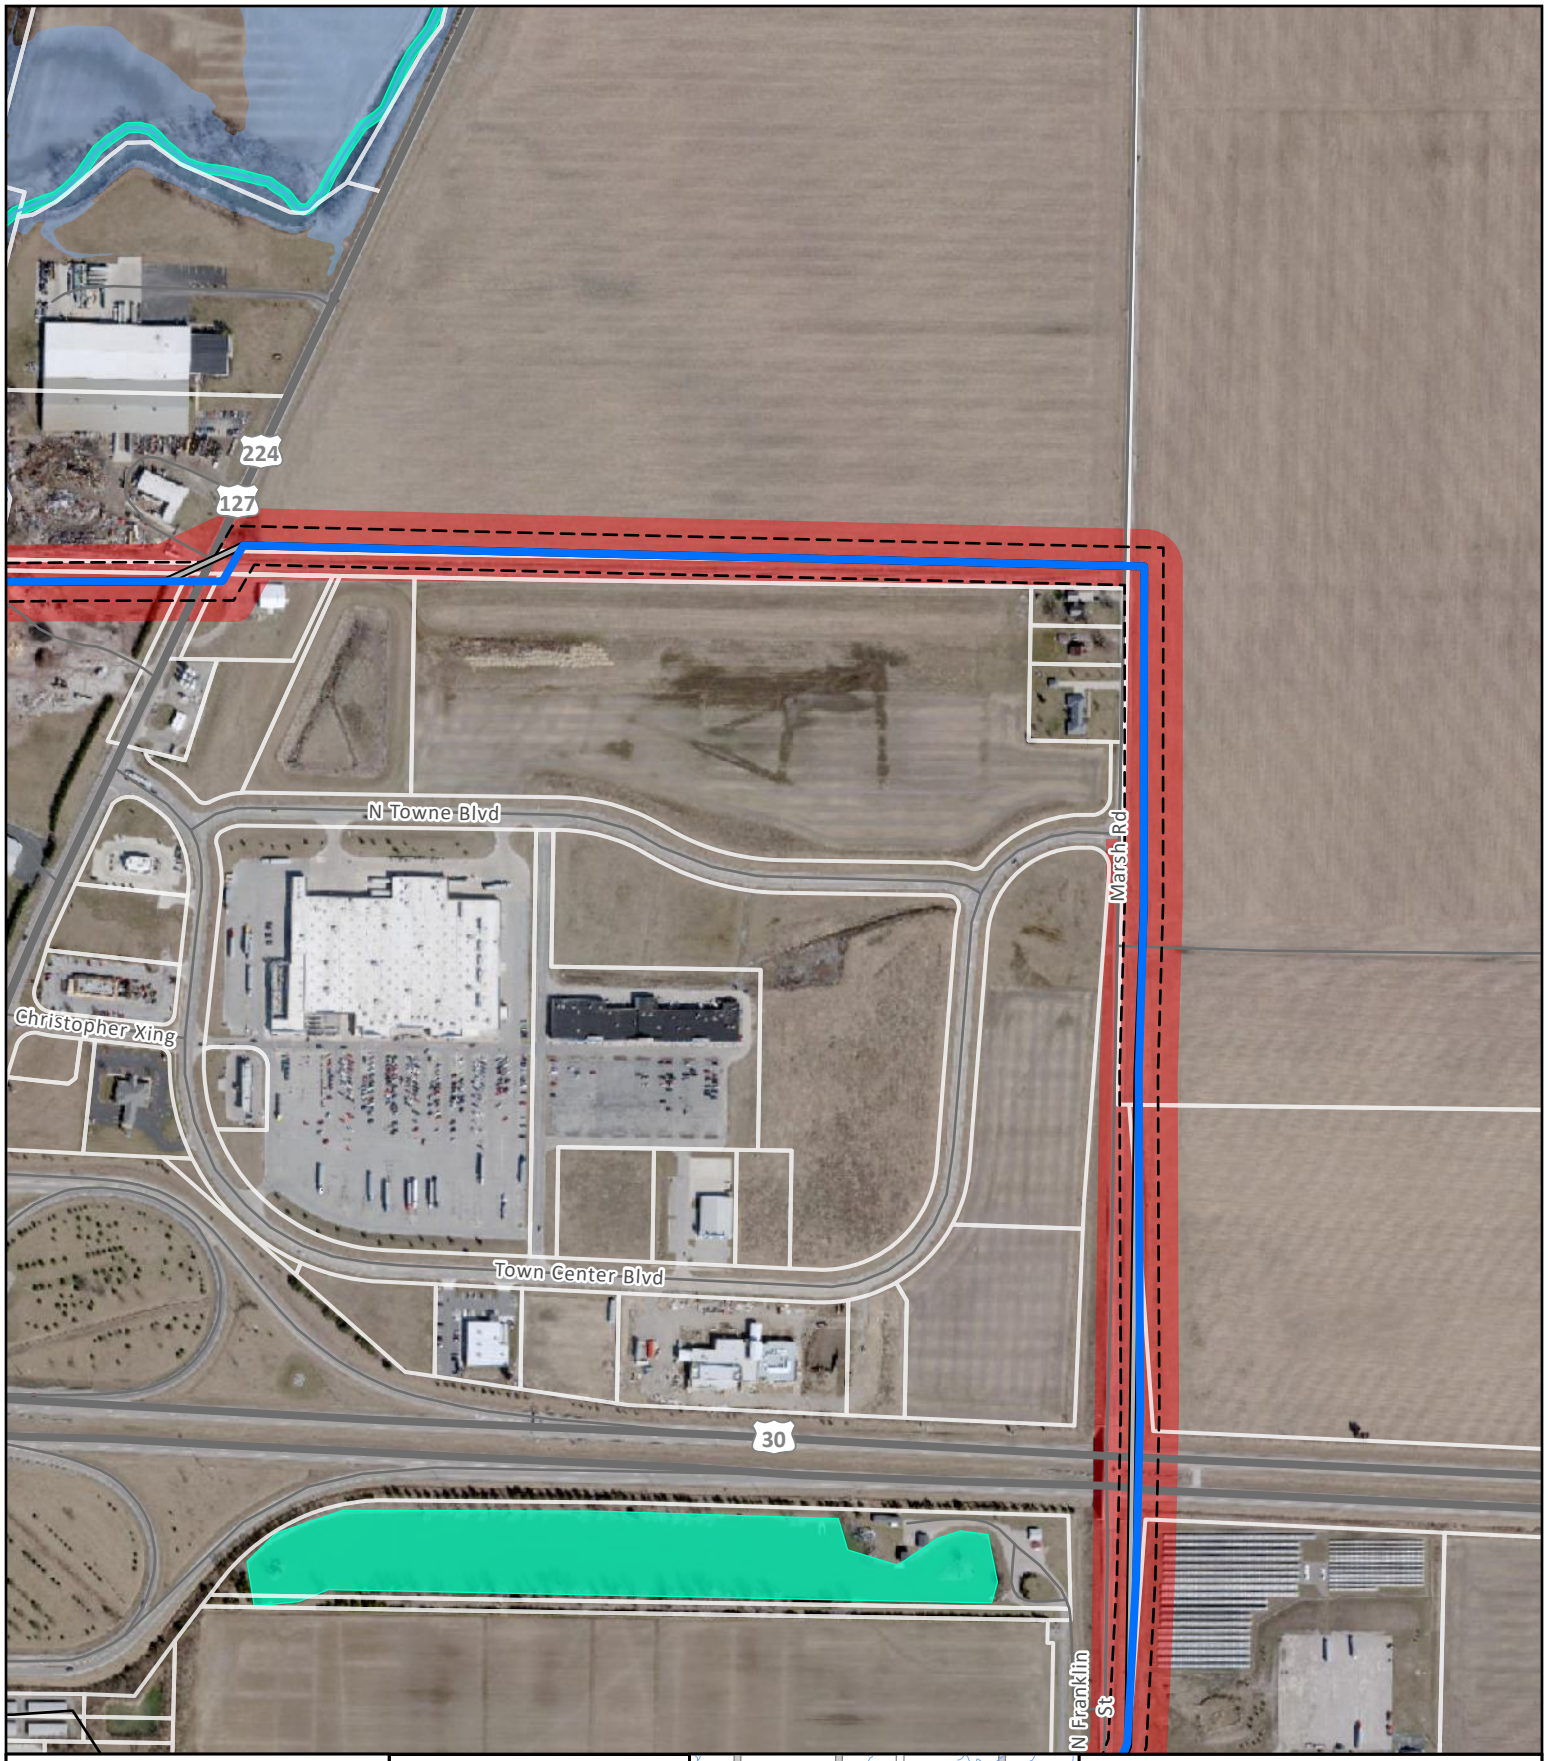

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

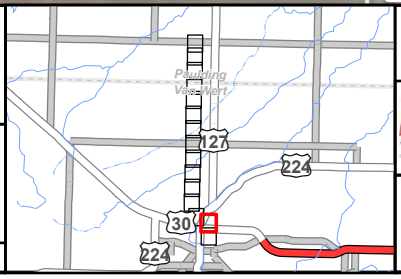

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

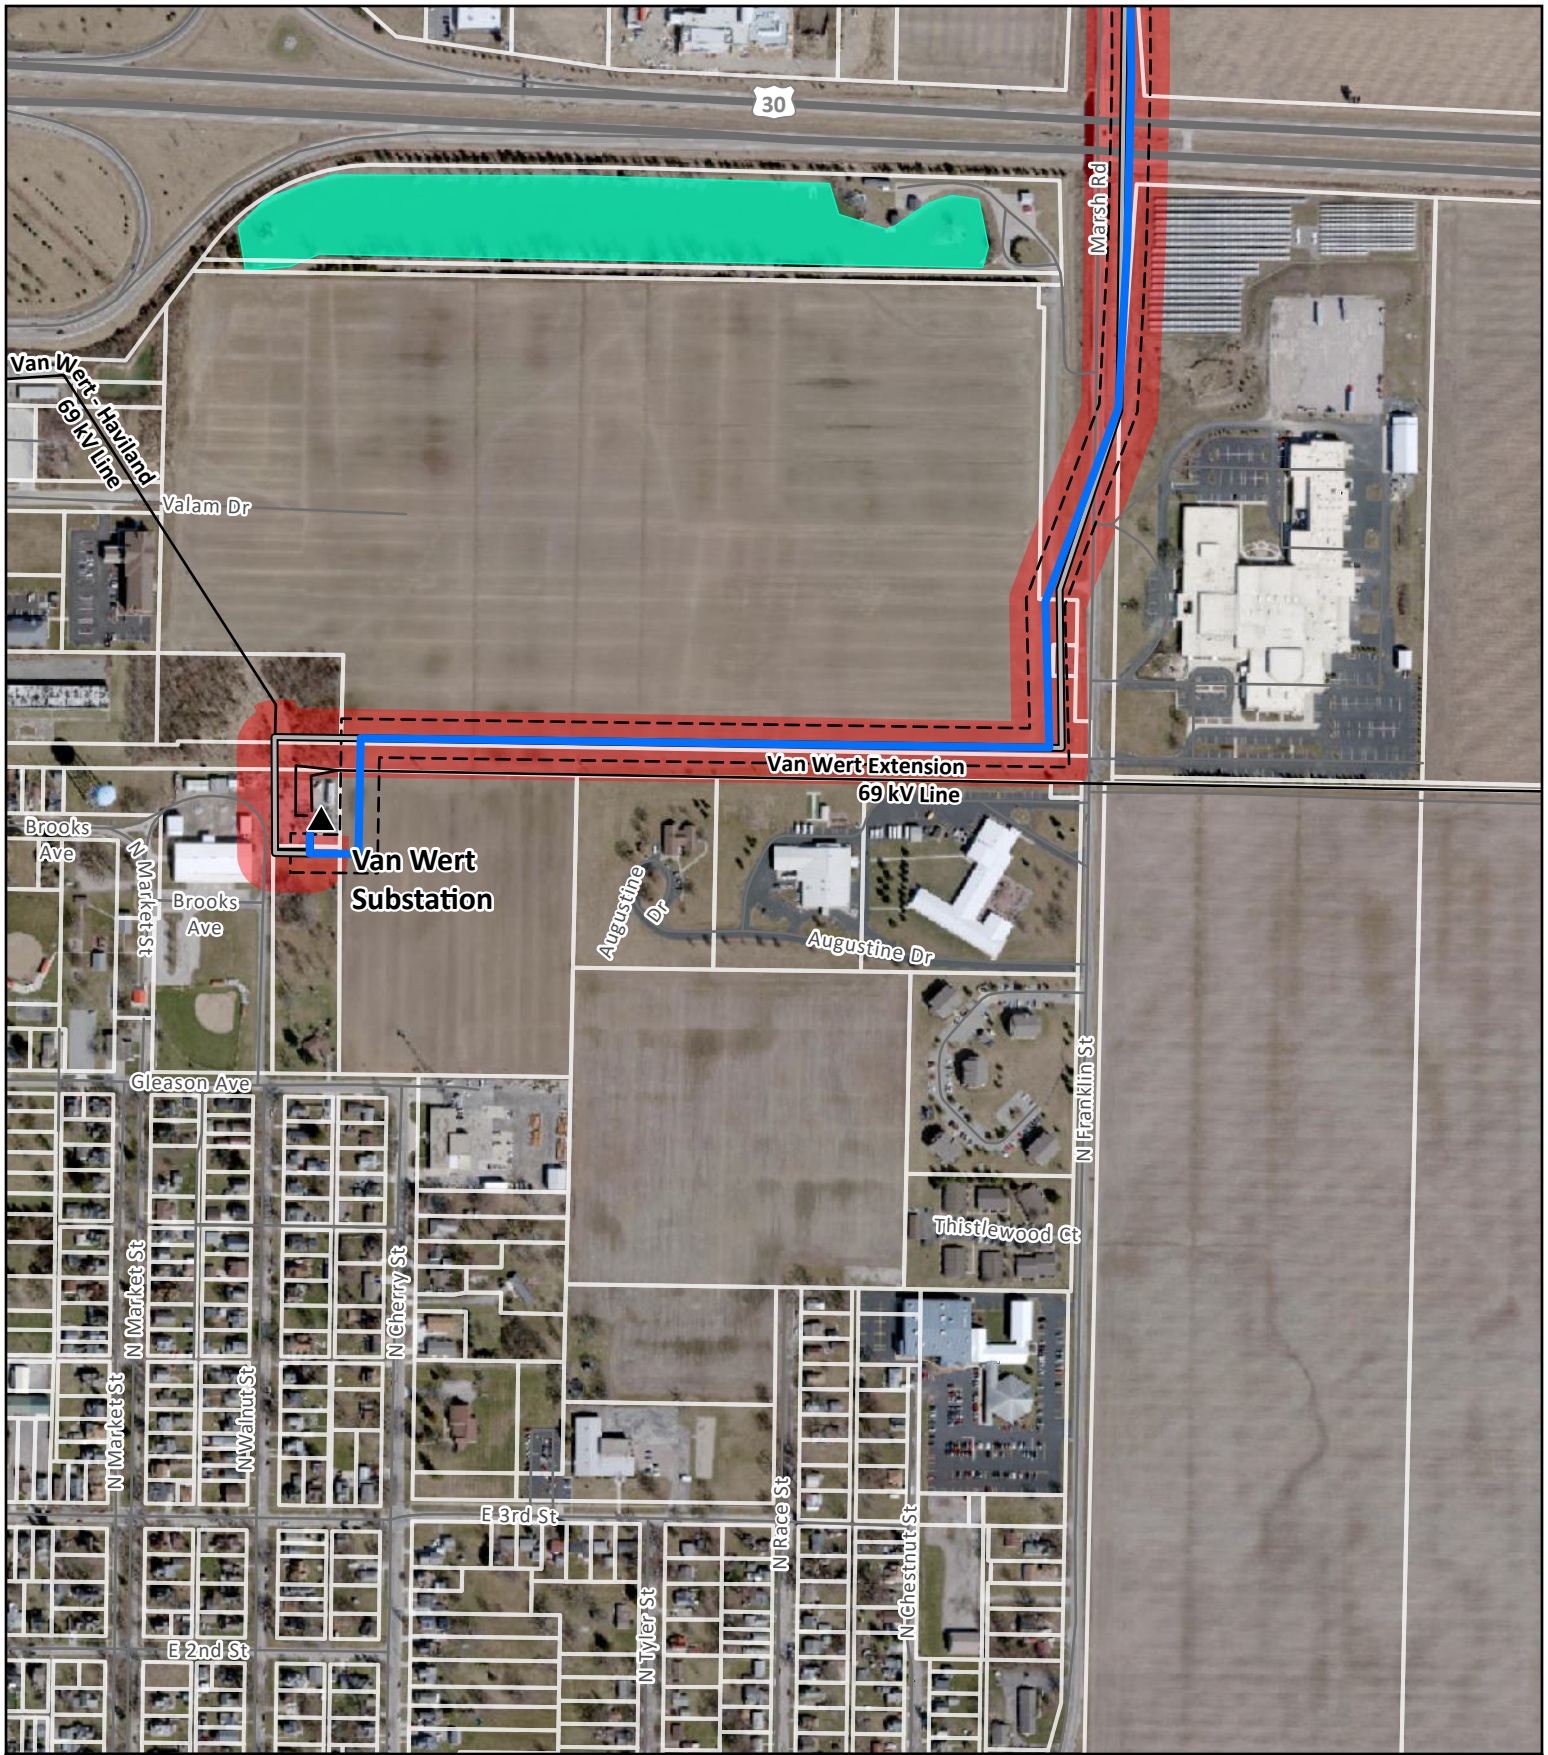

Adjusted Van Wert-Haviland 138 kV Transmission Line
OPSB Approved Van Wert-Haviland 138 kV Transmission Line
Project 100' Right of Way
Project Route Corridor
Existing Substation
Existing Transmission Line
Railroads
NHD Stream
NWI Wetland
FEMA 100 Year Floodplain
Parcel
County Boundary

Base Map Source:
OGRIP Statewide Imagery

Coordinate System
State Plane Ohio North
FIPS 3401 (US Feet)
Datum: NAD 1983
Scale: 1:6,000

N

7/21/2026

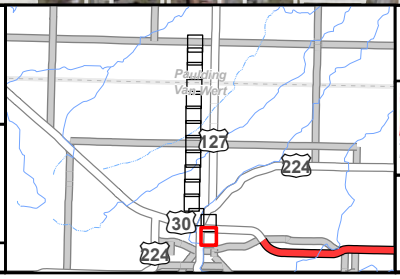

Exhibit 3
Aerial Overview

AEP OHIO TRANSMISSION COMPANY

Van Wert-Haviland 138 kV Transmission Line Project
Van Wert and Pauling County, OH

0 500 1,000
Feet

Appendix B PJM Solution and Long-Term Forecast Report

AEP Transmission Zone: Baseline
North Van Wert Sw. - Van Wert 69 kV Rebuild

Process Stage: Recommended Solution

Criteria: AEP 715 Criteria

Assumption Reference: 2026 RTEP assumption

Model Used for Analysis: 2026 RTEP cases

Proposal Window Exclusion: Below 200 kV Exclusion

Problem Statement:

FG: AEP-T59, AEP-T60, AEP-T61, AEP-T62

In 2026 RTEP Summer case, 2.3 miles of existing 4/0 Cu conductor on N. Van Wert Sw - Van Wert 69 kV line is overloaded for multiple N-1-1 contingency pairs.

Existing Facility Rating:

Branch	SN/SE/WN/WE (MVA)
05VAN WERT - 05N.VANWRTSS 69KV	54/54/76/76

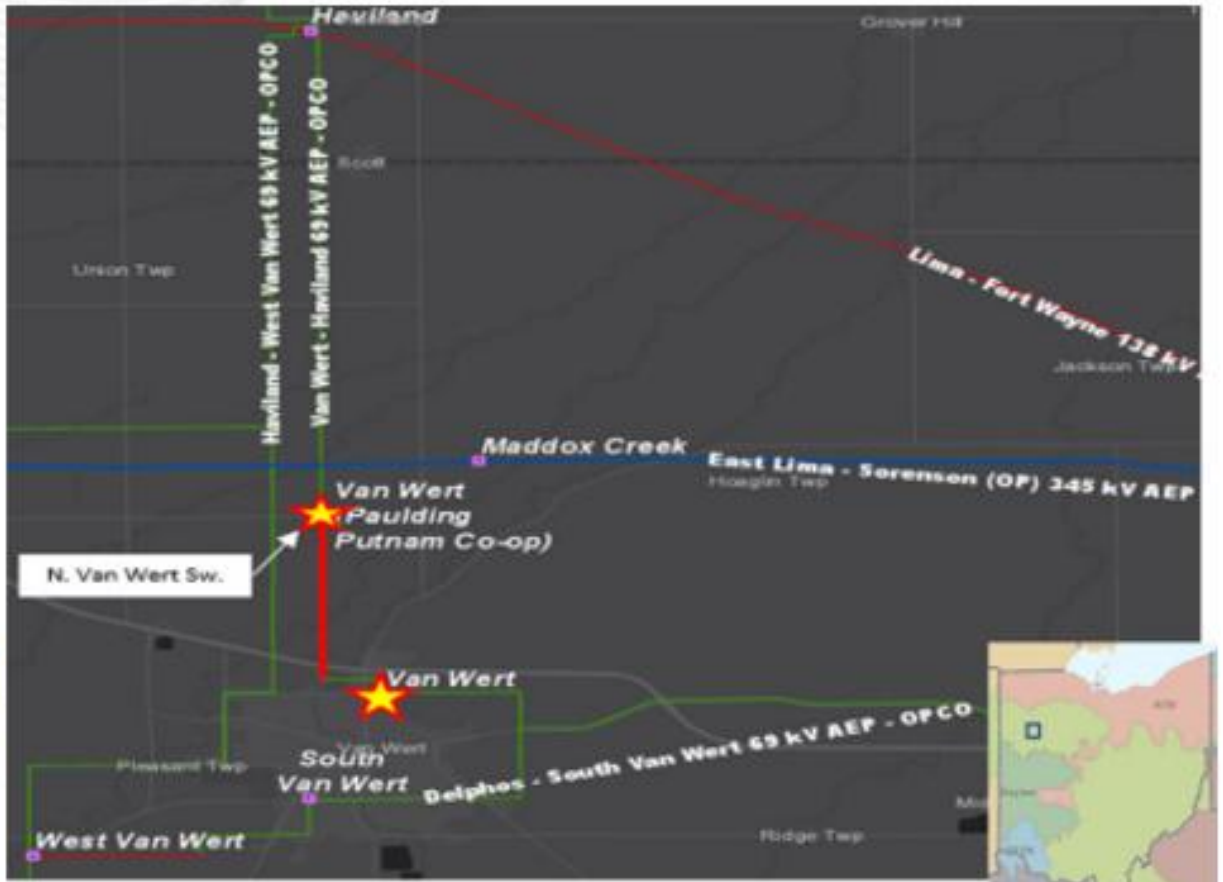

PJM©2022

AEP Transmission Zone: Baseline
North Van Wert Sw. - Van Wert 69 kV Rebuild

Recommended Solution:

Rebuild approximately 2.3 miles of the existing North Van Wert Sw - Van Wert 69 kV line utilizing 556 ACSR conductor. (**B3359**)

Transmission Estimated Cost: $6.2M

Preliminary Facility Rating:

Branch	SN/SE/WN/WE (MVA)
05VAN WERT - 05N.VANWRTSS 69KV	82/90/107/113

Ancillary Benefits: Project rebuilds a portion of the Van Wert - Haviland line that was originally constructed in in the 1920s and is primarily comprised of wood poles. The conductor being replaced as a part of this proposal dates back to the 1920's. There have been numerous customer speculation load requests in this area that would require this line rebuild if the alternative was chosen.

Required IS date: 6/1/2026

Projected IS date: 9/1/2025

Previously Presented: 10/15/2021

Existing:

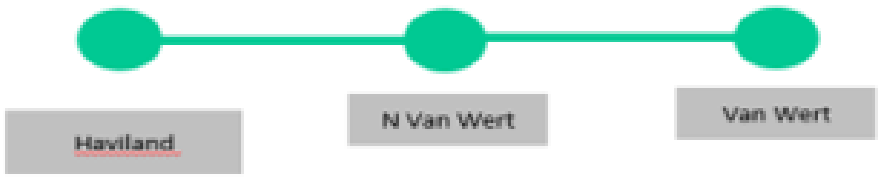

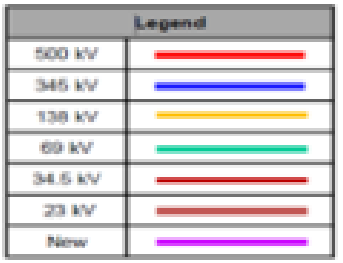

Proposed:

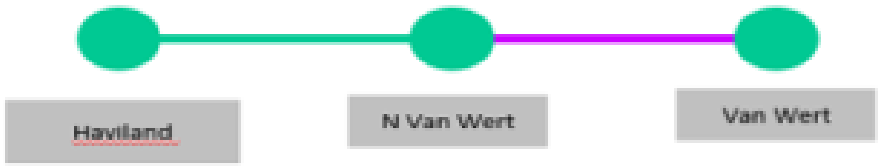

PJM©2022

AEP Transmission Zone M-3 Process
Paulding & Van Wert Co., OH

Need Number: AEP-2022-OH043

Process Stage: Submission of Supplemental Project for inclusion in the Local Plan 2/20/2024

Previously Presented:

Solution Meeting 10/20/2023

Need Meeting 07/22/2022

Project Driver:

Equipment Material/Condition/Performance/Risk

Specific Assumption Reference:

AEP Guidelines for Transmission Owner Identified Needs (AEP Assumptions Slide 13)

Problem Statement:

Van Wert - Haviland 69kV Line(1926) :

- Length of Line: 10.06 Miles
- Total Structure Count: 249
    - Wooden, Steel Monopole Structures
    - Vertical post insulators
- Conductor Types: 556.5 ACSR 18/1 (Osprey), 4/0 COOPER, 556.5 ALUMINUM 19 (Dahlia),795 ACSR 26/7 (Drake)
- Outage History: 1 Momentary and 2 Permanent outages – average duration of 38.72 hours, 66.6K CMI between 2015 and 2020
- Open Conditions: 19, including splice/dead end conductor issues, damaged/missing ground lead wires, broken shield wire, disconnected grounding mat and chipped insulators
- The Van Wert - Haviland line fails to meet 2017 NESC Grade B loading criteria, current AEP structural strength requirements, and the current ASCE structural strength requirements. The line is insulated with vertical post insulators that do not meet current AEP standards for CIFO and minimum leakage distance requirements.

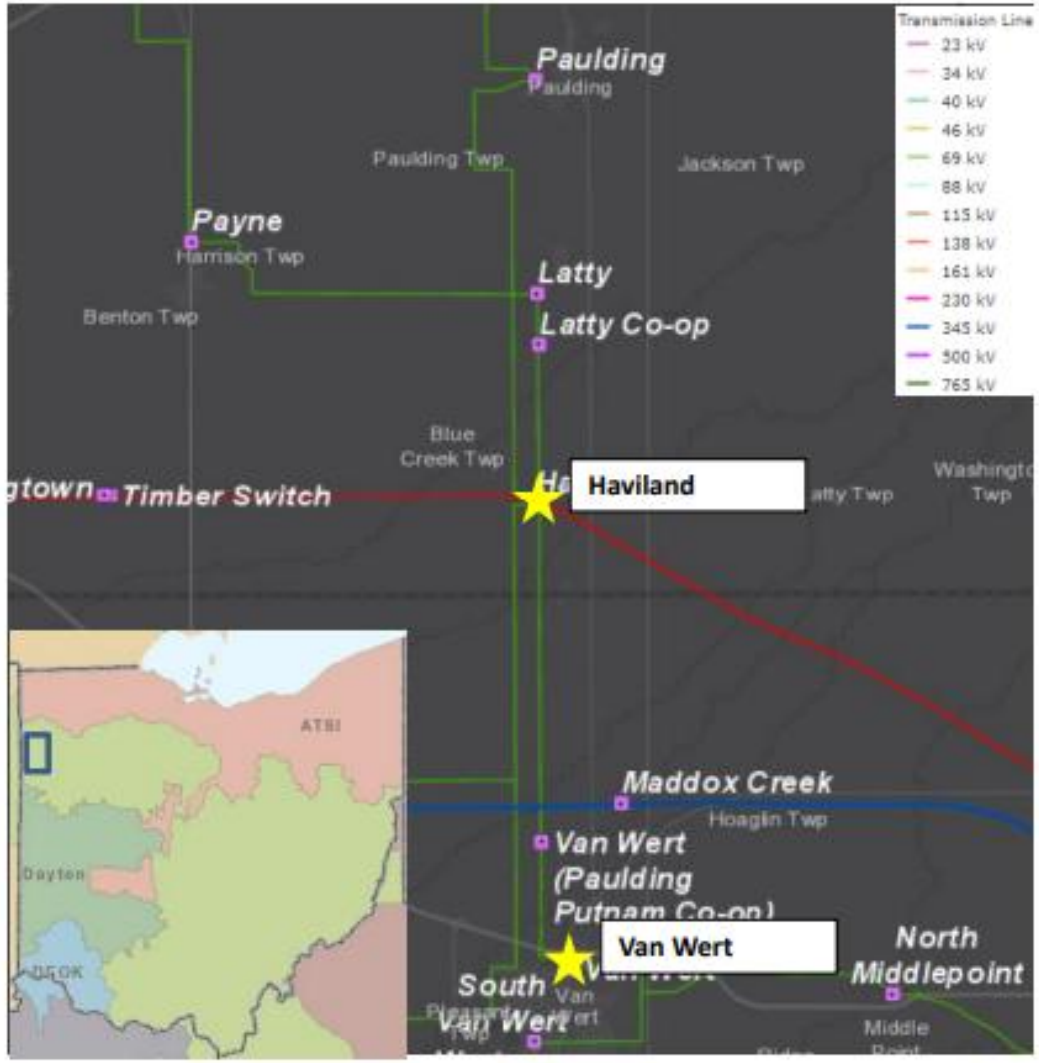

AEP Transmission Zone M-3 Process
Paulding & Van Wert Co., OH

Need Number: AEP-2022-OH043

Process Stage: Submission of Supplemental Project for inclusion in the Local Plan 2/20/2024

Problem Statement continued:

- 15 structures were further assessed by a ground crew. 73% of those structures had reported conditions, which included the following: one structure had PLP deadends in the shield wire, one structure had pole top decay and a twisted crossarm, one structure had pole top decay, a PLP splice in the shield wire, brown porcelain tie-top post insulators with aluminum bases (failure risk) and an insulator with broken skirts, one structure had insect damage to a crossarm, a twisted crossarm, spliced conductors, a PLP splice in the shield wire and a 2-pole brace structure with a bent anchor, one structure had a compression splice in the shield wire, one structure had a stolen "S" downlead, one structure had brown porcelain tie-top insulators (failure risk), one structure had crossarm splitting and rotting, one structure had un-guyed distribution primary lateral that is deflecting the pole, one structure had a distribution secondary that is deflecting the pole and one structure had a PLP splice in the shield wire.

Additional Information:

During the 2012 Derecho and 2017 straight-line wind storms Van Wert- Haviland experienced multiple cascading pole failure events. These failed structures were replaced with steel monopole type structures. There are 55 newer steel structures, representing 22% of the structures on the line.

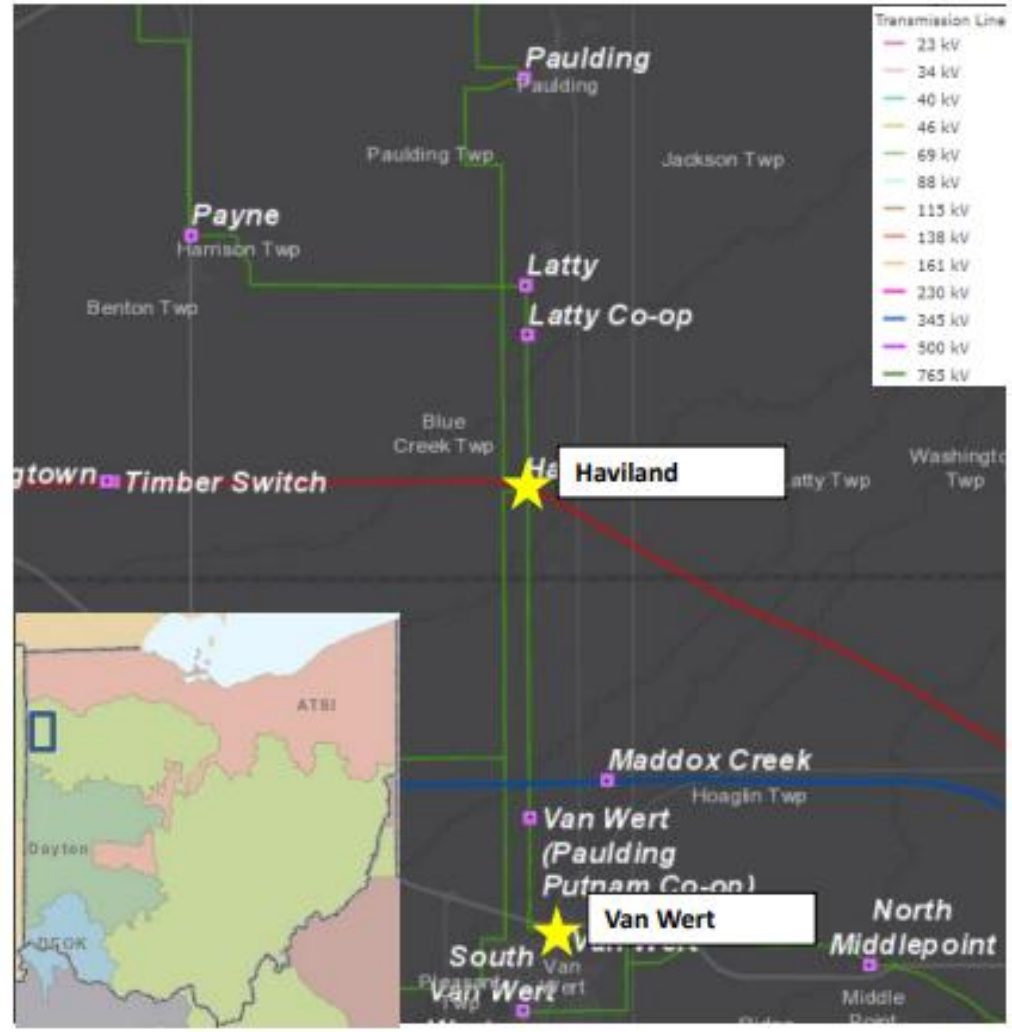

AEP Transmission Zone M-3 Process
Van Wert Co., OH

Need Number: AEP-2023-OH065

Process Stage: Submission of Supplemental Project for inclusion in the Local Plan 2/20/2024

Previously Presented:

Solution Meeting 10/20/2023

Need Meeting 04/21/2023

Project Driver:

Customer Service

Specific Assumption Reference:

AEP Guidelines for Transmission Owner Identified Needs (AEP Assumptions Slide 12)

Problem Statement:

Van Wert Mega Site:

The Van Wert Mega industrial site is located north of Van Wert in Van Wert County Ohio. The site is approximately one mile east of AEP's Van Wert - Haviland 69kV circuit. The site has been heavily targeted by regional and state economic development efforts and will continue to be. The site is highlighted by JobsOhio and its partner Regional Growth Partnership as its top available property for EV manufacturing. From January 2022 to March 2023 AEP Economic Development has had 32 requests for electric service plans at the site. The prospective customer's electric demand ranged from 5MW to 760MW. Around the industrial site, significant investment has been performed to prepare the site for manufacturing industry development, including installation of a rail spur.

Many of these prospective customers cannot be connected to the existing Van Wert area 69kV network without significant upgrades.

AEP Transmission Zone M-3 Process
Haviland-Van Wert Rebuild

Need Number: AEP-2022-OH043, AEP-2023-OH065

Process Stage: Submission of Supplemental Project for inclusion in the Local Plan 2/20/2024

Solution:

Haviland - Van Wert: Rebuild the line to double circuit 138kV design using 1033 Curlew ACSR conductor. The line will be six wired and operated at 69kV. The rebuild will include a 2.6-mile greenfield section to route the line near several new industrial sites. The overall line length will be 10.8 miles. Newer installed poles will be re-used elsewhere. **Estimated Cost $27.8M (s3142.1)**

Modify the b3359 scope from single circuit 69kV construction to double circuit 1033 Curlew at 138kV design **Estimated Cost $2.89M (s3142.2)**

Perform remote end work at Haviland **Estimated Cost $1.03M (s3142.3)**

Perform remote end work at Van Wert **Estimated Cost $0.635M (s3142.4)**

Upgrade telecom equipment at South Van Wert, Logtown, Maddox Creek, Timber Switch and North Delphos stations **Estimated Cost $0.194M (s3142.5)**

Total Estimated Transmission Cost: $32.57M

Ancillary benefits:

- Upgrading the maximum possible line voltage with double circuit construction allows flexibility for future Van Wert area projects. The proposed solution can be used as part of the service plan for loads at the Van Wert Mega site with less greenfield construction. The Van Wert area does not currently have facilities greater than 69kV. This 138kV double circuit design allows AEP to use the exiting ROW to establish a new 138kV path to the load site. In the future, the circuits could be split and operated independently to support planning needs, load growth or operational concerns while maintaining the 69 kV network.

Model: PJM 2027 RTEP

Projected In-Service: 1/1/2026

Supplemental Project ID: s3142.1-.5

Project Status: Scoping

Existing

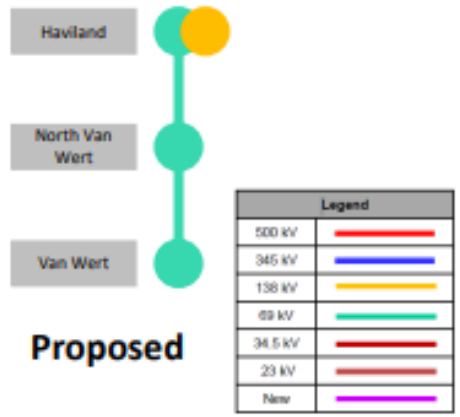

Proposed

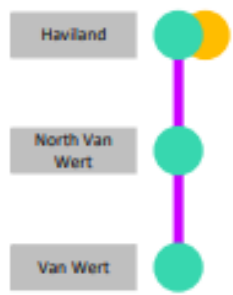

12	**CONSEQUENCES OF LINE CONSTRUCTION DEFERMENT OR TERMINATION**	Increased risk of equipment failure, reliability, and operational issues
13	**MISCELLANEOUS:**	
1	**LINE NAME AND NUMBER:**	Haviland - Van Wert 69 kV (B3359 TP2022110)
2	**POINTS OF ORIGIN AND TERMINATION**	Haviland - Van Wert INTERMEDIATE STATION - North Van Wert Switch
3	**RIGHTS-OF-WAY: LENGTH / WIDTH / CIRCUITS**	10.8 miles, 60 ft, 2 circuit (1.3 miles of work)
4	**VOLTAGE: DESIGN / OPERATE**	69 kV / 69 kV
5	**APPLICATION FOR CERTIFICATE:**	N/A (69 kV)
6	**CONSTRUCTION:**	2024 - 2025
7	**CAPITAL INVESTMENT:**	$5.49M
8	**PLANNED SUBSTATION:**	N/A
9	**SUPPORTING STRUCTURES:**	Steel
10	**PARTICIPATION WITH OTHER UTILITIES**	N/A
11	**PURPOSE OF THE PLANNED TRANSMISSION LINE**	Rebuild line due to baseline violation
12	**CONSEQUENCES OF LINE CONSTRUCTION DEFERMENT OR TERMINATION**	Increased risk of equipment failure, reliability, and operational issues
13	**MISCELLANEOUS:**	
1	**LINE NAME AND NUMBER:**	Sawmill - Lazelle (B3297 TP2020233)
2	**POINTS OF ORIGIN AND TERMINATION**	Sawmill - Lazelle INTERMEDIATE STATION - N/A
3	**RIGHTS-OF-WAY: LENGTH / WIDTH / CIRCUITS**	4.23 miles, 60 ft, 1 circuit
4	**VOLTAGE: DESIGN / OPERATE**	69 kV / 69 kV
5	**APPLICATION FOR CERTIFICATE:**	N/A
6	**CONSTRUCTION:**	2025
7	**CAPITAL INVESTMENT:**	$12.48M
8	**PLANNED SUBSTATION:**	N/A
9	**SUPPORTING STRUCTURES:**	Steel

4	VOLTAGE: DESIGN / OPERATE	138 kV / 138 kV
5	APPLICATION FOR CERTIFICATE:	2025
6	CONSTRUCTION:	2025 - 2026
7	CAPITAL INVESTMENT:	2.07 M
8	PLANNED SUBSTATION:	Jorden
9	SUPPORTING STRUCTURES:	Steel
10	PARTICIPATION WITH OTHER UTILITIES	N/A
11	PURPOSE OF THE PLANNED TRANSMISSION LINE	Tie new station into Innovation - Kirk 138 kV line
12	CONSEQUENCES OF LINE CONSTRUCTION DEFERMENT OR TERMINATION	Unable to provide requested service to customer
13	MISCELLANEOUS:	
1	LINE NAME AND NUMBER:	Haviland - Paulding 69 kV (s2984 TP2022110)
2	POINTS OF ORIGIN AND TERMINATION	Haviland - Paulding INTERMEDIATE STATIONS - N/A
3	RIGHTS-OF-WAY: LENGTH / WIDTH / CIRCUITS	~10.73 mi / 60 ft / 1 circuit
4	VOLTAGE: DESIGN / OPERATE	69 kV / 69 kV
5	APPLICATION FOR CERTIFICATE:	N/A
6	CONSTRUCTION:	2027 - 2028
7	CAPITAL INVESTMENT:	$18.74 M
8	PLANNED SUBSTATION:	N/A
9	SUPPORTING STRUCTURES:	Steel
10	PARTICIPATION WITH OTHER UTILITIES	N/A
11	PURPOSE OF THE PLANNED TRANSMISSION LINE	Rebuild aging infrastructure; improve system reliability
12	CONSEQUENCES OF LINE CONSTRUCTION DEFERMENT OR TERMINATION	Potential for increased transmission line outages
13	MISCELLANEOUS:	
1	LINE NAME AND NUMBER:	Haviland - Van Wert 69 kV (TP2022110)

2	**POINTS OF ORIGIN AND TERMINATION**	Haviland - Van Wert INTERMEDIATE STATION - North Van Wert Switch
3	**RIGHTS-OF-WAY: LENGTH / WIDTH / CIRCUITS**	~10.8 miles, 60 ft, 2 circuit (~9.5 miles of work)
4	**VOLTAGE: DESIGN / OPERATE**	138 kV / 69 kV
5	**APPLICATION FOR CERTIFICATE:**	2025
6	**CONSTRUCTION:**	2027 - 2028
7	**CAPITAL INVESTMENT:**	$27.8M
8	**PLANNED SUBSTATION:**	N/A
9	**SUPPORTING STRUCTURES:**	Steel
10	**PARTICIPATION WITH OTHER UTILITIES**	N/A
11	**PURPOSE OF THE PLANNED TRANSMISSION LINE**	Rebuild aging infrastructure; improve system reliability
12	**CONSEQUENCES OF LINE CONSTRUCTION DEFERMENT OR TERMINATION**	Potential for increased transmission line outages
13	**MISCELLANEOUS:**	
1	**LINE NAME AND NUMBER:**	Hyatt - Marysville 345 kV (s3006 b3919.10 TP2023316)
2	**POINTS OF ORIGIN AND TERMINATION**	Hyatt - Marysville INTERMEDIATE STATION - Tangy (FE)
3	**RIGHTS-OF-WAY: LENGTH / WIDTH / CIRCUITS**	~23.57 mi / 150 ft / 2 circuit (19.0 mi of work)
4	**VOLTAGE: DESIGN / OPERATE**	345 kV / 345 kV
5	**APPLICATION FOR CERTIFICATE:**	2025
6	**CONSTRUCTION:**	2025 - 2027
7	**CAPITAL INVESTMENT:**	$116.7 M
8	**PLANNED SUBSTATION:**	N/A
9	**SUPPORTING STRUCTURES:**	Steel
10	**PARTICIPATION WITH OTHER UTILITIES**	N/A
11	**PURPOSE OF THE PLANNED TRANSMISSION LINE**	Rebuild aging infrastructure; improve system reliability, fix a N-1-1 overload

Appendix C Easement Form

Line Name: Van Wert - Haviland
Line No.: TLN380:OH529 **Easement No.:** 1

SUPPLEMENTAL EASEMENT AND RIGHT OF WAY

On this ___ day of _____, 2025, , whose address is , ("Grantor"), whether one or more persons, owns an interest in a tract of real property that is more particularly described lands of the Grantor, situated in the State of Ohio, Van Wert County, Tax Parcel Number in that certain document, dated recorded in Deed Record Book, Page, of the real property records of Van Wert County, Ohio, and such tract is subject to easements and rights-of-way granted in favor of AEP Ohio Transmission Company, Inc..

AEP Ohio Transmission Company, Inc., a(n) Ohio corporation, a unit of American Electric Power, whose principal business address is 1 Riverside Plaza, Columbus, Ohio 43215, ("AEP") is the current owner and holder of the rights, title, and interest, or a portion thereof, granted in or arising under that certain right of way and easement, dated , and recorded in , of the official records of County, Ohio (the "Original Easement").

NOW, THEREFORE, in consideration of the sum of Ten and NO/100 Dollars ($10.00) and other good and valuable consideration, the receipt and sufficiency of which are hereby acknowledged, Grantor hereby grants, conveys and warrants this Supplemental Easement and Right of Way ("Easement") to AEP for electric transmission, distribution, and communication lines and appurtenant equipment and fixtures, being, in, on, over, under, through and across to supplement the Original Easement insofar as it encumbers such tract of real property owned by Grantor as more particularly described above.

Auditor/Key/Tax Number:

The location, width, and boundaries of the easement area are hereby revised, modified, and clarified to be as described and depicted on Exhibit "A", attached hereto and made a part hereof ("Easement Area").

The Easement is also supplemented by the addition of the following language:

AEP, its successors and assigns, are granted the right to construct, reconstruct, operate, maintain, alter, inspect and patrol (by ground or air), protect, repair, replace, renew, upgrade, relocate

within the Easement Area, remove and replace poles, towers, and structures, made of wood, metal, concrete or other materials, including crossarms, guys, anchors, anchoring systems, grounding systems, underground conduits, ducts, vaults, transformers, pedestals, risers, pads, communications facilities, and all other appurtenant equipment and fixtures, and to string conductors, wires and cables. The electric facilities may consist of a variable number of towers, poles, wires, guys, anchors and associated fixtures, including the right to enlarge, and may transmit electricity of any voltage or amperage, together with the right to add to said facilities from time to time, and the right to do anything necessary, useful or convenient for the enjoyment of the Easement Area herein granted, together with the privilege of removing at any time any or all of said facilities erected on the Easement Area.

AEP and its successors and assigns, shall have the right, in AEP's reasonable discretion, to cut down, trim, and otherwise control, using herbicides or tree growth regulators, or other means, and at AEP's option, to remove from the Easement Area any and all trees, overhanging branches, vegetation, brush, including all root systems or other obstructions. AEP shall also have the right to cut down, trim, remove, and otherwise control trees situated on lands of the Grantor which adjoin the Easement Area, when in the reasonable opinion of AEP those trees may endanger the safety of, or interfere with the construction, operation or maintenance of AEP's facilities or ingress or egress to, from or along the Easement Area.

AEP and its successors and assigns are granted the right of unobstructed ingress and egress, at any and all times, on, over, across, along and upon the Easement Area, and across the adjoining lands of Grantor as may be reasonably necessary to access the Easement Area for the above referenced purposes.

In no event shall Grantor, its heirs, successors, and assigns plant or cultivate any trees or place, construct, install, erect or permit any temporary or permanent building, structure, improvement or obstruction including but not limited to, storage tanks, billboards, signs, sheds, dumpsters, light poles, water impoundments, above ground irrigation systems, swimming pools or wells, or permit any alteration of the ground elevation, over or within the Easement Area. AEP may, at Grantor's cost, remove any structure or obstruction if placed within the Easement Area and may re-grade any alterations of the ground elevation within the Easement Area. AEP shall repair or pay Grantor for actual damages to growing crops, fences, gates, field tile, drainage ways, drives, or lawns caused by AEP in the exercise of the rights herein granted.

The failure of AEP to exercise any of the rights granted herein, including but not limited to the removal of any obstructions from the Easement Area, shall not be deemed to constitute a waiver of the rights granted herein and the removal of any facilities from the Easement Area shall not be deemed to constitute a permanent abandonment or release of the rights granted herein.

Except as modified by this Supplemental Easement and Right of Way, all terms and provisions of the Original Easement and all rights arising in connection with the Original Easement shall remain in full force and effect, and the Original Easement shall keep its priority in title as of the date of its recording. Those provisions and rights are expressly ratified, reaffirmed by and incorporated

within this Supplemental Easement and Right of Way. The Original Easement along with this Supplemental Easement and Right of Way shall for all purposes function as a single instrument, however, to the extent any terms or provisions of the Original Easement conflict with, limit or are inconsistent with any term or provision of the Supplemental Easement and Right of Way, the terms and provisions of this Supplemental Easement and Right of Way shall control. Nothing herein will in any manner vary, change, modify, or restrict the rights and privileges that AEP may have acquired through any instrument other than the Original Easement or by any other means.

The terms and conditions as supplemented by this instrument, are the complete agreement, expressed or implied between the parties hereto and shall inure to the benefit of and be binding on their respective successors, assigns, heirs, executors, administrators, lessees, tenants, licensees, and legal representatives.

This instrument may be executed in counterparts, each of which will be deemed an original, but all of which taken together will constitute one and the same instrument.

Any remaining space on this page intentionally left blank. See next page(s) for signature(s).

IN WITNESS WHEREOF, the Grantor has executed this Easement effective the day, month and year first above written.

GRANTOR

_____

By: _____

Title: _____

State of Ohio §

County of Van Wert §

This instrument was acknowledged before me on the _____ day of _____, 2025, by _____.

_____

Notary Public

Print Name: _____

My Commission Expires:_____

This instrument prepared by Marland L. Turner, Senior Counsel - Real Estate, American Electric Power Service Corporation, 1 Riverside Plaza, Columbus, OH 43215 for and on behalf of AEP Ohio Transmission Company, Inc., a unit of American Electric Power.

When recorded return to: American Electric Power - Transmission Right of Way, 8500 Smiths Mill Road, New Albany, OH 43054.

Line Name: Van Wert - Haviland
Line No.: TLN380:OH529 **Easement No.:** 1

EASEMENT AND RIGHT OF WAY

On this ___ day of_____, 2025, in consideration of Ten and NO/100 Dollars ($10.00), and other valuable consideration, the receipt and sufficiency of which is hereby acknowledged, and the covenants hereinafter set forth, , whose address is , ("Grantor"), whether one or more persons, hereby grants, sells, conveys, and warrants to **AEP Ohio Transmission Company, Inc.**, a(n) Ohio corporation, a unit of American Electric Power, whose principal business address is 1 Riverside Plaza, Columbus, Ohio 43215, (“AEP”) and its successors, assigns, lessees and tenants a permanent easement and right of way ("Easement"), for electric transmission, distribution, and communication lines and appurtenant equipment and fixtures, being, in, on, over, under, through and across the following described lands of the Grantor, situated in the State of Ohio, Van Wert County, Tax Parcel Number.

Grantor claims title by, Deed Record Book, Page, recorded on; in the Van Wert County Recorder's Office.

Auditor/Key/Tax Number:

The Easement Area is more fully described and depicted on Exhibit "A", a copy of which is attached hereto and made a part hereof ("Easement Area").

GRANTOR FURTHER GRANTS AEP THE FOLLOWING RIGHTS:

The right, now or in the future, to construct, reconstruct, operate, maintain, alter, improve, extend, inspect and patrol (by ground or air), protect, repair, remove, replace, upgrade and relocate within the Easement Area, poles, towers, and structures, made of wood, metal, concrete or other materials, and crossarms, guys, anchors, grounding systems, and all other appurtenant equipment and fixtures, and to string conductors, wires and cables; together with the right to add to said facilities from time to time, and the right to do anything necessary, useful or convenient for the enjoyment of the Easement herein granted.

The right, in AEP’s discretion, now or in the future, to cut down, trim, remove, and otherwise control, using herbicides or tree growth regulators or other means, any and all trees, overhanging branches, vegetation or brush situated within the Easement Area. AEP shall also have the right to

cut down, trim or remove trees situated on lands of Grantor which adjoin the Easement Area when in the opinion of AEP those trees may endanger the safety of, or interfere with the construction, operation or maintenance of AEP's facilities or ingress or egress to, from or along the Easement Area.

The right of unobstructed ingress and egress, at any and all times, over, across and along and upon the Easement Area, and across the adjoining lands of Grantor as may be necessary for access to and from the Easement Area for the above referenced purposes.

THIS GRANT IS SUBJECT TO THE FOLLOWING CONDITIONS:

The Grantor reserves the right to cultivate annual crops, pasture, construct fences (provided gates are installed that adequately provide AEP the access rights conveyed herein) and roads or otherwise use the lands encumbered by this Easement in any way not inconsistent with the rights herein granted. In no event, however, shall Grantor, its heirs, successors, and assigns plant or cultivate any trees or place, construct, install, erect or permit any temporary or permanent building, structure, improvement or obstruction including but not limited to, storage tanks, billboards, signs, sheds, dumpsters, light poles, water impoundments, above ground irrigation systems, swimming pools or wells, or permit any alteration of the ground elevation, over, or within the Easement Area. AEP may, at Grantor's cost, remove any structure or obstruction if placed within the Easement Area, and may re-grade any alterations of the ground elevation within the Easement Area.

AEP agrees to repair or pay the Grantor for actual damages sustained by Grantor to crops, fences, gates, irrigation and drainage systems, drives, or lawns that are permitted herein, when such damages arise out of AEP's exercise of the rights herein granted.

The failure of AEP to exercise any of the rights granted herein, or the removal of any facilities from the Easement, shall not be deemed to constitute an abandonment or waiver of the rights granted herein.

This instrument contains the complete agreement, expressed or implied between the parties herein and shall inure to the benefit of and be binding on their respective successors, assigns, heirs, executors, administrators, lessees, tenants, and licensees.

This Easement may be executed in counterparts, each of which shall be deemed an original, but all of which, taken together, shall constitute one and the same instrument.

Any remaining space on this page left intentionally blank. See next page for signatures.

IN WITNESS WHEREOF, the Grantor has executed this Easement effective the day, month and year first above written.

GRANTOR

_____
By: _____
Title: _____

State of Ohio §
§
County of Van Wert §

This instrument was acknowledged before me on the _____ day of _____, 2025, by _____.

_____
Notary Public
Print Name: _____
My Commission Expires:_____

This instrument prepared by Marland L. Turner, Senior Counsel - Real Estate, American Electric Power Service Corporation, 1 Riverside Plaza, Columbus, OH 43215 for and on behalf of AEP Ohio Transmission Company, Inc., a unit of American Electric Power.

When recorded return to: American Electric Power - Transmission Right of Way, 8500 Smiths Mill Road, New Albany, OH 43054.

Appendix D Agency Correspondence

United States Department of the Interior

FISH AND WILDLIFE SERVICE

Ecological Services
4625 Morse Road, Suite 104
Columbus, Ohio 43230
(614) 416-8993 / FAX (614) 416-8994

June 27, 2023

Project Code: 2023-0094841

Dear Mr. Daniel Godec:

The U.S Fish and Wildlife Service (Service) has received your recent correspondence requesting information about the subject proposal. We offer the following comments and recommendations to assist you in minimizing and avoiding adverse impacts to threatened, endangered, and proposed species pursuant to the Endangered Species Act of 1973 (16 U.S.C. 1531 et seq), as amended (ESA).

Federally Threatened and Endangered Species: The endangered Indiana bat (*Myotis sodalis*) and northern long-eared bat (*Myotis septentrionalis*) occur throughout the State of Ohio. The Indiana bat and northern long-eared bat may be found wherever suitable habitat occurs unless a presence/absence survey has been performed to document absence. Suitable summer habitat for Indiana bats and northern long-eared bats consists of a wide variety of forested/wooded habitats where they roost, forage, and breed that may also include adjacent and interspersed non-forested habitats such as emergent wetlands and adjacent edges of agricultural fields, woodlots, fallow fields, and pastures. Roost trees for both species include live and standing dead trees ≥3 inches diameter at breast height (dbh) that have any exfoliating bark, cracks, crevices, hollows and/or cavities. These roost trees may be located in forested habitats as well as linear features such as fencerows, riparian forests, and other wooded corridors. Individual trees may be considered suitable habitat when they exhibit the characteristics of a potential roost tree and are located within 1,000 feet of other forested/wooded habitat. Northern long-eared bats have also been observed roosting in human-made structures, such as buildings, barns, bridges, and bat houses; therefore, these structures should also be considered potential summer habitat. In the winter, Indiana bats and northern long-eared bats hibernate in caves, rock crevices and abandoned mines.

Federally Proposed Species: On September 14, 2022, the Service proposed to list the tricolored bat (*Perimyotis subflavus*) as endangered under the ESA. The bat faces extinction due to the impacts of white-nose syndrome, a deadly disease affecting cave-dwelling bats across the continent. During spring, summer, and fall, this species roosts primarily among leaf clusters of live or recently dead trees, emerging at dusk to hunt for insects over waterways and forest edges. While white-nose syndrome is by far the most serious threat to the tricolored bat, other threats now have an increased significance due to the dramatic decline in the species' population. These threats include disturbance to bats in roosting, foraging, commuting, and over-wintering habitats. Mortality due to collision with wind turbines, especially during migration, has also been documented across their range. Conservation measures for the Indiana bat and northern long-eared bat will also help to conserve the tricolored bat.

Seasonal Tree Clearing for Federally Listed Bat Species: Should the proposed project site contain trees ≥3 inches dbh, we recommend avoiding tree removal wherever possible. If any caves or abandoned mines may be disturbed, further coordination with this office is requested to determine if fall or spring portal surveys are warranted. If no caves or abandoned mines are present and trees ≥3 inches dbh cannot be avoided, we recommend removal of any trees ≥3 inches dbh only occur between October 1 and March 31. Seasonal clearing is recommended to avoid adverse effects to Indiana bats and northern long-eared bats.

If implementation of this seasonal tree cutting recommendation is not possible, a summer presence/absence survey may be conducted for Indiana bats and northern long-eared bats. If Indiana bats and northern long-eared bats are not detected during the survey, then tree clearing may occur at any time of the year. Surveys must be conducted by an approved surveyor and be designed and conducted in coordination with the Ohio Field Office. Surveyors must have a valid federal permit. Please note that in Ohio summer mist net surveys may only be conducted between June 1 and August 15.

Section 7 Coordination: If there is a federal nexus for the project (e.g., federal funding provided, federal permits required to construct), then no tree clearing should occur on any portion of the project area until consultation under section 7 of the ESA, between the Service and the federal action agency, is completed. We recommend the federal action agency submit a determination of effects to this office, relative to the Indiana bat and northern long-eared bat, for our review and concurrence. This letter provides technical assistance only and does not serve as a completed section 7 consultation document.

Stream and Wetland Avoidance: Over 90% of the wetlands in Ohio have been drained, filled, or modified by human activities, thus is it important to conserve the functions and values of the remaining wetlands in Ohio (https://epa.ohio.gov/portals/47/facts/ohio_wetlands.pdf). We recommend avoiding and minimizing project impacts to all wetland habitats (e.g., forests, streams, vernal pools) to the maximum extent possible in order to benefit water quality and fish and wildlife habitat. Additionally, natural buffers around streams and wetlands should be preserved to enhance beneficial functions. If streams or wetlands will be impacted, the U.S. Army Corps of Engineers should be contacted to determine whether a Clean Water Act section 404 permit is required. Best management practices should be used to minimize erosion, especially on slopes. Disturbed areas should be mulched and revegetated with native plant species. In addition, prevention of non-native, invasive plant establishment is critical in maintaining high quality habitats.

Due to the project type, size, and location, we do not anticipate adverse effects to any other federally endangered, threatened, or proposed species, or proposed or designated critical habitat. Should the project design change, or additional information on listed or proposed species or their critical habitat become available, or if new information reveals effects of the action that were not previously considered, coordination with the Service should be initiated to assess any potential impacts.

Thank you for your efforts to conserve listed species and sensitive habitats in Ohio. We recommend coordinating with the Ohio Department of Natural Resources due to the potential for the proposed project to affect state listed species and/or state lands. Contact Mike Pettegrew, Environmental Services Administrator, at (614) 265-6387 or at mike.pettegrew@dnr.ohio.gov.

If you have questions, or if we can be of further assistance in this matter, please contact our office at (614) 416-8993 or ohio@fws.gov.

Sincerely,

Patrice Ashfield
Field Office Supervisor

cc: Nathan Reardon, ODNR-DOW
Eileen Wyza, ODNR-DOW

Office of Real Estate
Tara Paciorek, Chief
2045 Morse Road – Bldg. E-2
Columbus, OH 43229
Phone: (614) 265-6661
Fax: (614) 267-4764

July 19, 2023

Daniel Godec
Stantec Consulting Services Inc.
11687 Lebanon Road
Cincinnati Ohio 45241

Re: 23-0710; Haviland-Van Wert 69 kV Line Rebuild

Project: The proposed project involves rebuilding approximately 10.1 miles of the existing Haviland-Van 69 kV transmission line.

Location: The proposed project is located in Blue Creek Township of Paulding County, and Pleasant, Ridge, & Union townships of Van Wert County, Ohio.

The Ohio Department of Natural Resources (ODNR) has completed a review of the above referenced project. These comments were generated by an inter-disciplinary review within the Department. These comments have been prepared under the authority of the Fish and Wildlife Coordination Act (48 Stat. 401, as amended; 16 U.S.C. 661 et seq.), the National Environmental Policy Act, the Coastal Zone Management Act, Ohio Revised Code and other applicable laws and regulations. These comments are also based on ODNR's experience as the state natural resource management agency and do not supersede or replace the regulatory authority of any local, state, or federal agency nor relieve the applicant of the obligation to comply with any local, state, or federal laws or regulations.

Natural Heritage Database: A review of the Ohio Natural Heritage Database indicates there are no records of state or federally listed plants or animals within one mile of the specified project area. Records searched date from 1980.

Please note that Ohio has not been completely surveyed and we rely on receiving information from many sources. Therefore, a lack of records for any particular area is not a statement that rare species or unique features are absent from that area.

Fish and Wildlife: The Division of Wildlife (DOW) has the following comments.

The DOW recommends that impacts to streams, wetlands and other water resources be avoided and minimized to the fullest extent possible, and that Best Management Practices be utilized to minimize erosion and sedimentation.

The portion of the project north of Fife Road is within the vicinity of records for the Indiana bat (*Myotis sodalis*), a state endangered and federally endangered species. Because presence of state endangered bat species has been established in this area, summer tree cutting is not recommended, and additional summer surveys would not constitute presence/absence in the area.

However, limited summer tree cutting inside this buffer may be acceptable after further consultation with DOW (contact Eileen Wyza at Eileen.Wyza@dnr.ohio.gov).

In addition, the entire state of Ohio is within the range of the Indiana bat (*Myotis sodalis*), a state endangered and federally endangered species, the northern long-eared bat (*Myotis septentrionalis*), a state endangered and federally endangered species, the little brown bat (*Myotis lucifugus*), a state endangered species, and the tricolored bat (*Perimyotis subflavus*), a state endangered species. During the spring and summer (April 1 through September 30), these bat species predominately roost in trees behind loose, exfoliating bark, in crevices and cavities, or in the leaves. The DOW recommends tree cutting only occur from October 1 through March 31, conserving trees with loose, shaggy bark and/or crevices, holes, or cavities, as well as trees with DBH ≥ 20 if possible. However, if trees are present within this area, (outside of the area delineated above) and trees must be cut during the summer months, the DOW recommends a mist net survey or acoustic survey be conducted from June 1 through August 15, prior to any cutting. Mist net and acoustic surveys should be conducted in accordance with the most recent version of the "*OHIO DIVISION OF WILDLIFE GUIDANCE FOR BAT SURVEYS AND TREE CLEARING*". If state listed bats are documented, DOW recommends cutting only occur from October 1 through March 31. However, limited summer tree cutting may be acceptable after consultation with the DOW.

The DOW also recommends that a desktop habitat assessment is conducted, followed by a field assessment if needed, to determine if a potential hibernaculum is present within the project area. Direction on how to conduct habitat assessments can be found in the current USFWS "*RANGE-WIDE INDIANA BAT & NORTHERN LONG-EARED BAT SURVEY GUIDELINES*." If a habitat assessment finds that a potential hibernaculum is present within 0.25 miles of the project area, please send this information to Eileen Wyza, for project recommendations. If a potential or known hibernaculum is found, the DOW recommends a 0.25-mile tree cutting and subsurface disturbance buffer around the hibernaculum entrance, however, limited summer or winter tree cutting may be acceptable after consultation with the DOW. If no tree cutting or subsurface impacts to a hibernaculum are proposed, this project is not likely to impact these species.

The project is within the range of the pondhorn *(Uniomerus tetralasmus*), a state threatened mussel. This project must not have an impact on native mussels. This applies to both listed and non-listed species, as all species of mussel are protected in Ohio. Per the Ohio Mussel Survey Protocol (2022), all Group 2, 3, and 4 streams (Appendix A) require a mussel survey. Per the Ohio Mussel Survey Protocol, Group 1 streams (Appendix A) and unlisted streams with a watershed of 5 square miles or larger above the point of impact should be assessed using the Reconnaissance Survey for Unionid Mussels (Appendix B) to determine if mussels are present. Mussel surveys may be recommended for these streams as well. Therefore, if in-water work is planned in any stream that meets any of the above criteria, the DOW recommends the applicant provide information to indicate no mussel impacts will occur. If this is not possible, the DOW recommends a professional malacologist conduct a mussel survey in the project area. If mussels that cannot be avoided are found in the project area, the DOW recommends a professional malacologist collect and relocate the mussels to suitable and similar habitat upstream of the project site. Mussel surveys and any subsequent mussel relocation should be done in accordance with the Ohio Mussel Survey Protocol. If there is no in-water work proposed, impacts to mussels are not likely.

The project is within the range of the pugnose minnow (*Opsopoeodus emiliae*), a state endangered fish. The DOW recommends no in-water work in perennial streams from March 15 through June 30 to reduce impacts to indigenous aquatic species and their habitat. If no in-water

work is proposed in a perennial stream, this project is not likely to impact this or other aquatic species.

The project is within the range of the northern harrier (*Circus hudsonius*), a state endangered bird. This is a common migrant and winter species. Nesters are much rarer, although they occasionally breed in large marshes and grasslands. Harriers often nest in loose colonies. The female builds a nest out of sticks on the ground, often on top of a mound. Harriers hunt over grasslands. If this type of habitat will be impacted, construction should be avoided in this habitat during the species' nesting period of April 15 through July 31. If this habitat will not be impacted, this project is not likely to impact this species.

The project is within the range of the upland sandpiper (*Bartramia longicauda*), a state endangered bird. Nesting upland sandpipers utilize dry grasslands including native grasslands, seeded grasslands, grazed and ungrazed pasture, hayfields, and grasslands established through the Conservation Reserve Program (CRP). If this type of habitat will be impacted, construction should be avoided in this habitat during the species' nesting period of April 15 through July 31. If this type of habitat will not be impacted, the project is not likely to impact this species.

Due to the potential of impacts to federally listed species, as well as to state listed species, we recommend that this project be coordinated with the US Fish & Wildlife Service.

Water Resources: The Division of Water Resources has the following comment.

The local floodplain administrator should be contacted concerning the possible need for any floodplain permits or approvals for this project.

ODNR appreciates the opportunity to provide these comments. Please contact Mike Pettegrew at mike.pettegrew@dnr.ohio.gov if you have questions about these comments or need additional information.

Mike Pettegrew
Environmental Services Administrator

In reply, refer to
2023-PAU-58252

July 7, 2023

Mr. Ryan J. Weller
Weller & Associates, Inc.
1395 West Fifth Avenue
Columbus, Ohio 43212

RE: Haviland-Van Wert 69kV to 138kV Transmission Line Rebuild and Partial Greenfield Project in Blue Creek Township, Paulding County and Union/Pleasant Townships, Van Wert County, Ohio

Dear Mr. Weller:

This letter is in response to the correspondence received June 14, 2023 regarding the proposed Haviland-Van Wert 69kV to 138kV Transmission Line Rebuild and Partial Greenfield Project in Blue Creek Township, Paulding County and Union/Pleasant Townships, Van Wert County, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board rules for siting this project (OAC 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Phase I Archaeological Investigations for the 16.1 km (10 mi) Haviland-Van Wert 69kV to 138kV Transmission Line Rebuild and Partial Greenfield Project in Blue Creek Township, Paulding County and Union/Pleasant Townships, Van Wert County, Ohio* by Ryan J. Weller (Weller & Associates, Inc. 2023).

A literature review, visual inspection, surface collection, shovel probe and shovel test unit excavation was completed as part of the investigations. One (1) previously identified archaeological sites are located within the project area, Ohio Archaeological Inventory (OAI) #33VW0233. The site was reidentifed during survey. The site was previously determined not eligible for listing in the National Register of Historic Places (NRHP). Our office continues to agree with that recommendation. No new archaeological sites were identified during survey. Our office agrees no additional archaeological survey is needed.

The following comments pertain to the *History/Architecture Investigations for the 16.1 km (10 mi) Haviland-Van Wert 69kV to 138kV Transmission Line Rebuild and Partial Greenfield Project in Blue Creek Township, Paulding County and Union/Pleasant Townships, Van Wert County, Ohio* by Scott McIntosh (Weller & Associates, Inc. 2023).

A literature review and field survey were completed as part of the investigations. A total of fifty-three (53) resources fifty years of age or older were identified within the Area of Potential Effects (APE). Weller recommends these resources are not eligible for listing in the NRHP. Our office agrees with Weller's recommendations of eligibility.

Based on the information provided, we agree that the project as proposed will have no effect on historic properties. No further coordination with this office is necessary, unless the project changes or unless new or additional historic properties are discovered during implementation of this project. In such a situation, this office should be contacted. Our office also requests Weller & Associates, Inc. update OAI form #33VW0233 as soon as possible. Please notify our office when that form have been completed. If you have any questions, please contact me at (614) 298-2022, or by e-mail at khorrocks@ohiohistory.org or Joy Williams at jwilliams@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Krista Horrocks, Project Reviews Manager
Resource Protection and Review

RPR Serial No: 1098669-1098670

In reply, refer to
2023-PAU-58252

February 10, 2025

Ryan J. Weller
Weller & Associates, Inc.
1395 West Fifth Avenue
Columbus, Ohio 43212
rweller@wellercrm.com

RE: Haviland-Van Wert 69kV to 138kV Transmission Line Rebuild and Partial Greenfield Project, Paulding and Van Wert Counties, Ohio

Dear Mr. Weller:

This letter is in response to the correspondence received on January 13, 2025, regarding the proposed Haviland-Van Wert 69kV to 138kV Transmission Line Rebuild and Partial Greenfield Project located in Paulding and Van Wert Counties, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board (OPSB) rules for siting this project (OAC 4906-4 & 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Addendum: Phase I Archaeological Investigations for the 16.1 km (10 mi) Haviland-Van Wert 69kV to 138kV Transmission Line Rebuilding and Partial Greenfield Project in Paulding and Van Wert Counties, Ohio* by Ryan J. Weller (Weller & Associates, Inc. 2025). These investigations included work area expansions, alignment shifts/reroutes, access roads, and pull pads located outside any previously surveyed areas associated with the Haviland-Van Wert 69kV to 138kV transmission line project (McIntosh 2023; Weller 2023).

A literature review, visual inspection, photographic documentation, surface collection, shovel probes, and shovel test unit excavations were completed as part of the investigations. Portions of the project corridor were previously investigated through several professional surveys; these portions were not resurveyed during the current investigations. Areas of inundated or disturbed soils, as well as areas not accessible due to landowner concerns, were not subjected to surface collection or subsurface testing. These investigations re-identified one (1) previously identified archaeological site, Ohio Archaeological Inventory (OAI) site 33VW0233, as well as one (1) new archaeological site, OAI site 33VW0458. OAI site 33VW0233 was previously determined not eligible for the National Register of Historic Places (NRHP; July 7, 2023). Based on the additional information gathered from these investigations, our office continues to agree with that recommendation. OAI site 33VW0458 is a prehistoric isolated find and was not recommended as eligible for the NRHP. Our office agrees with

these recommendations and agrees that no additional archaeological survey is needed.

A literature review and field survey for architectural resources were conducted as part of the investigations. A total of five (5) resources fifty years of age or older were identified in the Area of Potential Effects (APE). It is Weller's recommendation that none of these resources are eligible for listing in the NRHP. Our office agrees with Weller's recommendations of eligibility. Therefore, we agree that there will be no effect on historic resources as a result of the project.

Based on the information provided, we continue to agree that the project, as proposed, will have no effect on historic properties. No further coordination with this office is necessary, unless the project changes or unless new or additional cultural resources are discovered during the implementation of this project. In such a situation, this office should be contacted. If you have any questions, please contact me by e-mail at cgullett@ohiohistory.org or Ms. Joy Williams at jwilliams@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Catherine Gullett, Project Reviews Coordinator - Archaeology
Resource Protection and Review
State Historic Preservation Office

RPR Serial No: 1106783

In reply, refer to
2023-PAU-58252

May 20, 2025

Ryan J. Weller
Weller & Associates, Inc.
1395 West Fifth Avenue
Columbus, Ohio 43212
rweller@wellercrm.com

RE: Haviland-Van Wert 69kV to 138kV Transmission Line Project, Paulding and Van Wert Counties, Ohio

Dear Mr. Weller:

This letter is in response to the correspondence received on April 23, 2025, regarding the proposed Haviland-Van Wert 69kV to 138kV Transmission Line Project located in Paulding and Van Wert Counties, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board (OPSB) rules for siting this project (OAC 4906-4 & 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Addendum 2: Phase I Archaeological Investigations for a 969 m (3,179 ft) Long Reroute for the Haviland-Van Wert 69kV to 138kV Transmission Line Project in Pleasant Township, Van Wert County, Ohio* by Ryan J. Weller (Weller & Associates, Inc. 2025). These investigations included work area expansions, alignment shifts/reroutes, access roads, and pull pads located outside any previously surveyed areas associated with the Haviland-Van Wert 69kV to 138kV transmission line project (McIntosh 2023; Weller 2023; Weller 2025). A literature review, visual inspection, photographic documentation, surface collection, shovel probes, and shovel test unit excavations were completed as part of the investigations. Portions of the addendum project area were previously investigated through several professional surveys, while disturbed conditions were noted in other portions. There were no previously documented archaeological sites located within the addendum project area, nor were there any new archaeological sites identified during the current investigations. Our office agrees no additional archaeological survey is needed. There were no additional architectural resources identified within the Area of Potential Effect (APE).

Based on the information provided, we continue to agree that the project, as proposed, will have no effect on historic properties. No further coordination with this office is necessary, unless the project changes or unless new or additional cultural resources are discovered during the implementation of this project. In such a situation, this office should be contacted. If you have any questions, please contact me by e-mail at cgullett@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Catherine Gullett, Project Reviews Coordinator - Archaeology
Resource Protection and Review
State Historic Preservation Office

RPR Serial No: 1108636

In reply, refer to
2023-PAU-58252

July 1, 2025

Ryan J. Weller
Weller & Associates, Inc.
1395 West Fifth Avenue
Columbus, Ohio 43212
rweller@wellercrm.com

RE: Haviland-Van Wert 69kV to 138kV Transmission Line Project, Paulding and Van Wert Counties, Ohio

Dear Mr. Weller:

This letter is in response to the correspondence received on June 3, 2025, regarding the proposed Haviland-Van Wert 69kV to 138kV Transmission Line Project located in Paulding and Van Wert Counties, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board (OPSB) rules for siting this project (OAC 4906-4 & 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Addendum 3: Archaeological Investigations for Additional Work Areas and a Minor Transmission Line Reroute Associated with the Haviland-Van Wert 69kV to 138kV Transmission Line Project in Pleasant Township, Van Wert County, Ohio* by Ryan J. Weller (Weller & Associates, Inc. 2025). These investigations included additional work areas and a transmission line reroute located outside any previously surveyed areas associated with the Haviland-Van Wert 69kV to 138kV transmission line project (McIntosh 2023; Weller 2023; Weller 2025a; Weller 2025b). A literature review, visual inspection, photographic documentation, surface collection, shovel probes, and shovel test unit excavations were completed as part of the investigations. Portions of the addendum project area were previously investigated through several professional surveys, while disturbed conditions were noted in other portions. There were no previously documented archaeological sites located within the addendum project area, nor were there any new archaeological sites identified during the current investigations. Our office agrees no additional archaeological survey is needed. There were no additional architectural resources identified within the Area of Potential Effect (APE).

Based on the information provided, we continue to agree that the project, as proposed, will have no effect on historic properties. No further coordination with this office is necessary, unless the project changes or unless new or additional cultural resources are discovered during the implementation of this project. In such a situation, this office should be contacted. If you have any questions, please contact me by e-mail at cgullett@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Catherine Gullett, Project Reviews Coordinator - Archaeology
Resource Protection and Review
State Historic Preservation Office

RPR Serial No: 1109322

In reply, refer to
2023-PAU-58252

August 21, 2025

Ryan J. Weller
Weller & Associates, Inc.
1395 West Fifth Avenue
Columbus, Ohio 43212
rweller@wellercrm.com

RE: Haviland-Van Wert 69kV to 138kV Transmission Line Project, Paulding and Van Wert Counties, Ohio

Dear Mr. Weller:

This letter is in response to the correspondence received on July 24, 2025, regarding the proposed Haviland-Van Wert 69kV to 138kV Transmission Line Project located in Paulding and Van Wert Counties, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board (OPSB) rules for siting this project (OAC 4906-4 & 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Addendum 4: Cultural Resource Management Investigations for an Expanded Project/Work Area Associated with the Haviland-Van Wert 69kV to 138kV Transmission Line Project in Pleasant Township, Van Wert County, Ohio* by Ryan J. Weller (Weller & Associates, Inc. 2025). This survey investigated an expanded work area not covered by previous surveys associated with this project (McIntosh 2023; Weller 2023; Weller 2025a, 2025b, 2025c). A literature review, visual inspection, and photographic documentation were completed as part of the investigations. Extensive visible disturbance was noted throughout the addendum project area. There were no previously documented archaeological sites located within the addendum project area, nor were there any new archaeological sites identified during the current investigations. Our office agrees no additional archaeological survey is needed. There were no additional architectural resources identified within the Area of Potential Effect (APE).

Based on the information provided, we continue to agree that the project, as proposed, will have no effect on historic properties. No further coordination with this office is necessary, unless the project changes or unless new or additional cultural resources are discovered during the implementation of this project. In such a situation, this office should be contacted. If you have any questions, please contact me by e-mail at cgullett@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Catherine Gullett, Project Reviews Coordinator - Archaeology
Resource Protection and Review
State Historic Preservation Office

RPR Serial No: 1110061

In reply, refer to
2023-PAU-58252

December 4, 2025

Ryan J. Weller
Weller & Associates, Inc.
1395 West Fifth Avenue
Columbus, Ohio 43212
rweller@wellercrm.com

RE: Haviland-Van Wert 69kV to 138kV Transmission Line Project, Paulding and Van Wert Counties, Ohio

Dear Mr. Weller:

This letter is in response to the correspondence received on October 30, 2025, regarding the proposed Haviland-Van Wert 69kV to 138kV Transmission Line Project located in Paulding and Van Wert Counties, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board (OPSB) rules for siting this project (OAC 4906-4 & 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Addendum 5: Cultural Resource Management Investigations for an Expanded Project/Work Area Associated with the Haviland-Van Wert 69kV to 138kV Transmission Line Project in Pleasant Township, Van Wert County, Ohio* by Weller & Associates, Inc. (Weller 2025). This survey investigated an expanded work area not covered by previous surveys associated with this project (McIntosh 2023; Weller 2023; Weller 2025a, 2025b, 2025c, 2025d). A literature review, visual inspection, photographic documentation, and surface collection were completed as part of the investigations. Extensive visible disturbance was noted throughout the addendum project area. There were no previously documented archaeological sites located within the addendum project area, nor were there any new archaeological sites identified during the current investigations. Our office agrees no additional archaeological survey is needed. There were no additional architectural resources identified within the Area of Potential Effect (APE).

Based on the information provided, we continue to agree that the project, as proposed, will have no effect on historic properties. No further coordination with this office is necessary, unless the project changes or unless new or additional cultural resources are discovered during the implementation of this project. In such a situation, this office should be contacted. If you have any questions, please contact me by e-mail at cgullett@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Catherine Gullett, Project Reviews Coordinator - Archaeology
Resource Protection and Review
State Historic Preservation Office

RPR Serial No: 1111545

In reply refer to:
2023-PAU-58252

July 6, 2026

Chad Porter
Weller & Associates, Inc.
1395 West 5th Ave.
Columbus, OH 43212
Email: c.porter@wellercrm.com

RE: **Section 106 Review: Haviland-Van Wert 69kV to 138kV, Paulding County, Ohio**

Dear Mr. Porter:

This letter is in response to the correspondence received on June 18, 2026, regarding the Haviland-Van Wert 69kV to 138kV project in Paulding County, Ohio. We appreciate the opportunity to comment on this project. The comments of the Ohio State Historic Preservation Office (SHPO) are made pursuant to Section 149.53 of the Ohio Revised Code and the Ohio Power Siting Board (OPSB) for siting this project (OAC 4906-4 & 4906-5). The comments of the Ohio SHPO are also submitted in accordance with the provisions of Section 106 of the National Historic Preservation Act of 1966, as amended (54 U.S.C. 306108 [36 CFR 800]).

The following comments pertain to the *Addendum 6: Cultural Resource Management Investigations for Several Expanded Project/Work Areas Associated with the Haviland-Van Wert 69kV to 138kV project in Pleasant Township, Van Wert County, Ohio* (Weller & Associates, Inc., June 2026). The current investigations were conducted at several locations situated outside areas that have previously been surveyed associated with original investigations in June 2023 (Weller 2023; McIntosh 2023) and addendums in 2025 (Weller 2025e-a). The field reconnaissance work involved visual inspection, shovel testing, and surface collection. Much of the addendum project area was found to be disturbed or contained areas that were previously investigated. There were no previously documented archaeological sites located within the addendum project areas and no new archaeological sites were identified. Our office agrees that no further cultural resource management work is considered necessary for the addendum project areas.

Therefore, based on the information provided, our office continues to agree that the project, as proposed, will have no effect on historic properties. No further coordination is required, unless the project changes or additional cultural resources are discovered during the implementation of this project. In such a situation, this office should be contacted as required by 36 CFR § 800.13. If you have any questions concerning this review, please contact me via email at broddy@ohiohistory.org. Thank you for your cooperation.

Sincerely,

Bridget C. Roddy

Bridget C. Roddy, Project Reviews Manager-Archaeology
Resource Protection and Review
State Historic Preservation Office

RPR Serial No. 1114513

Appendix E Ecological Survey Report

Van Wert-Haviland 138 kV Transmission Line Project

Ecological Survey Report

Prepared for:

AEP Ohio Transmission Company, Inc.
8600 Smiths Mill Road
New Albany, OH 43054

Prepared by:

Stantec Consulting Services, Inc.
10200 Alliance Rd, Suite 300
Blue Ash, OH 45242

July 7, 2026

Sign-off Sheet

This document entitled Van Wert-Haviland 138 kV Transmission Line Project Ecological Survey Report was prepared by Stantec Consulting Services Inc. ("Stantec") for the account of AEP Ohio Transmission Company, Inc. Any reliance on this document by any third party is strictly prohibited. The material in it reflects Stantec's professional judgment in light of the scope, schedule and other limitations stated in the document and in the contract between Stantec and the Client. The opinions in the document are based on conditions and information existing at the time the document was published and do not take into account any subsequent changes. In preparing the document, Stantec did not verify information supplied to it by others. Any use which a third party makes of this document is the responsibility of such third party. Such third party agrees that Stantec shall not be responsible for costs or damages of any kind, if any, suffered by it or any other third party as a result of decisions made or actions taken based on this document.

Prepared by

(signature)

Malea Casey

Reviewed by

(signature)

Kate Bomar

Table of Contents

1.0 INTRODUCTION 1

2.0 METHODS 2
2.1 WETLAND DELINEATION 2
2.2 STREAM DELINEATION 2
2.3 RARE SPECIES 2

3.0 RESULTS 3
3.1 TERRESTRIAL HABITAT 3
3.2 WETLANDS 5
3.3 STREAMS 9
3.4 OPEN WATERS 11
3.5 RARE, THREATENED, OR ENDANGERED SPECIES HABITAT 12

4.0 CONCLUSIONS AND RECOMMENDATIONS 17

5.0 REFERENCES 20

LIST OF TABLES

Table 1. Vegetation Communities and Land Cover Types Found within the Van Wert-Haviland 138 kVTransmission LineProject Area, Paulding and Van Wert Counties, Ohio 3
Table 2. Summary of Wetland Resources Found within the Van Wert-Haviland 138 kV Tranmission Line Project Area, Paulding and Van Wert Counties, Ohio 6
Table 3. Summary of NWI Disposition within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio 7
Table 4. Summary of Stream Resources Found within the Van Wert-Haviland 138 kVTransmission Line Project Area, Paulding and Van Wert Counties, Ohio 9
Table 5. Summary of Potential Federally Listed and Ohio State-Listed Species within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio 12

LIST OF APPENDICES

APPENDIX A FIGURES A.1
Figure 1 – Project Location Map A.1
Figure 2 – Wetland and Waterbody Delineation Map A.2
Figure 3 – Habitat Assessment Map A.3
Figure 4 – Bat Hibernacula Desktop Study Map A.4

APPENDIX B AGENCY CORRESPONDENCE B.1

APPENDIX C REPRESENTATIVE PHOTOGRAPHS C.1
Wetland and Waterbody Photographs C.1

Habitat Photographs C.2

APPENDIX D DATA FORMS D.1
Wetland Determination Data Forms D.1
ORAM Data Forms D.2
HHEI/QHEI Data Forms D.3

1.0 INTRODUCTION

AEP Ohio Transmission Company, Inc. (AEP) is proposing construction activities associated with the Van Wert-Haviland 138 kV Transmission Line Project. AEP plans to rebuild approximately 10.7 miles of the existing Haviland-Van Wert 69 kV Transmission Line to 138 kV standards, including an approximately 2.2 mile-long greenfield reroute of the transmission line (Figure 1, Appendix A). The Project area was surveyed for wetlands, waterbodies, open water features, and potential threatened, endangered, and rare species habitat by Stantec Consulting Services Inc. (Stantec) biologists on June 25-27, 2024, December 9, 2024, April 16, 2025, June 2, 2025, July 22, 2025, and June 18, 2026. The approximate locations of features located up to 50 feet outside of the Project area were also recorded during the field surveys, where landowner access was permitted. However, no data forms were collected on features that did not extend into the Project area. The approximate locations of these features are shown on the Figure 2 maps in Appendix A as "approximate" wetlands, streams (waterways), open waters, and upland drainage features.

2.0 METHODS

2.1 WETLAND DELINEATION

Prior to completing the field surveys, a desktop review of the Project area was conducted using U.S. Geological Survey (USGS) topographic mapping, National Wetlands Inventory (NWI) maps, U.S. Department of Agriculture (USDA) Natural Resources Conservation Service (NRCS) soil survey data, and aerial imagery mapping. Stantec completed a wetland delineation study in accordance with the *Corps of Engineers Wetlands Delineation Manual* (USACE 1987), the *Regional Supplement to the Corps of Engineers Wetland Delineation Manual: Northcentral and Northeast Region (Version 2.0)* (USACE 2012). Wetland categories were classified using the Ohio Rapid Assessment Method (ORAM) for Wetlands Version 5.0 (Mack 2001).

2.2 STREAM DELINEATION

Streams that demonstrated a continuously defined channel (bed and bank), ordinary high-water mark (OHWM), and the disturbance of terrestrial vegetation were delineated within the Project area, per the protocols outlined in the USACE's Guidance on Ordinary High Water Mark Identification (Regulatory Guidance Letter, No. 05-05) (USACE 2005). Delineated streams were classified as ephemeral, intermittent, or perennial per definitions in the Federal Register/Vol. 67, No. 10 (USACE 2002). Functional assessment of streams identified within the Project area was based on completion of the Ohio Environmental Protection Agency's (OEPA) Headwater Habitat Evaluation Index (HHEI; OEPA 2020) and/or Qualitative Habitat Evaluation Index (QHEI; OEPA 2006) data forms. The centerline of each waterway and/or the OHWM of each waterway was identified and surveyed using a handheld sub-meter accuracy global positioning system (GPS) unit and mapped with geographic information system (GIS) software. Additionally, the locations of ponds/open water features and upland drainage features (which lacked a continuously defined bed and bank/OHWM) identified within the Project area were also recorded with a sub-meter accuracy GPS unit during the field surveys.

2.3 RARE SPECIES

Prior to conducting the field surveys, Stantec contacted the Ohio Department of Natural Resources (ODNR) and the U.S. Fish and Wildlife Service (USFWS) for information regarding rare, threatened, or endangered species and their habitats of concern within the vicinity of the Project area (Appendix B – Agency Correspondence). To assess potential impacts to rare, threatened, or endangered species, Stantec scientists conducted a pedestrian reconnaissance of the proposed Project area, collected information on existing habitats within the Project area, and assessed the potential for these habitats to be used by federally listed or state-listed species that have the potential to occur within Paulding and Van Wert Counties.

3.0 RESULTS

3.1 TERRESTRIAL HABITAT

Stantec completed field surveys for threatened and endangered species or their habitats on June 25-27, 2024, December 9, 2024, April 16, 2025, June 2, 2025, July 22, 2025, and June 18, 2026. Figure 3 (Appendix A) shows the vegetation communities/habitats and land cover types identified within the Project area and the locations of any identified rare, threatened, or endangered species habitat observed within the Project area during the time of the habitat assessment surveys. Representative photographs of the vegetation communities/habitats and land cover types identified within the Project area are included in Appendix C of this report (photo locations are shown on Figure 3, Appendix A). Information regarding the vegetation communities/habitats/land cover types identified within the Project area is provided in Table 1.

Table 1. Vegetation Communities and Land Cover Types Found within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio

Vegetation Communities and Land Cover Types within the Project Area	Degree of Human-Related Ecological Disturbance	Unique, Rare, or High Quality?	Approximate Acreage Within Project Area
Agricultural Land	Extreme Disturbance/Ruderal Community (dominated by planted row crop species such as corn (*Zea mays*) and soybean (*Glycine max*)).	No	98.64
Early Successional Deciduous Forest	Moderate Disturbance/Natural Community (dominated by native woody and herbaceous species and/or opportunistic invaders). Common plant species included boxelder maple (*Acer negundo*), American sycamore (*Platanus occidentalis*), multiflora rose (*Rosa multiflora*), Allegheny blackberry (*Rubus allegheniensis*), and eastern poison ivy (*Toxicodendron radicans*).	No	5.12
Existing Road	Extreme Disturbance/existing paved road or other paved area (little to no vegetation is present in these habitats).	No	22.75
Existing Railroad	Extreme Disturbance (little to no vegetation is present in these habitats)	No	1.40
Industrial Land	Extreme Disturbance/Ruderal Community (little to no vegetation is present in these habitats)	No	8.60

Vegetation Communities and Land Cover Types within the Project Area	Degree of Human-Related Ecological Disturbance	Unique, Rare, or High Quality?	Approximate Acreage Within Project Area
Maintained Lawn	Extreme Disturbance/Ruderal Community (dominated by planted non-native species, opportunistic invaders, and/or native highly tolerant taxa). Common plant species included common dandelion (*Taraxacum officinale*), white clover (*Trifolium repens*), narrowleaf plantain (*Plantago lanceolata*), tall fescue (*Schedonorous arundinaceus*), and Kentucky bluegrass (*Poa pratensis*).	No	65.46
New Field	Extreme Disturbance/Ruderal Community (dominated by planted non-native species, opportunistic invaders, and/or native highly tolerant taxa). Common plant species included Kentucky bluegrass, Canada thistle (*Cirsium arvense*), narrowleaf plantain, white clover, and St. John's wort (*Hypericum perforatum*).	No	12.45
Old Field	Extreme Disturbance/Ruderal Community (dominated by opportunistic invaders and/or native highly tolerant taxa). Common plant species included giant ironweed (*Vernonia gigantea*), Canada thistle, Fuller's teasel (*Dipsacus fullonum*), Canada goldenrod (*Solidago canadensis*), multiflora rose, and Allegheny blackberry.	No	3.25
Palustrine Emergent Wetland	Moderate Disturbance/Natural Community (dominated by native herbaceous species and/or opportunistic invaders). Common plant species included rice cutgrass (*Leersia oryzoides*), broadleaf cattail (*Typha latifolia*), softstem bulrush (*Schoenoplectus tabermaemontani*), lake sedge (*Carex lacustris*), reed canarygrass (*Phalaris arundinacea*), and creeping jenny (*Lysimachia nummularia*).	No	4.92
Palustrine Forested Wetland	Moderate Disturbance/Natural Community (dominated by native woody and herbaceous species and/or opportunistic invaders). Common plant species included silver maple (*Acer saccharinum*), shellbark hickory (*Carya laciniosa*), eastern cottonwood	No	0.17

Vegetation Communities and Land Cover Types within the Project Area	Degree of Human-Related Ecological Disturbance	Unique, Rare, or High Quality?	Approximate Acreage Within Project Area
	(*Populus deltoides*), American elm (*Ulmus americana*), red osier dogwood (*Cornus sericea*), and three-way sedge (*Dulichium arundinaceum*).		
		TOTAL	**222.76**

3.2 WETLANDS

Stantec completed field surveys for wetlands within the Project area on June 25-27, 2024, December 9, 2024, April 16, 2025, June 2, 2025, July 22, 2025, and June 18, 2026. As a result of the field surveys, Stantec identified 14 wetlands within the Project area. Figure 2 (Appendix A) shows the locations of the wetlands identified by Stantec within the Project area. Representative photographs of the wetlands identified within the Project area are included in Appendix C of this report (photograph locations are shown on Figure 2, Appendix A). Completed wetland determination data forms and ORAM data forms are included in Appendix D. Information regarding the Cowardin classification and ORAM categories of wetlands identified within the Project area is provided in Table 2. A summary of the disposition of NWI-mapped wetlands within the Project area is provided in Table 3.

Results
July 7, 2026

Table 2. Summary of Wetland Resources Found within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio

Wetland ID	Location		Isolated?[2]	Habitat Type[3,4,5]	Delineated Area (acre)	ORAM		Nearest Proposed Structure Number	Existing Structure Number in Wetland	Proposed Structure Number in Wetland	Structure Installation Method	Proposed Impacts	
	Latitude	Longitude				Score[6]	Category[6]					Temporary Matting Area (acre)	Permanent Impact Area (acre)
Wetland 1	41.011692	-84.592451	No	PEM[4]	0.01	17	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 2	41.004334	-84.592153	No	PEM[4]	0.11	12	1	TBD[7]	229, 230, 231, 232, 233	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 3	40.99348	-84.592072	No	PEM[4]	1.14	10	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 4	40.983874	-84.592030	No	PEM[4]	0.60	17	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 5	40.974789	-84.591966	No	PEM[4]	0.47	19	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 6	40.968053	-84.591907	No	PEM[4]	1.05	25	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 7	40.945413	-84.591601	No	PEM[4]	0.03	19	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 8	40.942451	-84.591739	No	PEM[4]	0.25	19	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 9	40.940270	-84.591721	No	PEM[4]	0.58	22	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 10	40.921068	-84.591476	No	PEM[4]	0.64	16	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 11	40.885247	-84.571431	No	PEM[4]	0.03	15	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 12	40.891594	-84.585148	Yes	PFO[5]	0.14	29	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 13	40.891806	-84.581417	No	PEM[4]	0.01	7	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
Wetland 14	40.892256	-84.582565	No	PFO[5]	0.03	28	1	TBD[7]	N/A	TBD[7]	TBD[7]	TBD[7]	TBD[7]
				TOTAL	**5.09**						**TOTAL**	TBD[7]	TBD[7]

[1] Appendix A - Figure 2 and Appendix C – Wetland and Waterbody Photographs
[2] Pending USACE jurisdictional review
[3] Habitat type based on Cowardin et al. (1979).
[4] PEM = Palustrine Emergent Wetland
[5] PFO = Palustrine Forested Wetland
[6] ORAM Score and Category are based on the Ohio Rapid Assessment Method for Wetland v. 5.0 (Mack 2001).
[7] TBD = To be determined. Wetland impacts and proposed structure locations are unknown at this time.

Table 3. Summary of NWI Disposition within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio

NWI Code	NWI Description	Figure 2 Page Number	Related Field Inventoried Resource(s)	Comments
R4SBC	Riverine, intermittent, streambed, seasonally flooded	2	Wetland 1	Wetland 1 was delineated within the mapped NWI feature. The ORAM data form and wetland determination data form completed for this wetland are provided in Appendix D. Representative photographs are available in Appendix C.
R4SBC	Riverine, intermittent, streambed, seasonally flooded	3, 4	Wetland 2	Wetland 2 was delineated near the mapped NWI feature. The ORAM data form and wetland determination data form completed for this wetland are provided in Appendix D. Representative photographs are available in Appendix C.
R5UBH	Riverine, unknown perennial, unconsolidated bottom, permanently flooded	5	Stream 2 (Prairie Creek)	Stream 2 (Prairie Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C.
R4SBC	Riverine, intermittent, streambed, seasonally flooded	5-12	Stream 3, Stream 4, Stream 5, Wetland 3, Wetland 4, Wetland 5, Wetland 6	Streams 3, 4, and 5 were delineated within the mapped NWI feature. The HHEI data forms completed for these streams are provided in Appendix D. Representative photographs are available in Appendix C. Wetlands 3, 4, 5 and 6 were delineated within the mapped NWI feature. The ORAM data forms and wetland determination data forms completed for these wetlands are provided in Appendix D. Representative photographs are available in Appendix C.
R4SBC	Riverine, intermittent, streambed, seasonally flooded	13	Stream 6 (Hagerman Creek)	Stream 6 (Hagerman Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C.
R5UBH	Riverine, unknown perennial, unconsolidated bottom, permanently flooded	15	Stream 7 (Pottawatomi Creek), Wetland 7	Stream 7 (Pottawatomi Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C. Wetland 7 was delineated within the mapped NWI feature. The ORAM data form and wetland determination data forms completed for this wetland are provided in Appendix D. Representative photographs are available in Appendix C.

NWI Code	NWI Description	Figure 2 Page Number	Related Field Inventoried Resource(s)	Comments
R4SBC	Riverine, intermittent, streambed, seasonally flooded	15-19	Wetland 8, Wetland 9	Wetlands 8 and 9 were delineated near the mapped NWI feature. The ORAM data forms and wetland determination data forms completed for these wetlands are provided in Appendix D. Representative photographs are available in Appendix C.
R5UBH	Riverine, unknown perennial, unconsolidated bottom, permanently flooded	19	Stream 8 (Hoaglin Creek)	Stream 8 (Hoaglin Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C.
R4SBC	Riverine, intermittent, streambed, seasonally flooded	19-21	Wetland 10	Wetland 10 was delineated within the mapped NWI feature. The ORAM data form and wetland determination data forms completed for this wetland are provided in Appendix D. Representative photographs are available in Appendix C.
R5UBH	Riverine, unknown perennial, unconsolidated bottom, permanently flooded	25	Stream 9 (Maddox Creek)	Stream 9 (Maddox Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C.
R5UBH	Riverine, unknown perennial, unconsolidated bottom, permanently flooded	28	Stream 10 (Town Creek)	Stream 10 (Town Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C.
PSS1A	Palustrine, scrub-shrub, broad-leaved deciduous, temporarily flooded	30	Wetland 12	Wetland 12 was delineated within the mapped NWI feature. The ORAM data form and wetland determination data form completed for this wetland are provided in Appendix D. Representative photographs are available in Appendix C.
R5UBH	Riverine, unknown perennial, unconsolidated bottom, permanently flooded	30	Stream 11 (Town Creek)	Stream 11 (Town Creek) was delineated within the mapped NWI feature. The QHEI data form completed for this stream is provided in Appendix D. Representative photographs are available in Appendix C.

3.3 STREAMS

Stantec completed field surveys for streams (waterways) within the Project area on June 25-27, 2024, December 9, 2024, April 16, 2025, June 2, 2025, July 22, 2025, and June 18, 2026. Figure 2 (Appendix A) shows the locations of streams identified by Stantec within the Project area. Representative photographs of the streams are included in Appendix C of this report (photograph locations are shown on Figure 2, Appendix A). Completed QHEI and HHEI data forms for the identified streams are included in Appendix D. Information regarding the identified streams is provided in Table 4.

Table 4. Summary of Stream Resources Found within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio

Stream ID	Location		Stream Type	Stream Name[1]	Delineated Length (feet)	Bankfull Width (feet)	OHWM Width (feet)	Field Evaluation			Ohio EPA 401 Eligibility	Stream Crossing?	Proposed Impacts	
	Latitude	Longitude						Method	Score[2,3]	Category/ Rating/ OAC Use Designation[2,3,4]			Fill Type	Area (acre)
Stream 1	41.016576	-84.592147	Ephemeral	UNT to Prairie Creek	275	6	5	HHEI	42	Modified Class II/ PHW	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 2	40.997387	-84.592405	Perennial	Prairie Creek	116	30	27	QHEI	33.5	Poor	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 3	40.986790	-84.592073	Ephemeral	UNT to Prairie Creek	2,664	8	6	HHEI	40	Modified Class II/ PHW	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 4	40.980057	-84.592017	Intermittent	UNT to Prairie Creek	2,748	8	3	HHEI	40	Modified Class II/ PHW	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 5	40.960677	-84.592186	Intermittent	UNT to Prairie Creek	54	4	3	HHEI	47	Modified Class II/ PHW	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 6	40.954664	-84.591843	Perennial	Hagerman Creek	116	12	9	QHEI	30.5	Poor	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 7	40.945381	-84.591781	Perennial	Pottawatomie Creek	121	4.8	4.5	QHEI/HHEI	33.5/62	Modified Class II/ PHW	Eligible	TBD[5]	TBD[5]	TBD[5]

Results
July 7, 2026

Stream ID	Location		Stream Type	Stream Name[1]	Delineated Length (feet)	Bankfull Width (feet)	OHWM Width (feet)	Field Evaluation			Ohio EPA 401 Eligibility	Stream Crossing?	Proposed Impacts	
	Latitude	Longitude						Method	Score[2,3]	Category/ Rating/ OAC Use Designation[2,3,4]			Fill Type	Area (acre)
Stream 8	40.929116	-84.591671	Perennial	Hoaglin Creek	166	40	34	QHEI	28.5	Very Poor	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 9	40.894820	-84.591472	Perennial	Maddox Creek	121	22	18	QHEI	31.5	Poor	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 10	40.883629	-84.588255	Perennial	Town Creek	106	41	35	QHEI	30.5	Poor	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 11	40.892102	-84.583467	Perennial	Town Creek	309	36	31	QHEI	41	Poor	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 12	40.885265	-84.572328	Intermittent	UNT to Little Auglaize River	60	6	4	HHEI	45	Modified Class II PHW	Eligible	TBD[5]	TBD[5]	TBD[5]
Stream 13	40.884856	-84.572205	Ephemeral	UNT to Little Auglaize River	247	3	0.6	HHEI	18	Modified Class I PHW	Eligible	TBD[5]	TBD[5]	TBD[5]
				TOTAL	**7,103**								**TOTAL**	TBD[5]

[1]UNT = Unnamed Tributary
[2]Based on the designated use evaluation presented in the Field Methods for Evaluating Primary Headwater Habitat Streams in Ohio, Version 4.0 (OEPA 2020).
[3]Based on the designated use evaluation presented in the Methods for Assessing Habitat in Flowing Waters: Using the Qualitative Habitat Evaluation Index (OEPA 2006).
[4]Based on Ohio Administrative Code (OAC) 3745-1-16.
[5]TBD – To be determined. Impact information and stream crossing information is unknown at this time.

3.4 OPEN WATERS

One open water feature (Open Water 1) was identified within the Project area during the field surveys completed on June 25-27, 2024, December 9, 2024, April 16, 2025, June 2, 2025, July 22, 2025, and June 18, 2026. Representative photographs of the open water feature are included in Appendix C of this report (photograph locations are shown in Figure 2, Appendix A).

3.5 RARE, THREATENED, OR ENDANGERED SPECIES HABITAT

Table 5. Summary of Potential Federally Listed and Ohio State-Listed Species within the Van Wert-Haviland 138 kV Transmission Line Project Area, Paulding and Van Wert Counties, Ohio

Common Name/ Scientific Name	State Listed Status[1,2]	Federally Listed Status[1,3]	Typical Habitat	Habitat Observed	Agency Comments (Appendix B)	Potential Impacts and Avoidance Dates
Mussels						
Pondhorn/ *Uniomerus tetralasmus*	T	N/A	This species occurs in fine gravel in moderate current. It may be encountered in shallow, quiet, or slow-moving water at depths seldom exceeding two feet. This species typically inhabits the quiet or slow-moving, shallow waters of sloughs, borrow pits, ponds, ditches, and meandering streams. It is typically found buried in a substrate of fine sand and mud in shallow sloughs and ditches, and it is a species tolerant of adverse habitat conditions, surviving for periods of weeks or even months buried in the bottoms or banks of dried-up ponds (Parmalee and Bogan 1998; NatureServe 2025).	Potentially suitable habitat (perennial streams and open water features) was observed within the Project area.	**ODNR** – The Project is within the range of the pondhorn. This Project must not have an impact on native mussels. If in-water work is planned in any stream that meets the Ohio Mussel Survey Protocol criteria, ODNR recommends the applicant provide information to indicate no mussel impacts will occur. If this is not possible, the ODNR recommends a professional malacologist conduct a mussel survey in the Project area. If there is no in-water work proposed, impacts to mussels are not likely. **USFWS** – No comments received.	Potentially suitable habitat was observed within the Project area. However, no in-water work in perennial streams or open water features is proposed by AEP. Therefore, impacts to this species are not anticipated and avoidance dates are not applicable.
Fish						
Pugnose Minnow/ *Opsopoeodus emiliae*	E	N/A	Habitat includes lowlands in clear to turbid, sluggish, often weedy waters of lakes, reservoirs, sloughs, swamps, and streams of all sizes (NatureServe 2025).	Potentially suitable habitat (perennial streams and open water features) was observed within the Project area.	**ODNR** – The Project is within the range of the pugnose minnow. The ODNR recommends no in-water work in perennial streams from March 15 through June 30 to reduce impacts to indigenous aquatic species and their habitat. If no in-water work is proposed in a perennial stream, this Project is not likely to impact this species. **USFWS** – No comments received.	Potentially suitable habitat was observed within the Project area. However, no in-water work in perennial streams or open water features is proposed by AEP. Therefore, impacts to this species are not anticipated and avoidance dates are not applicable.
Mammals						
Indiana Bat/ *Myotis sodalis*	E	E	The Indiana bat is likely distributed over the entire State of Ohio, though not uniformly. This species generally forages in openings and edge habitats within upland and floodplain forest, but they also forage over old fields and pastures (Brack et al. 2010). Natural roost structures include trees (live or dead) with exfoliating bark, and exposure to solar radiation. Other important factors for roost trees include relative location to other trees, a permanent water source and foraging areas; Dead trees are preferred as maternity roosts; however, live trees are often used as secondary roosts depending on microclimate conditions (USFWS 2007; USFWS 2024). Roosts have also occasionally been found to consist of cracks and hollows in trees, utility poles, buildings, and bat boxes. Primarily use caves for	Potentially suitable foraging and roosting habitat (early successional deciduous forest habitat) was observed within the Project area. No potential bat hibernacula were observed within the Project area.	**ODNR** – The portion of the Project north of Fife Road is within the vicinity of records of the Indiana bat. Because presence of a state endangered bat species has been established in this area, summer tree cutting is not recommended, and additional summer surveys would not constitute presence/absence in the area. However, limited summer tree cutting inside this buffer may be acceptable after further consultation with the ODNR. In addition, ODNR recommends a desktop habitat assessment is conducted, followed by a field assessment if needed, to determine if there are potential hibernacula present within the Project area. If a habitat assessment finds that	Potentially suitable summer foraging and roosting habitat was observed within early successional deciduous forest habitat areas within the Project area. It is anticipated that AEP will conduct any tree clearing required for the Project between October 1 and March 31. If any summer tree clearing is required, AEP will proceed with agency recommendations to avoid impacts to this species. Additionally, a desktop bat hibernacula habitat assessment was completed by Stantec. No active or abandoned underground mines were identified within 0.25 miles of the Project area as a result of the assessment. An area of karst geology was identified that overlaps the entirety of the Project area (Appendix A, Figure 4). However, no underground openings, caves, or any other potentially suitable hibernacula were observed within the Project area during the field surveys completed by Stantec.

Common Name/ Scientific Name	State Listed Status[1,2]	Federally Listed Status[1,3]	Typical Habitat	Habitat Observed	Agency Comments (Appendix B)	Potential Impacts and Avoidance Dates
			hibernacula, although are also known to hibernate in abandoned underground mines (Brack et al. 2010).		potential hibernacula are present within 0.25 miles of the Project area, please send this information to Eileen Wyza for project recommendations. If no tree cutting or subsurface impacts to a hibernaculum are proposed, this Project not likely to impact this species. **USFWS** – The Indiana bat occurs throughout the state of Ohio. Should the proposed Project site contain trees ≥3 inches dbh, the USFWS recommends avoiding tree removal wherever possible. If any caves or abandoned mines may be disturbed, further coordination with the USFWS office is requested to determine if fall or spring portal surveys are warranted. If no caves or abandoned mines are present and trees ≥3 inches dbh cannot be avoided, the USFWS recommends removal of any trees ≥3 inches dbh only occur between October 1 and March 31.	**Avoidance Dates: April 1 – September 30**
Northern Long-eared Bat/ *Myotis septentrionalis*	E	E	The northern long-eared bat is found throughout Ohio. This species generally forages in forested habitat and openings in forested habitat and utilizes cracks, cavities, and loose bark within live and dead trees, as well as buildings as roosting habitat (Brack et al. 2010; USFWS 2020). The species utilizes caves and abandoned mines as winter hibernacula. Various sized caves are used providing they have a constant temperature, high humidity, and little to no air current (Brack et al. 2010).	Potentially suitable foraging and roosting habitat (early successional deciduous forest habitat) was observed within the Project area. No potential bat hibernacula were observed within the Project area.	**ODNR** – The entire state of Ohio is within the range of the northern long-eared bat. The ODNR recommends tree cutting only occur from October 1 through March 31, conserving trees with loose, shaggy bark and/or crevices, holes, or cavities, as well as trees with dbh ≥ 20 inches if possible. If trees must be cut during summer months (outside of the portion of the Project area north of Fife Road), the ODNR recommends a mist net survey or acoustic survey be conducted from June 1 through August 15, prior to any cutting. If state listed bats are documented, ODNR recommends cutting only occur from October 1 through March 31. In addition, ODNR recommends a desktop habitat assessment is conducted, followed by a field assessment if needed, to determine if there are potential hibernacula present within the Project area. If a habitat assessment finds that potential hibernacula are present within 0.25 miles of the Project area, please send this information to Eileen Wyza for project recommendations. **USFWS** - The northern long-eared bat occurs throughout the state of Ohio. Should the proposed project site contain	Potentially suitable summer foraging and roosting habitat was observed within early successional deciduous forest habitat areas within the Project area. It is anticipated that AEP will conduct any tree clearing required for the Project between October 1 and March 31. If any summer tree clearing is required, AEP will proceed with agency recommendations to avoid impacts to this species. Additionally, a desktop bat hibernacula habitat assessment was completed by Stantec. No active or abandoned underground mines were identified within 0.25 miles of the Project area as a result of the assessment. An area of karst geology was identified that overlaps the entirety of the Project area (Appendix A, Figure 4). However, no underground openings, caves, or any other potentially suitable hibernacula were observed within the Project area during the field surveys completed by Stantec. **Avoidance Dates: April 1 – September 30**

Common Name/ Scientific Name	State Listed Status[1,2]	Federally Listed Status[1,3]	Typical Habitat	Habitat Observed	Agency Comments (Appendix B)	Potential Impacts and Avoidance Dates
					trees ≥3 inches dbh, the USFWS recommends avoiding tree removal wherever possible. If any caves or abandoned mines may be disturbed, further coordination with the USFWS office is requested to determine if fall or spring portal surveys are warranted. If no caves or abandoned mines are present and trees ≥3 inches dbh cannot be avoided, the USFWS recommends removal of any trees ≥3 inches dbh only occur between October 1 and March 31.	
Little Brown Bat/ *Myotis lucifugus*	E	N/A	The little brown bat is found throughout Ohio. This species seems to prefer to forage over water but also forages among trees in rather open areas (Harvey et al. 1999). During summer, it typically inhabits buildings, attics, church belfries, barns and outbuildings, and occasionally more natural habitats such as sloughing bark of a dead tree. During summer, two types of roosts are utilized: day roosts and night roosts. Day roosts are the maternity colony roost, while little brown bats often roost in other areas where they rest and congregate to digest their food in between foraging bouts. In Ohio, this species typically utilizes caves and mines as hibernacula, although at least one hibernaculum was found to be located in an attic of an old building (Brack et al. 2010).	Potentially suitable foraging and roosting habitat (early successional deciduous forest habitat and riparian areas along perennial streams) was observed within the Project area. No potential bat hibernacula were observed within the Project area.	**ODNR** – The entire state of Ohio is within the range of the little brown bat. The ODNR recommends tree cutting only occur from October 1 through March 31, conserving trees with loose, shaggy bark and/or crevices, holes, or cavities, as well as trees with dbh ≥ 20 inches if possible. If trees must be cut during summer months (outside of the portion of the Project area north of Fife Road), the ODNR recommends a mist net survey or acoustic survey be conducted from June 1 through August 15, prior to any cutting. If state listed bats are documented, ODNR recommends cutting only occur from October 1 through March 31. In addition, ODNR recommends a desktop habitat assessment is conducted, followed by a field assessment if needed, to determine if there are potential hibernacula present within the Project area. If a habitat assessment finds that potential hibernacula are present within 0.25 miles of the Project area, please send this information to Eileen Wyza for project recommendations. **USFWS** – No comments received.	Potentially suitable summer foraging and roosting habitat was observed within early successional deciduous forest habitat areas within the Project area. It is anticipated that AEP will conduct any tree clearing required for the Project between October 1 and March 31. If any summer tree clearing is required, AEP will proceed with agency recommendations to avoid impacts to this species. Additionally, a desktop bat hibernacula habitat assessment was completed by Stantec. No active or abandoned underground mines were identified within 0.25 miles of the Project area as a result of the assessment. An area of karst geology was identified that overlaps the entirety of the Project area (Appendix A, Figure 4). However, no underground openings, caves, or any other potentially suitable hibernacula were observed within the Project area during the field surveys completed by Stantec. **Avoidance Dates: April 1 – September 30**
Tricolored Bat/ *Perimyotis subflavus*	E	PE	The tricolored bat is found throughout Ohio. This species has been found to forage above and within a variety of habitats, including woodlands, agricultural fields, grassy areas, and over streamside vegetation (Sparks et al. 2011). Maternity colonies have often been found within clusters of dead leaves, hanging in trees. Maternity colonies have also been found in or on buildings. Little is known of male tricolored bats in summer, but it is thought that they are probably solitary and spend their days in similar situations, as well as crevices, caves and	Potentially suitable foraging and roosting habitat (early successional deciduous forest habitat and riparian areas along perennial streams) was observed within the Project area. No potential bat hibernacula were observed within the Project area.	**ODNR** – The entire state of Ohio is within the range of the tricolored bat. The ODNR recommends tree cutting only occur from October 1 through March 31, conserving trees with loose, shaggy bark and/or crevices, holes, or cavities, as well as trees with dbh ≥ 20 inches if possible. If trees must be cut during summer months (outside of the portion of the Project area north of Fife Road), the ODNR recommends a mist net survey or acoustic survey be conducted from June 1 through	Potentially suitable summer foraging and roosting habitat was observed within early successional deciduous forest habitat areas within the Project area. It is anticipated that AEP will conduct any tree clearing required for the Project between October 1 and March 31. If any summer tree clearing is required, AEP will proceed with agency recommendations to avoid impacts to this species. Additionally, a desktop bat hibernacula habitat assessment was completed by Stantec. No active or abandoned underground mines were identified within 0.25 miles of the Project area as a result of the assessment. An area of karst geology was

Common Name/ Scientific Name	State Listed Status[1,2]	Federally Listed Status[1,3]	Typical Habitat	Habitat Observed	Agency Comments (Appendix B)	Potential Impacts and Avoidance Dates
			mines (Brack et al. 2010). In Ohio, this species typically utilizes caves and mines as hibernacula, utilizing a variety of situations, including very cold areas near cave entrances to deeper passages that seem to be too warm for other species of bats (Brack et al. 2010).		August 15, prior to any cutting. If state listed bats are documented, ODNR recommends cutting only occur from October 1 through March 31. In addition, ODNR recommends a desktop habitat assessment is conducted, followed by a field assessment if needed, to determine if there are potential hibernacula present within the Project area. If a habitat assessment finds that potential hibernacula are present within 0.25 miles of the Project area, please send this information to Eileen Wyza for project recommendations. **USFWS** - On September 14, 2022, the USFWS proposed to list the tricolored bat as endangered under the ESA. Conservation measures for the Indiana bat and northern long-eared bat will also help to conserve the tricolored bat.	identified that overlaps the entirety of the Project area (Appendix A, Figure 4). However, no underground openings, caves, or any other potentially suitable hibernacula were observed within the Project area during the field surveys completed by Stantec. **Avoidance Dates: April 1 – September 30**
Birds						
Northern Harrier/ *Circus hudsonius*	E	N/A	Harriers hunt low over grasslands, with wings held in a distinctive dihedral (V-shape). This is a common migrant and winter species in Ohio. Nesters are much rarer, although they occasionally breed in large marshes and grasslands (ODNR 2018). Northern harriers appear to be associated with large tracts of undisturbed habitat. They are uncommon in blocks of contiguous grassland less than 100 hectares (Slater and Rock 2005).	No suitable nesting habitat (large marshes and grasslands) was observed within the Project area.	**ODNR** – The Project is within the range of the northern harrier. This is a common migrant and winter species in Ohio. Nesters are much rarer, although they occasionally nest in loose colonies in large marshes and grasslands. If this type of habitat will be impacted, construction should be avoided in this habitat during the species' nesting period of April 15 through July 31. If this habitat will not be impacted, the Project is not likely to impact this species. **USFWS** – No comments received.	Northern harriers require large tracts of wetlands and/or grasslands that are 100 hectares (247 acres) or more for suitable breeding/nesting habitat (Slater and Rock 2005). No suitable nesting habitat (large tracts of marshes and/or grasslands) was observed within the Project area. Therefore, no impacts are anticipated and avoidance dates are not applicable.
Upland Sandpiper/ *Bartramia longicauda*	E	N/A	Nesting upland sandpipers utilize dry grasslands including native grasslands, seeded grasslands, grazed and ungrazed pasture, hayfields, and grasslands established through the Conservation Reserve Program (CRP) (ODNR 2018). Upland sandpipers are primarily restricted to extensive, open tracts of short grassland habitats. These habitats also include edges of highway rights-of-way and airfields (NatureServe 2025).	No potentially suitable nesting habitat (large areas of pastures, hayfields, or other grassland habitats) was observed within the Project area.	**ODNR** - This Project is within range of the upland sandpiper. Nesting upland sandpipers utilize dry grasslands including native grasslands, seeded grasslands, grazed and ungrazed pasture, hayfields, and grasslands established through the Conservation Reserve Program (CRP). If this type of habitat will be impacted, construction should be avoided in this habitat during the species' nesting period of April 15 through July 31. If this type of habitat will not be impacted, the Project is not likely to impact this species. **USFWS** - No comments received.	No potentially suitable nesting habitat was observed within the Project area. The tracts of grassland/hayfield habitats within the Project area are likely too small to attract nesting upland sandpipers. Therefore, no impacts are anticipated and avoidance dates are not applicable.

[1]E=Endangered; T=Threatened; PE=Proposed Endangered; N/A=Not Applicable

Results
July 7, 2026

Common Name/ Scientific Name	State Listed Status[1,2]	Federally Listed Status[1,3]	Typical Habitat	Habitat Observed	Agency Comments (Appendix B)	Potential Impacts and Avoidance Dates
[2]According to ODNR, State Listed Wildlife and Plant Species by County (ODNR 2025a). [3]According to the USFWS Information for Planning and Consultation website (USFWS 2025).						

4.0 CONCLUSIONS AND RECOMMENDATIONS

Stantec conducted wetland and waterbodies delineation and a preliminary habitat assessment for threatened and endangered species within the Project area on June 25-27, 2024, December 9, 2024, April 16, 2025, June 2, 2025, July 22, 2025, and June 18, 2026. Twelve palustrine emergent wetlands and two palustrine forested wetlands totaling approximately 5.09 acres were identified within the Project area. Three ephemeral streams, three intermittent streams, seven perennial streams and one open water feature were also identified within the Project area. USGS-named streams identified within the Project area include Prairie Creek, Hagerman Creek, Pottawatomie Creek, Hoaglin Creek, Maddox Creek, and Town Creek. See Table 2 and Table 4 for more information regarding wetlands and streams identified within the Project area, respectively. Data forms for the identified wetland and stream features are provided in Appendix D and representative photographs of the wetlands, streams, and open waters identified within the Project area are provided in Appendix C.

The information provided by Stantec regarding wetland and stream boundaries is based on an analysis of the wetland and upland conditions present within the Project area at the time of the field work. The delineations were performed by experienced and qualified professionals using regulatory agency-accepted practices and sound professional judgment.

An ODNR Ohio Natural Heritage Program data request and environmental review request letter was sent to the ODNR Office of Real Estate on June 20, 2023. The ODNR Office of Real Estate response letter dated July 19, 2023 (Appendix B) states that a review of the Ohio Natural Heritage Database indicates there are no records of state or federally listed plants or animals within one mile of the specified Project area.

The ODNR response states that the portion of the Project area located north of Fife Road is within the vicinity of records for the Indiana bat. Because presence of a state endangered bat species has been established in this area, summer tree cutting is not recommended, and additional summer surveys would not constitute presence/absence in the area. However, limited summer tree cutting inside this buffer may be acceptable after further consultation with the ODNR.

In addition, the ODNR stated that the entire state of Ohio is within the range of the Indiana bat, northern long-eared bat, little brown bat, and tricolored bat. During the spring and summer (April 1 through September 30), these bat species predominately roost in trees behind loose, exfoliating bark, in crevices and cavities, or in the leaves. The ODNR recommends tree cutting only occur from October 1 through March 31, conserving trees with loose, shaggy bark and/or crevices, holes, or cavities, as well as trees with dbh ≥ 20 inches if possible. However, if trees are present within this area (outside of the portion of the Project area located north of Fife Road) and trees must be cut during the summer months, the ODNR recommends a mist net survey or acoustic survey be conducted from June 1 through August 15, prior to any cutting. Mist net and acoustic surveys should be conducted in accordance with the most recent version of the "Ohio Division of Wildlife

Guidance for Bat Surveys and Tree Clearing". If state-listed bats are documented, the ODNR recommends cutting only occur from October 1 through March 31. However, limited summer tree cutting may be acceptable after consultation with the ODNR.

Potentially suitable summer foraging and roosting habitat was observed within early successional deciduous forest habitats within the Project area for the Indiana bat (state and federally listed endangered), northern long eared bat (state-listed endangered; federally listed endangered), tricolored bat (state-listed endangered; proposed federally endangered), and little brown bat (state-listed endangered). If any summer tree clearing is required, AEP will proceed with agency recommendations to avoid impacts to these bat species.

Additionally, Stantec completed a desktop bat hibernacula habitat assessment in accordance with the 2024 Range-wide Indiana Bat and Northern Long-eared Bat Survey Guidelines (USFWS 2024) utilizing available ODNR websites, including data on known abandoned or active mines (ODNR 2025b) and locations of known or suspected karst geology (ODNR 2025c). No abandoned or active underground mines were identified within 0.25 miles of the Project area as a result of the assessment, but an area of karst geology was identified that overlaps the entirety of the Project area (Appendix A, Figure 4). However, no underground openings, caves, or any other potentially suitable bat hibernacula were observed within the Project area during the field surveys completed by Stantec. Therefore, no impacts to potential bat hibernacula are anticipated.

The ODNR response states that the Project is within the range of the pugnose minnow, a state endangered fish. Potentially suitable habitat (perennial streams and an open water feature) was observed within the Project area. However, no in-water work in perennial streams or the open water feature is proposed by AEP. Therefore, impacts to this species are not anticipated and avoidance dates are not applicable.

The ODNR response also states that the Project is within the range of the upland sandpiper, a state endangered bird. However, no potentially suitable nesting habitat (large tracts of grassland, hayfield, or pasture) was observed within the Project area. Therefore, no impacts are anticipated and avoidance dates are not applicable.

The ODNR response states that the Project is within the range of the northern harrier, a state endangered bird. Northern harriers require large tracts of wetlands and/or grasslands that are 100 hectares (247 acres) or more for suitable breeding/nesting habitat (Slater and Rock 2005). No suitable nesting habitat (large tracts of wetlands and/or grasslands) was observed within the Project area. Therefore, no impacts are anticipated and avoidance dates are not applicable.

According to the ODNR, the Project is within the range of the state threatened pondhorn mussel and this project must not have an impact on native mussels. This applies to both listed and non-listed species, as all species of mussel are protected in Ohio. Per the Ohio Mussel Survey Protocol (2025), all Group 2, 3, and 4 streams require a mussel survey. Per the Ohio Mussel Survey Protocol, Group 1 streams and unlisted streams with a watershed of 5 square miles or larger above the point of impact should be assessed using the Reconnaissance Survey for Unionid Mussels to determine if mussels are present. Mussel surveys may be recommended for these streams as well. Therefore,

if in-water work is planned in any stream that meets any of the above criteria, the ODNR recommends the applicant provide information to indicate no mussel impacts will occur. If this is not possible, the ODNR recommends a professional malacologist conduct a mussel survey in the Project area. If mussels that cannot be avoided are found in the Project area, the ODNR recommends a professional malacologist collect and relocate the mussels to suitable and similar habitat upstream of the project site. Mussel surveys and any subsequent mussel relocation should be done in accordance with the Ohio Mussel Survey Protocol. As there is no in-water work proposed in perennial streams or the open water, no impacts to the pondhorn are anticipated.

A technical assistance request letter was submitted to the USFWS on June 20, 2023. The USFWS response letter dated June 27, 2023, recommends that impacts to wetland and other water resources be avoided or minimized to the fullest extent possible, and that best management practices be utilized o minimize erosion and sedimentation (Appendix B).

According to the USFWS response letter (Appendix B), all projects in the state of Ohio lie within the range of the federally endangered Indiana bat, the federally endangered northern long-eared bat, and the federally proposed endangered tricolored bat. In Ohio, presence of these species is assumed wherever suitable habitat occurs unless a presence/probable absence survey has been performed to document probable absence. The USFWS response letter states that, should the Project site contain trees ≥3 inches dbh, the USFWS recommends trees be saved whenever possible. If any caves or abandoned mines may be disturbed, further coordination is requested. If no caves or abandoned mines are present and trees ≥3 inches dbh cannot be avoided, the USFWS recommends that removal of trees ≥3 inches dbh only occur between October 1 and March 31 in order to avoid adverse effects to these species. It is anticipated that AEP will conduct any tree clearing required for the Project between October 1 and March 31. If any summer tree clearing is required, AEP will proceed with agency recommendations to avoid impacts to these bat species.

The USFWS response letter also stated that due to the Project type, size, and location they do not anticipate adverse effects to any other federally endangered, threatened, or proposed species or proposed or designated critical habitat.

5.0 REFERENCES

Brack, Virgil Jr., Dale W. Sparks, John O. Whitaker Jr., Brianne L. Walters, and Angela Boyer. 2010. Bats of Ohio. Indiana State University Center for North American Bat Research and Conservation.

Cowardin, L.M., V. Carter V., F.C. Golet, and E.T. LaRoe. 1979. Classification of Wetlands and Deepwater Habitats of the United States. U.S. Fish and Wildlife Service Report No. FWS/OBS/-79/31.Washington, D.C.

Harvey, Michael J., J. Scott Altenbach, and Troy L. Best. 1999. Bats of the United States. Arkansas Game & Fish Commission, Little Rock, Arkansas. 64 pp.

Mack, J.J. 2001. Ohio Rapid Assessment Method for Wetlands, Manual for Using Version 5.0. Ohio EPA Technical Bulletin Wetland/2001-1-1. Ohio Environmental Protection Agency, Division of Surface Water, 401 Wetland Ecology Unit, Columbus, Ohio.

NatureServe. 2025. NatureServe Explorer: An online encyclopedia of life [web application]. Version 7.0. NatureServe, Arlington, VA. U.S.A. Available http://explorer.natureserve.org. Accessed January 2025.

Ohio Department of Natural Resources (ODNR) Division of Wildlife. 2018. Species Guide Index. Available at http://wildlife.ohiodnr.gov/species-and-habitats/species-guide-index/. Accessed 2020.

ODNR Division of Wildlife. 2025a. State Listed Wildlife and Plant Species by County. Available at https://ohiodnr.gov/discover-and-learn/safety-conservation/about-odnr/wildlife/documents-publications/wildlife-plants-county. Accessed January 2025.

ODNR Division of Mineral Resources and Division of Geological Survey. 2025b. Mines of Ohio. Available online at ODNR Mines of Ohio Viewer (ohiodnr.gov). Accessed January 2025.

ODNR Division of Geological Survey. 2025c. Karst Interactive Map. Available online at Karst Interactive Map Viewer (ohiodnr.gov). Accessed January 2025.

Ohio Environmental Protection Agency (OEPA). 2006. Methods for Assessing Habitat in Flowing Waters: Using the Qualitative Habitat Evaluation Index (QHEI).

OEPA 2020. Field Methods for Evaluating Primary Headwater Streams in Ohio. Version 4.1. Ohio EPA Division of Surface Water, Columbus, Ohio. 130 pp.

Parmalee, P.W. and A.E. Bogan. 1998. The Freshwater Mussels of Tennessee. University of Tennessee Press: Knoxville, Tennessee. 328 pp

Slater, G.L. and C. Rock. 2005. Northern Harrier (Circus cyaneus): a technical conservation assessment. [Online]. USDA Forest Service, Rocky Mountain Region. Available online at http://www.fs.fed.us/r2/projects/scp/assessments/northernharrier.pdf. Accessed January 2025.

Sparks, Dale W., Curtis J. Schmidt, and Jerry R. Choate. 2011. Bats of Kansas. Indiana State University Center for North American Bat Research and Conservation, Terre Haute, Indiana. 60 pp.

U.S. Army Corps of Engineers (USACE), Environmental Laboratory. 1987. Corps of Engineers Wetlands Delineation Manual, Technical Report Y-87-1, U.S. Army Engineer Waterway Experiment Station, Vicksburg, Mississippi.

USACE. 2002. Issuance of Nationwide Permits; Notice**,** 67 Fed. Reg. 10. January 15, 2002. Federal Register: The Daily Journal of the United States. Available at https://www.gpo.gov/fdsys/pkg/FR-2002-01-15/pdf/02-539.pdf.

USACE. 2005. *Guidance on Ordinary High Water Mark Identification* (Regulatory Guidance Letter, No. 05-05). Available online at http://www.usace.army.mil/Portals/2/docs/civilworks/RGLS/rgl05-05.pdf. Accessed January 2025.

USACE. 2012. *Regional Supplement to the Corps of Engineers Wetland Delineation Manual: Northcentral and Northeast Region (Version 2.0)*, ed. J. S. Wakeley, R. W. Lichvar, and C. V. Noble. ERDC/EL TR-10-16. Vicksburg, MS: U.S. Army Engineer Research and Development Center.

U.S. Fish and Wildlife Service (USFWS). 2007. Indiana bat (Myotis sodalis) draft recovery plan: First revision. U.S. Fish and Wildlife Service, Ft. Snelling, Minnesota. 258 pp.

USFWS. 2020. Northern Long-eared Bat (*Myotis septentrionalis*). Available online at https://www.fws.gov/midwest/Endangered/mammals/nleb/nlebFactSheet.html. Accessed January 2025.

USFWS. 2024. 2024 Range-wide Indiana Bat and Northern Long-eared Bat Survey Guidelines, March 2024. Available at https://www.fws.gov/sites/default/files/documents/2024-10/2024_usfws_rangewide_ibat-nleb_survey_guidelines.pdf. Accessed January 2025.

USFWS. 2025. Information for Planning and Consultation website. Available at https://ipac.ecosphere.fws.gov/. Accessed January 2025.

Appendix A FIGURES

A.1 FIGURE 1 – PROJECT LOCATION MAP

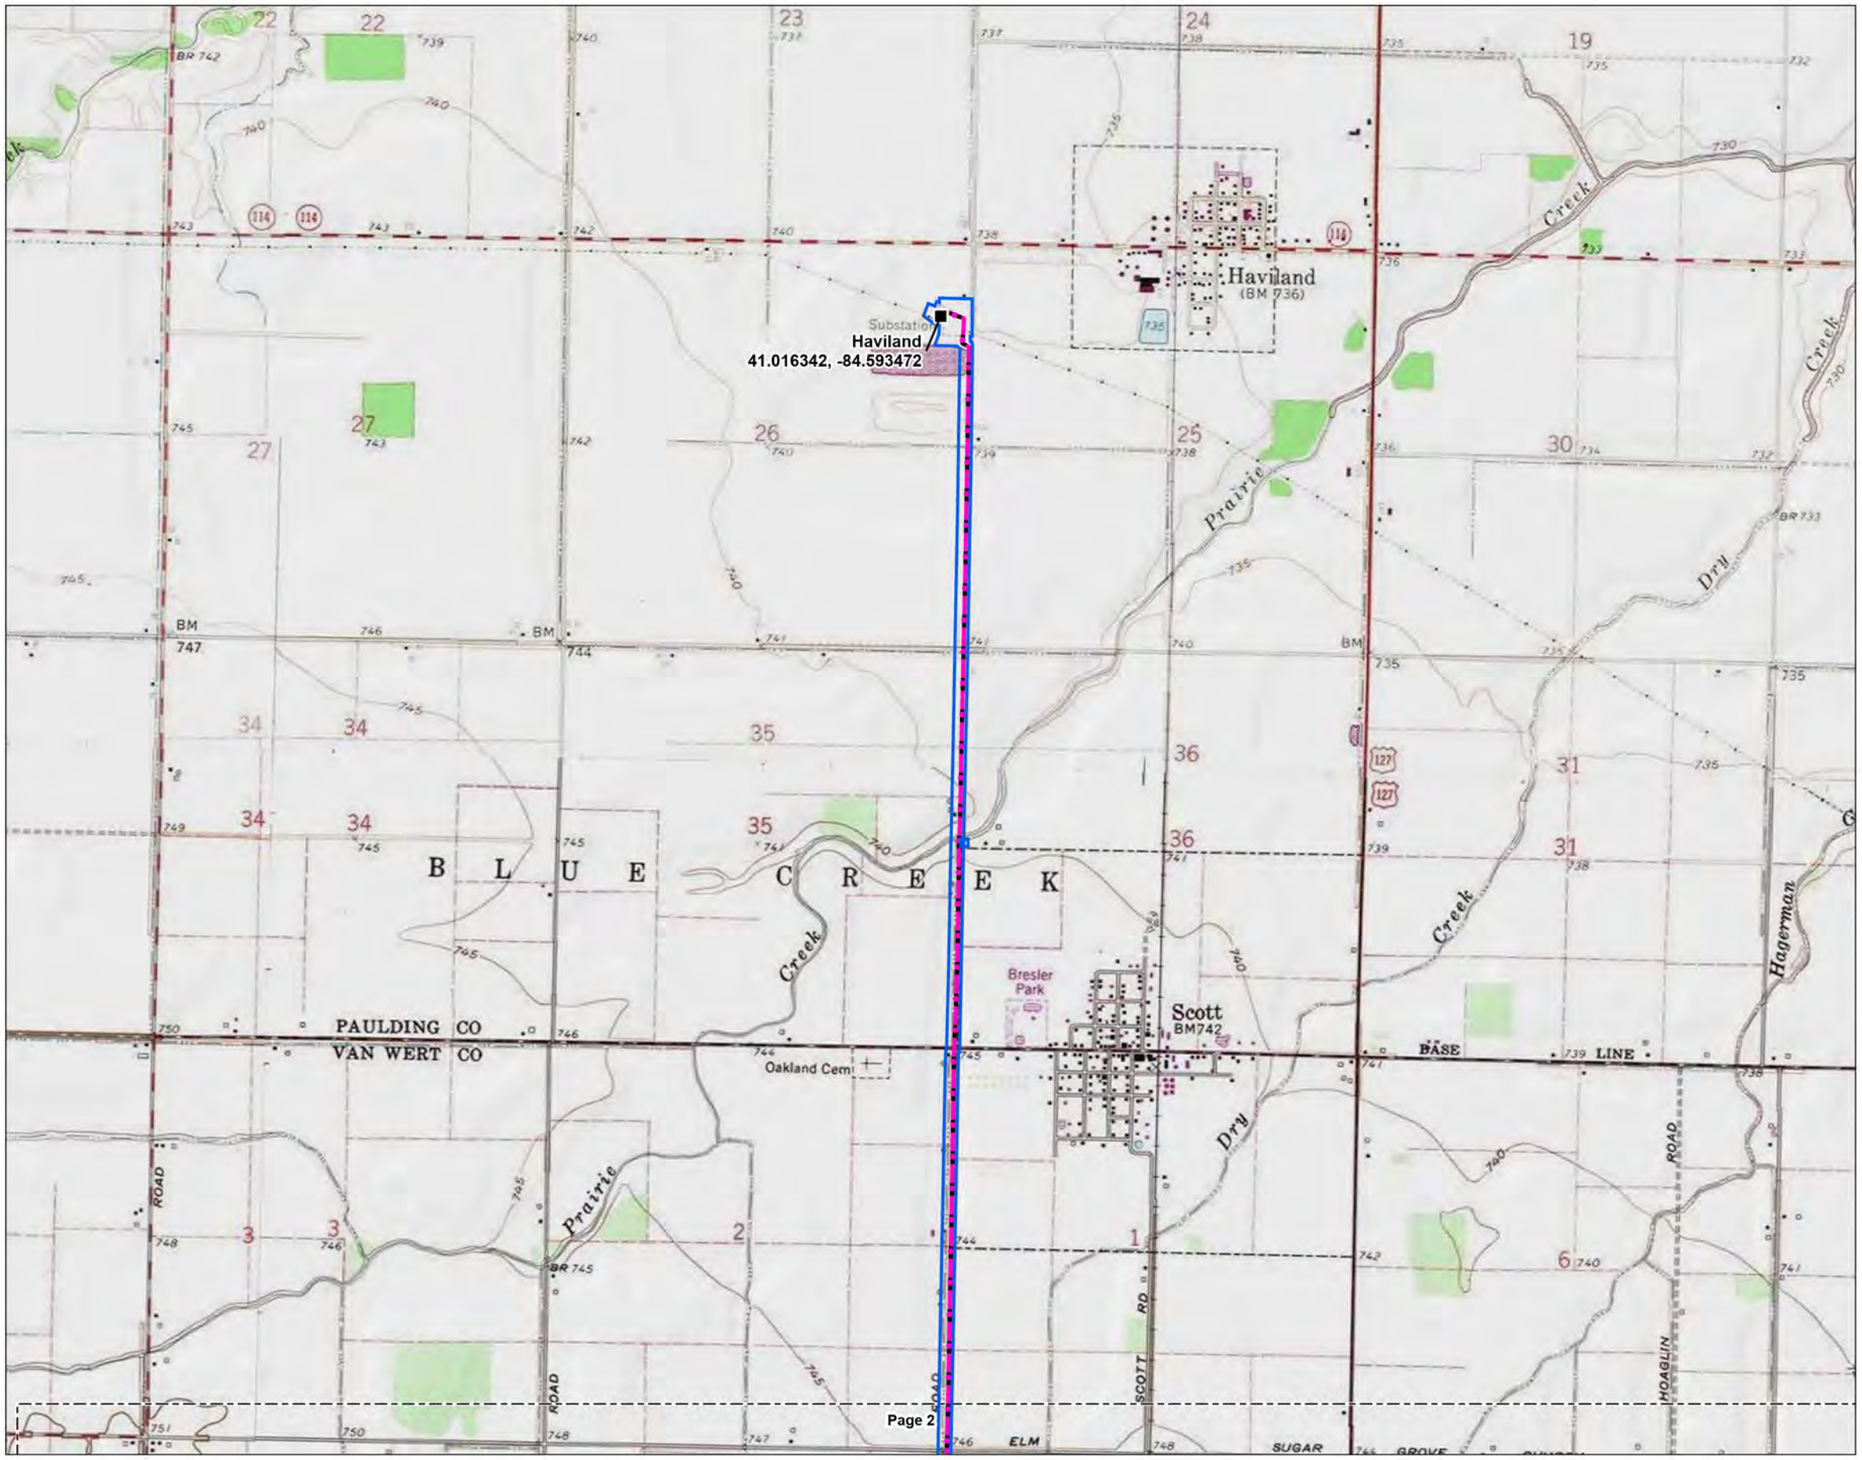

Figure No.

1

Title

Project Location Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County
Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 1,000 2,000 Feet

(At original document size of 11x17)
1:24,000

Legend

- AEP Substation
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area

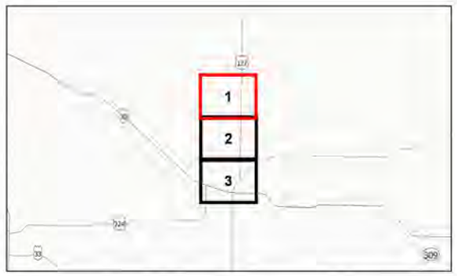

Notes

1. Coordinate System: NAD 1983 StatePlane Ohio North FIPS 3401 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, NADS
3. Background: USGS 7.5' Topographic Quadrangles: Latty (1974), Scott (1983)

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland VanWert Paulding\03 data\gis exhibits\239000324 Haviland VanWert239000324 Haviland VanWert.aprx Revised: 2025-07-08 By: mkalczewski

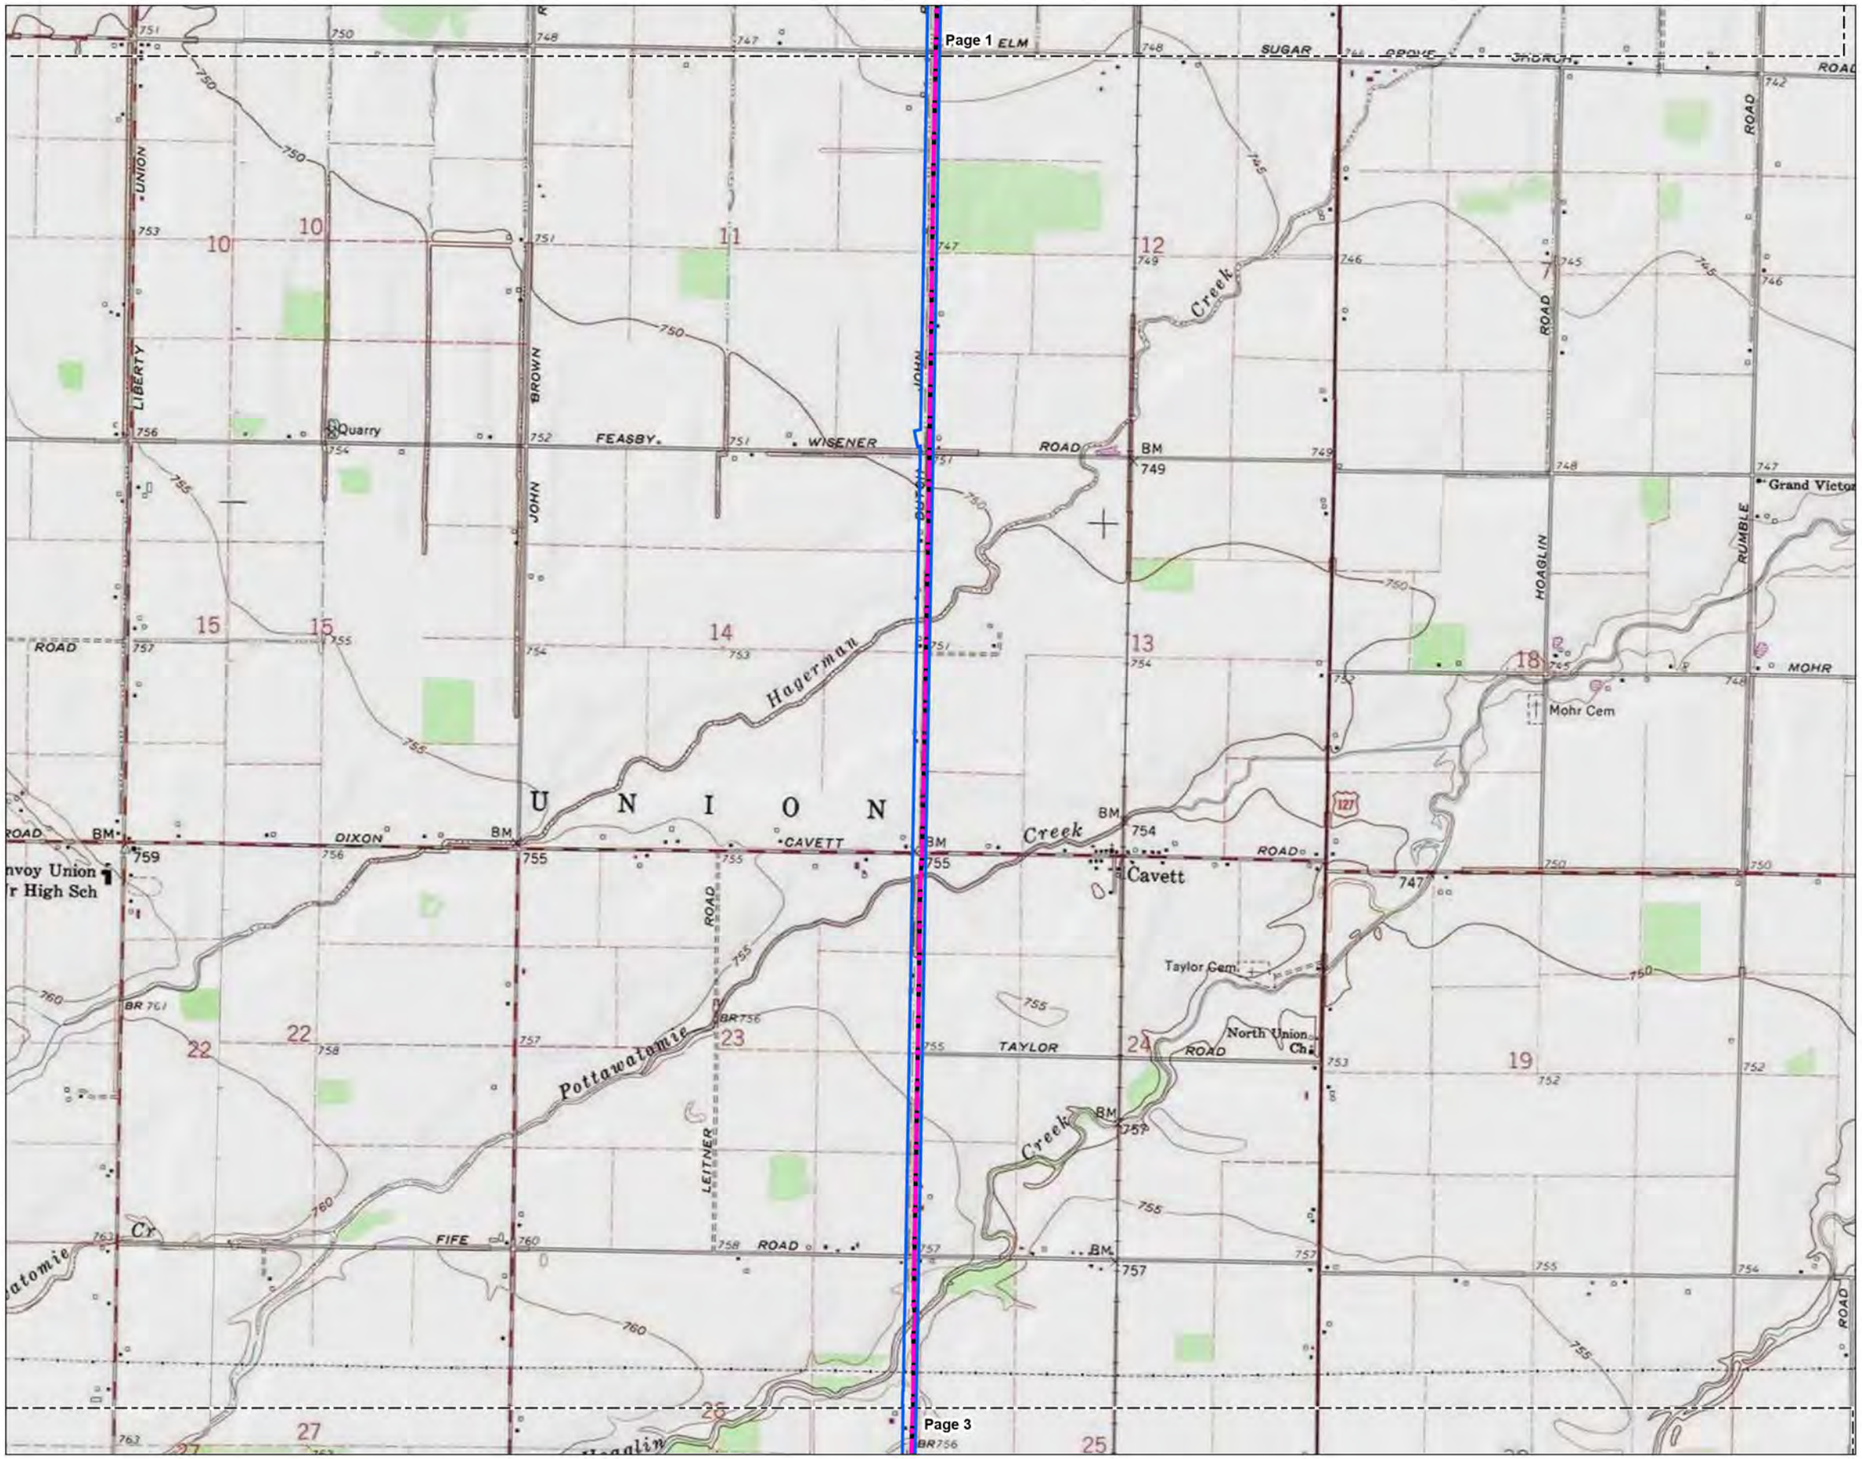

Figure No.
1

Title
Project Location Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County
Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 1,000 2,000 Feet
(At original document size of 11x17)
1:24,000

Legend
- AEP Substation
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area

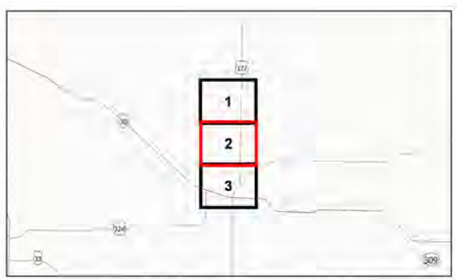

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio North FIPS 3401 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, NADS
3. Background: USGS 7.5' Topographic Quadrangles: Latty (1974), Scott (1983)

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\0324\239000324_239000325 Haviland VanWert Paulding\03 data\gis cad\gis\mxd\239000324 Haviland VanWert.aprx Revised: 2025-07-08 By: mkalczewski

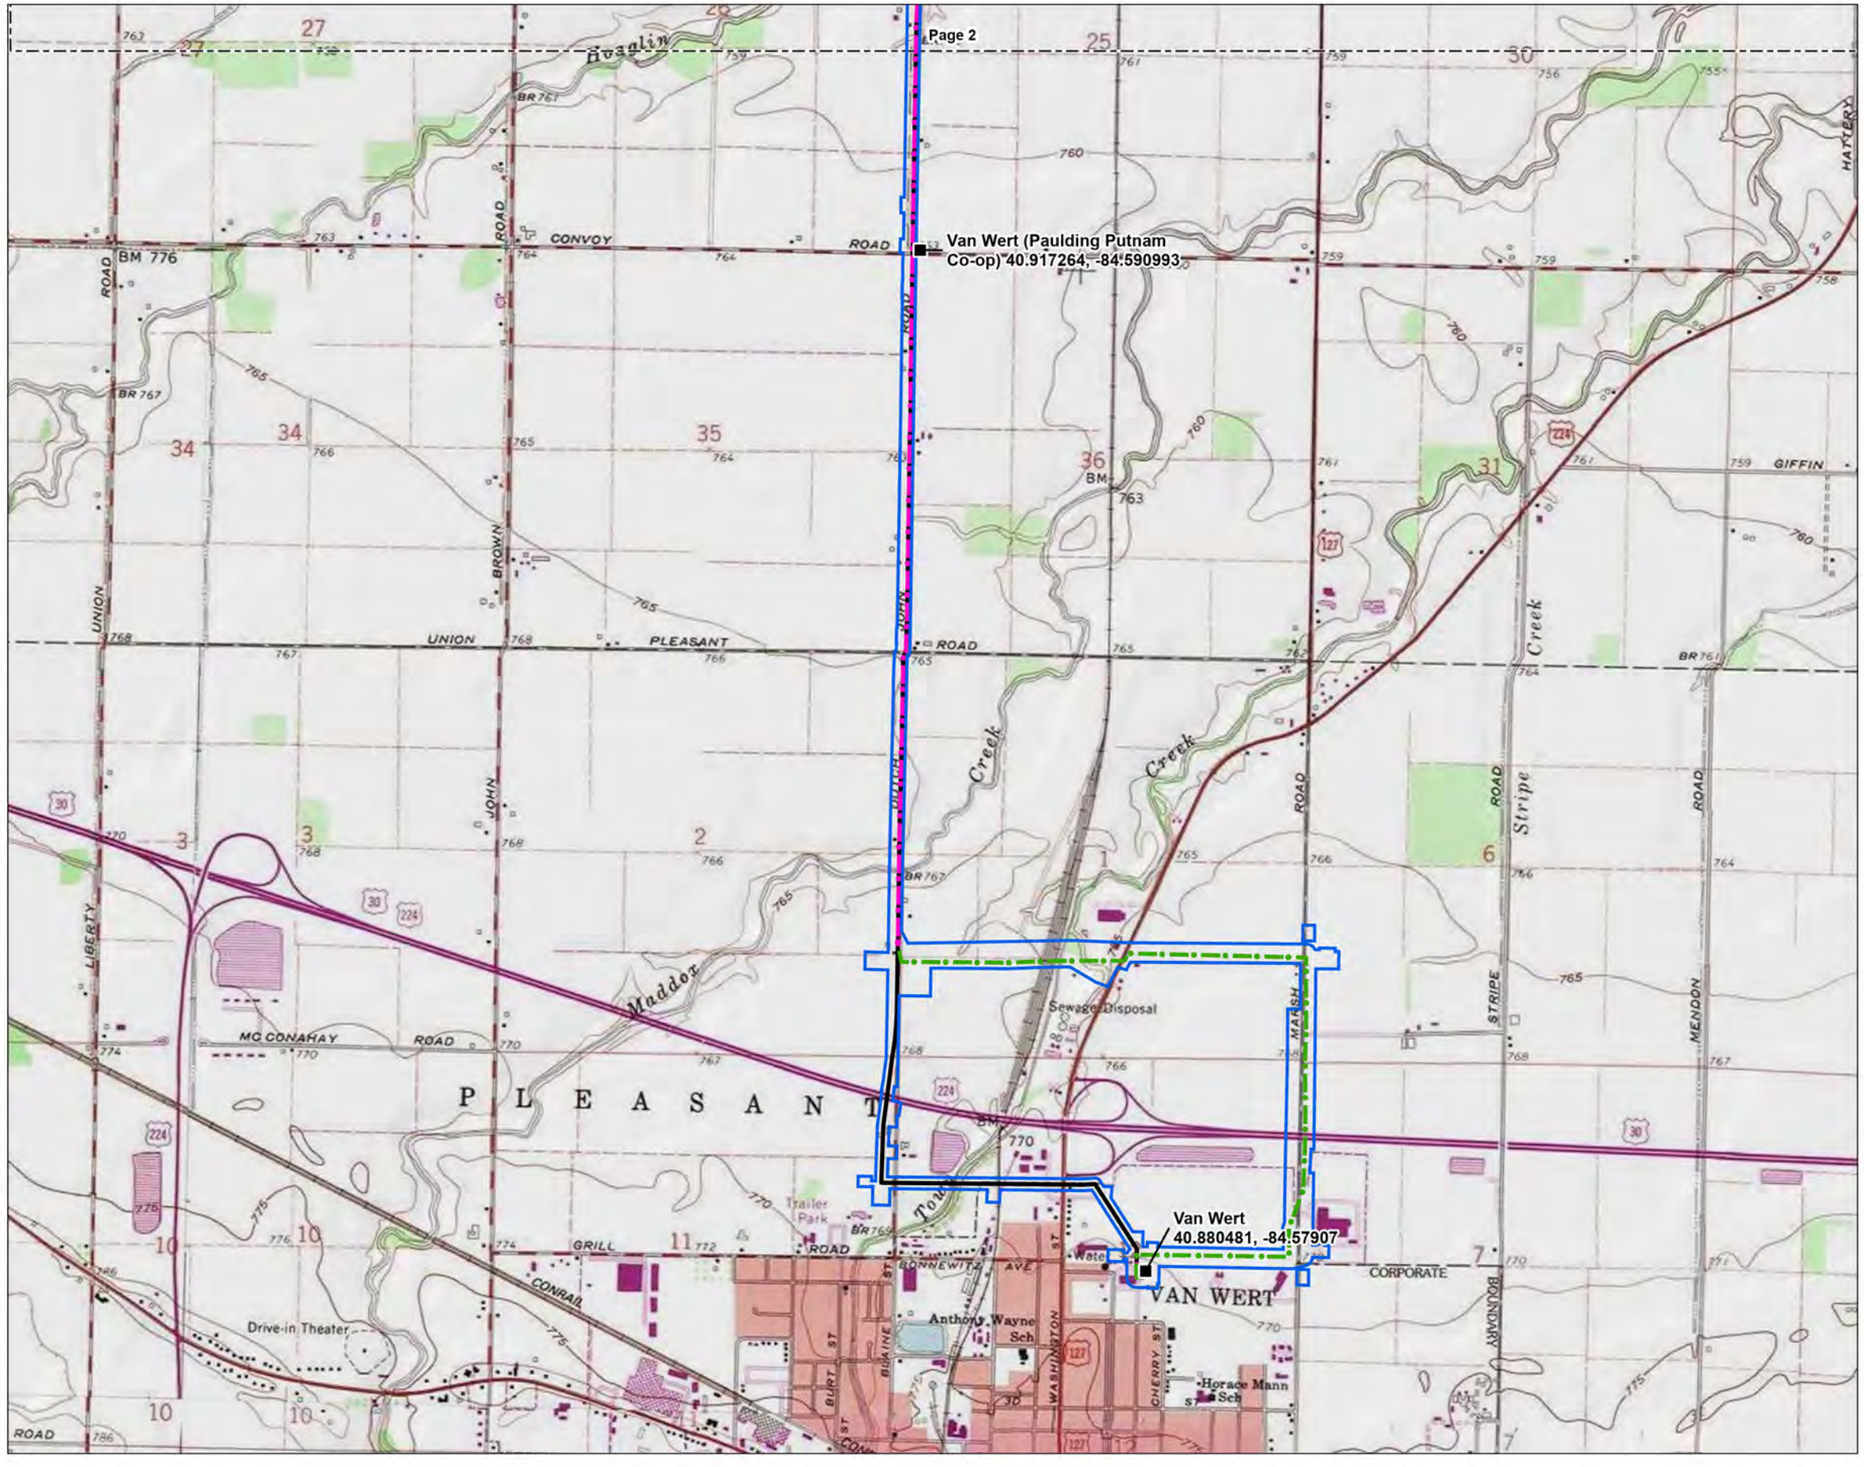

Figure No.
1

Title
Project Location Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County
Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 1,000 2,000 Feet
(At original document size of 11x17)
1:24,000

Legend
- AEP Substation
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area

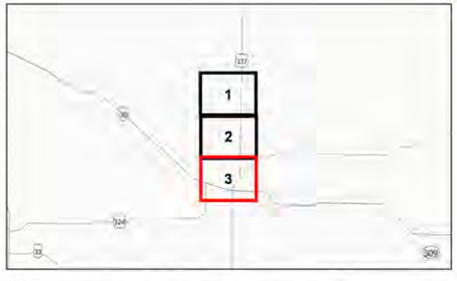

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio North FIPS 3401 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, NADS
3. Background: USGS 7.5' Topographic Quadrangles: Latty (1974), Scott (1983)

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland VanWert Paulding\03_data\gis_cad\gis\mxds\239000324 Haviland VanWert239000324 Haviland VanWert.aprx Revised: 2025-07-08 By: mkalczewski

A.2 FIGURE 2 – WETLAND AND WATERBODY DELINEATION MAP

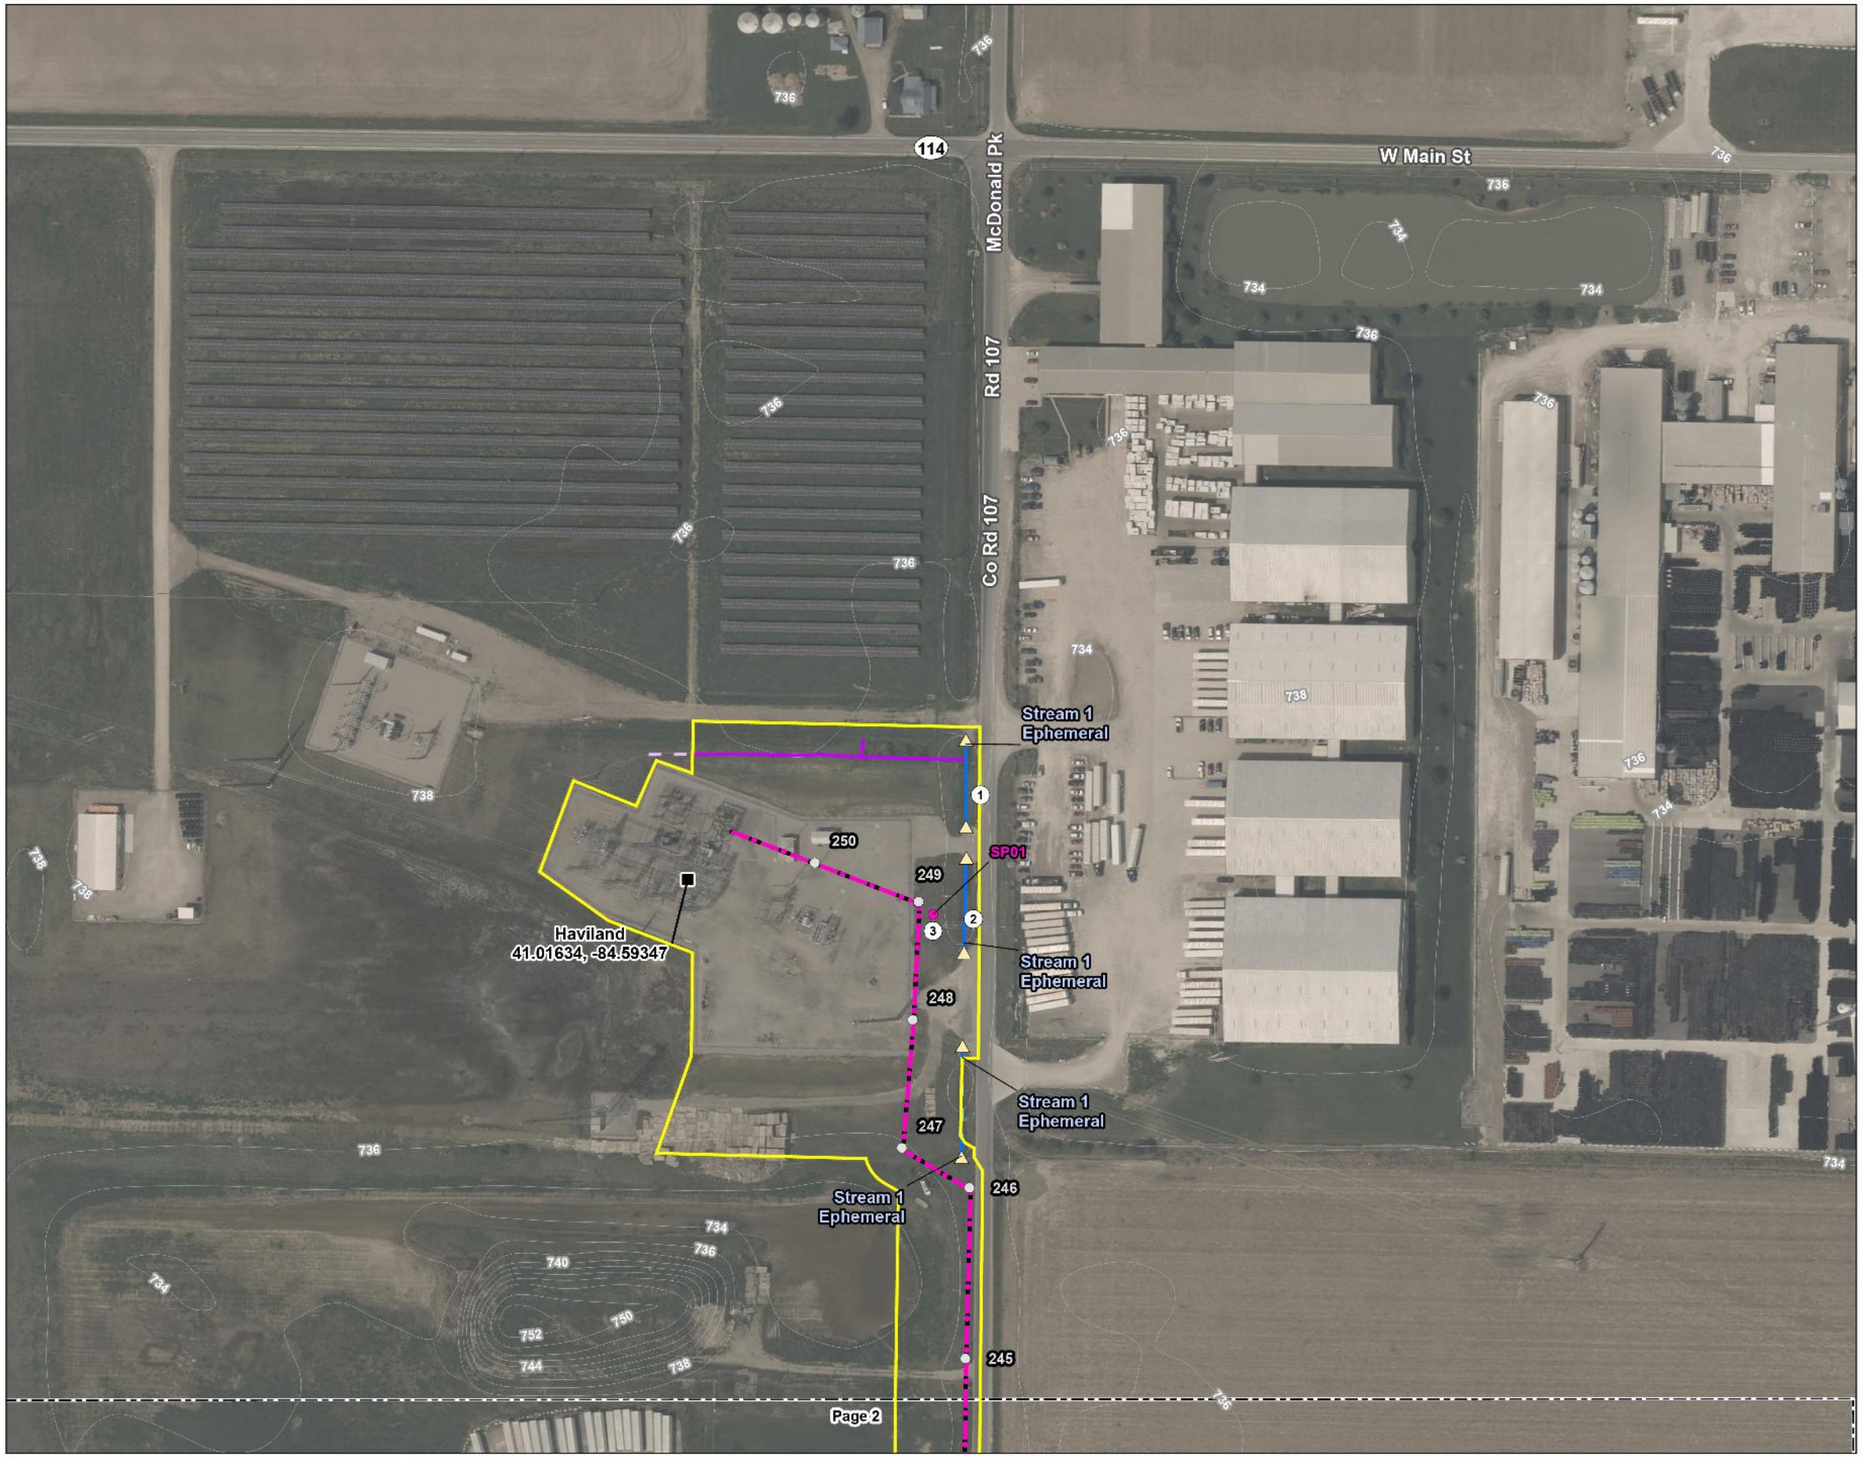

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

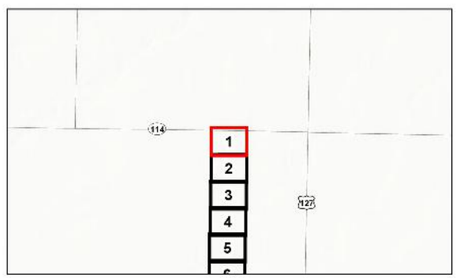

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxd\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkarczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

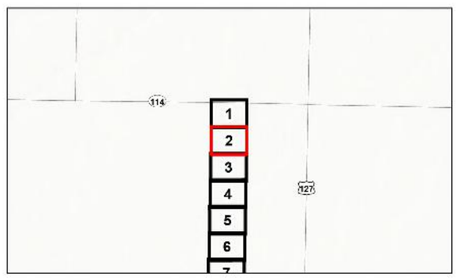

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.

2

Title

Wetland and Waterbody Delineation Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

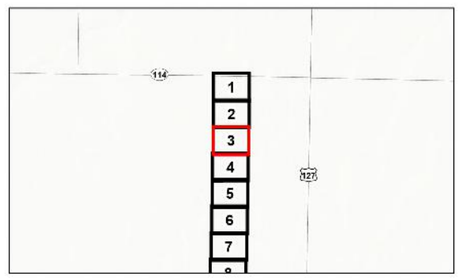

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczwski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

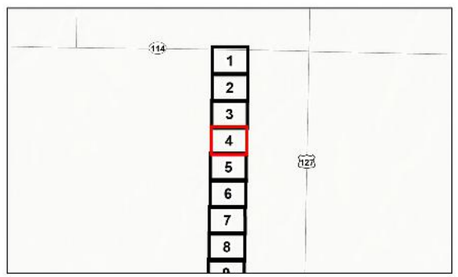

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

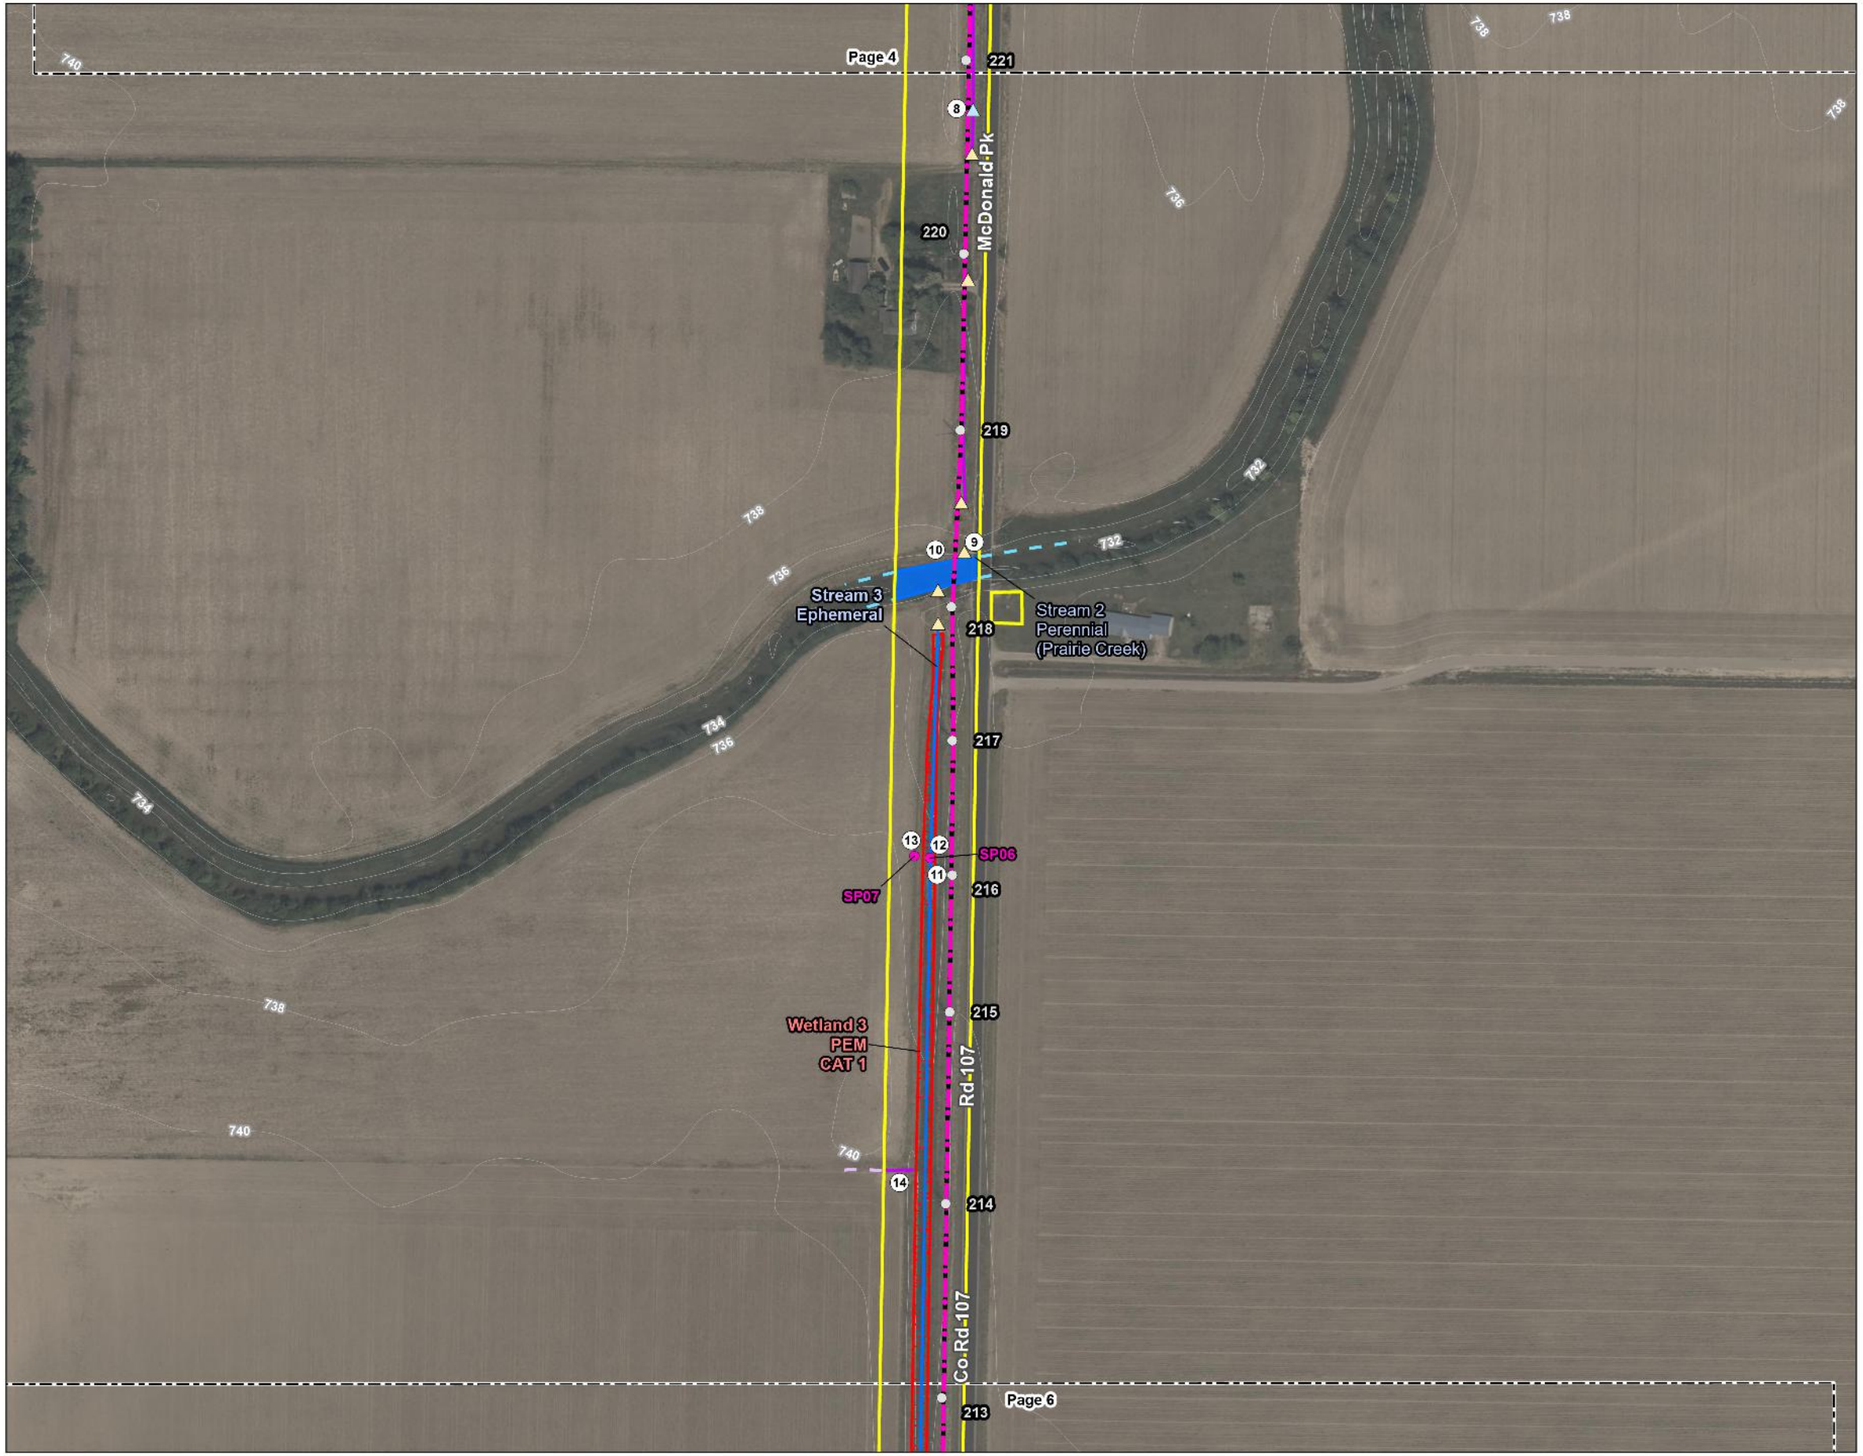

Figure No.

2

Title

Wetland and Waterbody Delineation Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

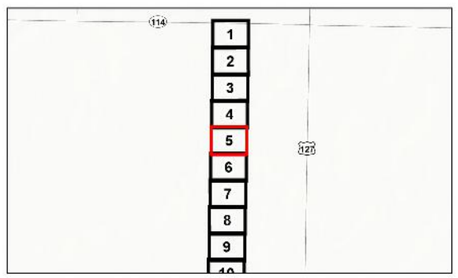

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

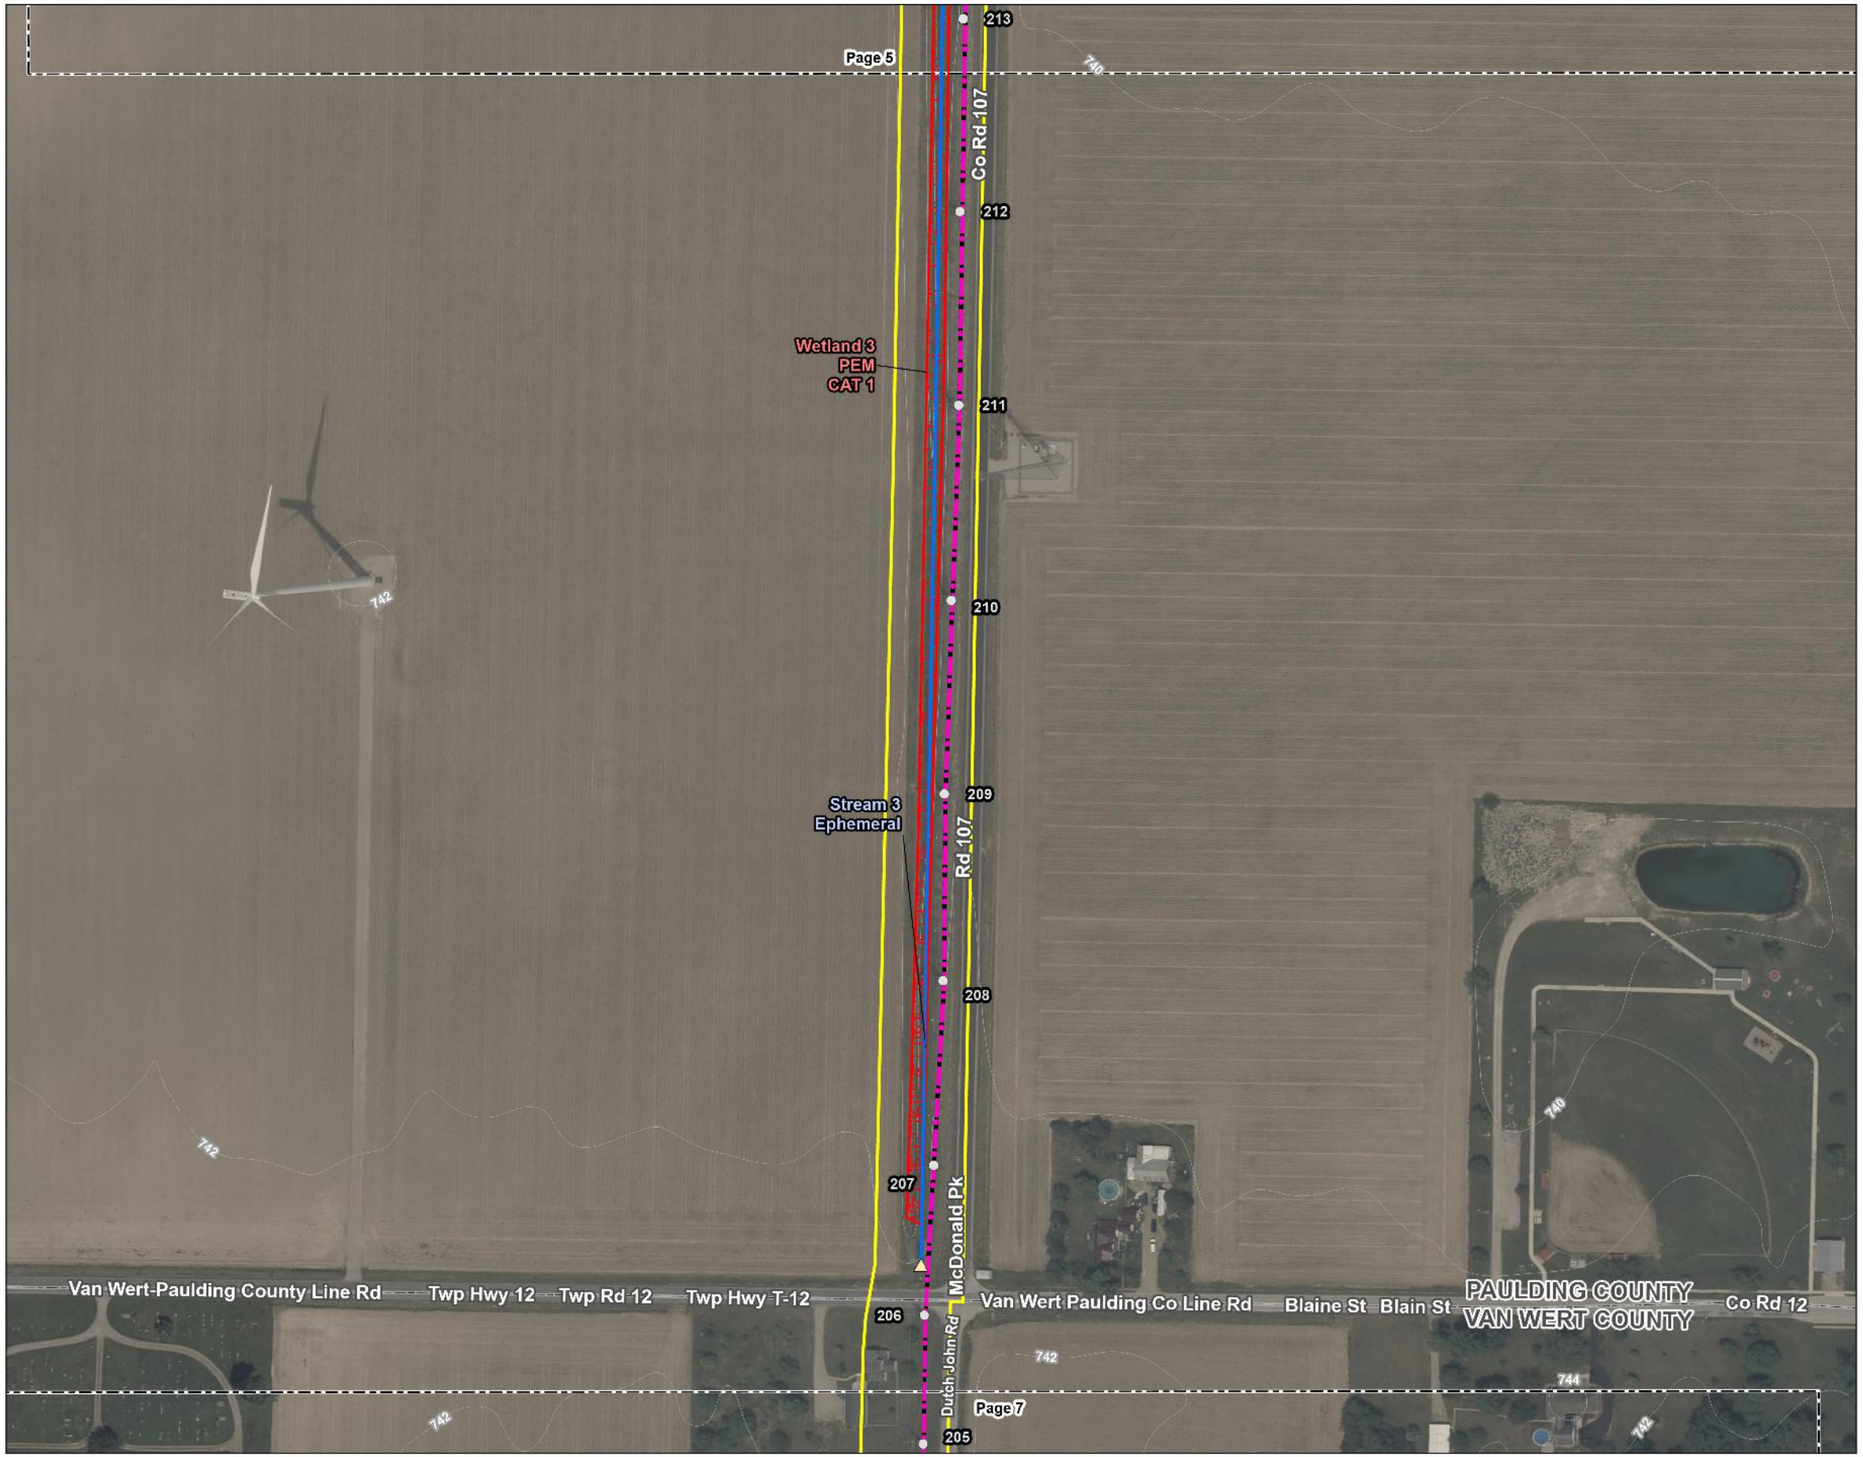

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

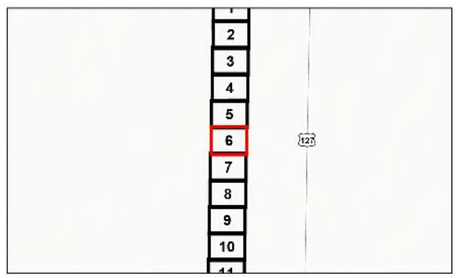

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

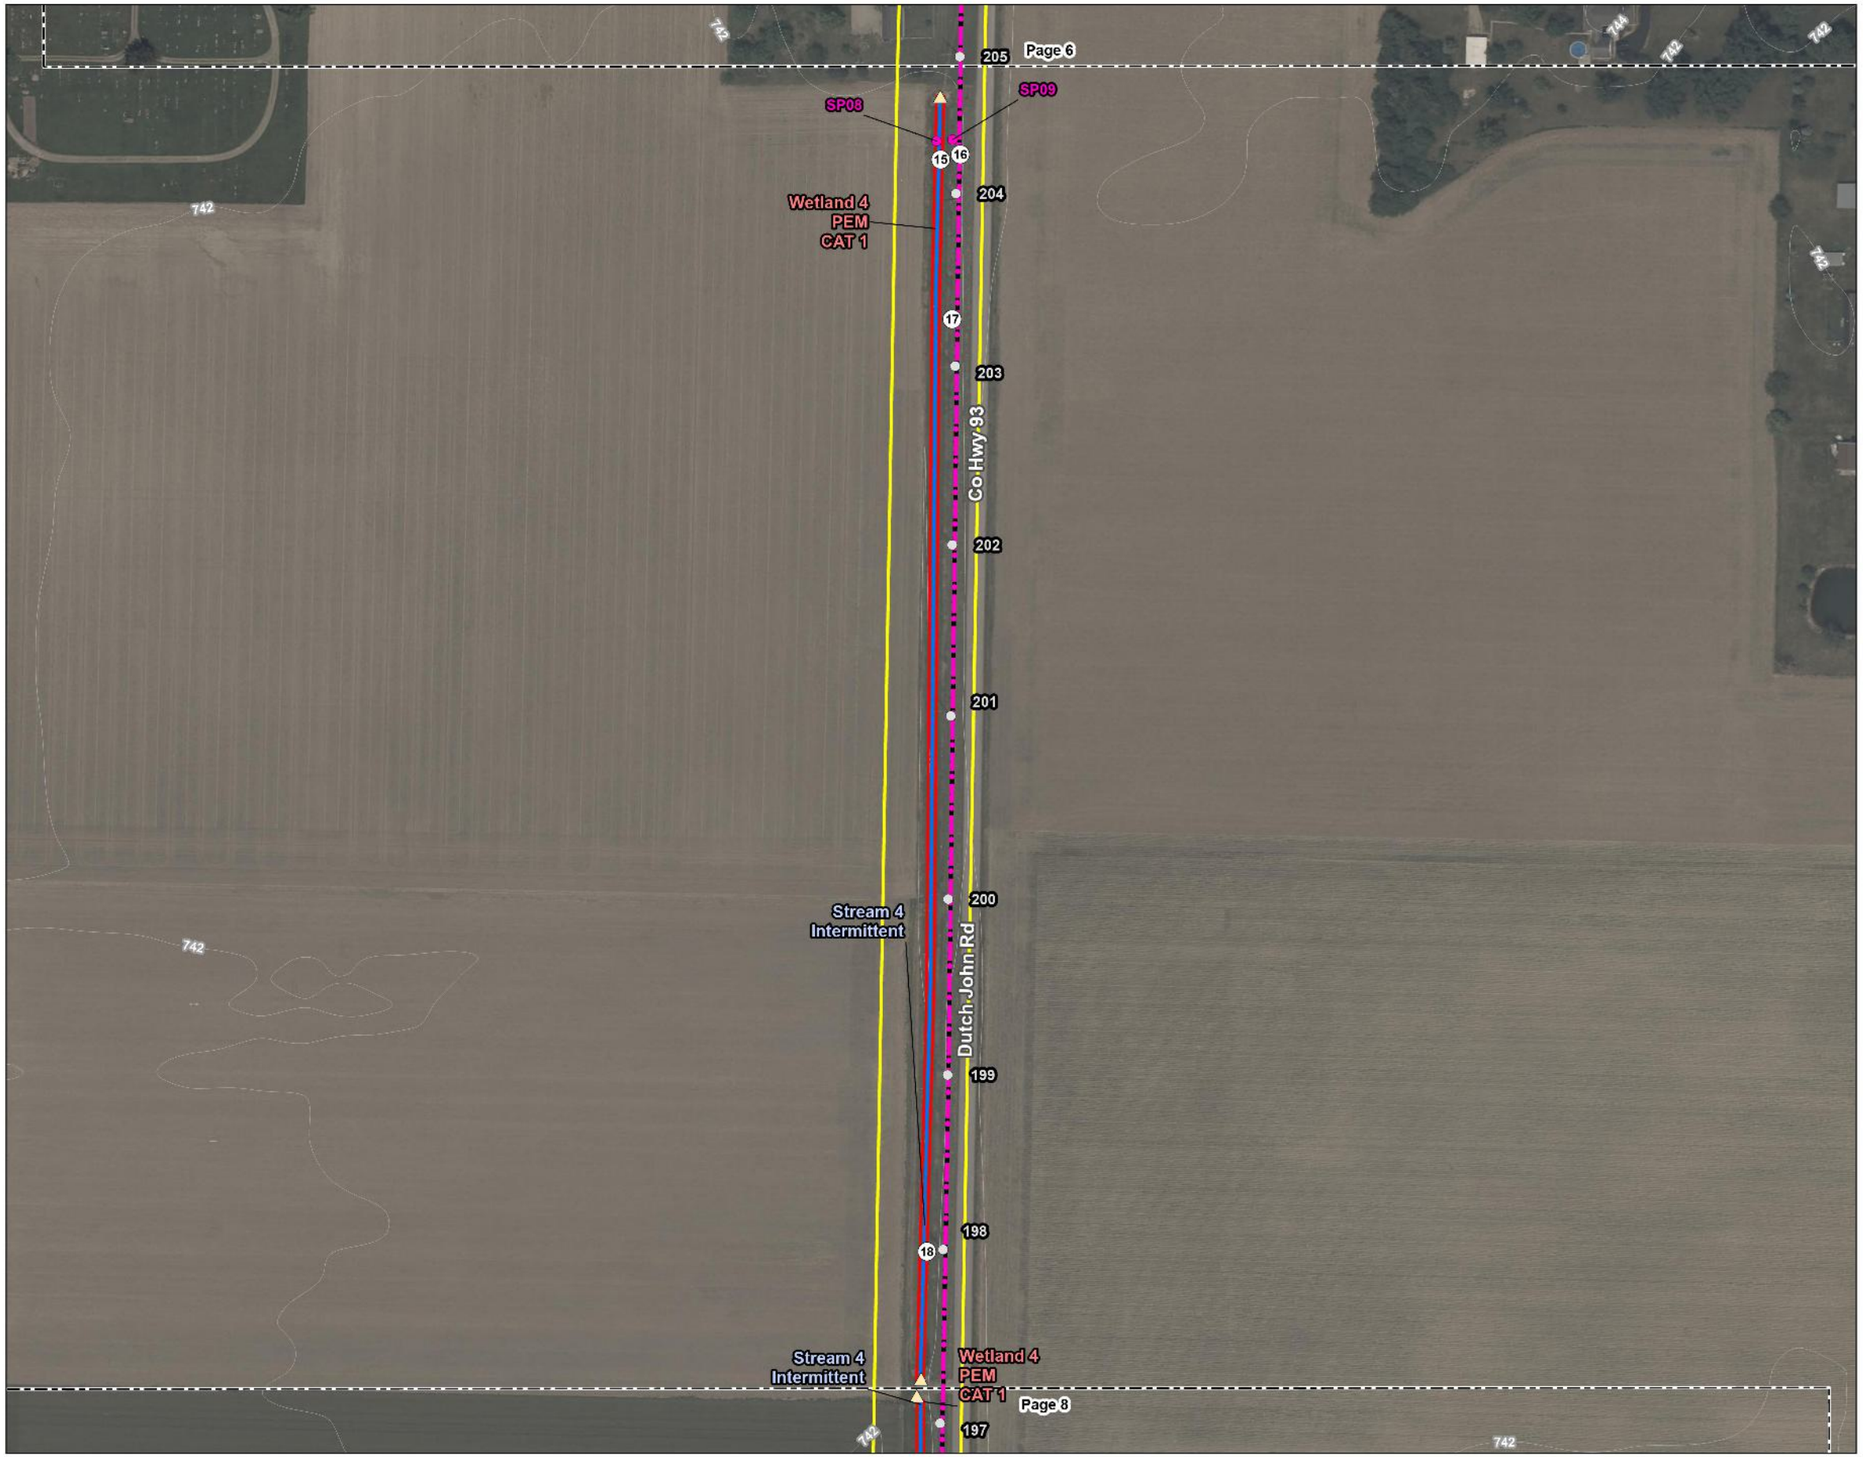

Figure No.

2

Title

Wetland and Waterbody Delineation Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

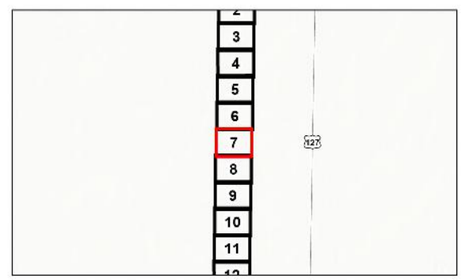

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

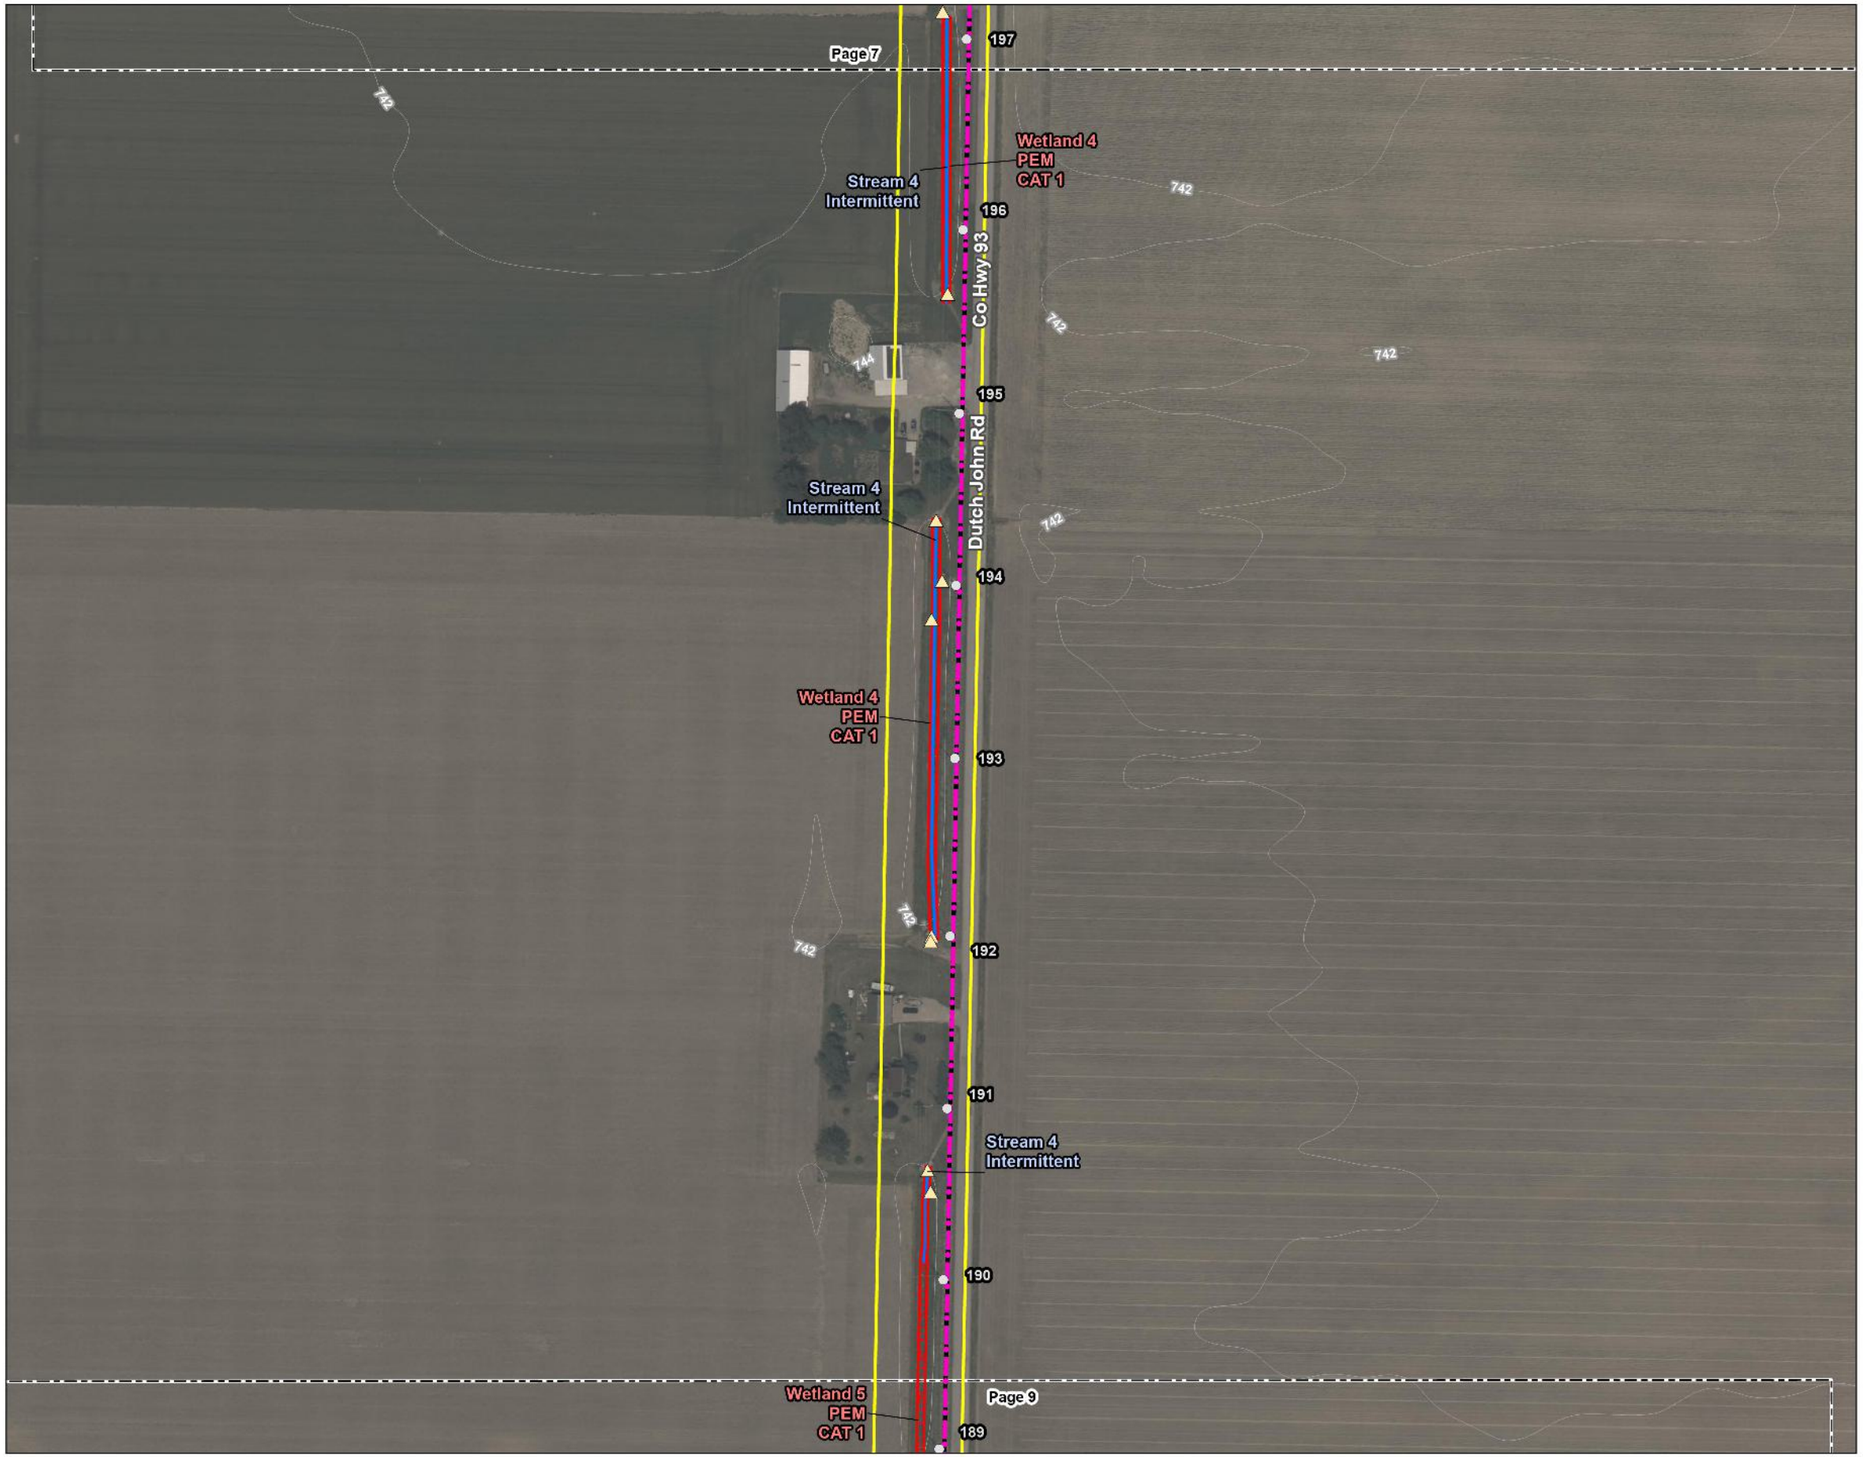

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

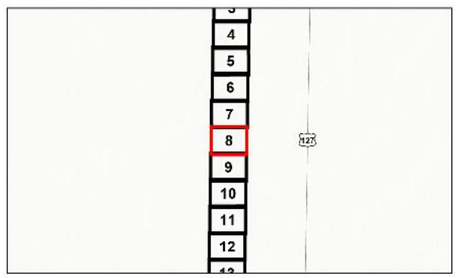

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.

2

Title

Wetland and Waterbody Delineation Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

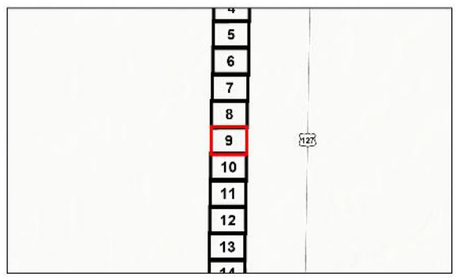

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

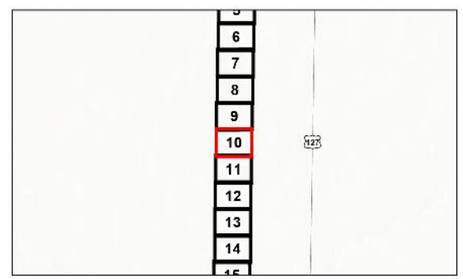

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

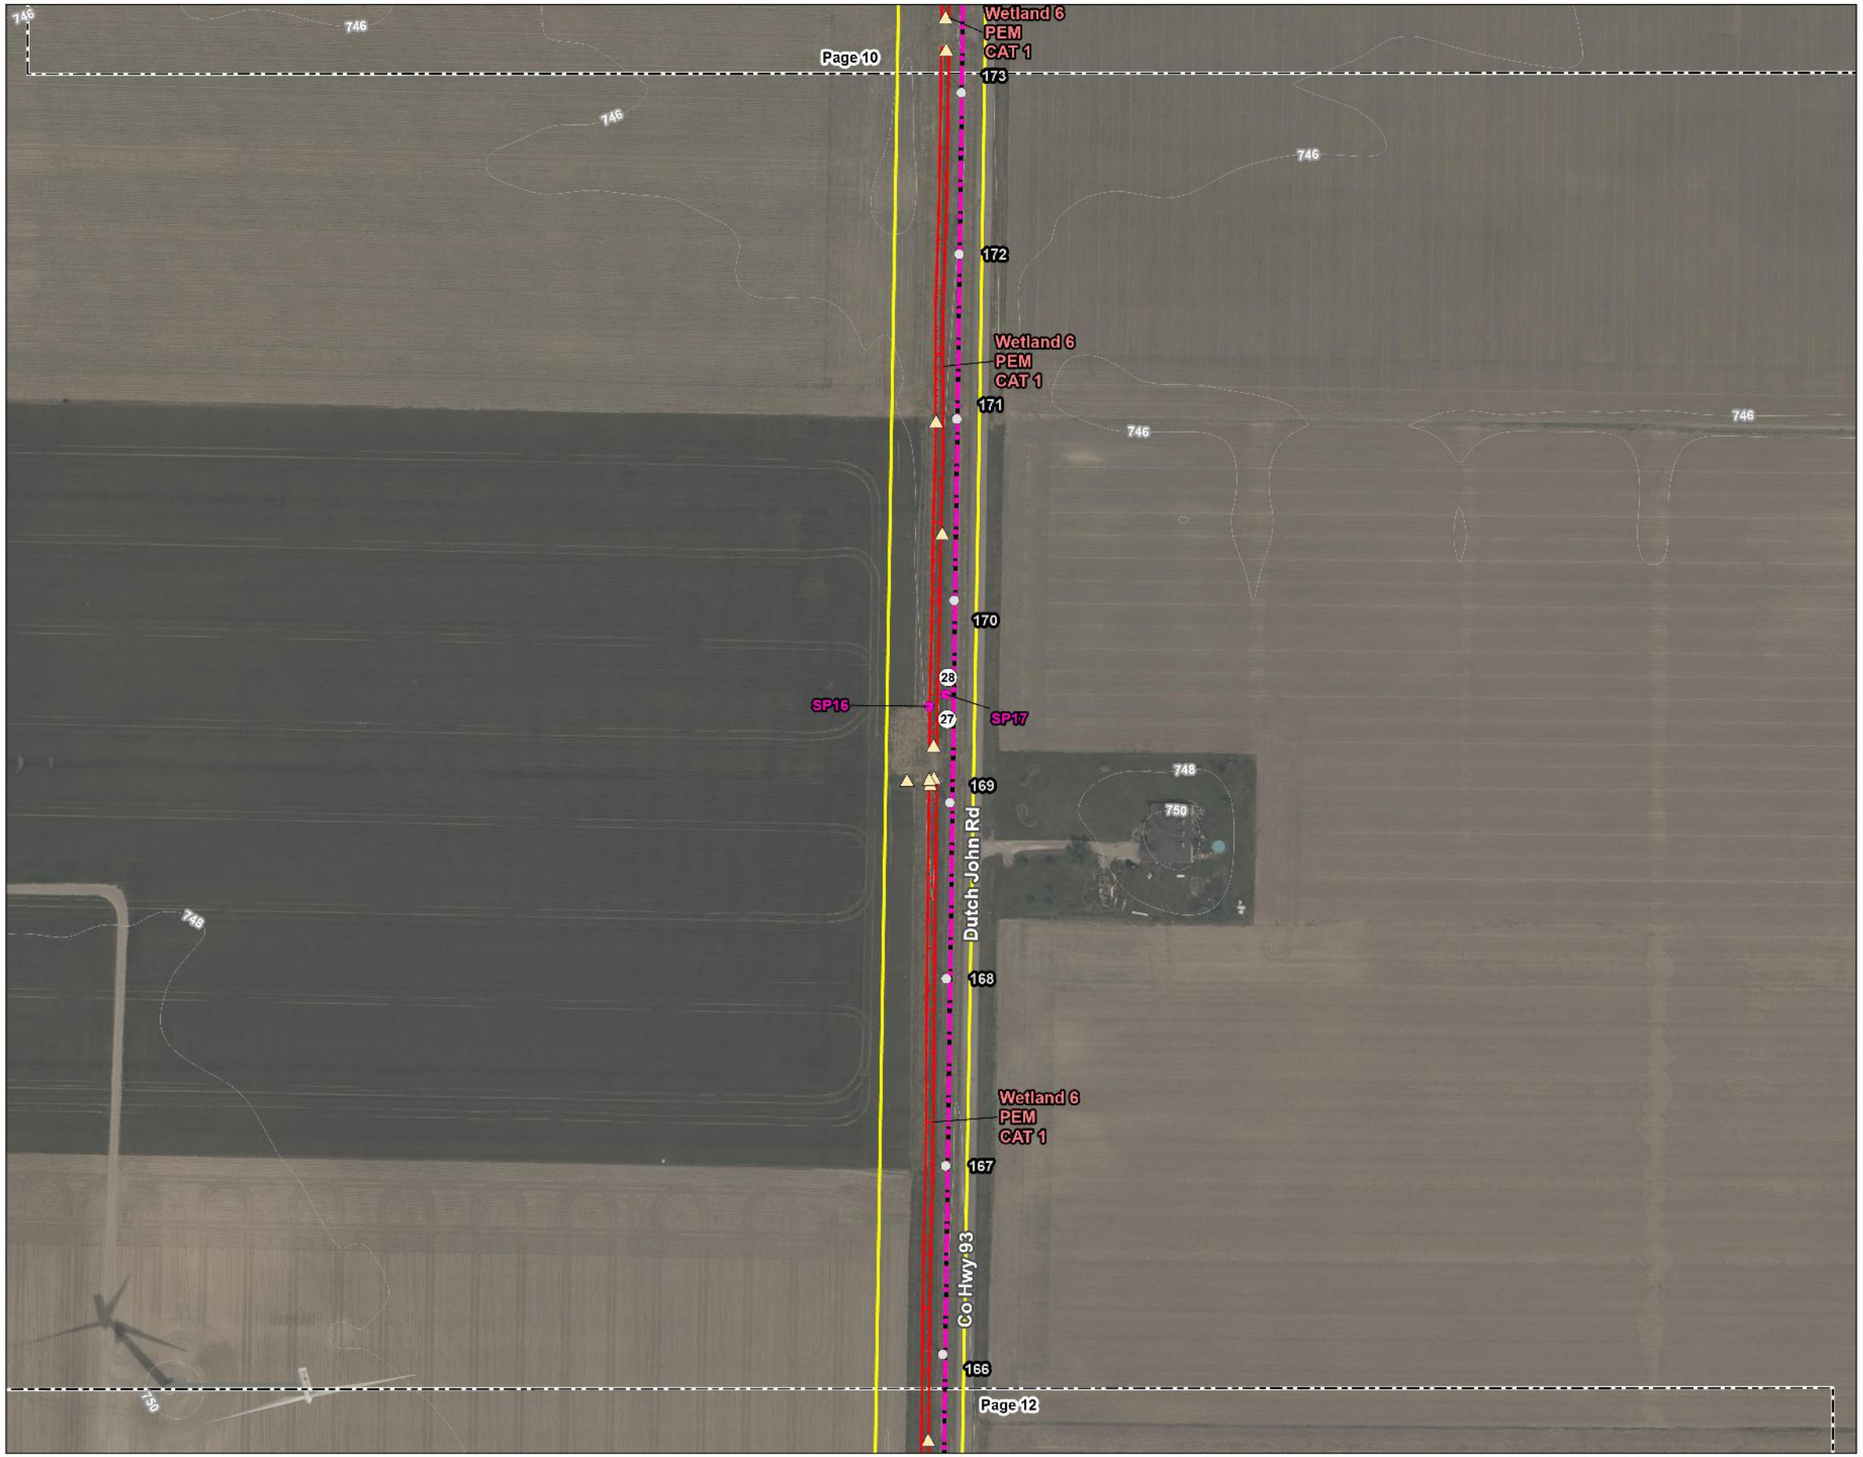

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

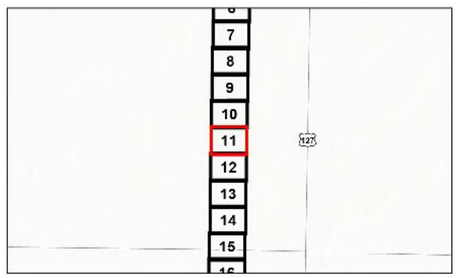

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

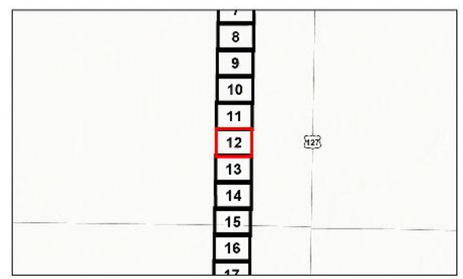

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

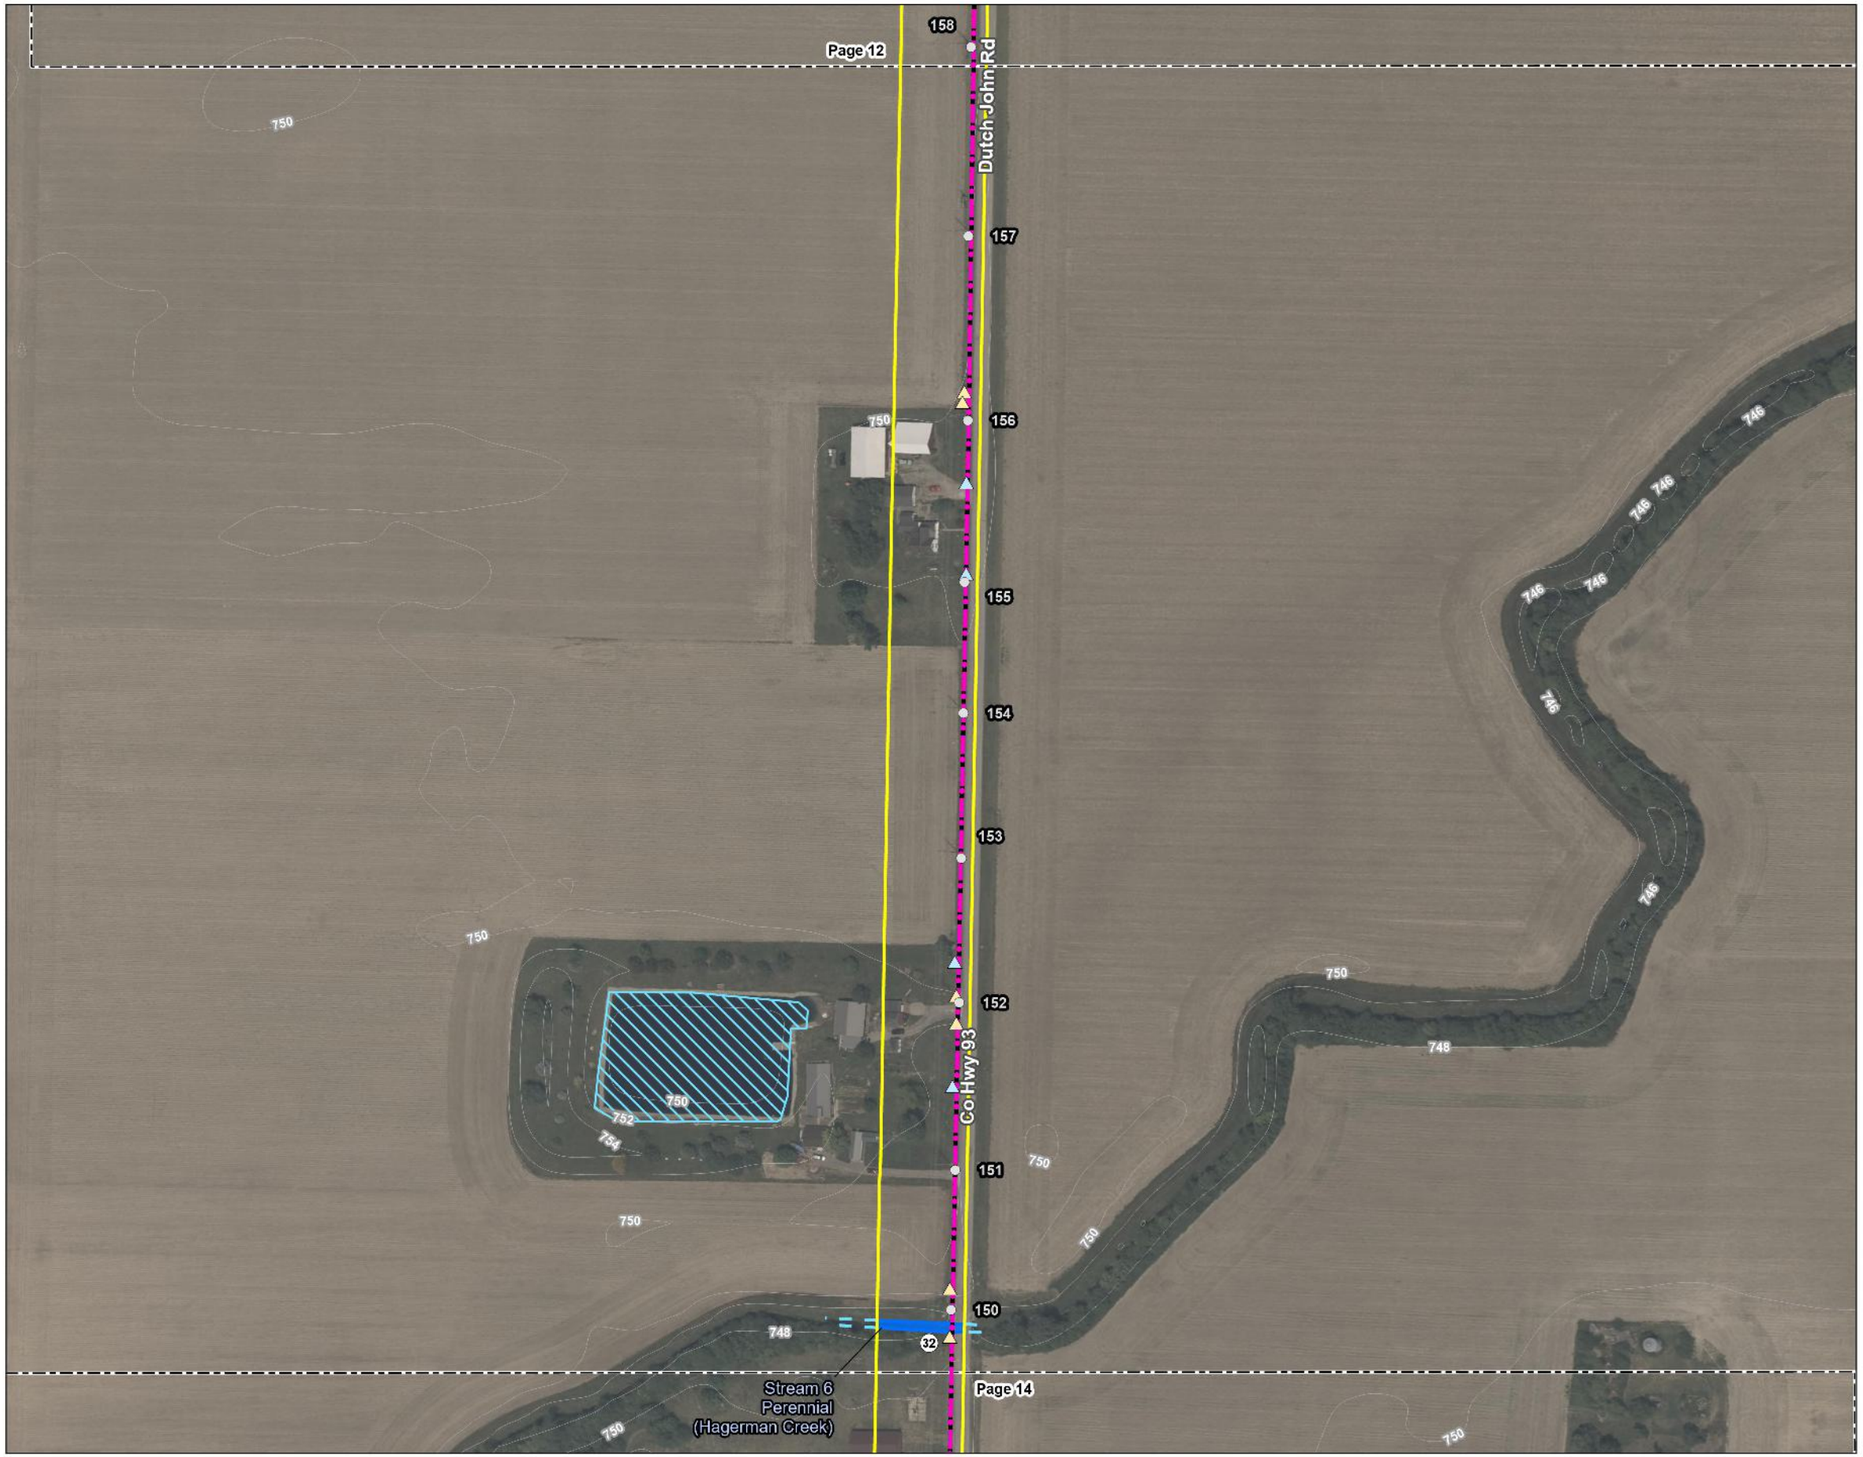

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

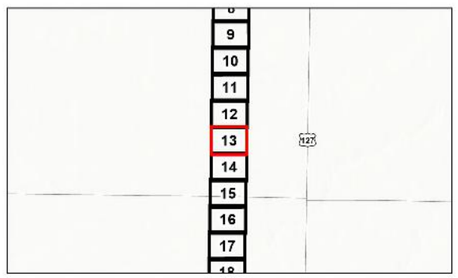

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

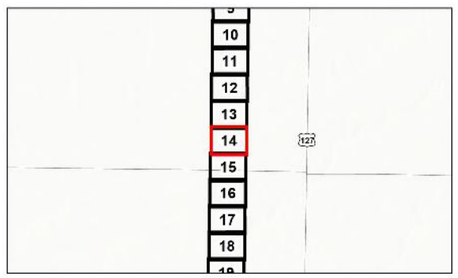

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\0239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.

2

Title

Wetland and Waterbody Delineation Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

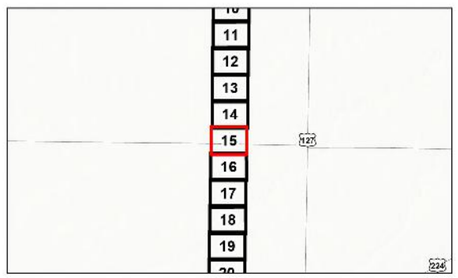

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

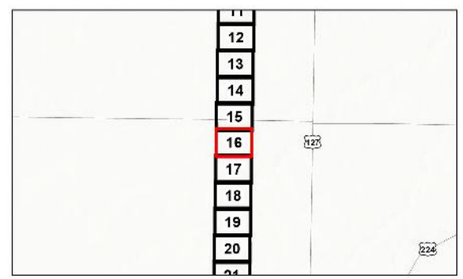

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.

2

Title

Wetland and Waterbody Delineation Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

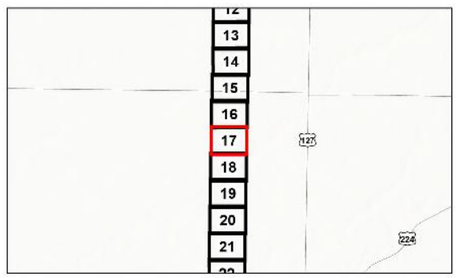

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

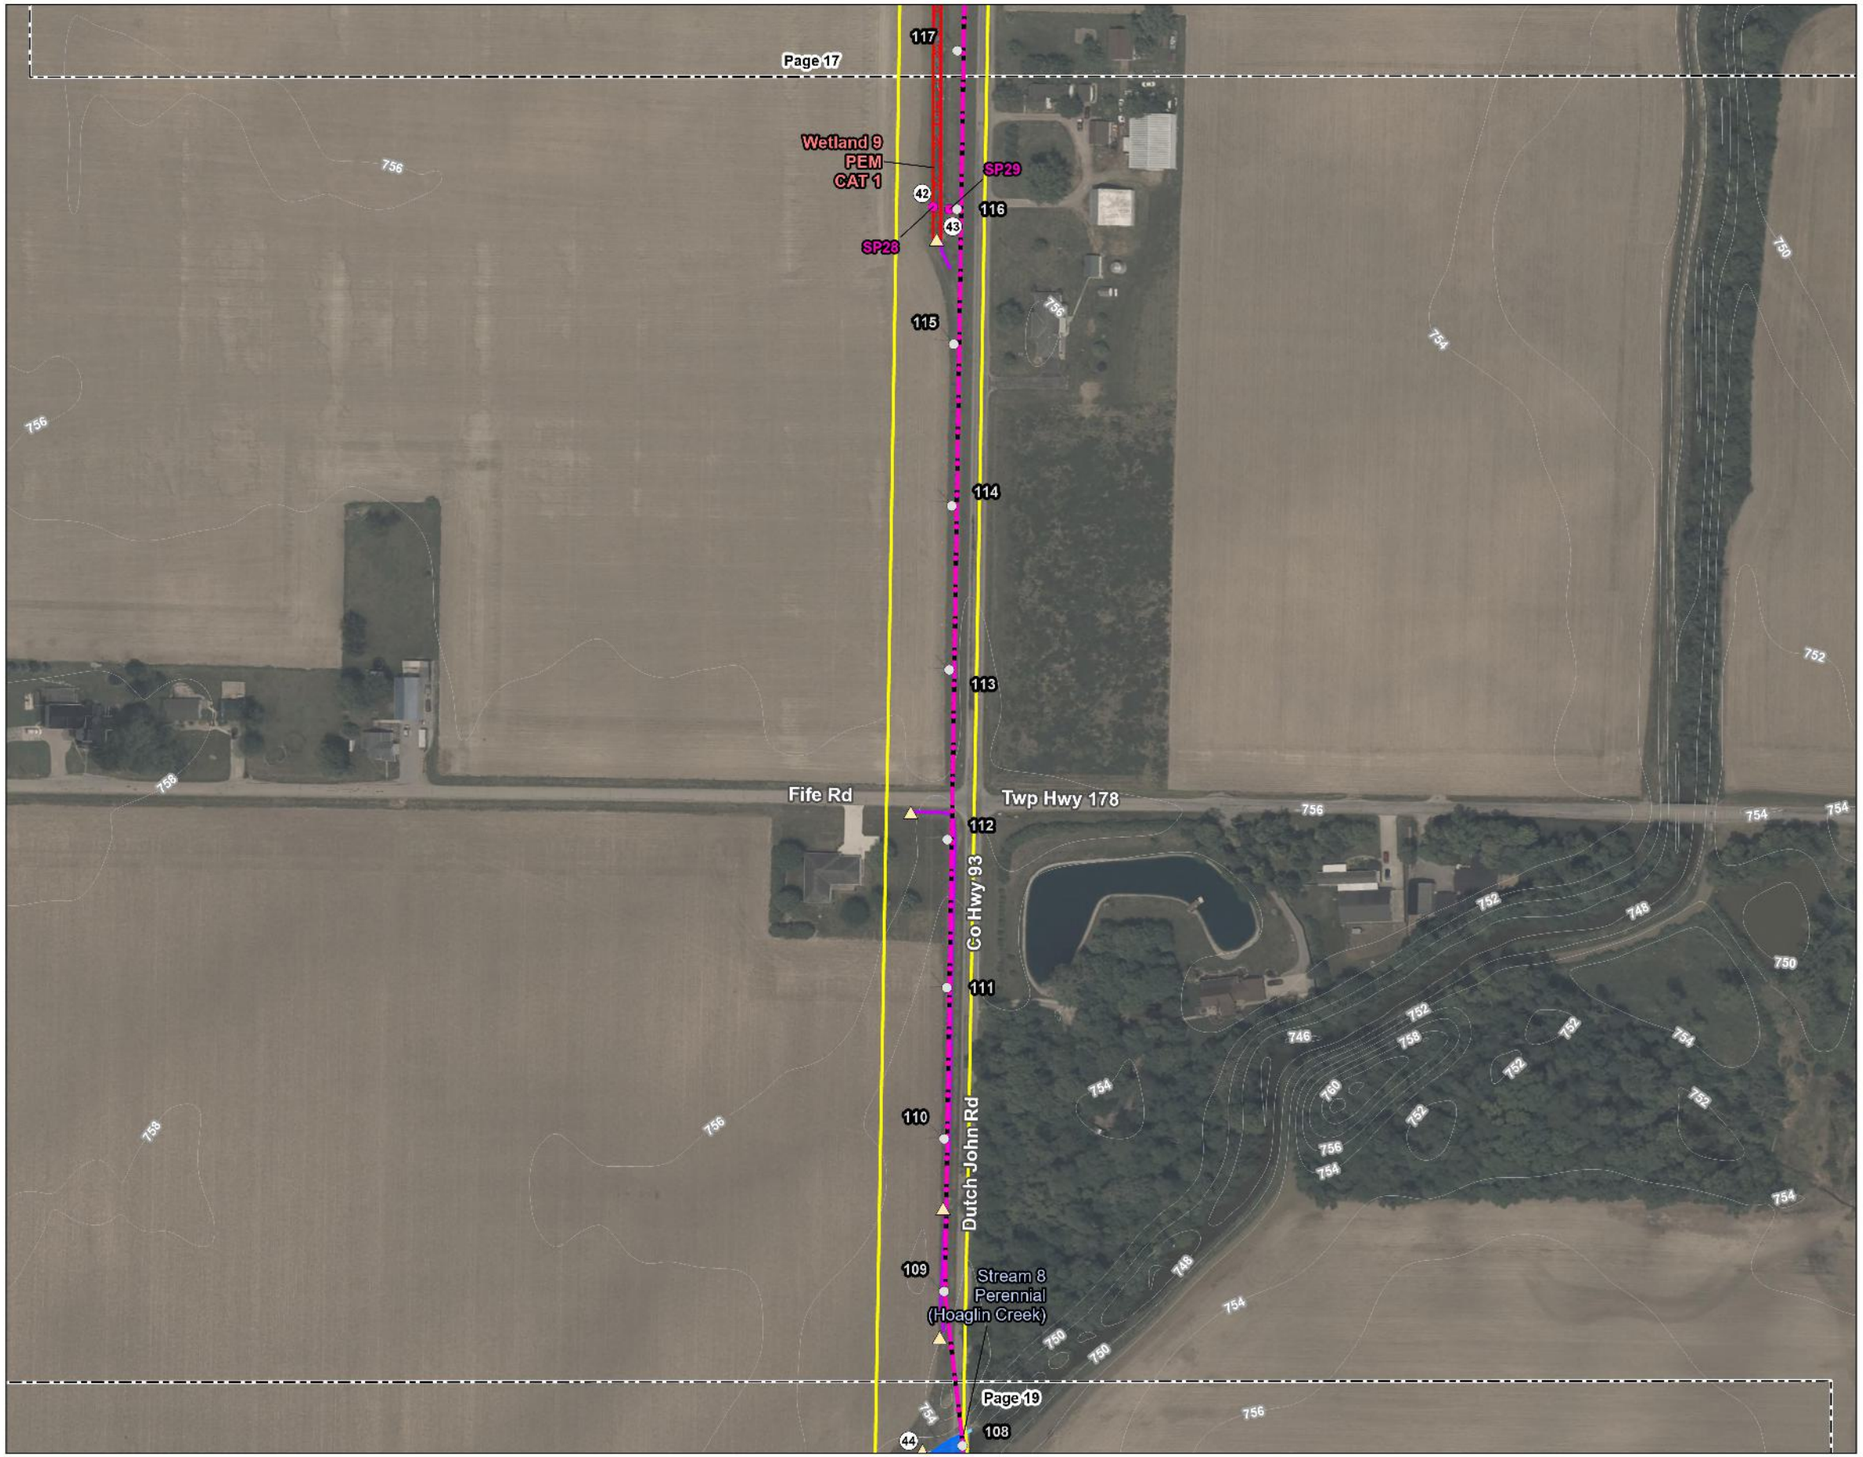

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

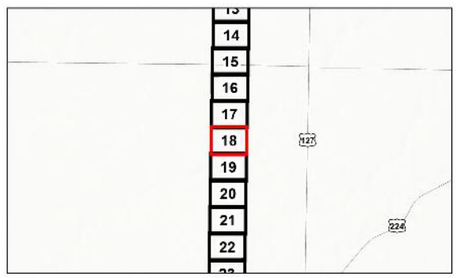

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

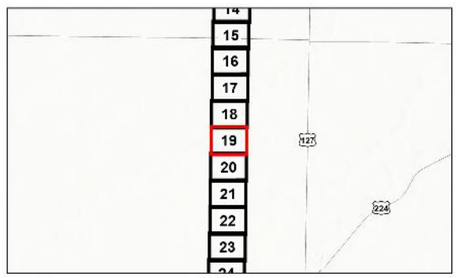

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

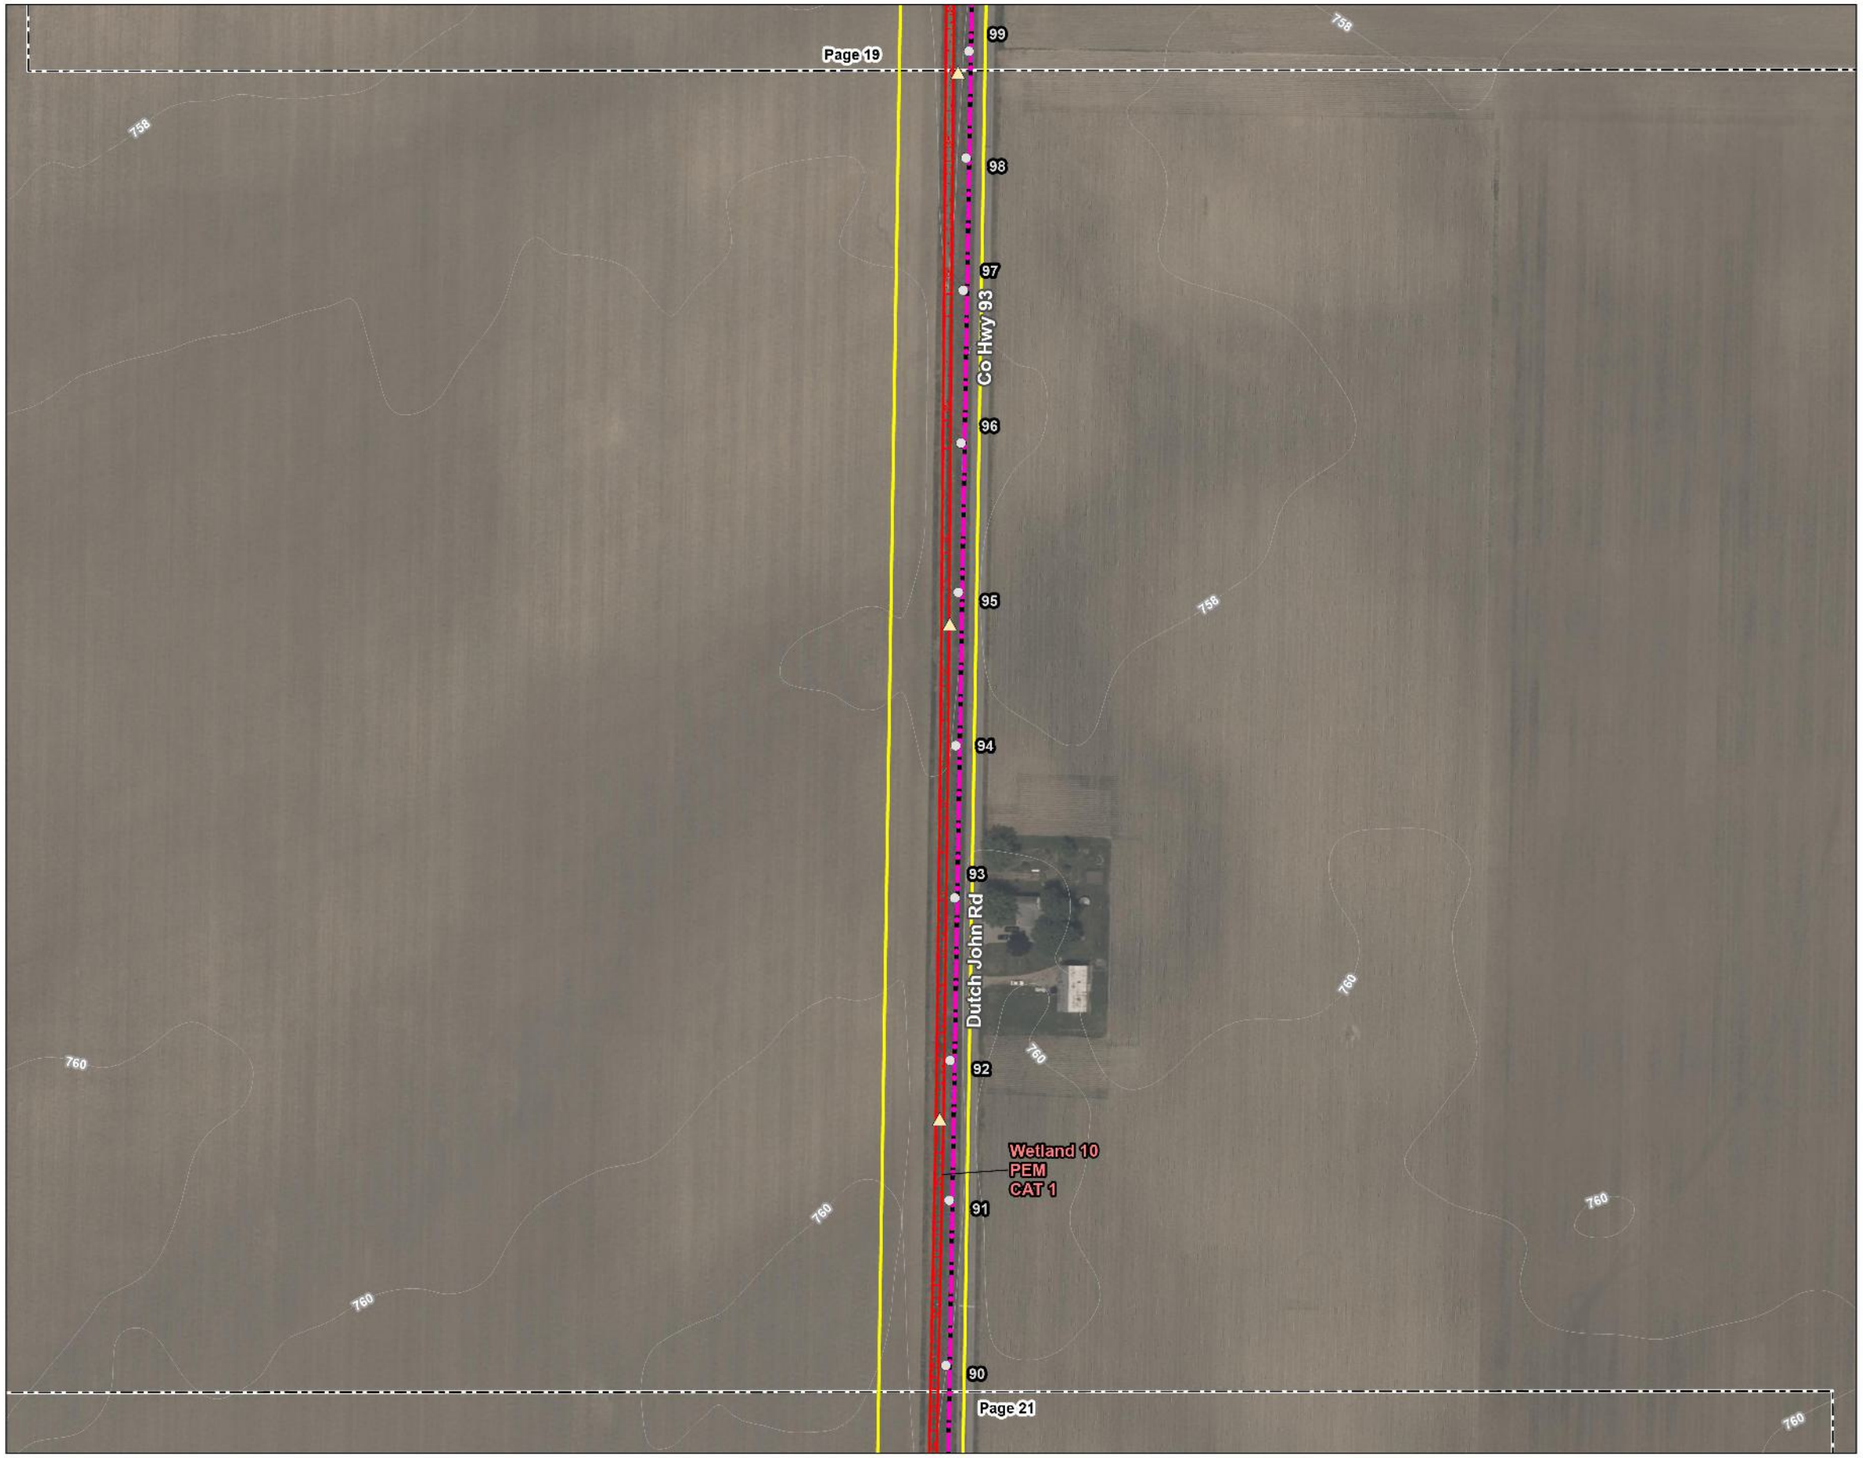

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

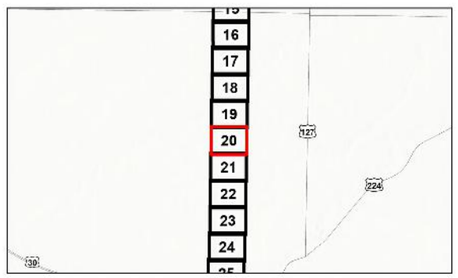

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

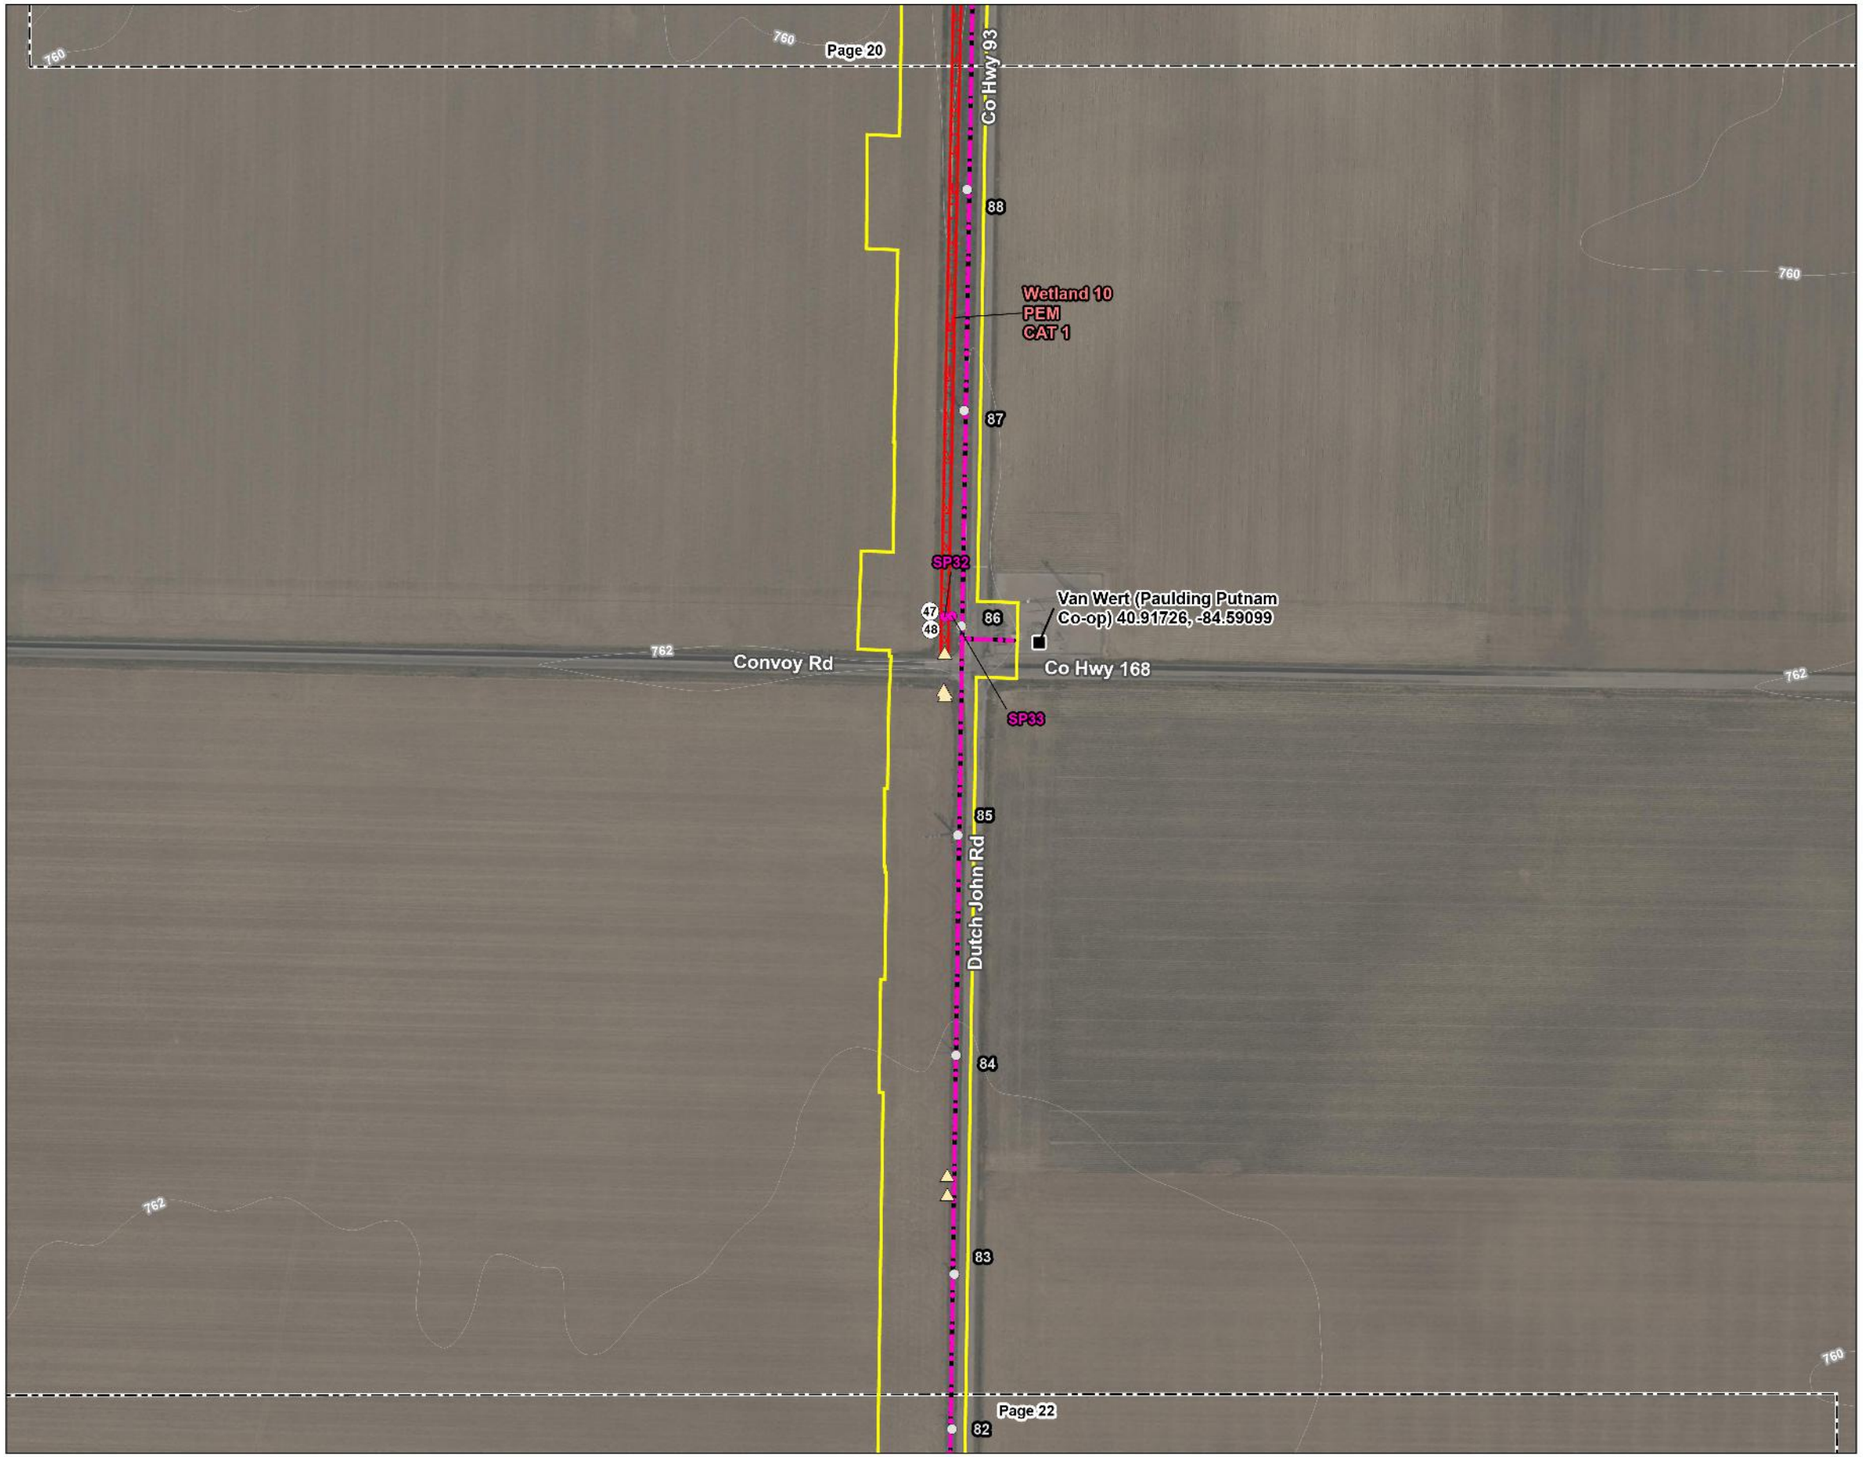

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

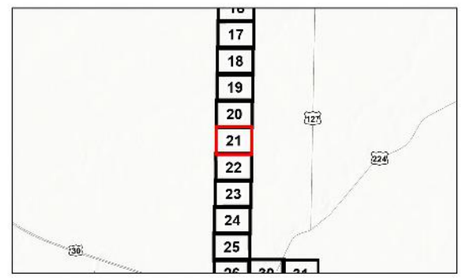

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

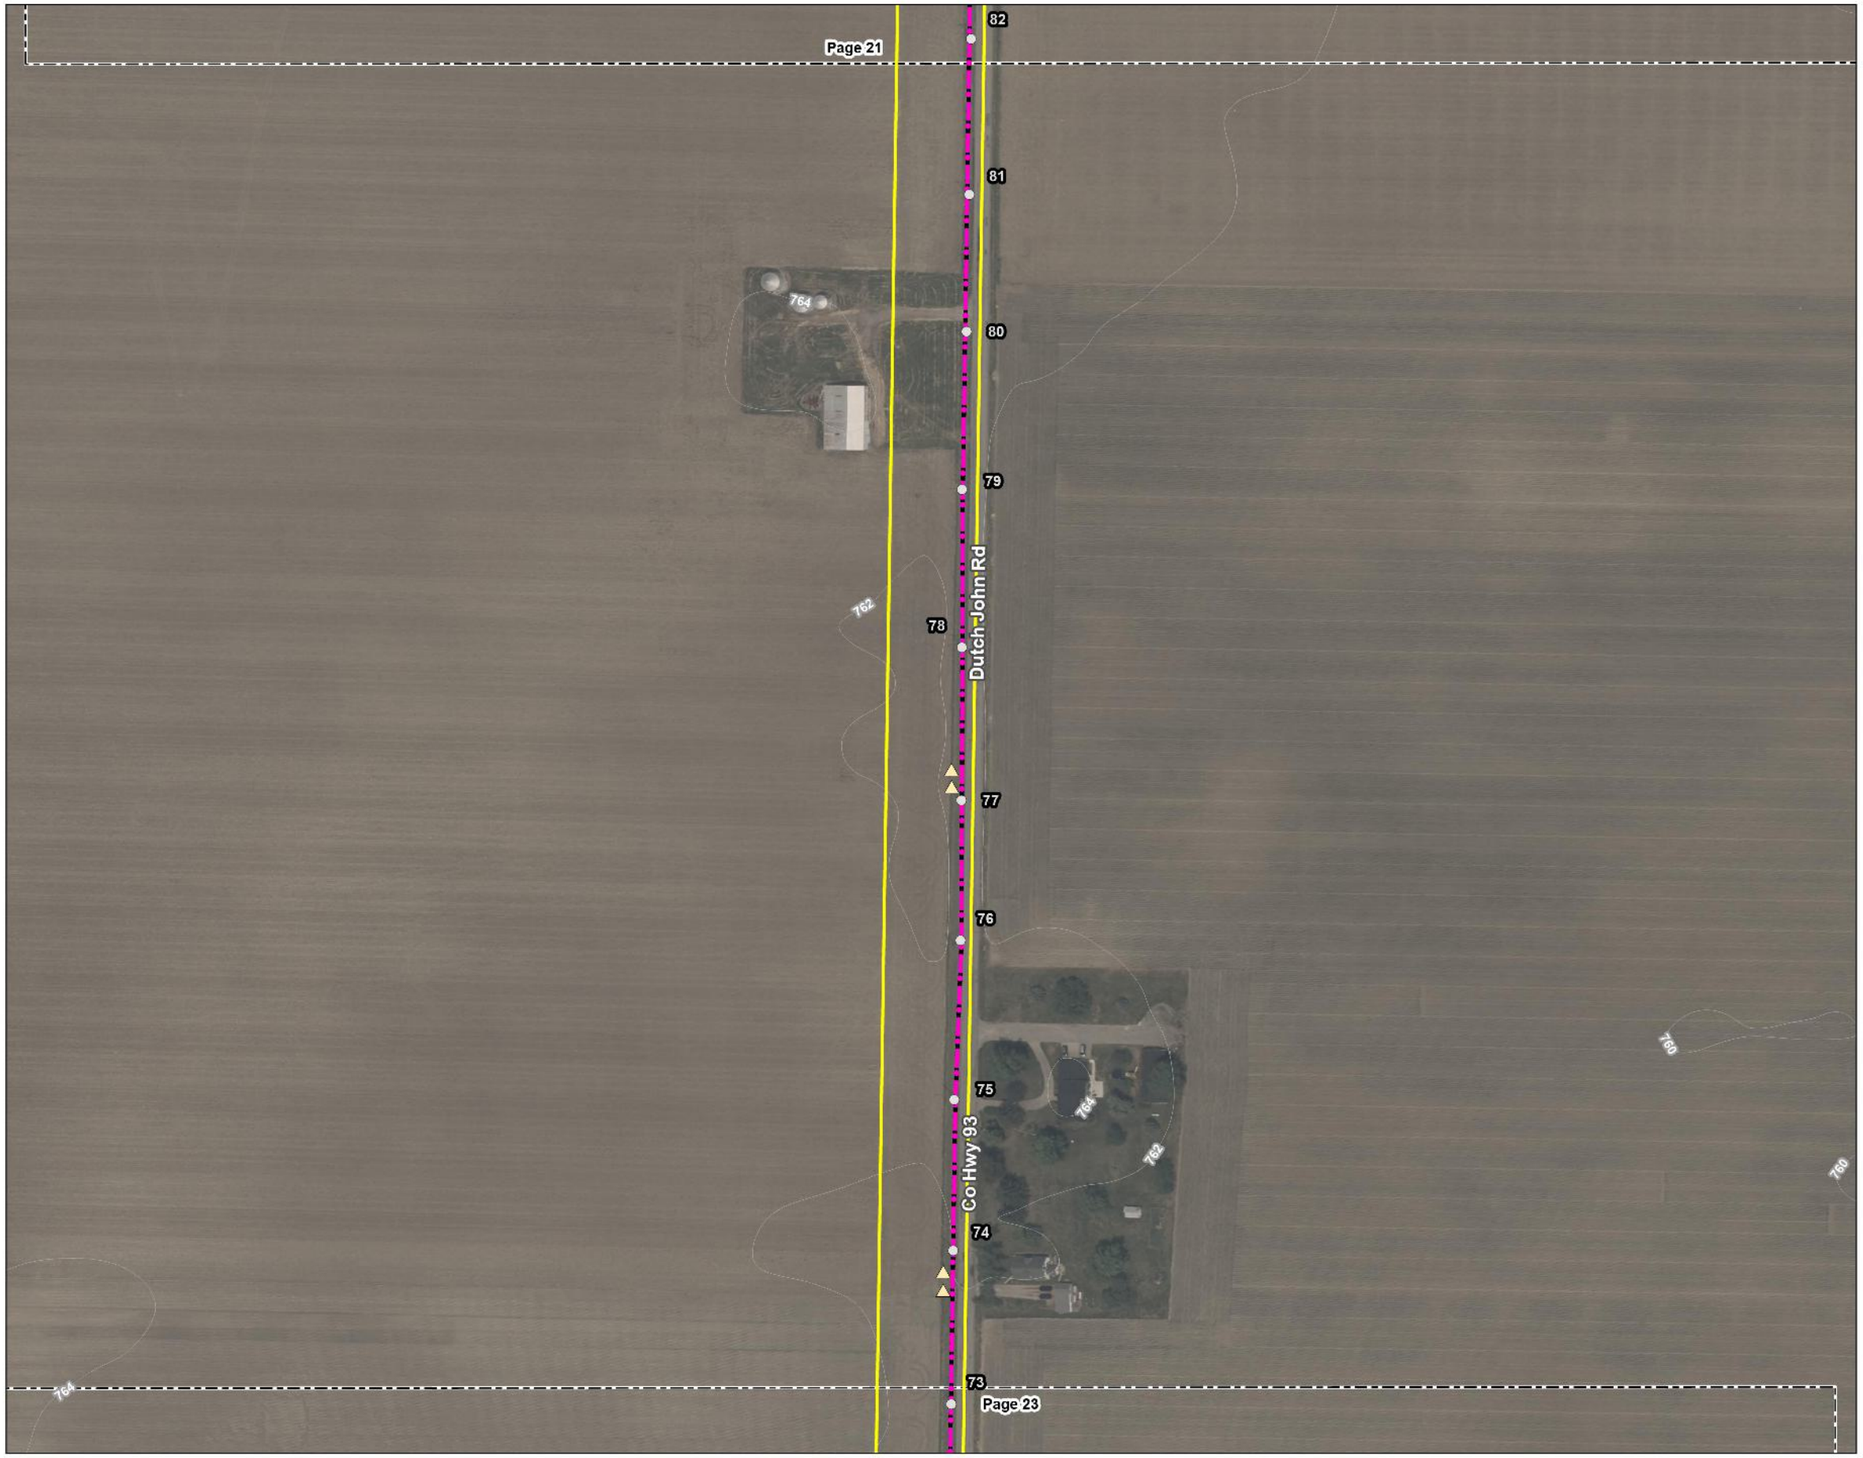

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

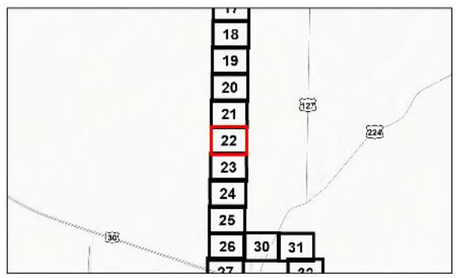

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

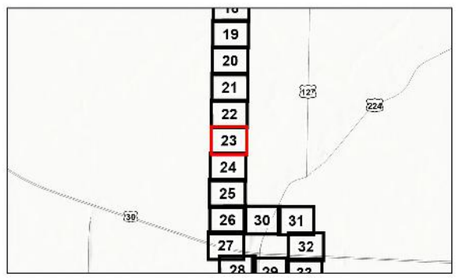

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\0239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

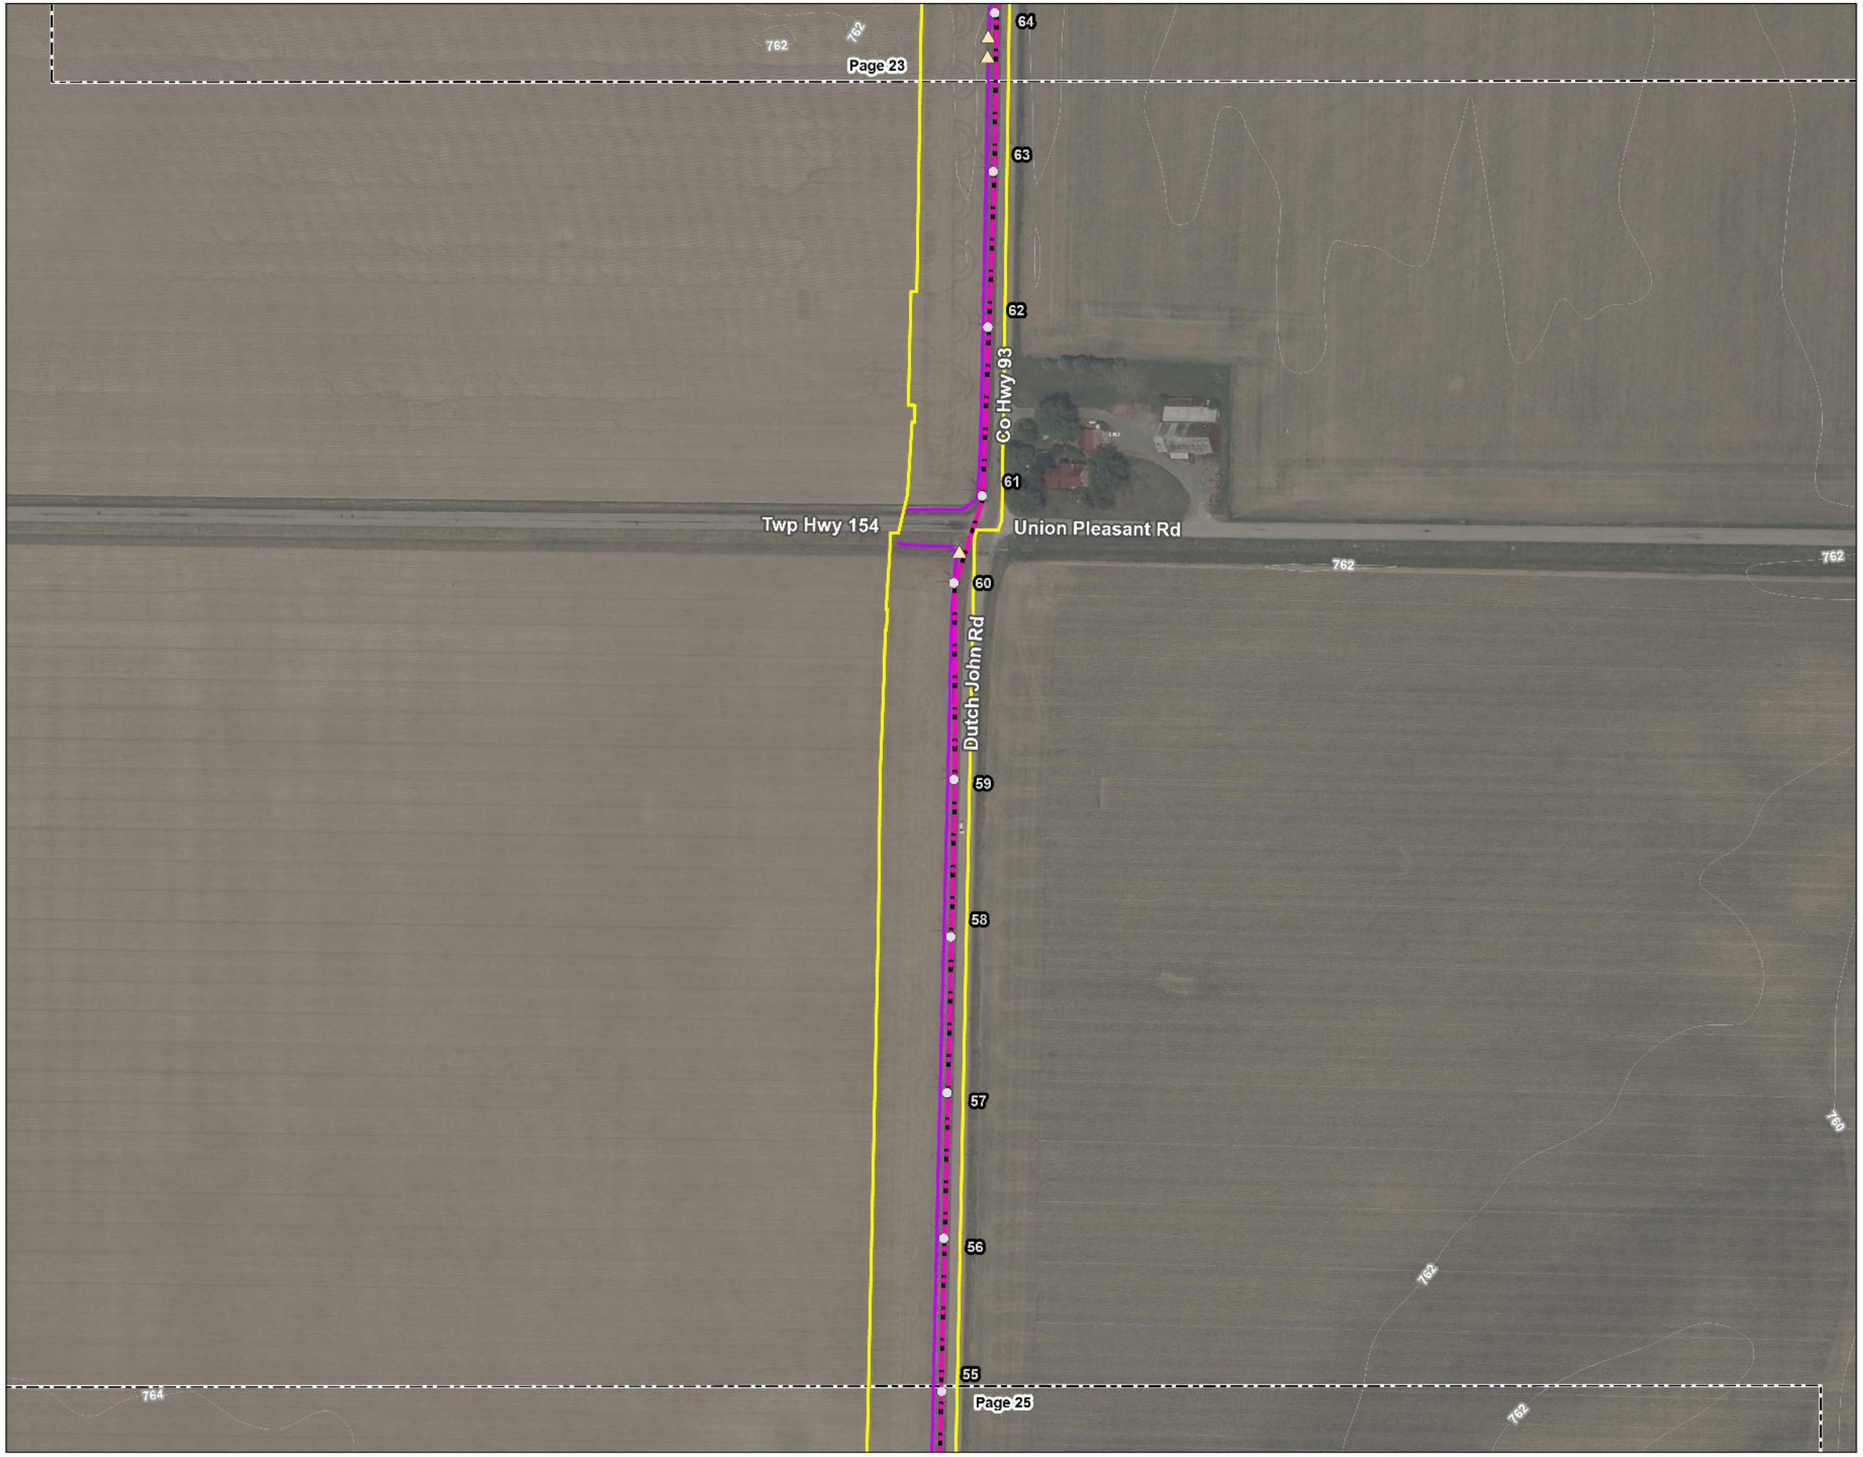

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

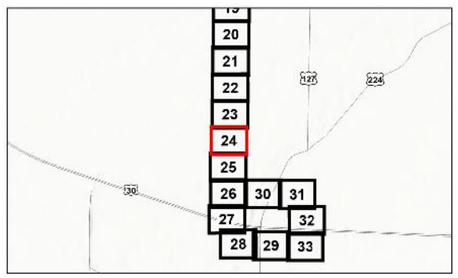

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

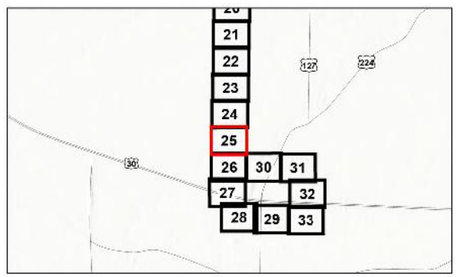

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

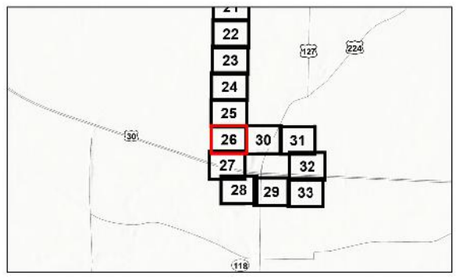

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\0\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

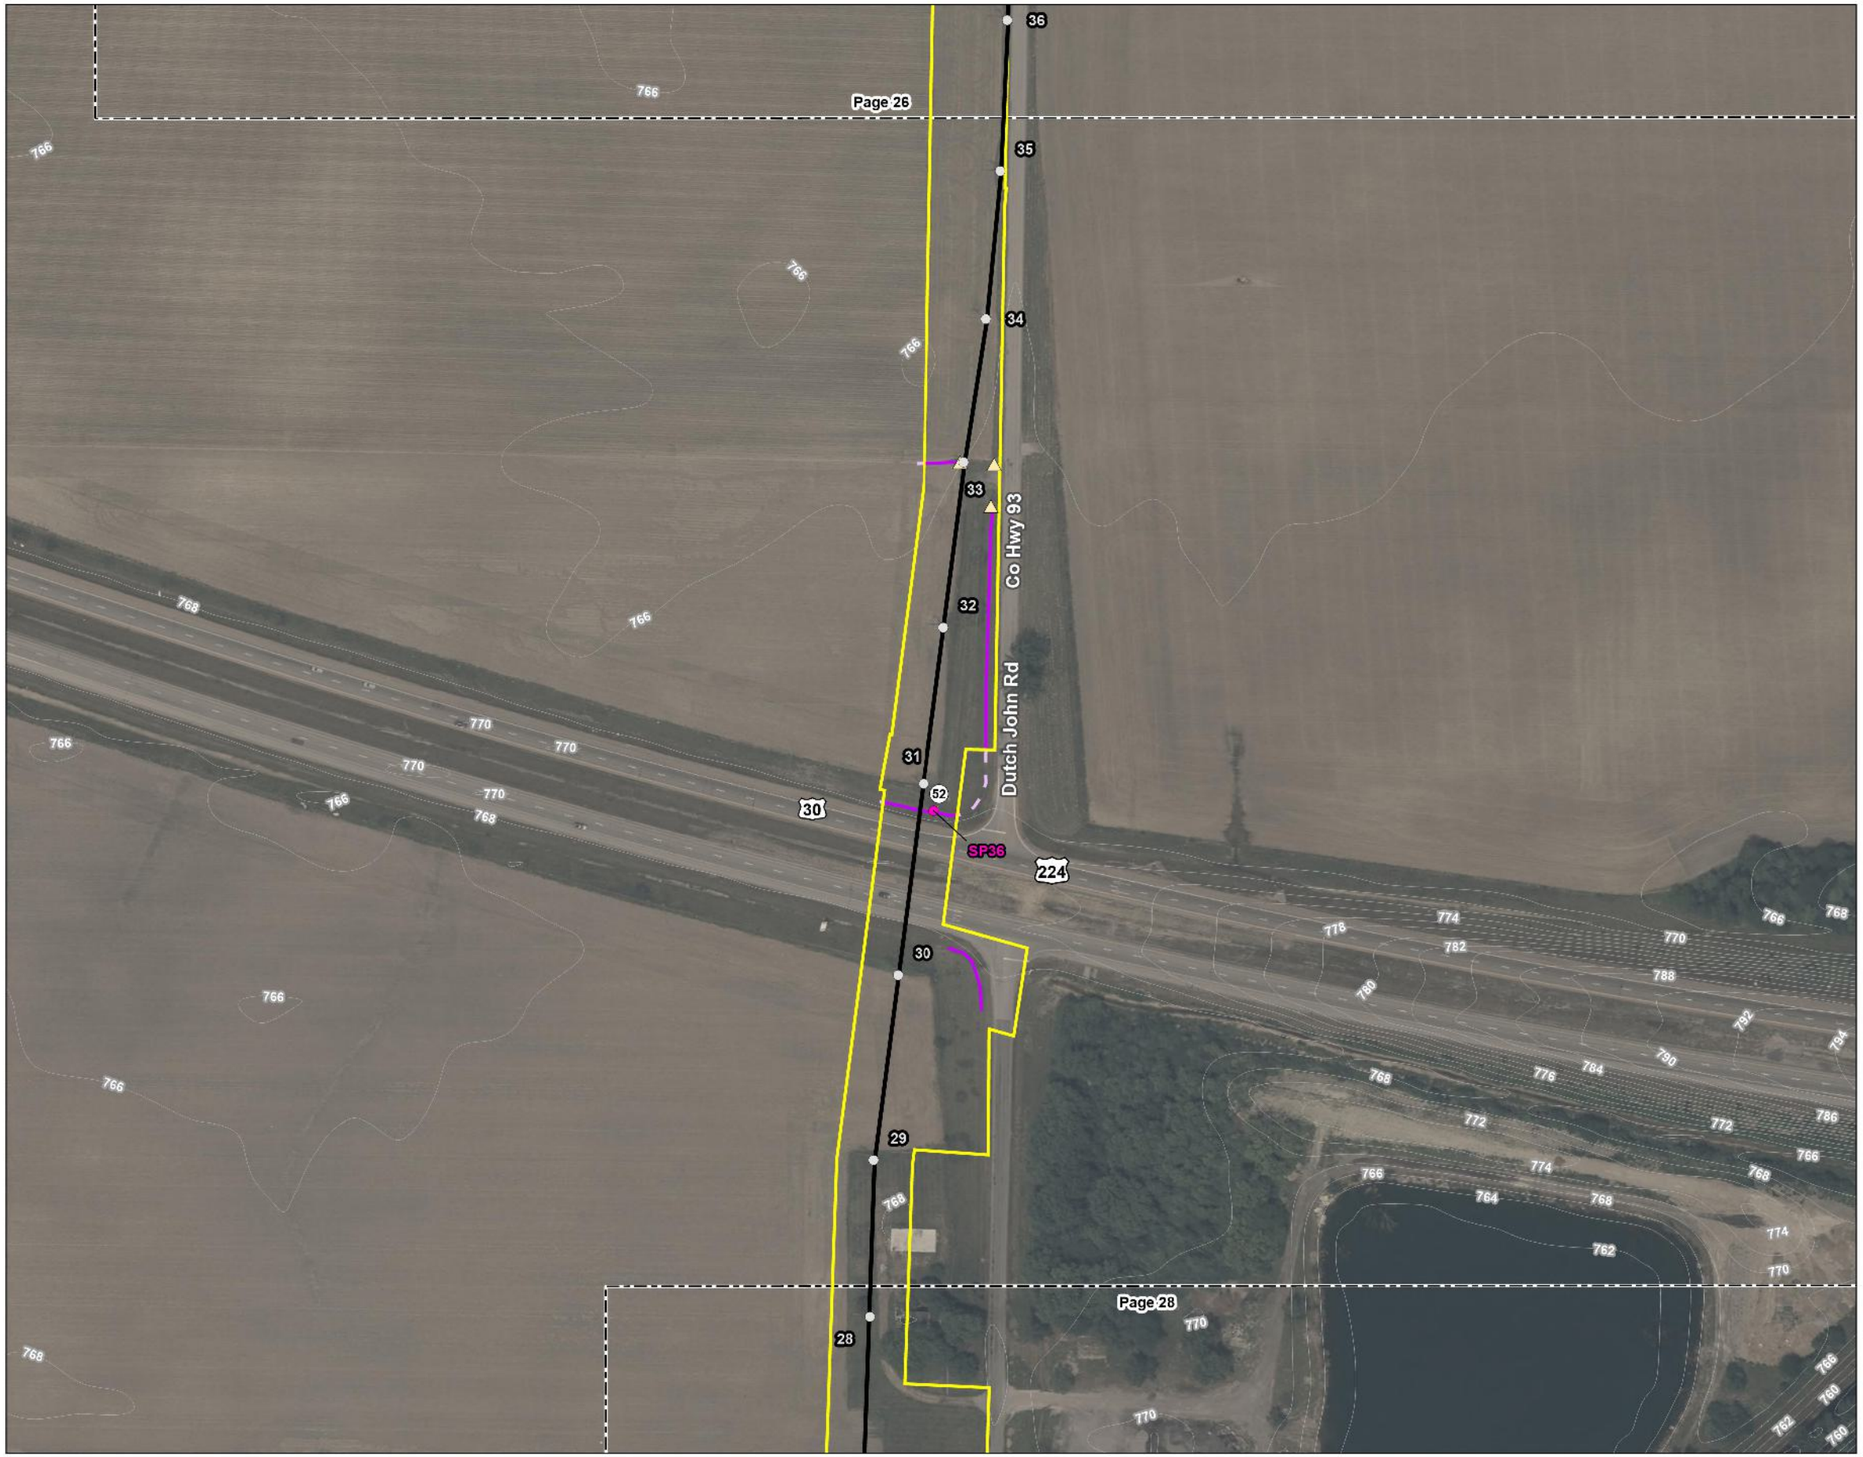

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

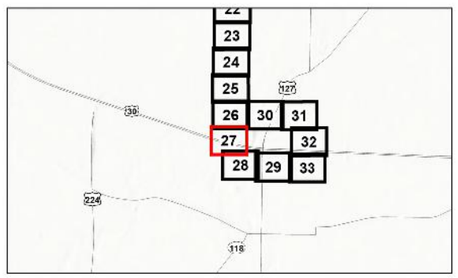

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

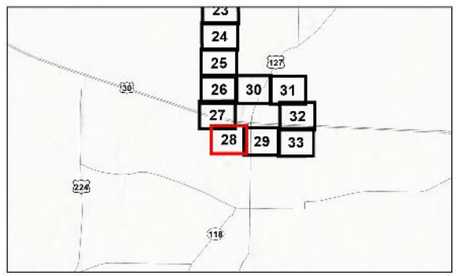

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\0239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxd\fig\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

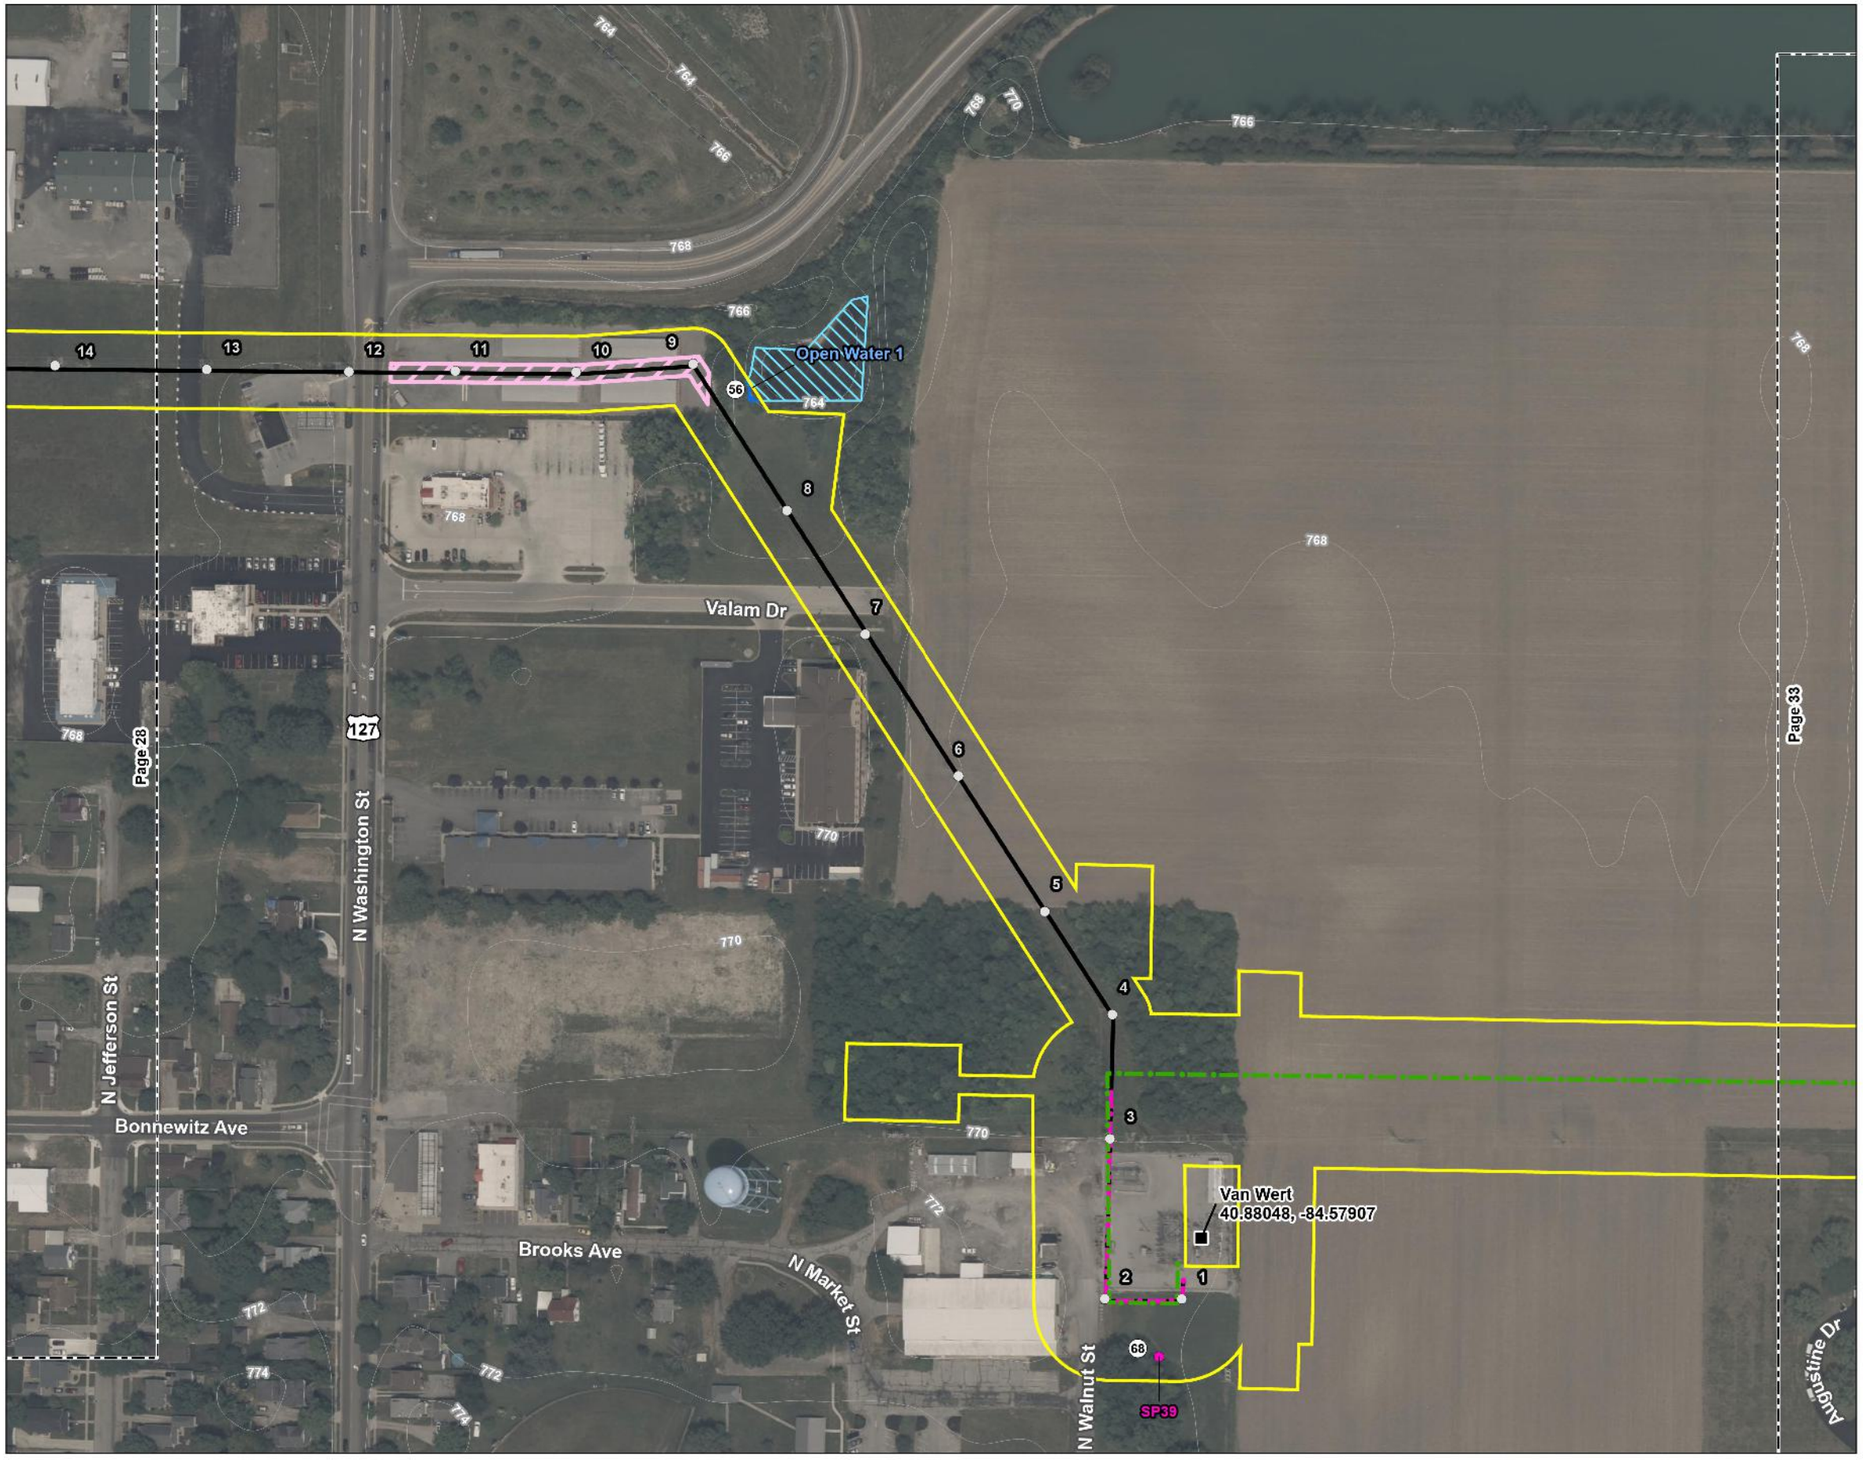

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

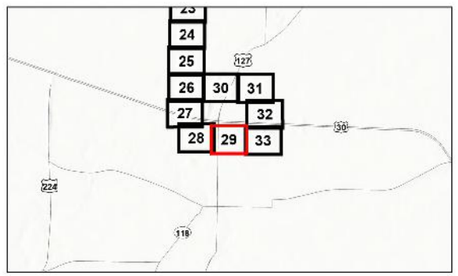

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxd\fig239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

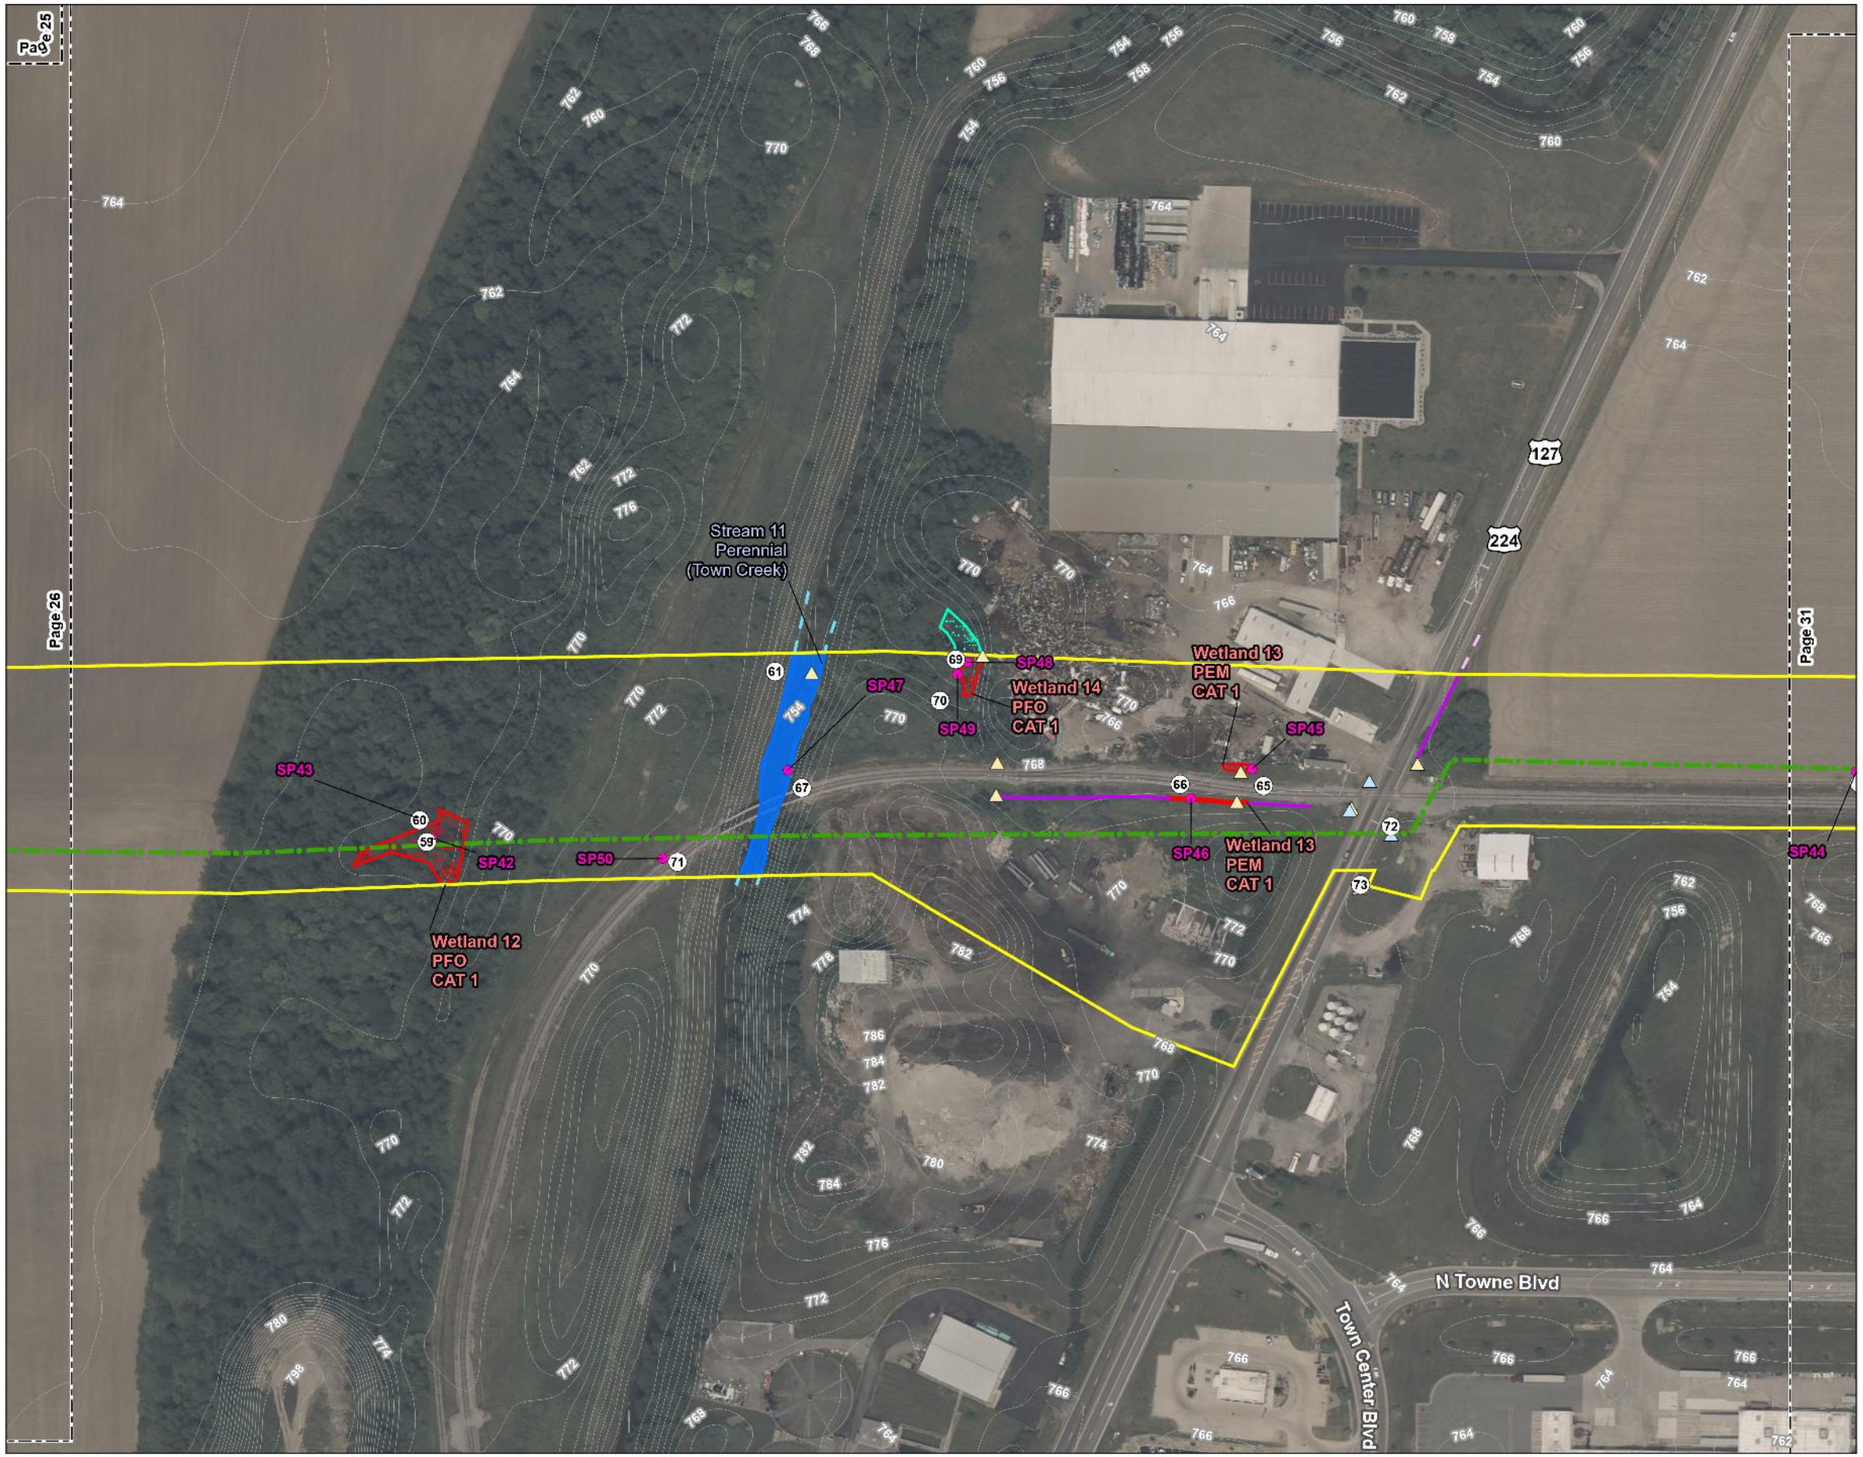

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

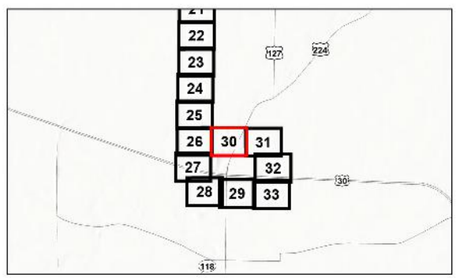

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert Paulding\03 data\gis_cad\gis\mxd\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

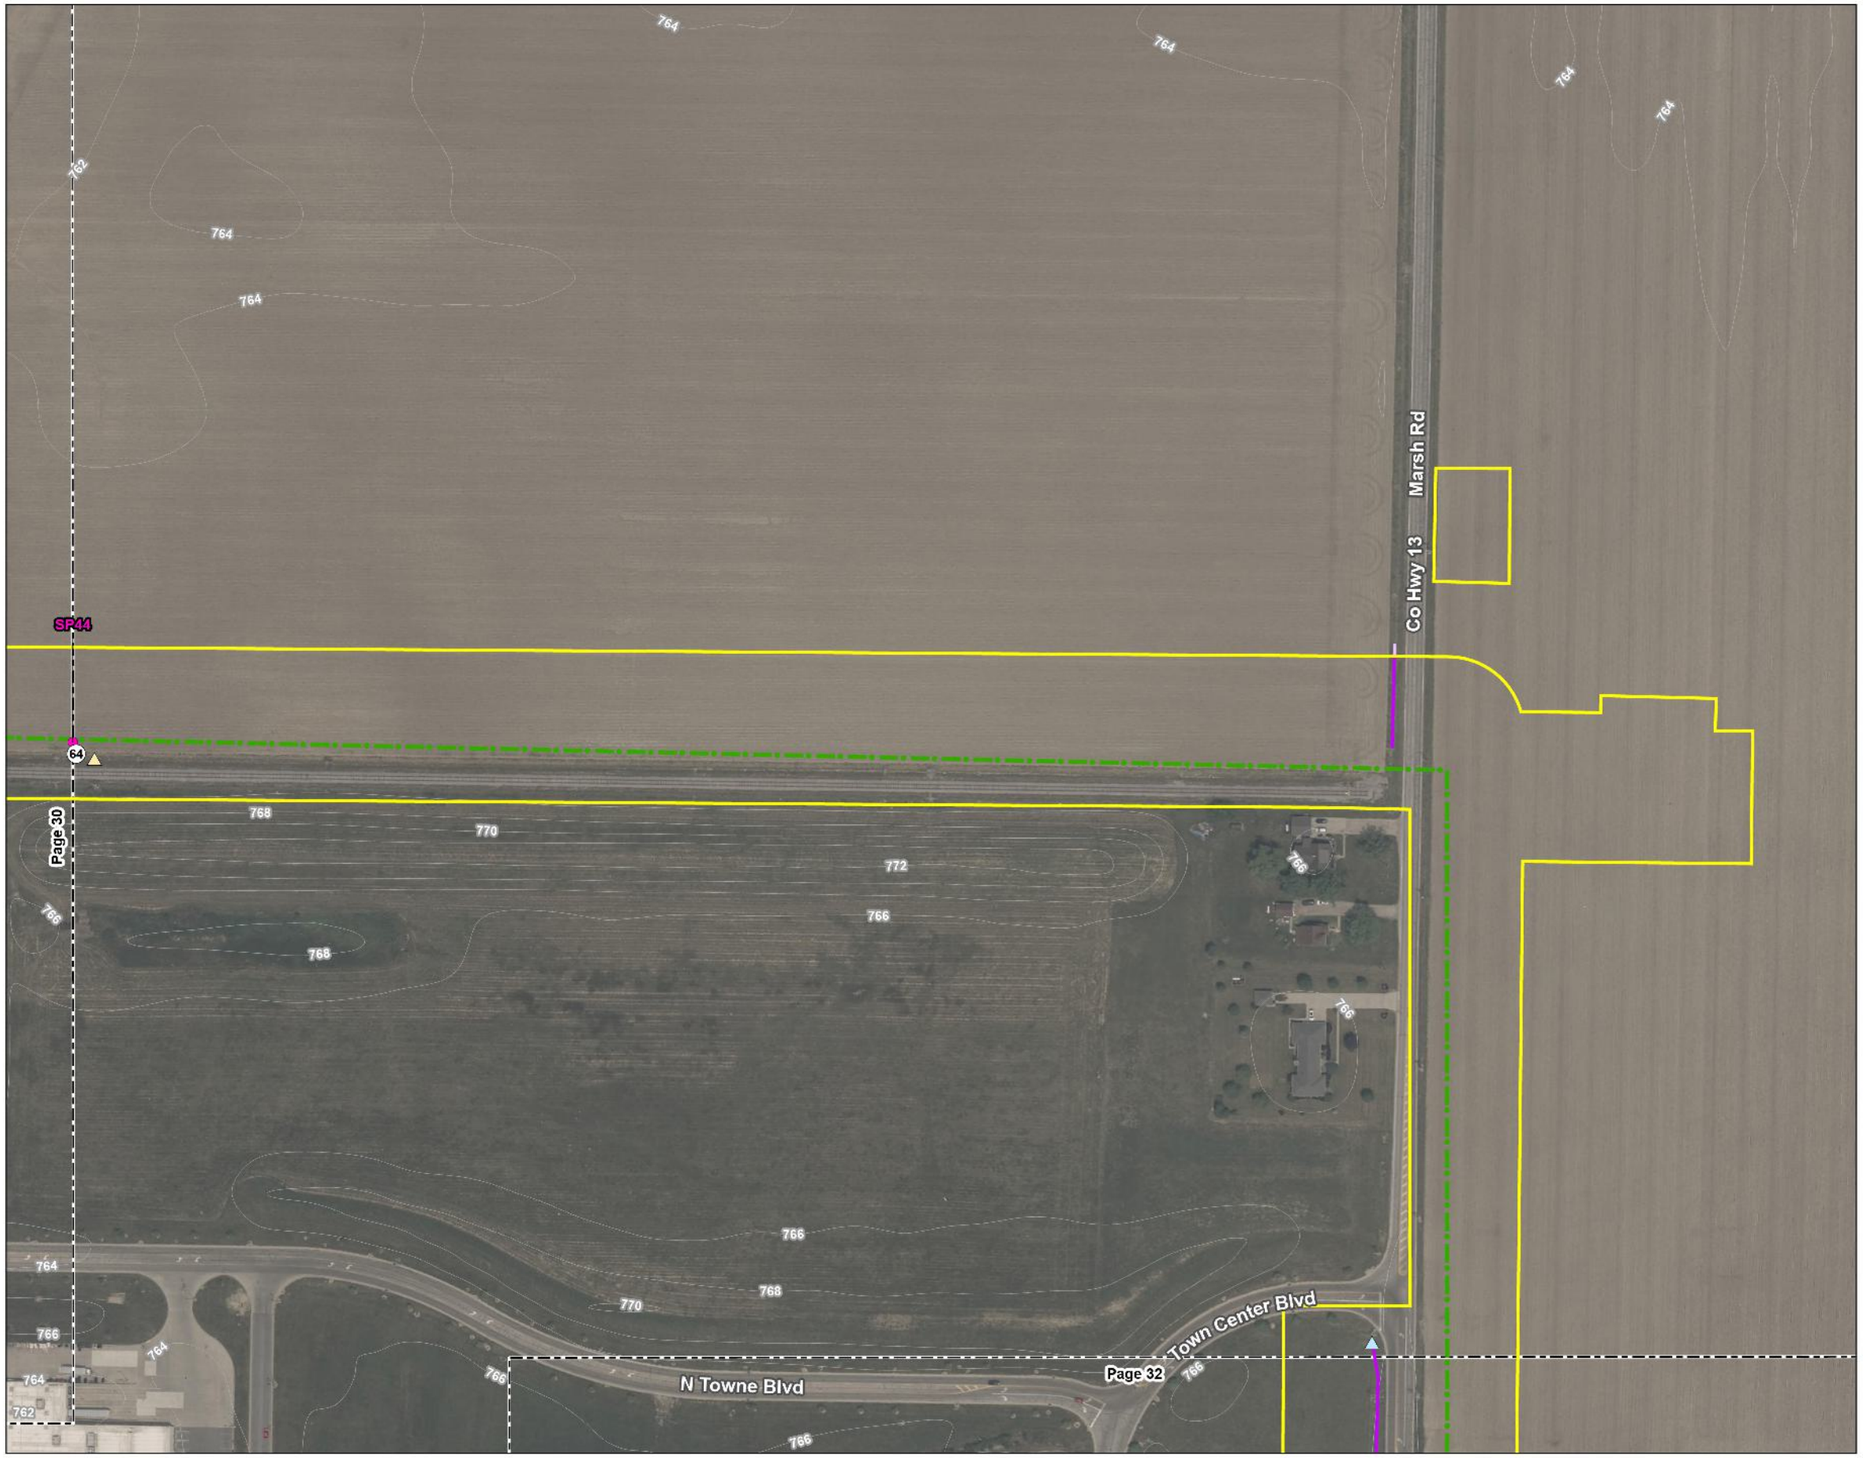

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

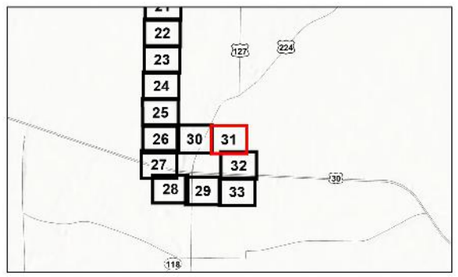

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert2239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

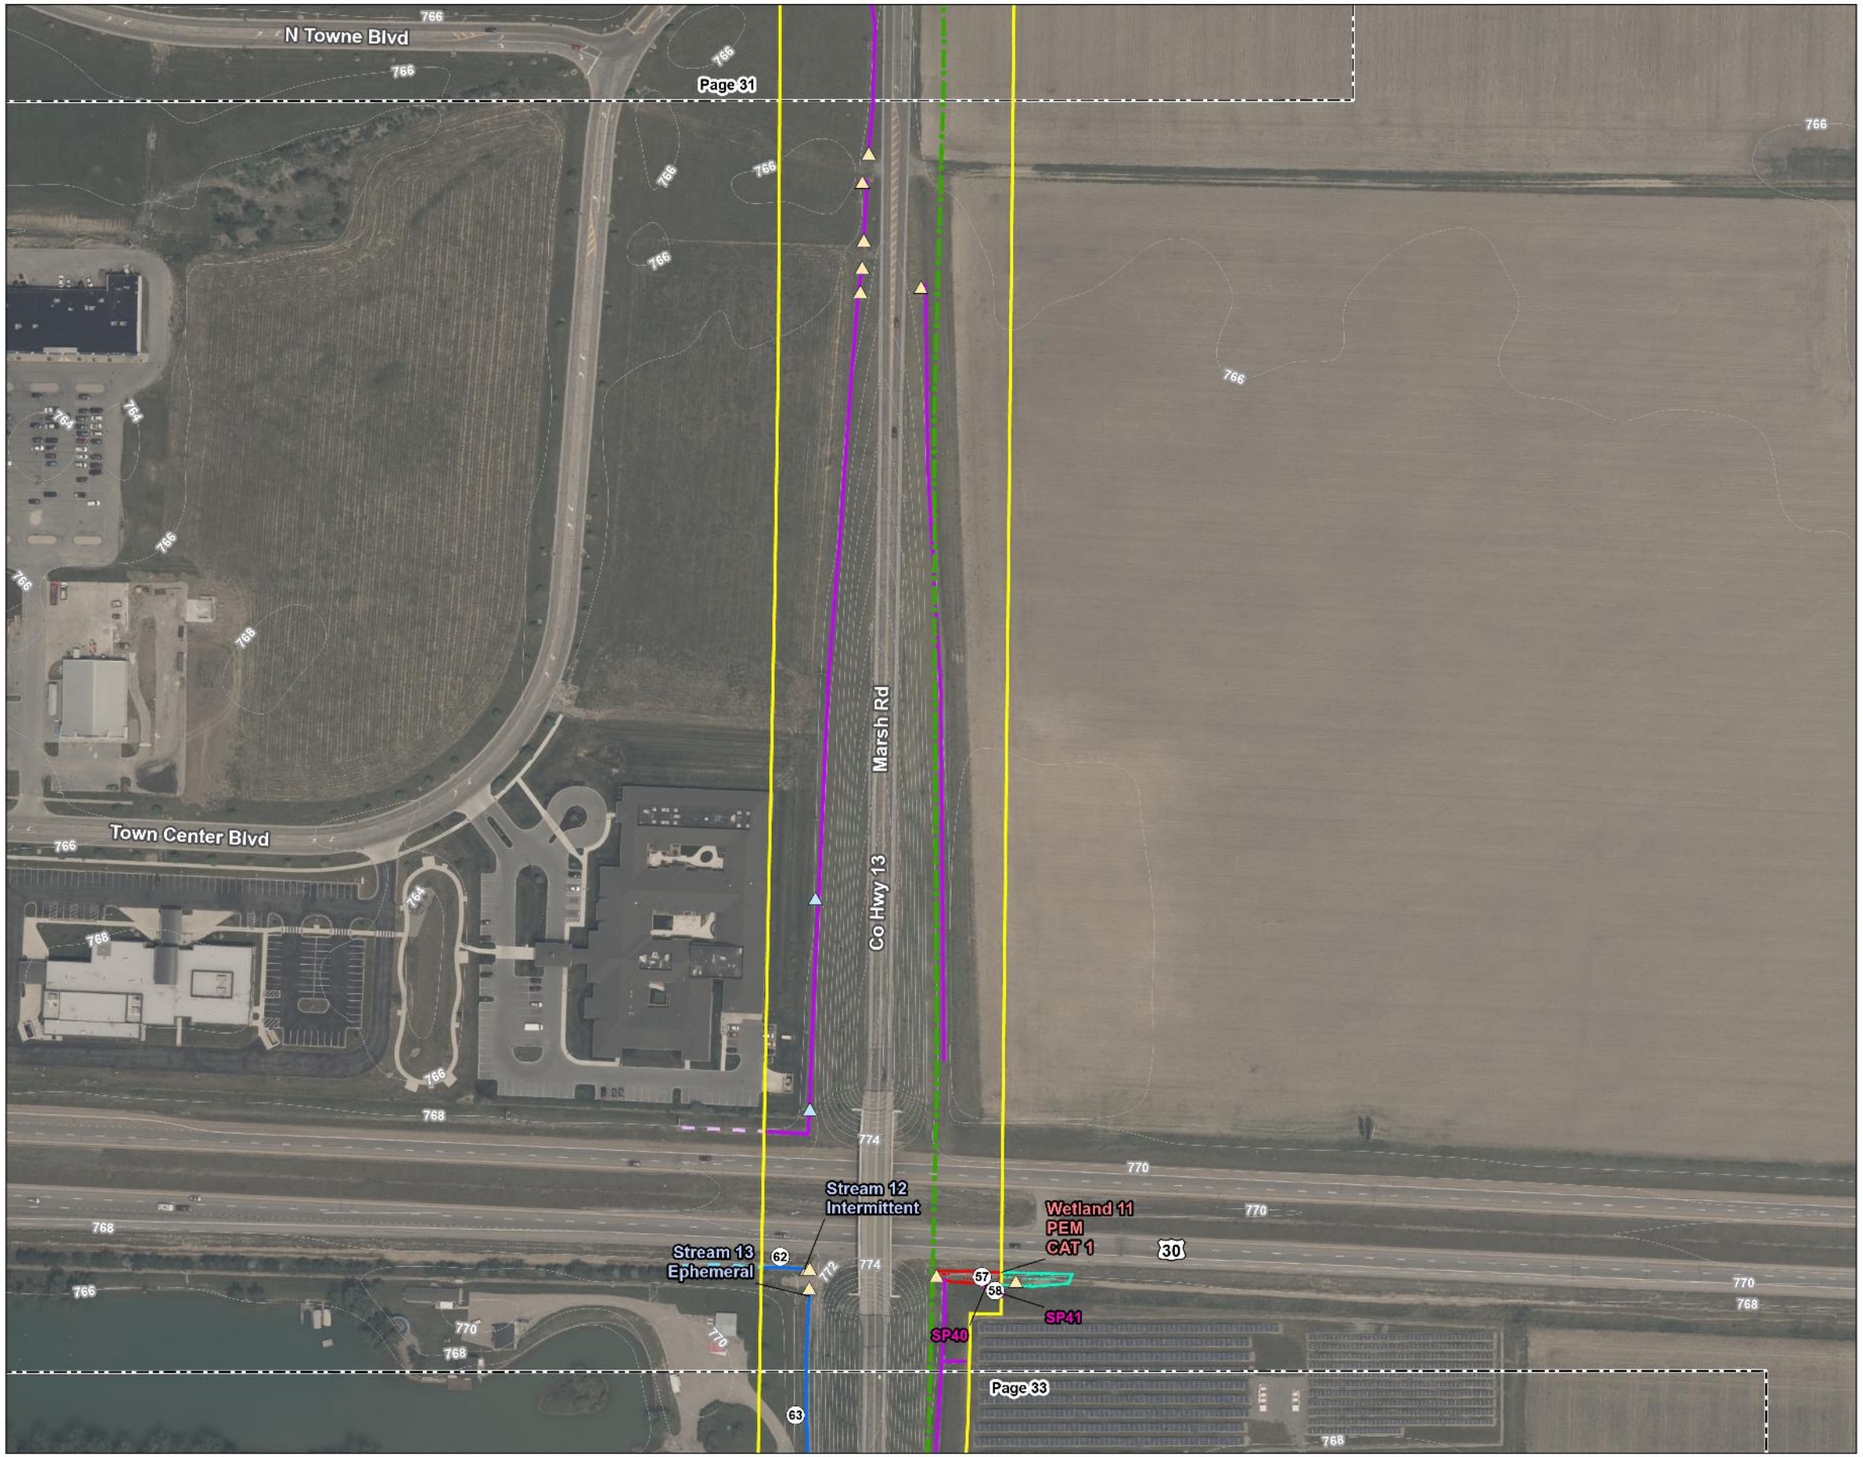

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

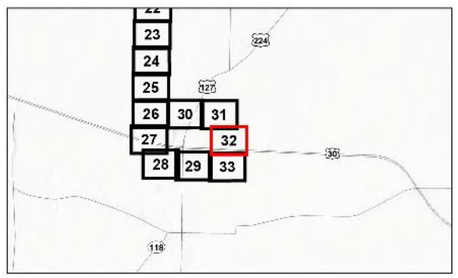

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Figure No.
2

Title
Wetland and Waterbody Delineation Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Limited ROW Access (12' either side of Exising Line)

Field Collected Data

- Photo Location
- Existing Culvert
- Existing Storm Drain
- Wetland Determination Sample Point
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area
- 2 ft Elevation Contour
- National Wetlands Inventory Feature

FEMA Flood Hazard Area

- 100-year Floodplain
- Floodway*

*No features within data frame

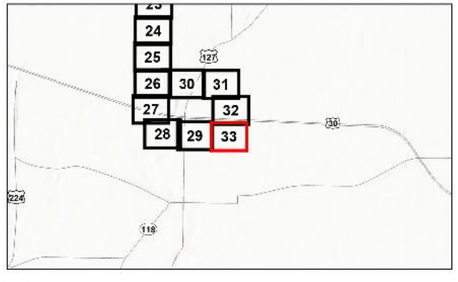

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, USFWS, FEMA, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

A.3 FIGURE 3 – HABITAT ASSESSMENT MAP

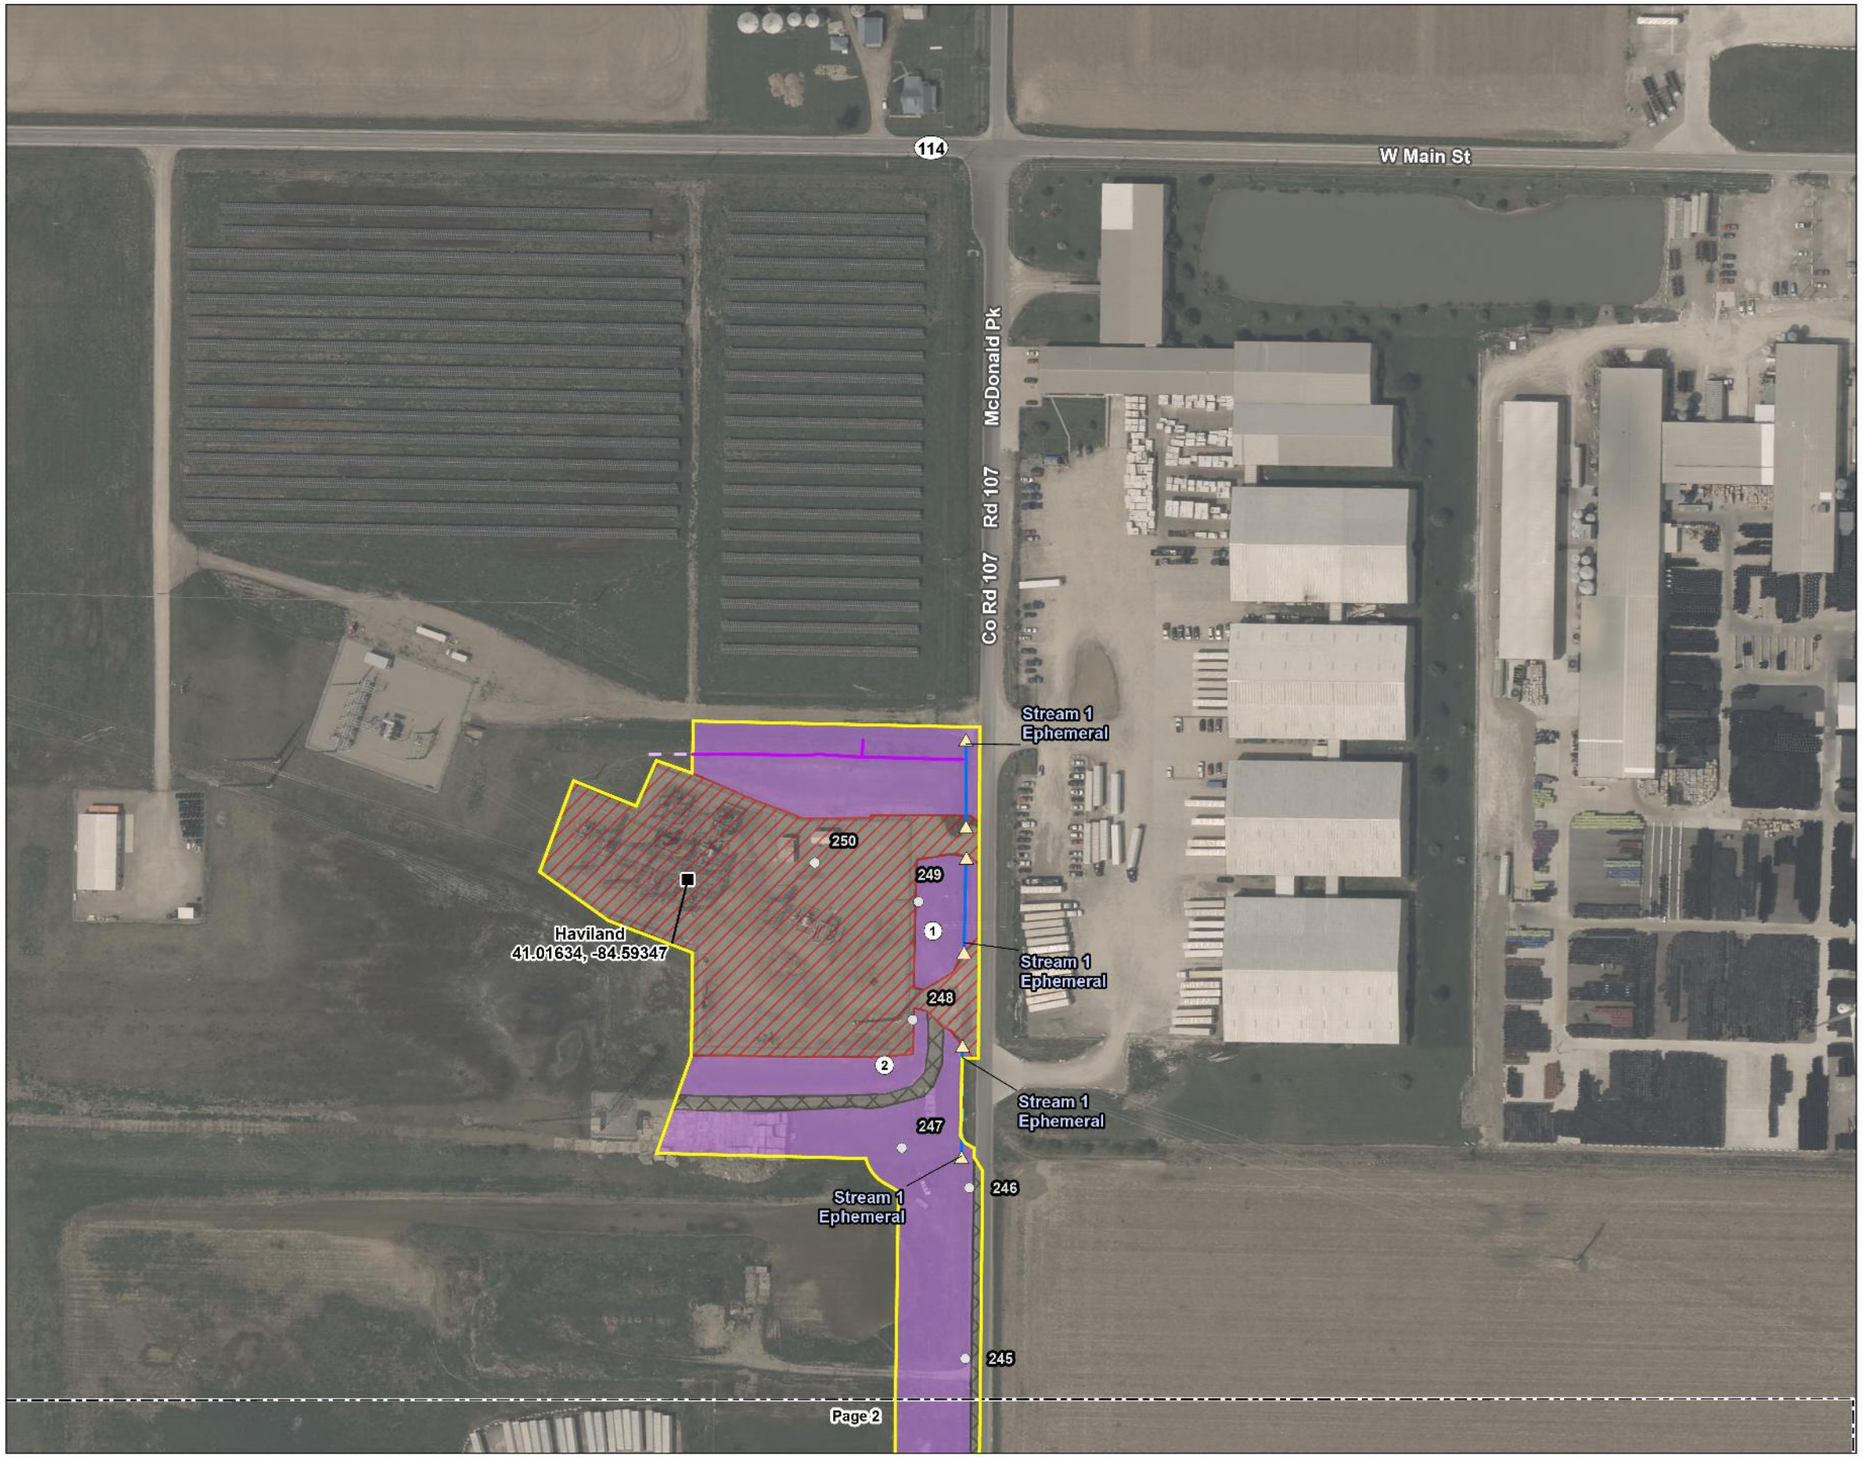

Figure No.
3

Title
Habitat Assessment Map

Client/Project
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

239000324

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

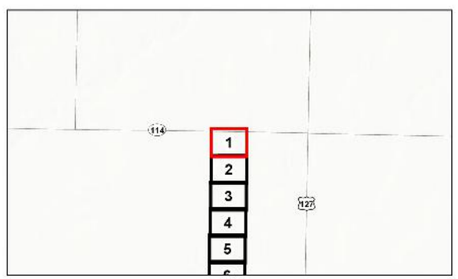

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxd\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

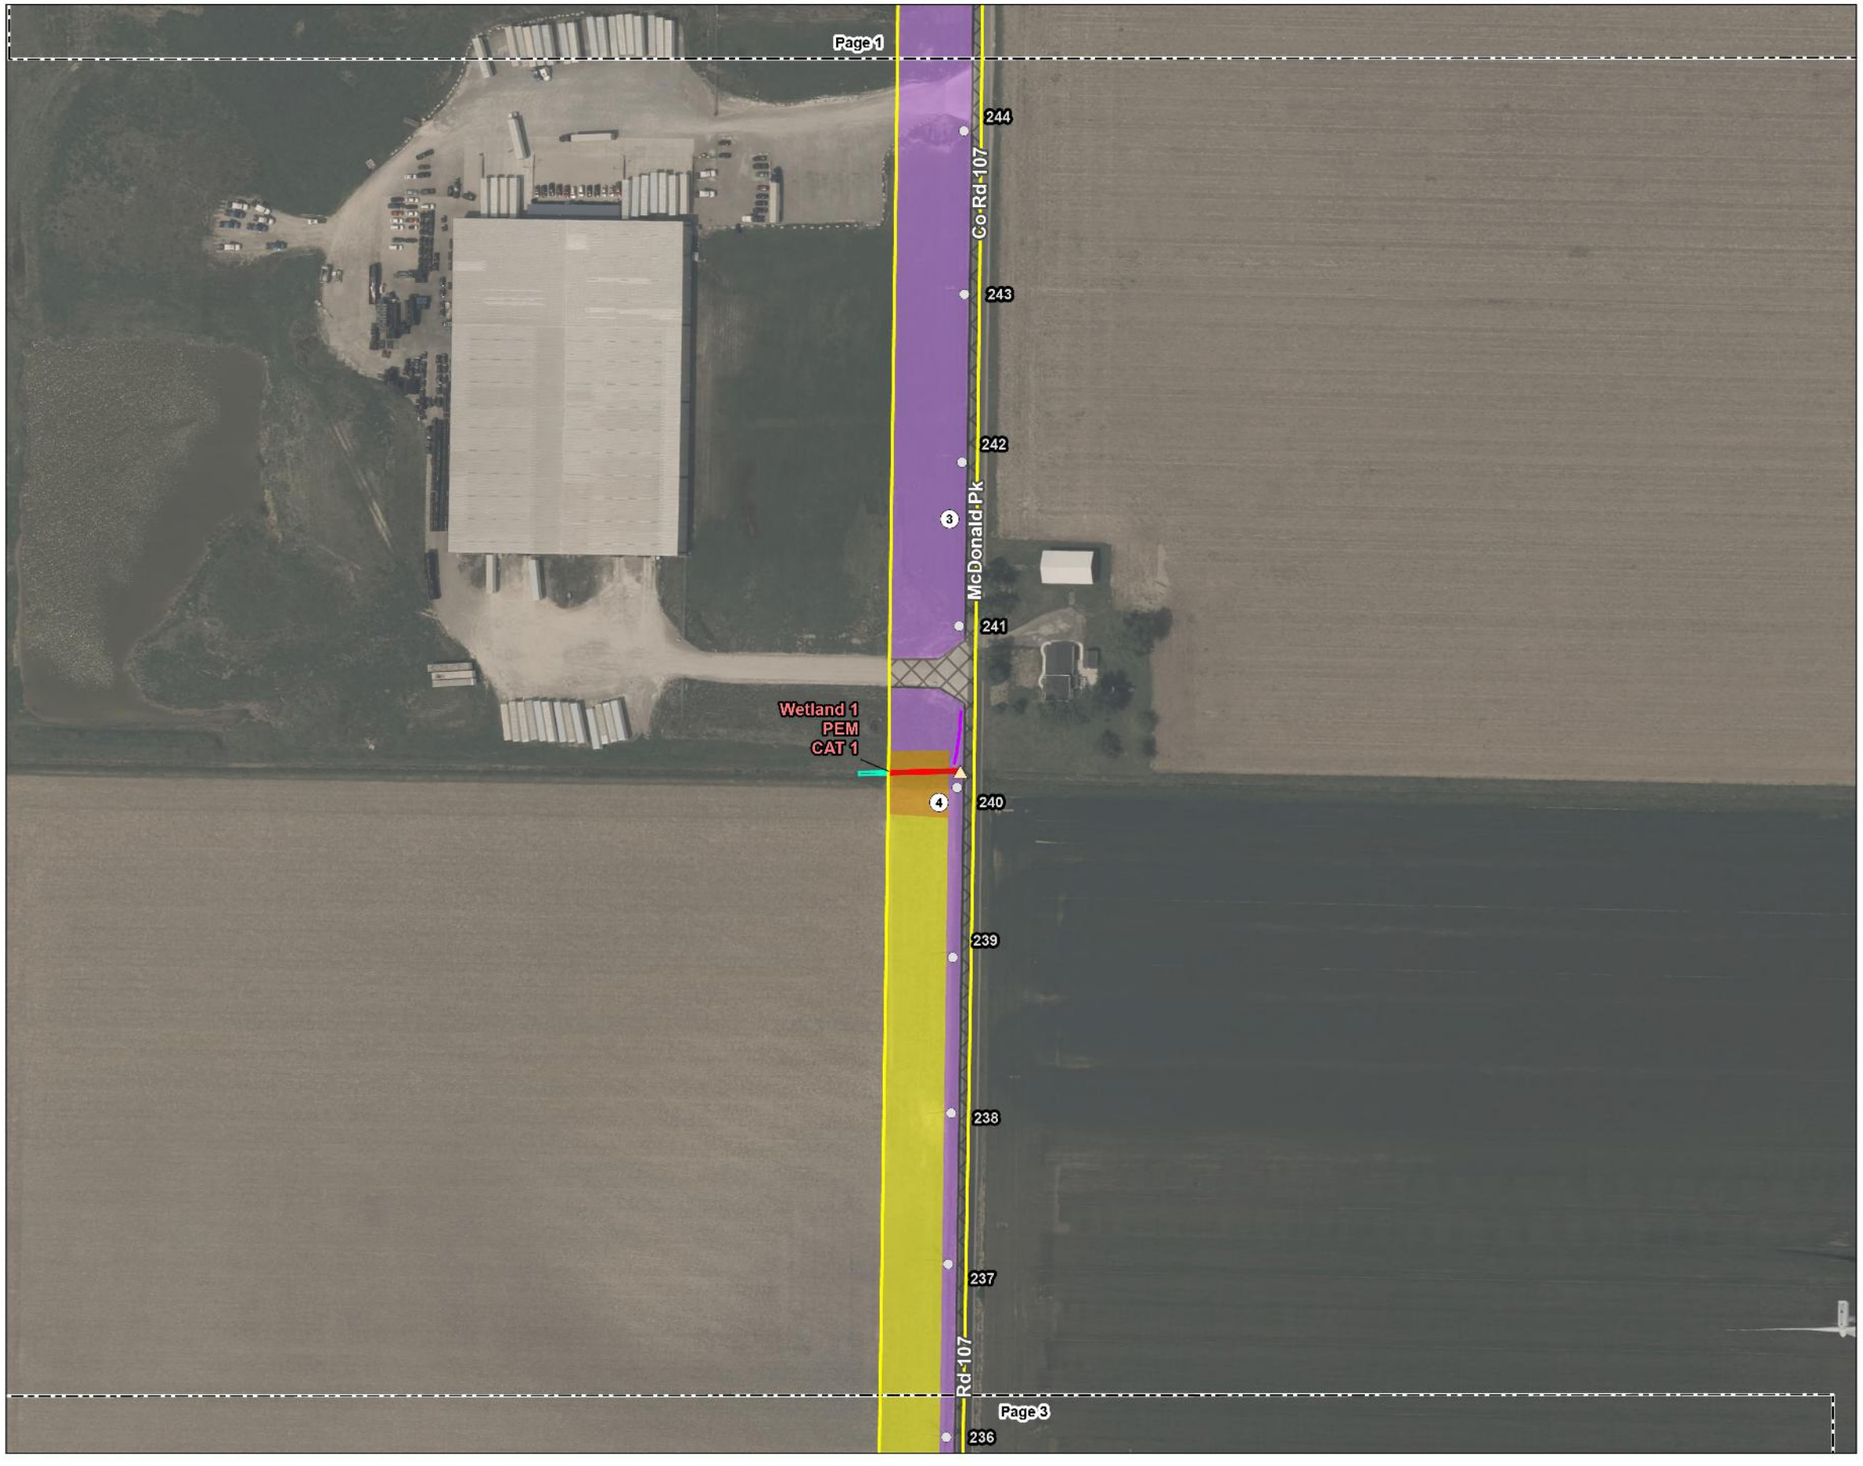

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

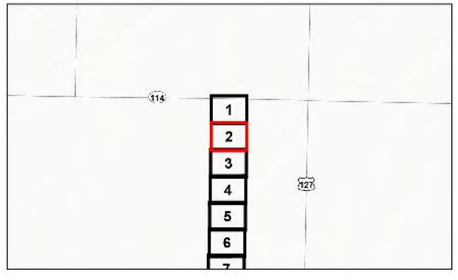

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

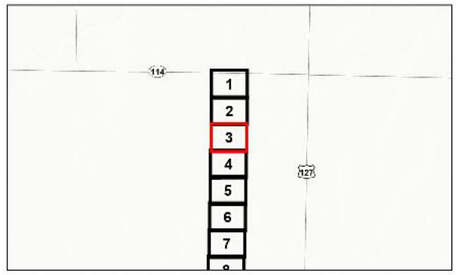

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

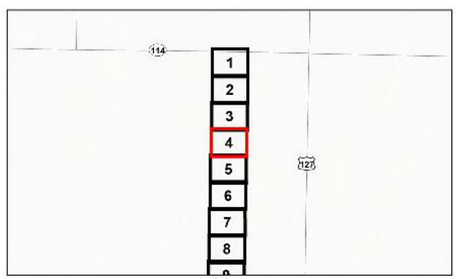

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_esri\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

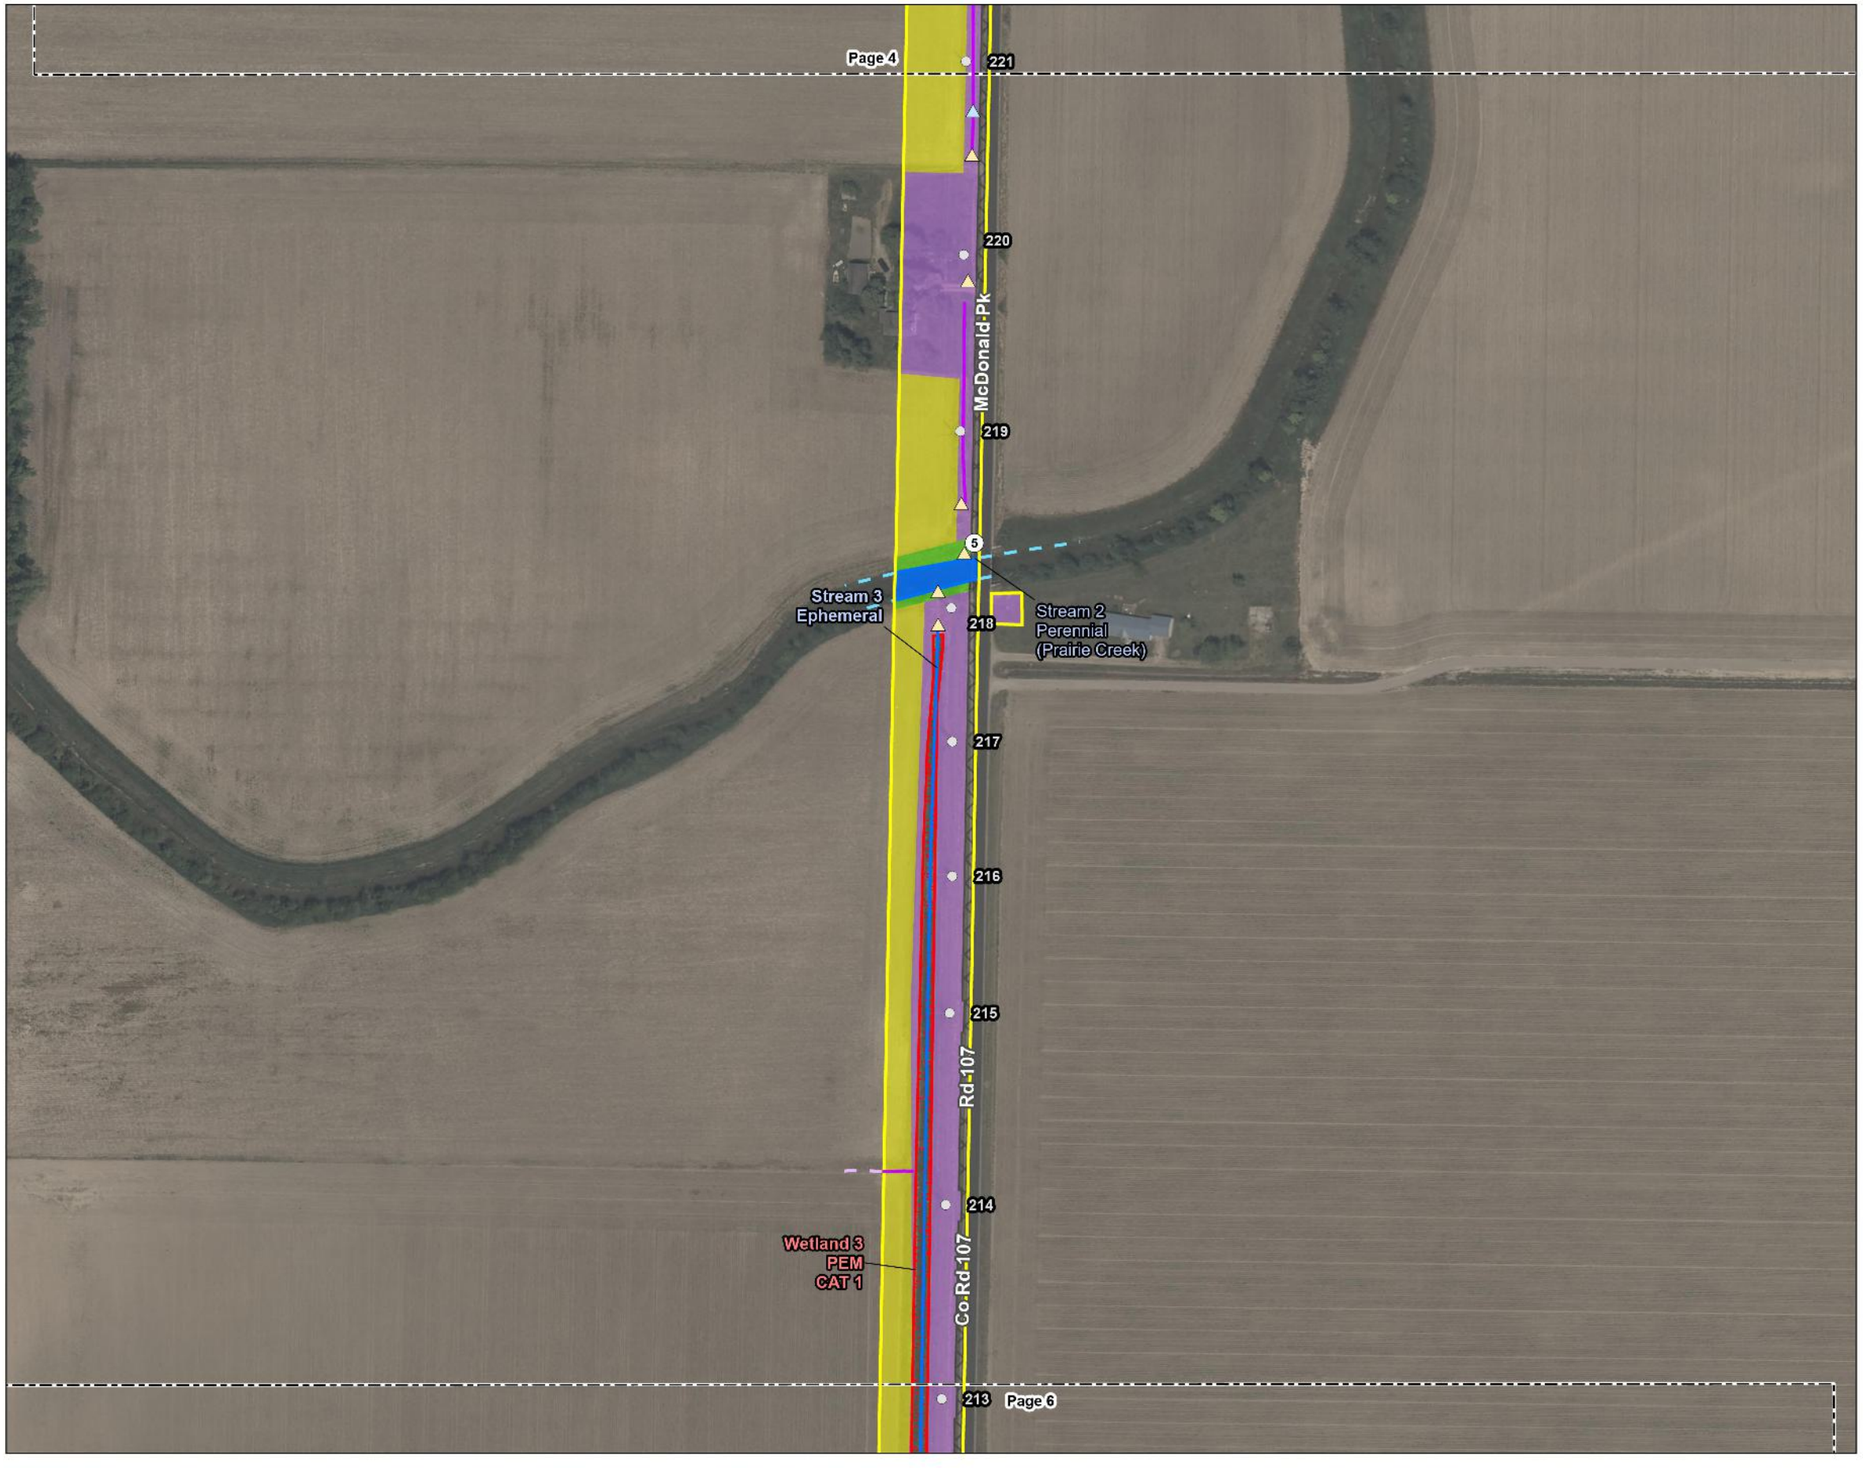

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

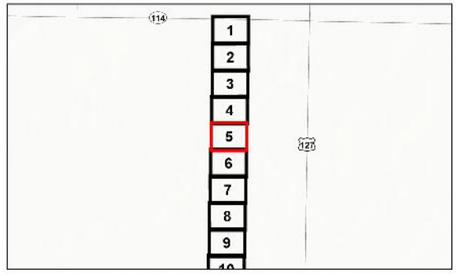

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

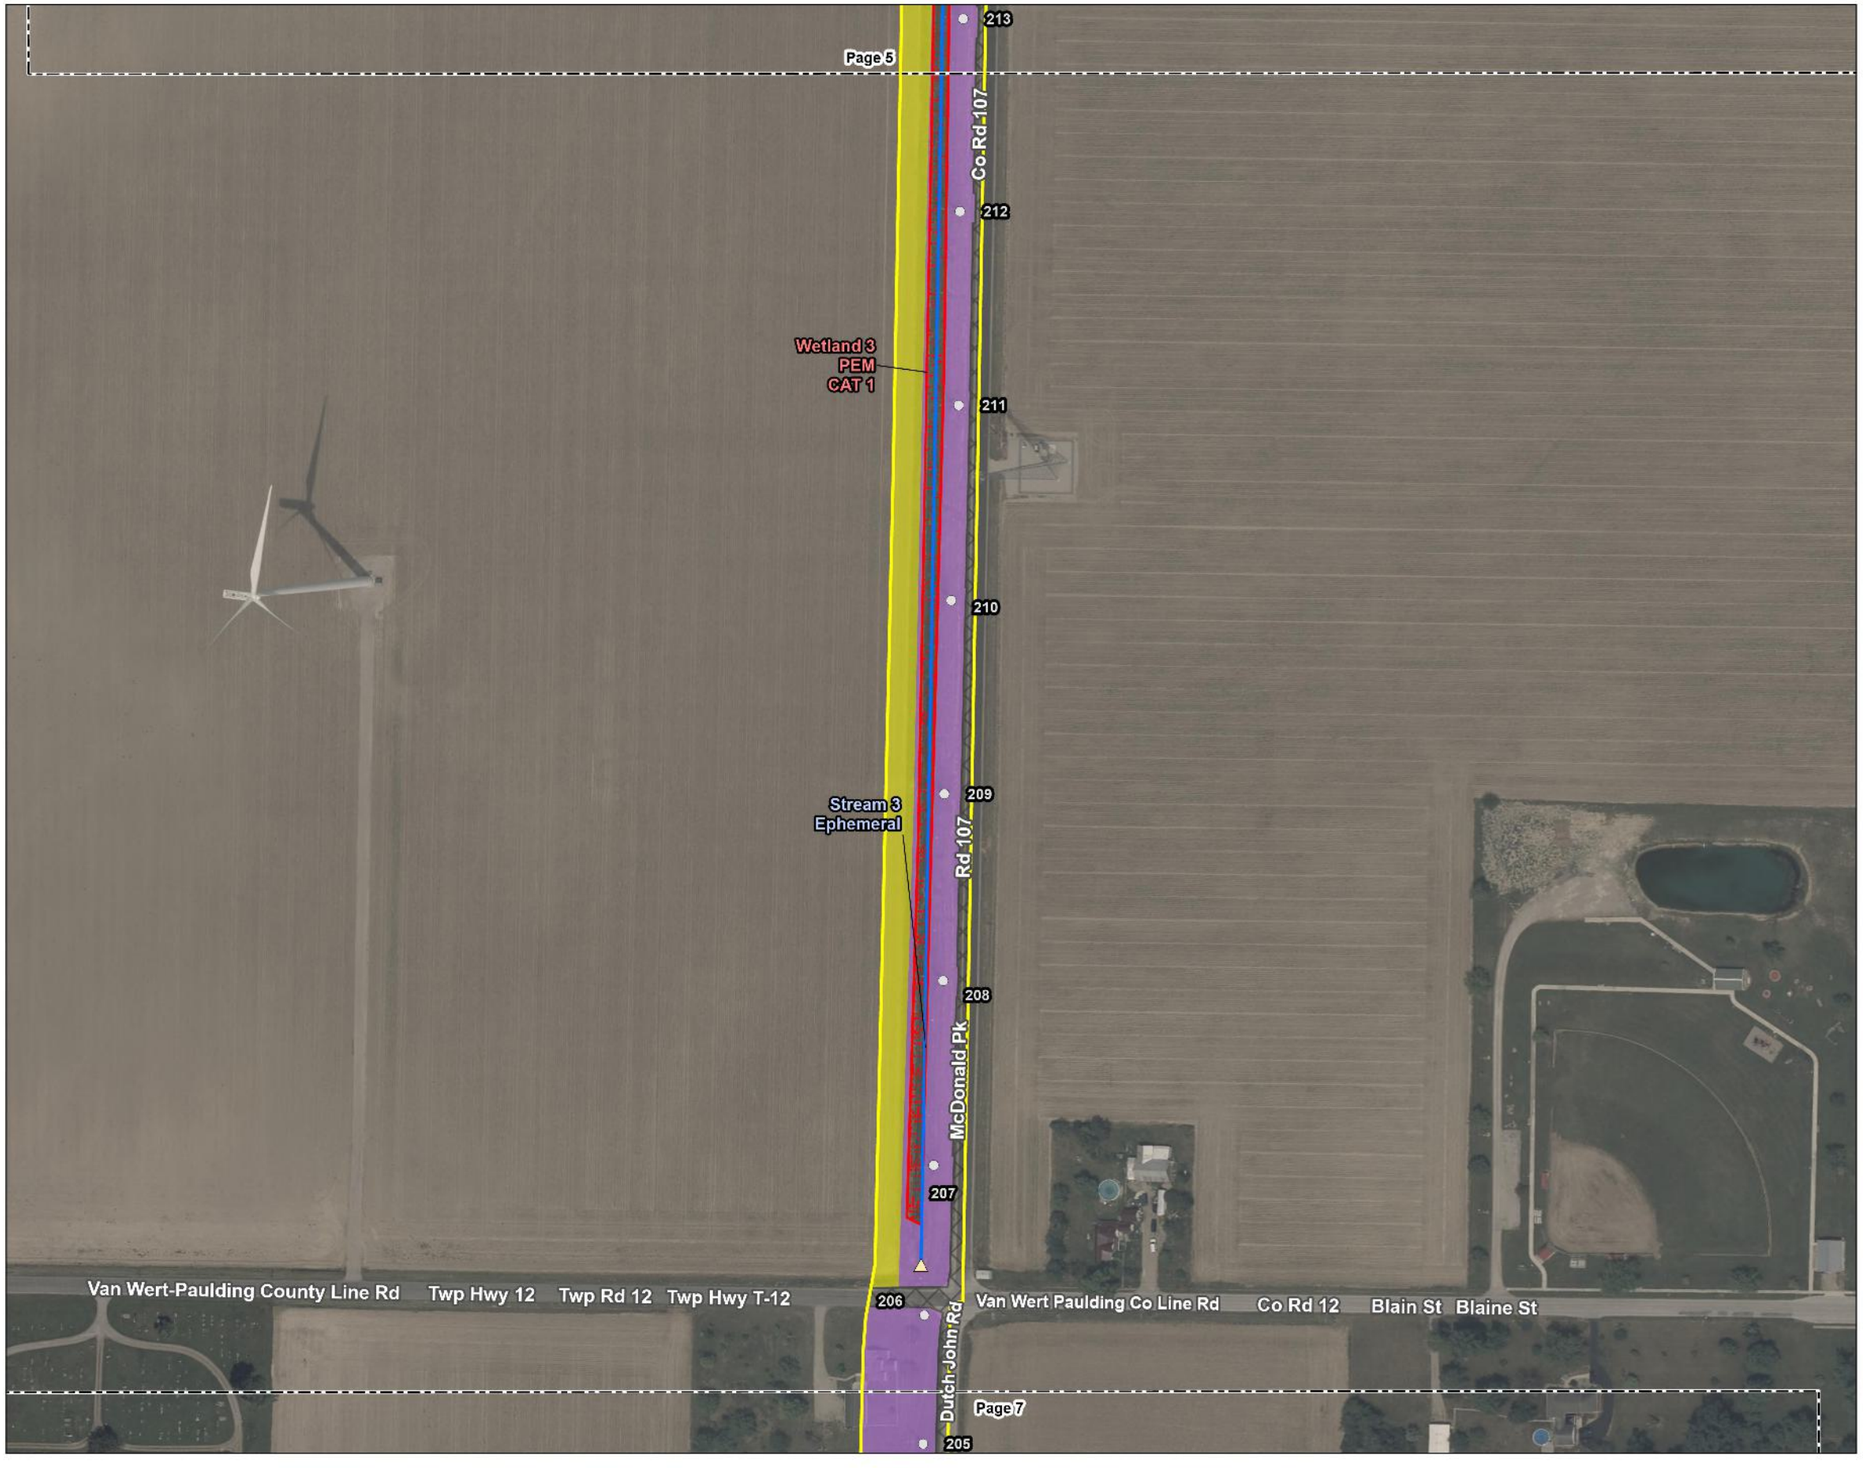

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

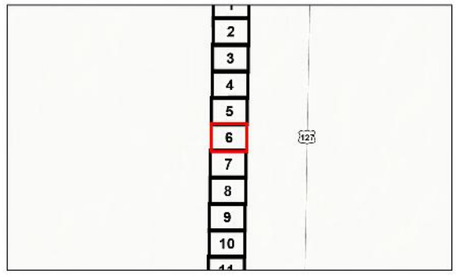

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

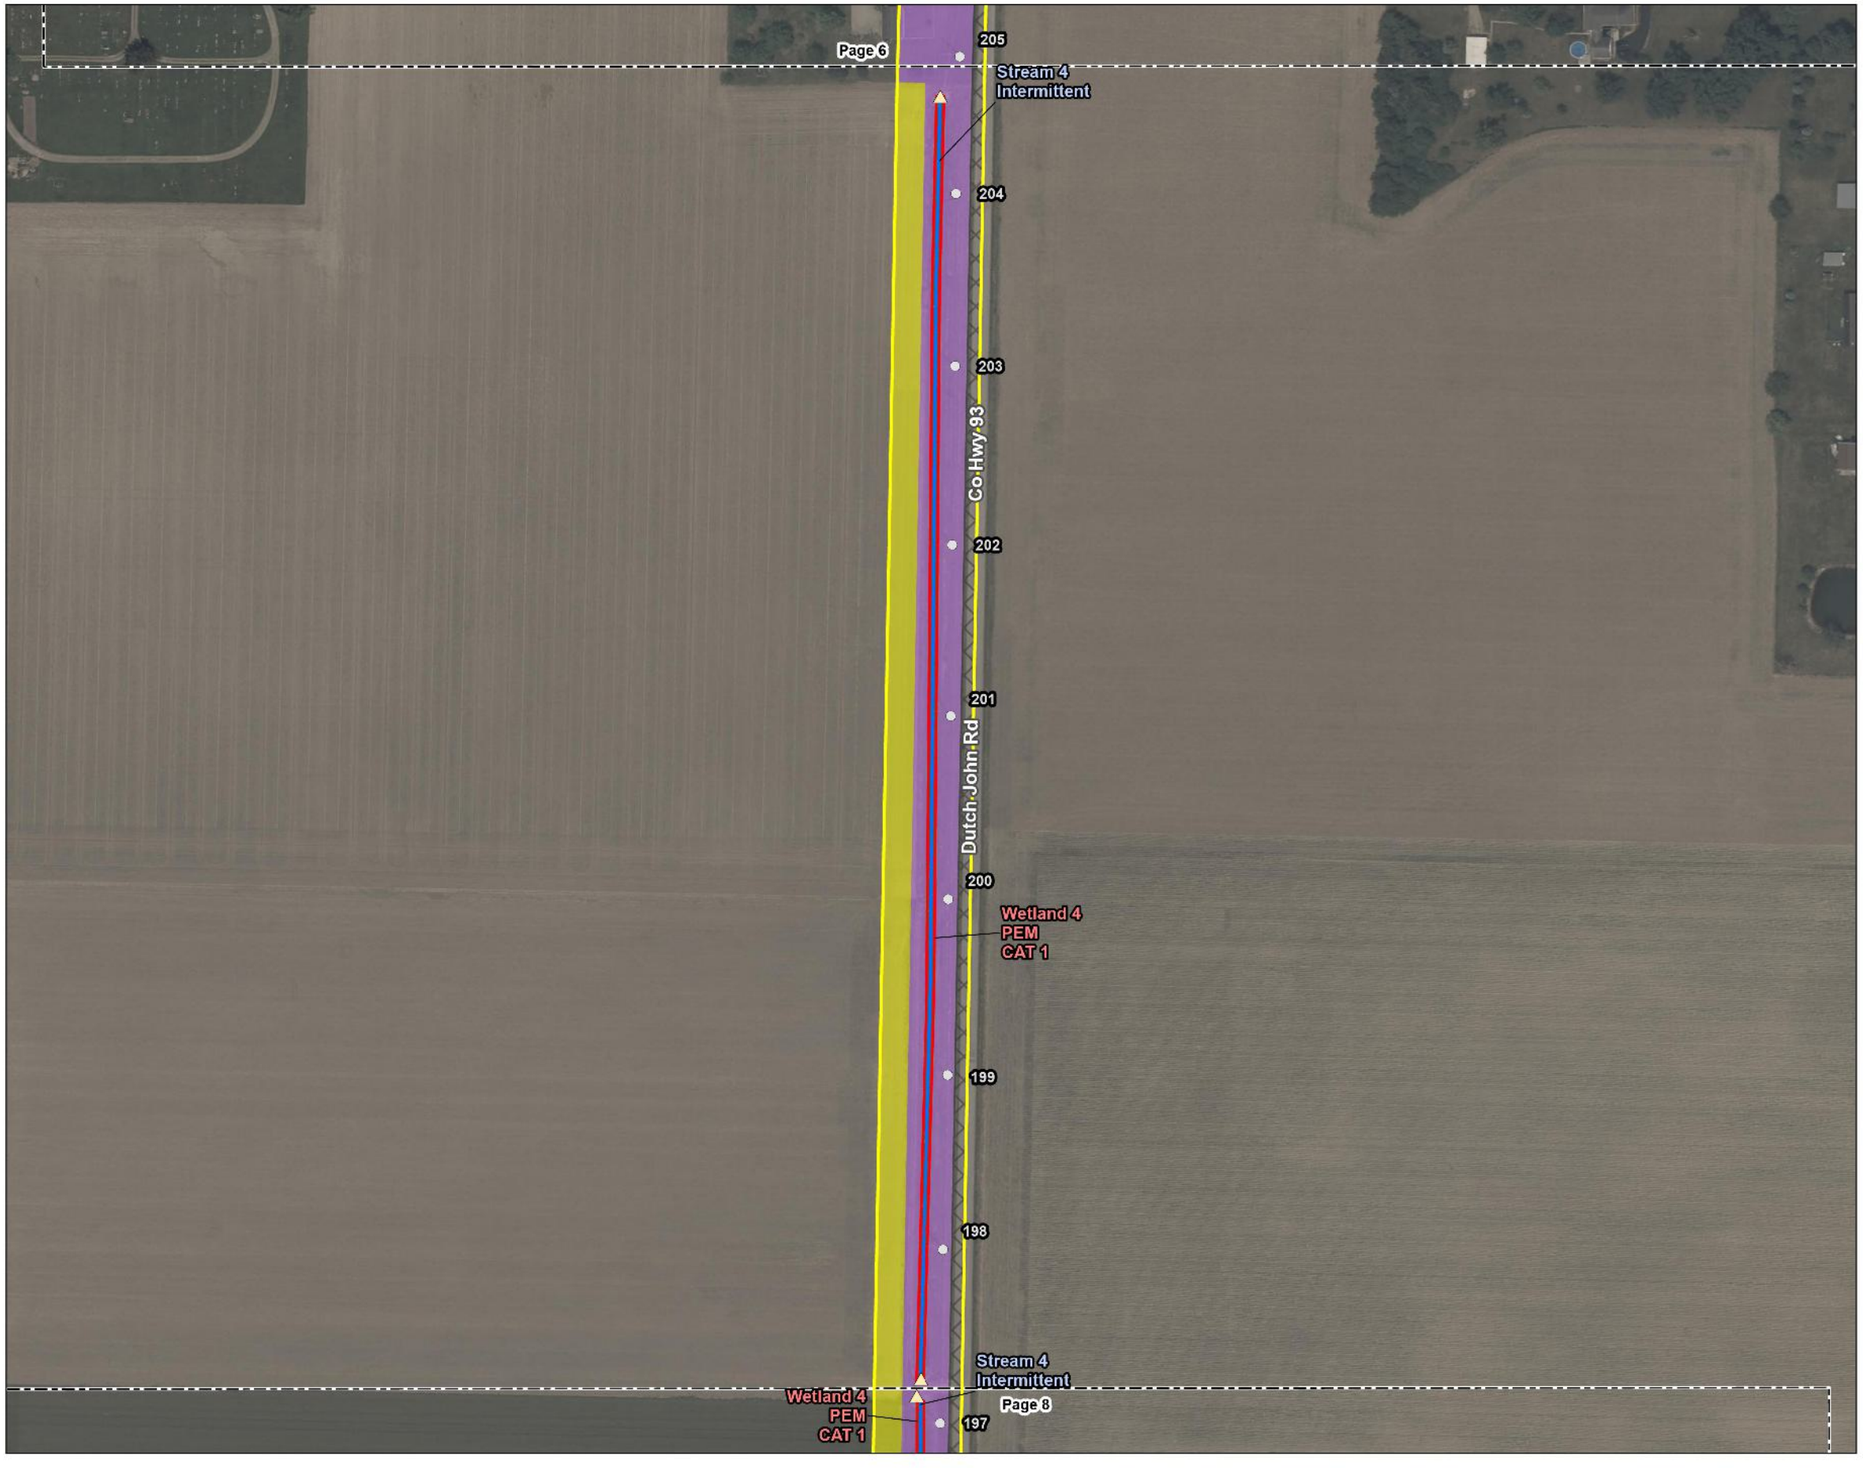

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

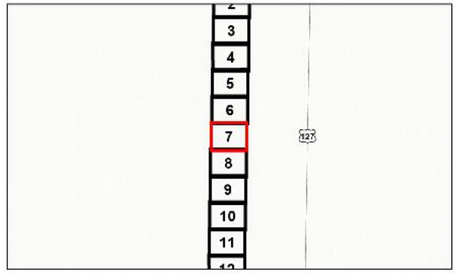

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

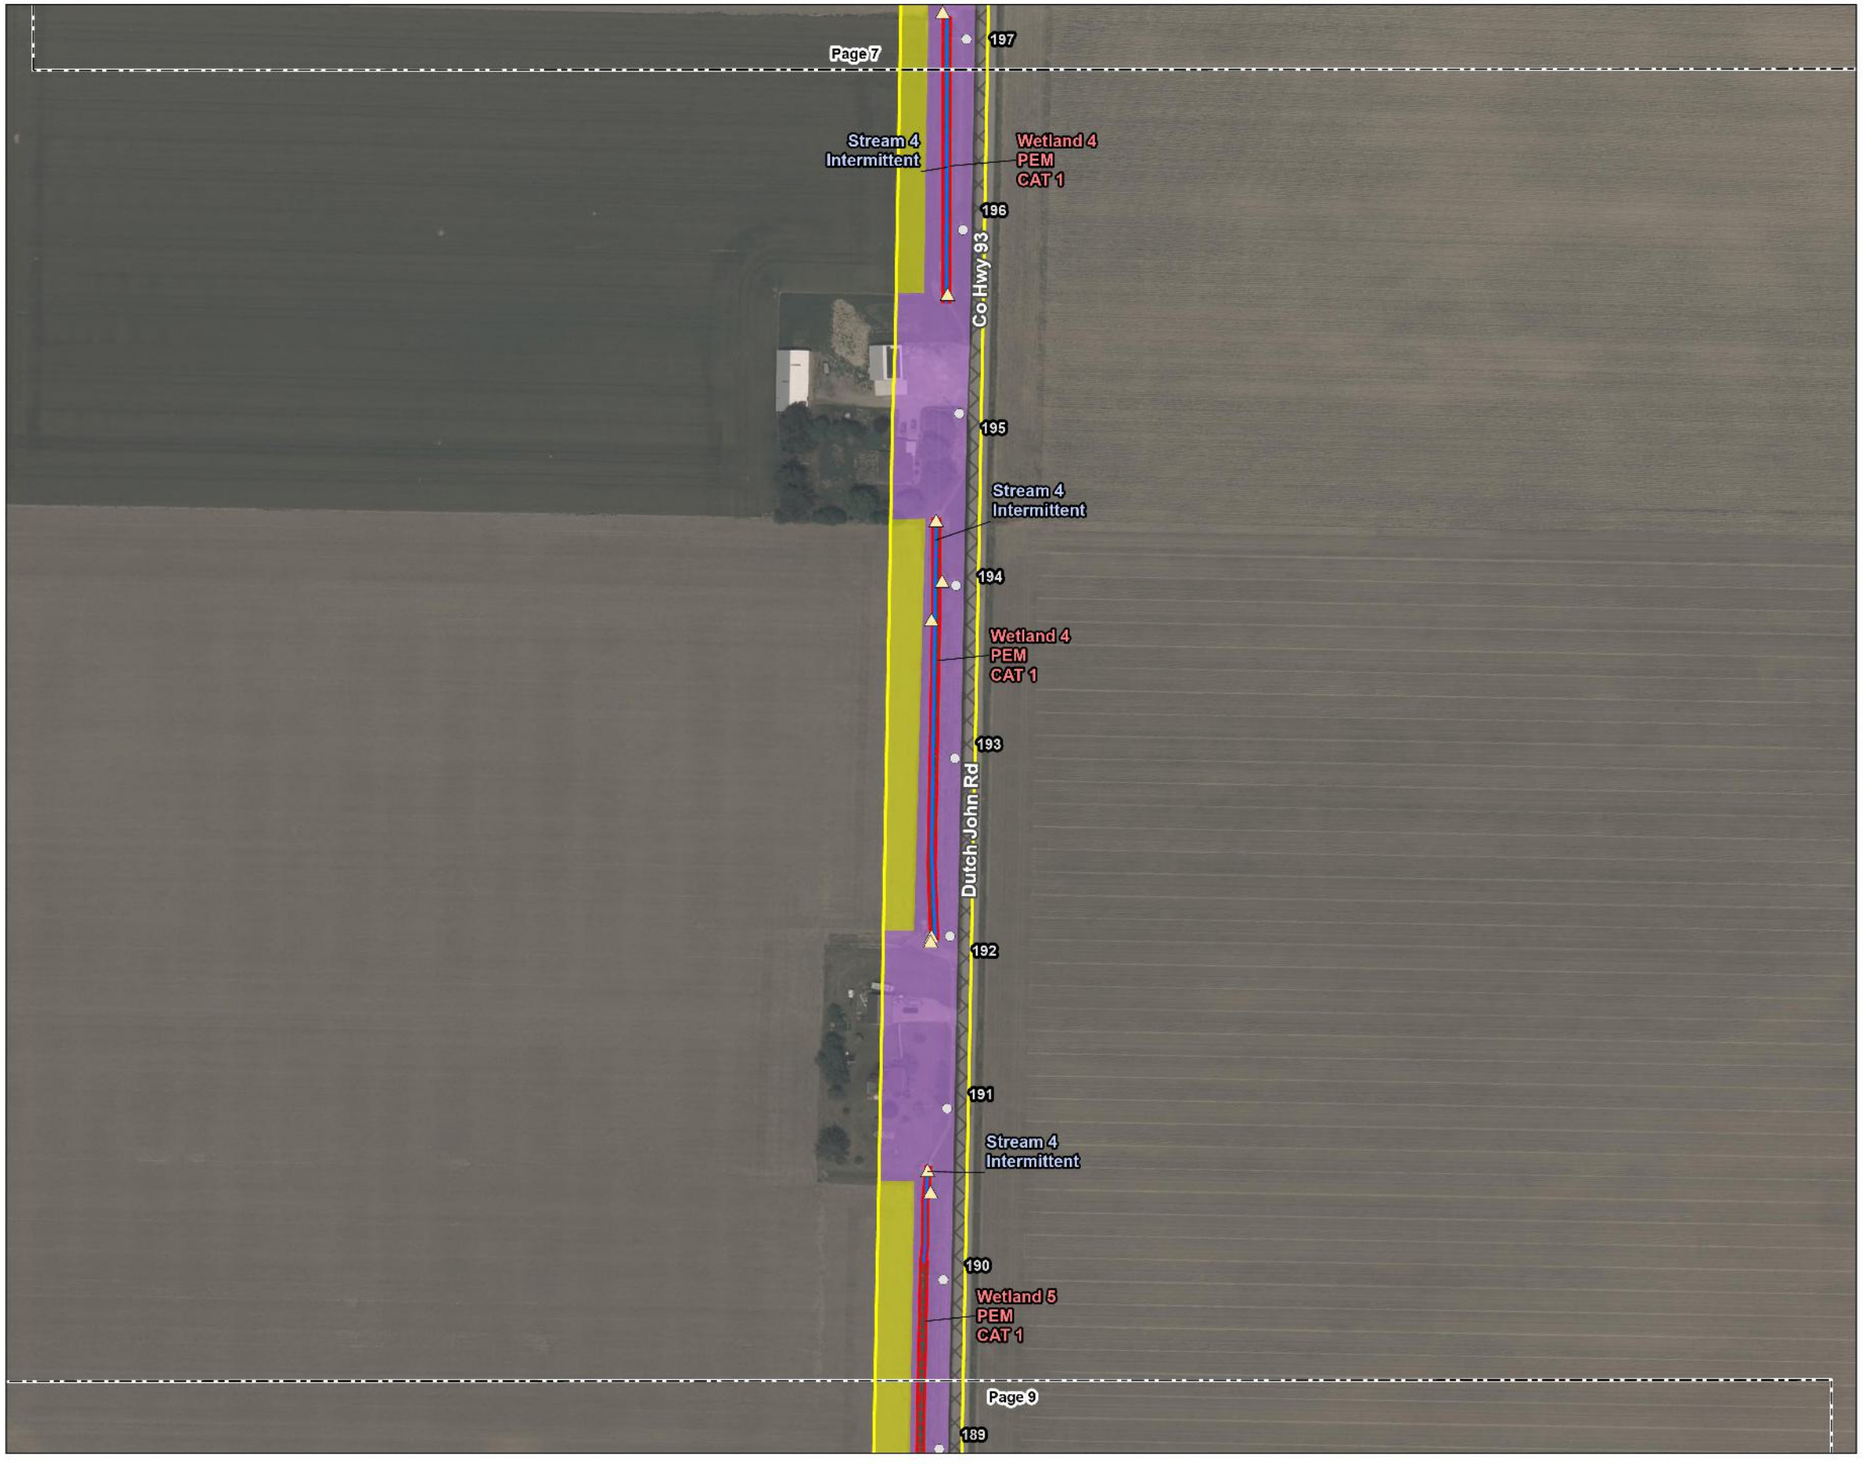

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

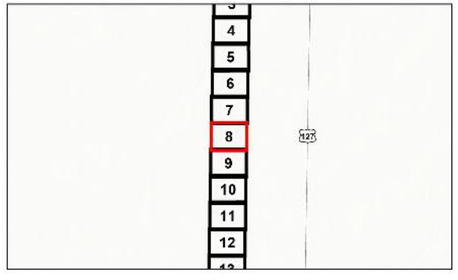

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert Paulding\03 data\gis_cad\gis\mxd\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

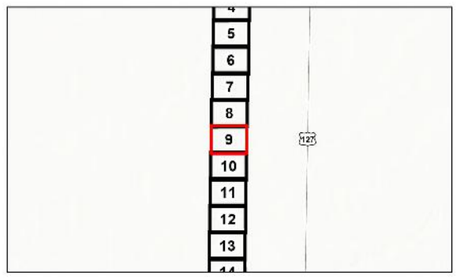

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

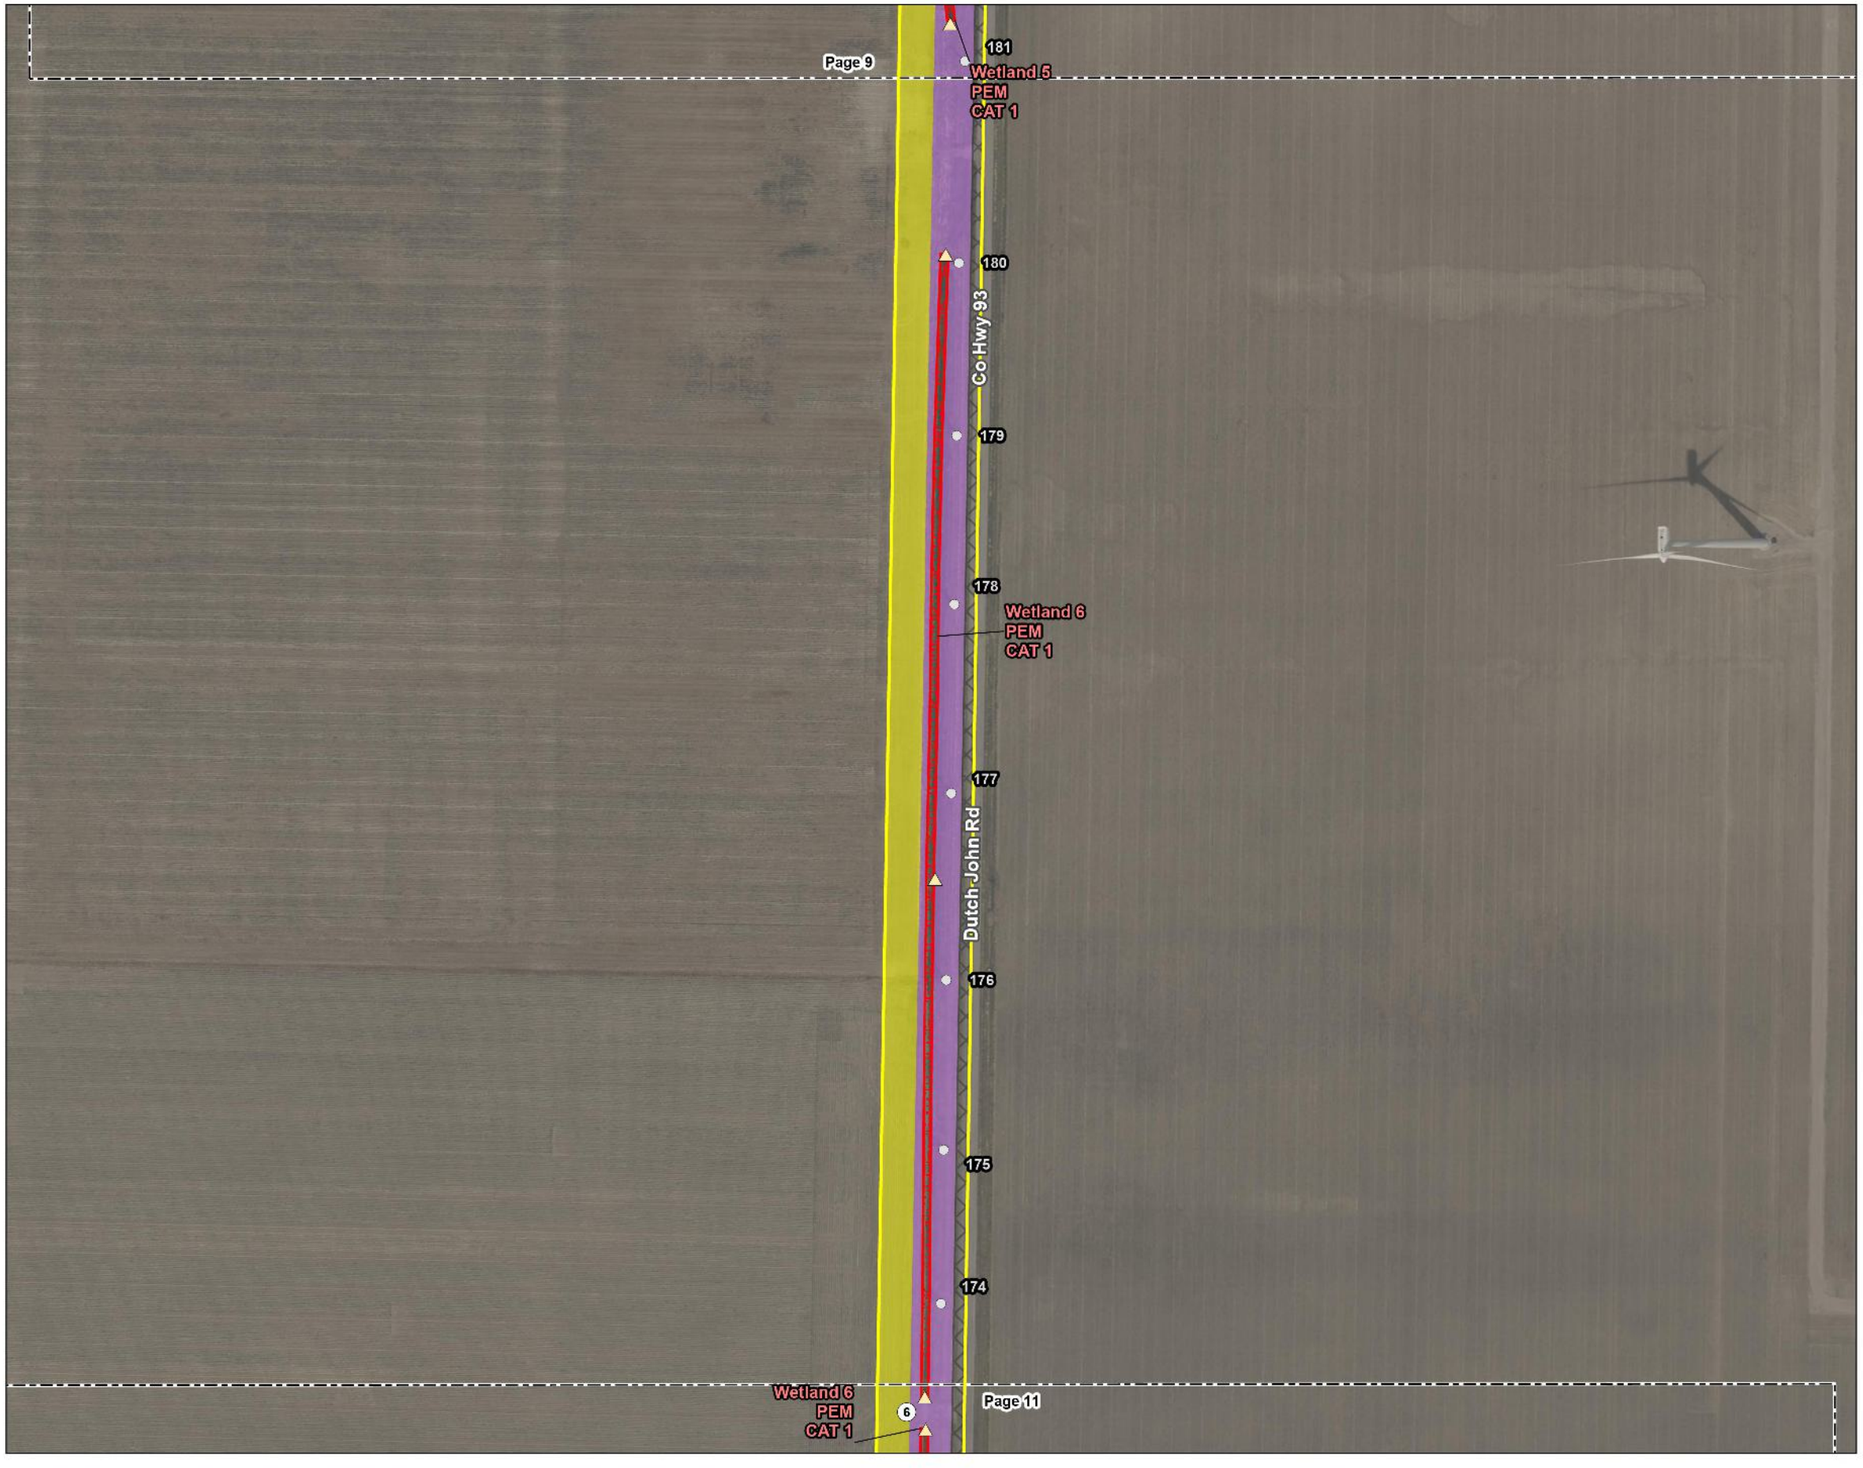

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

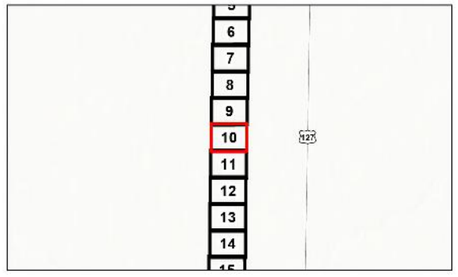

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

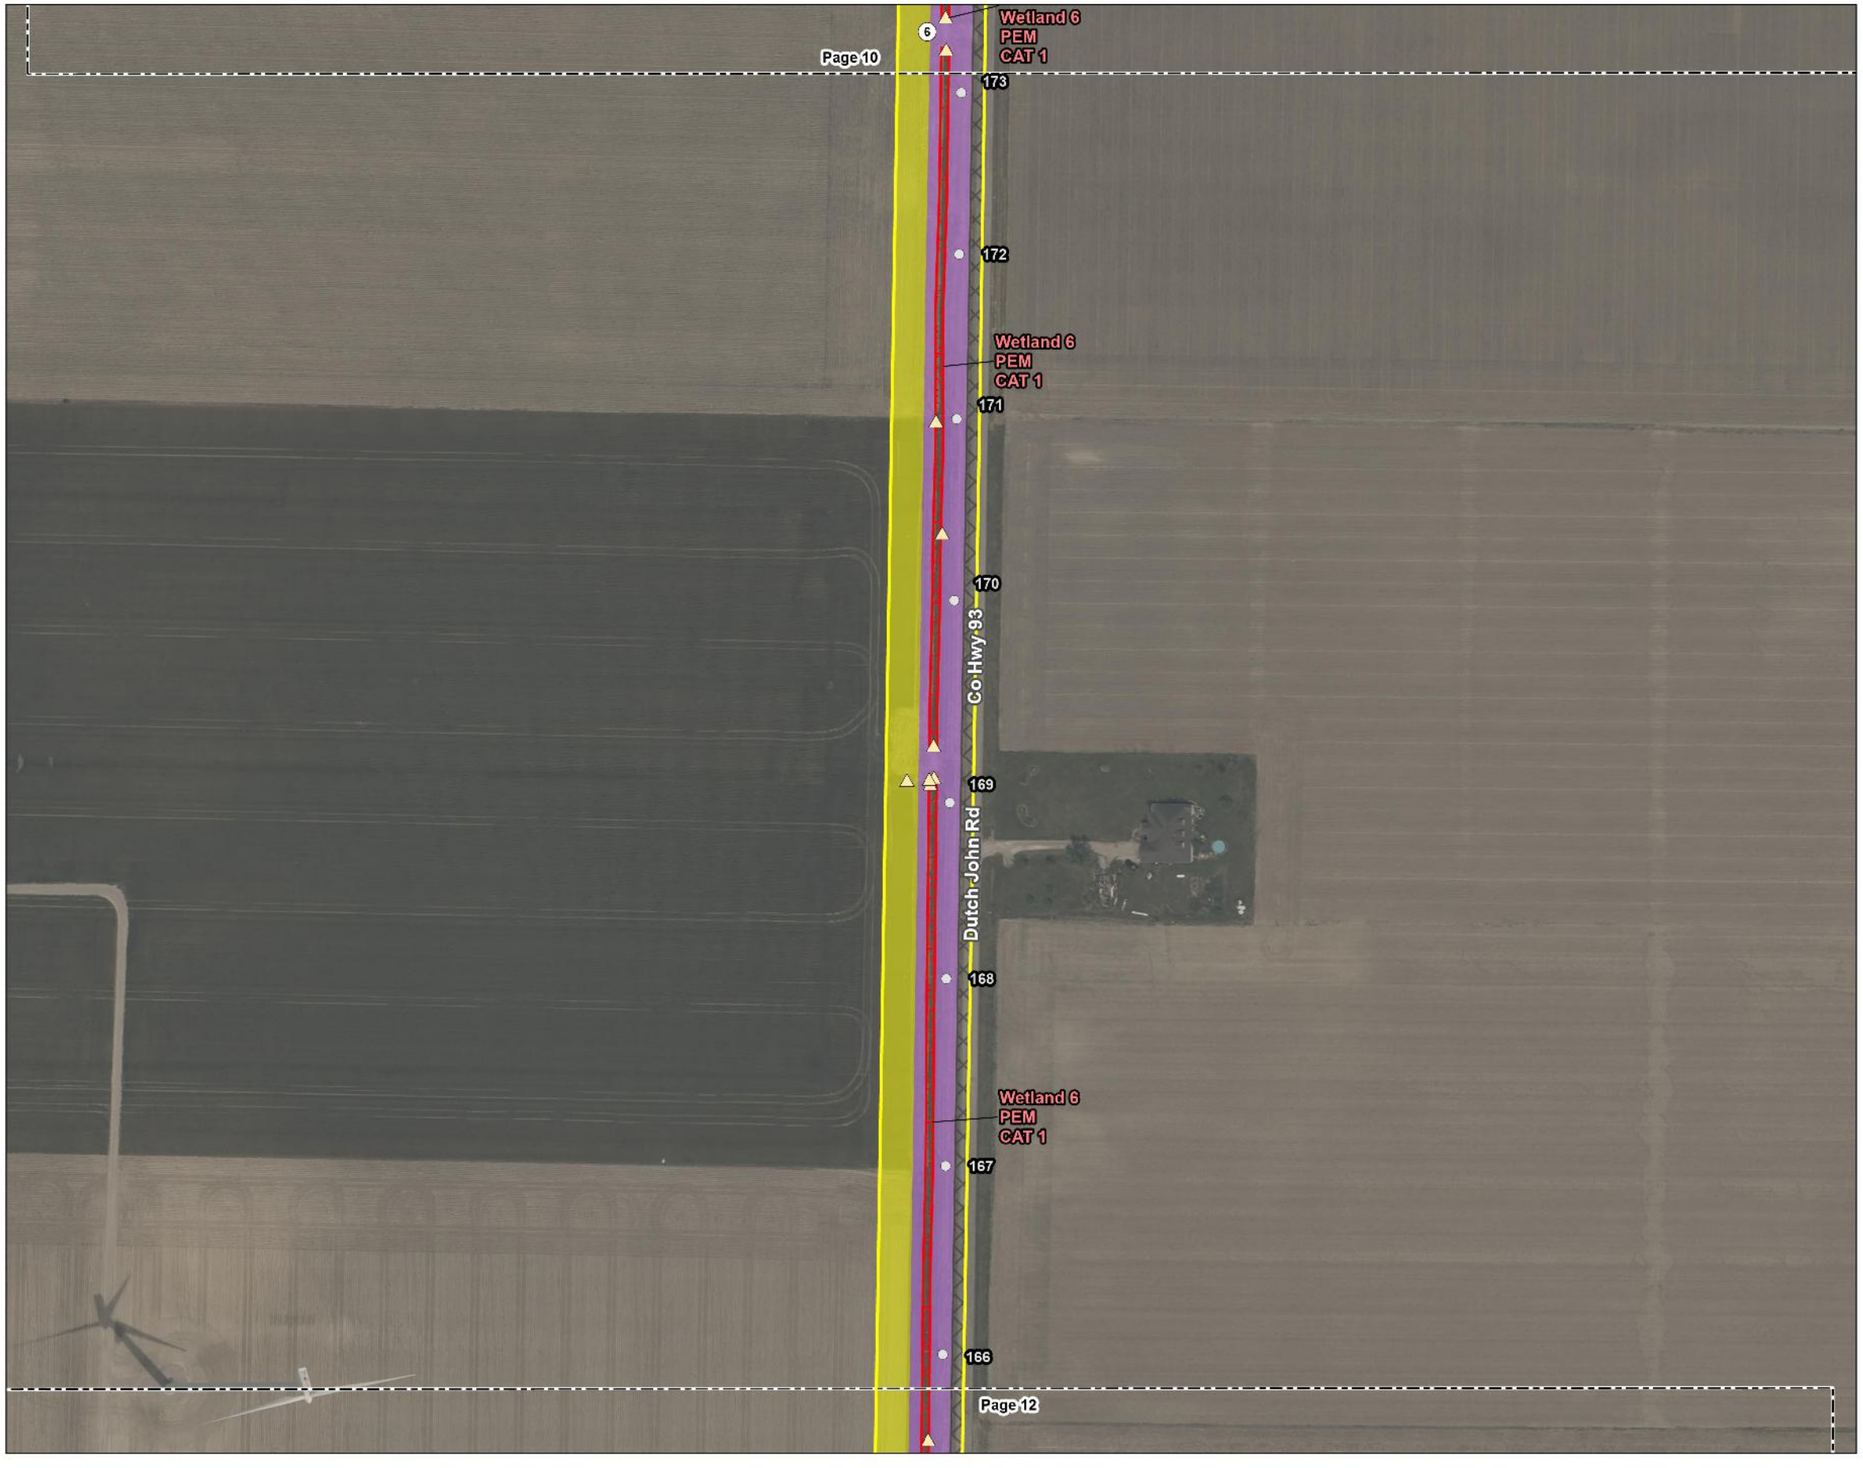

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

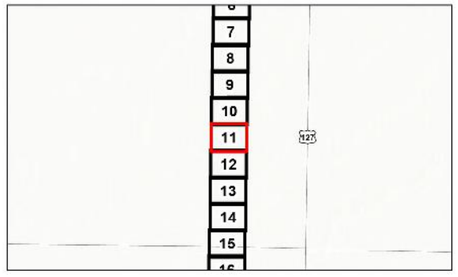

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

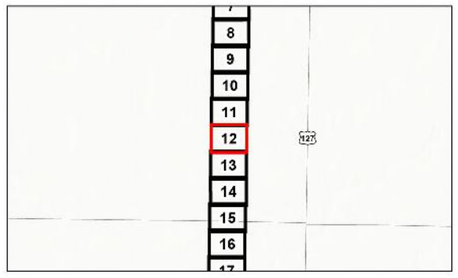

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

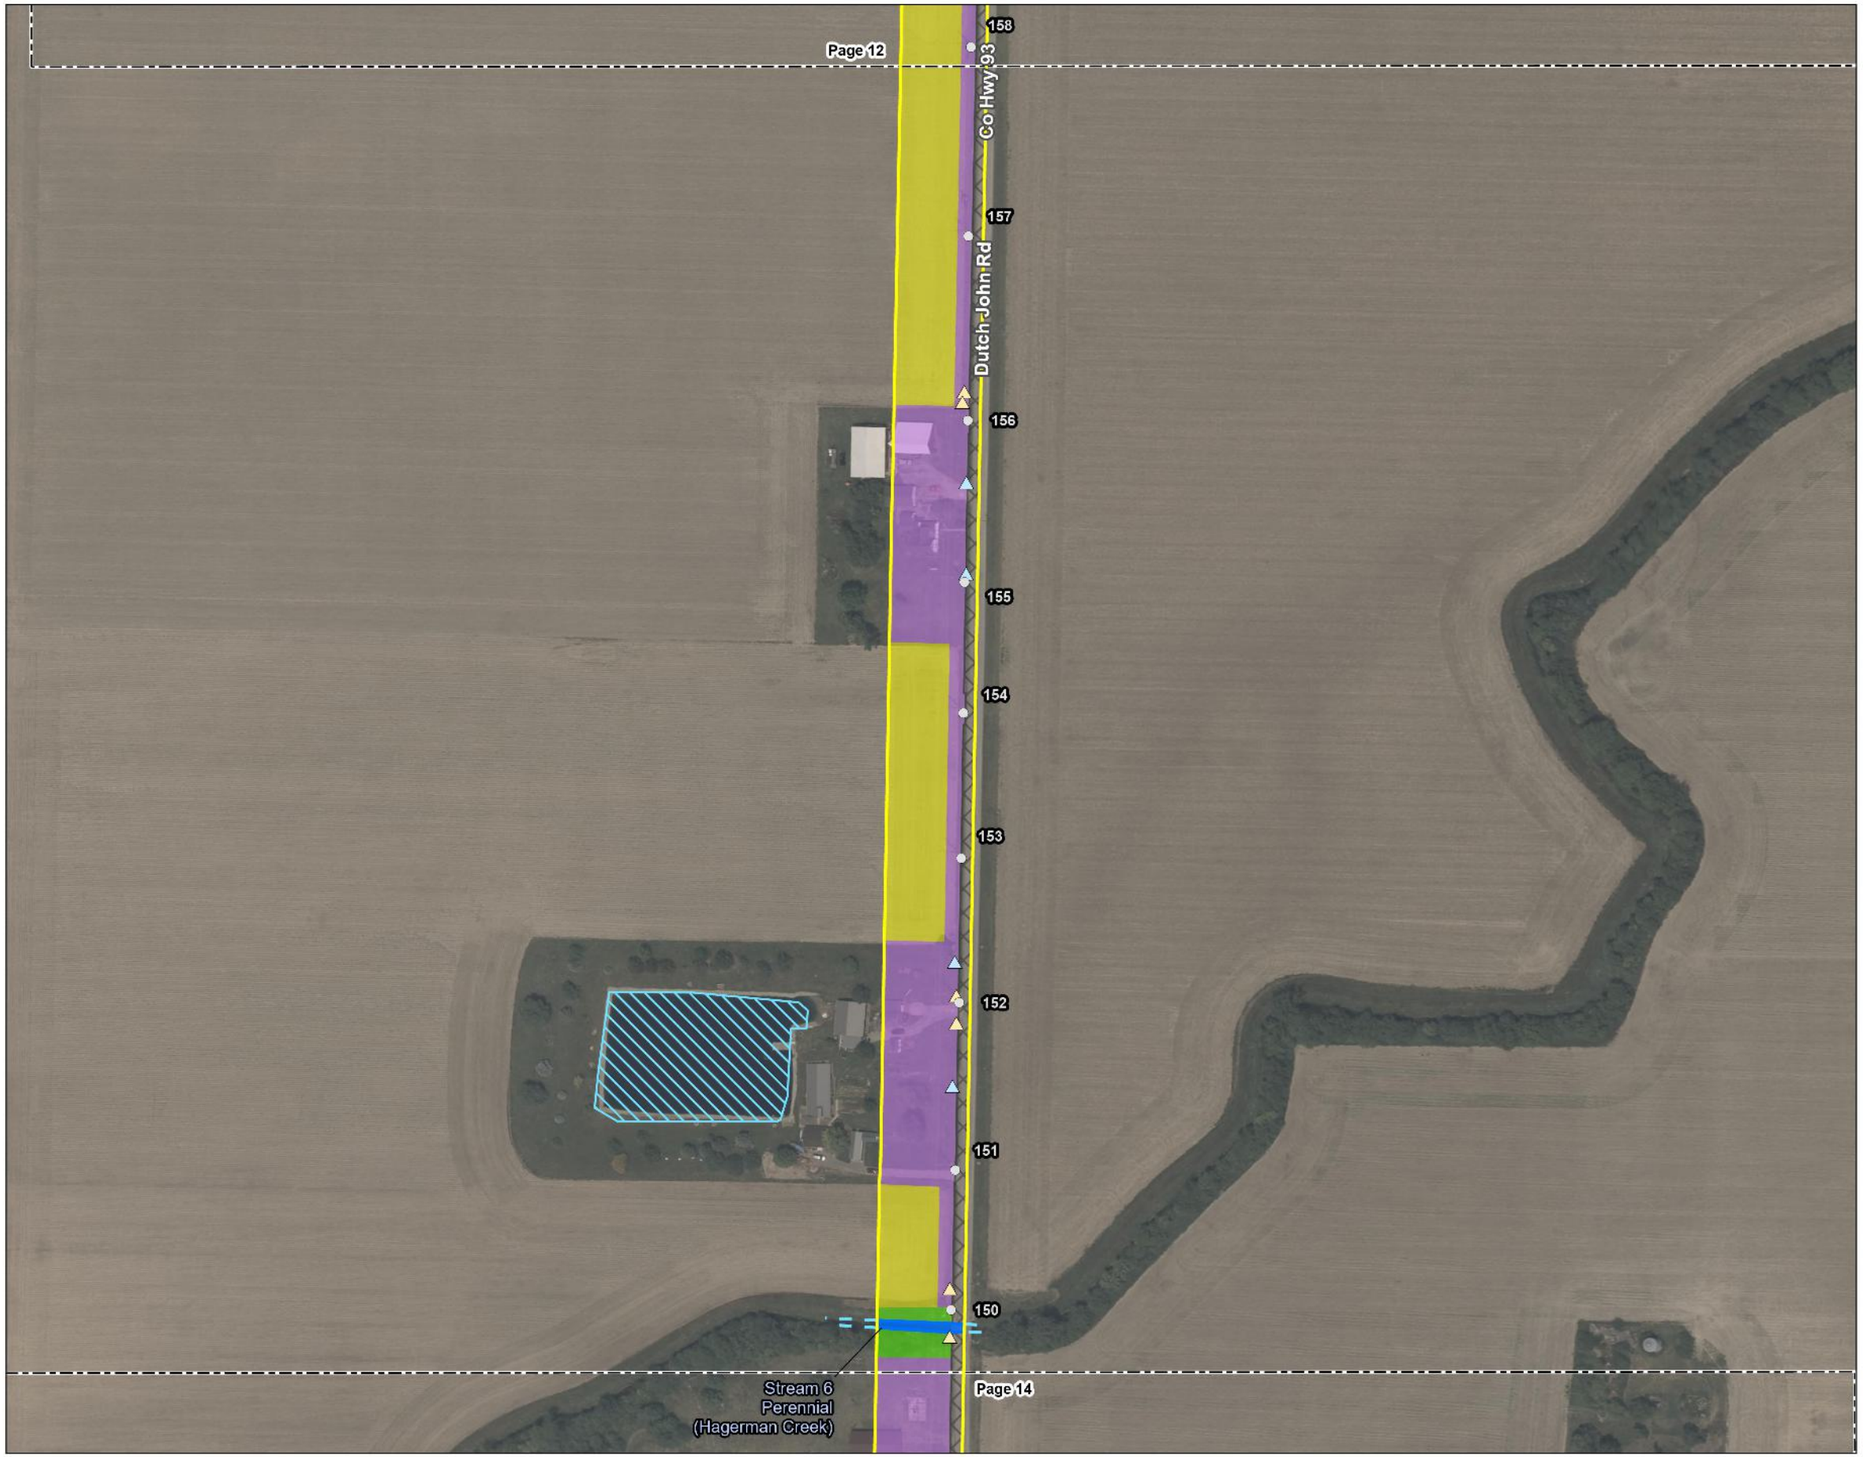

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

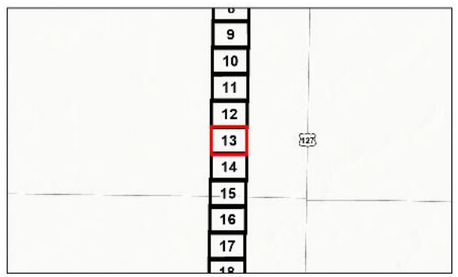

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

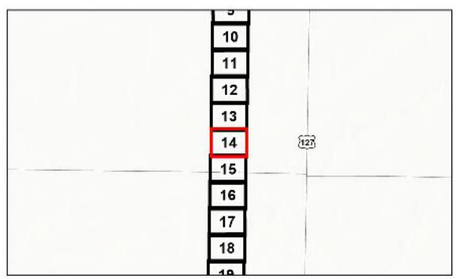

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

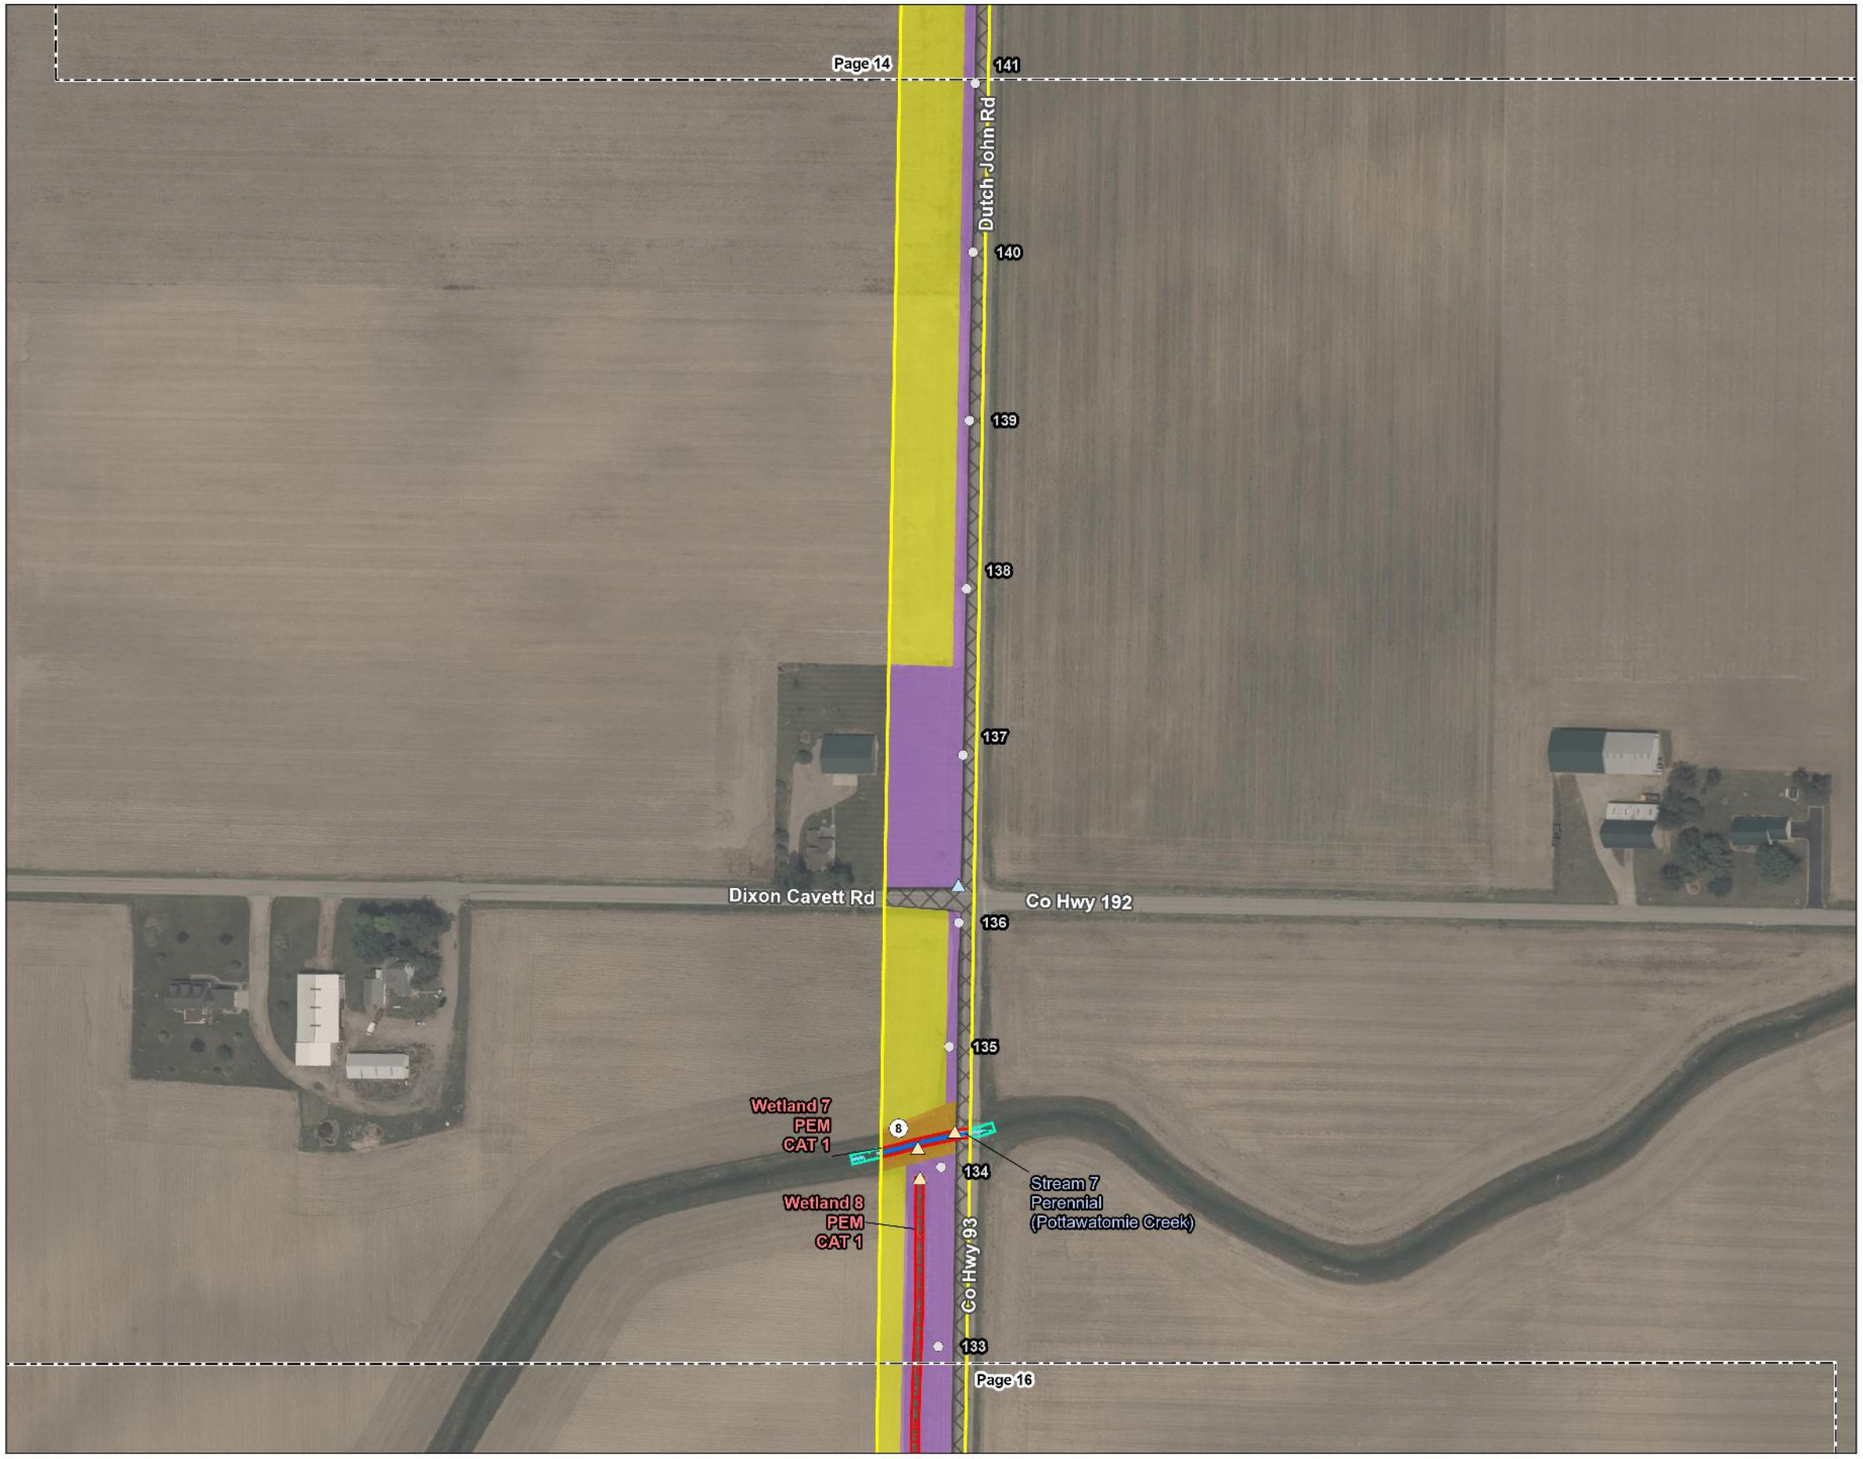

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

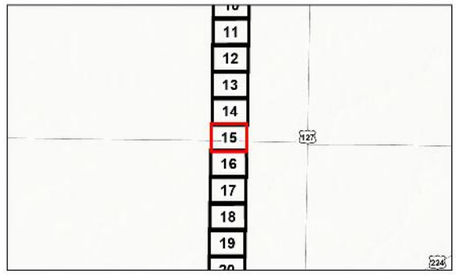

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

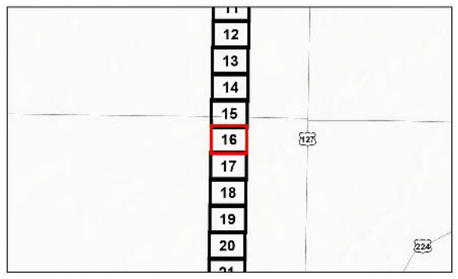

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

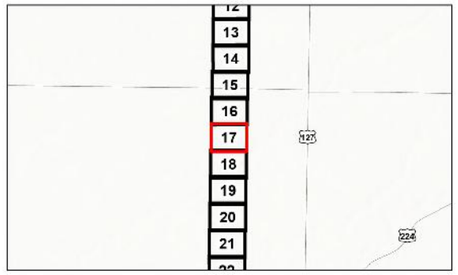

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

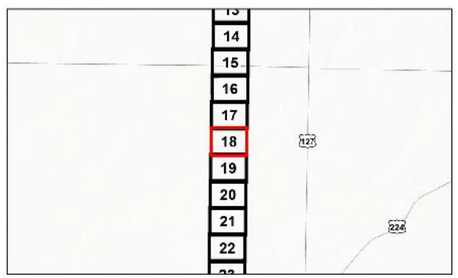

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert Paulding\03 data\gis ea\gis\mxd\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

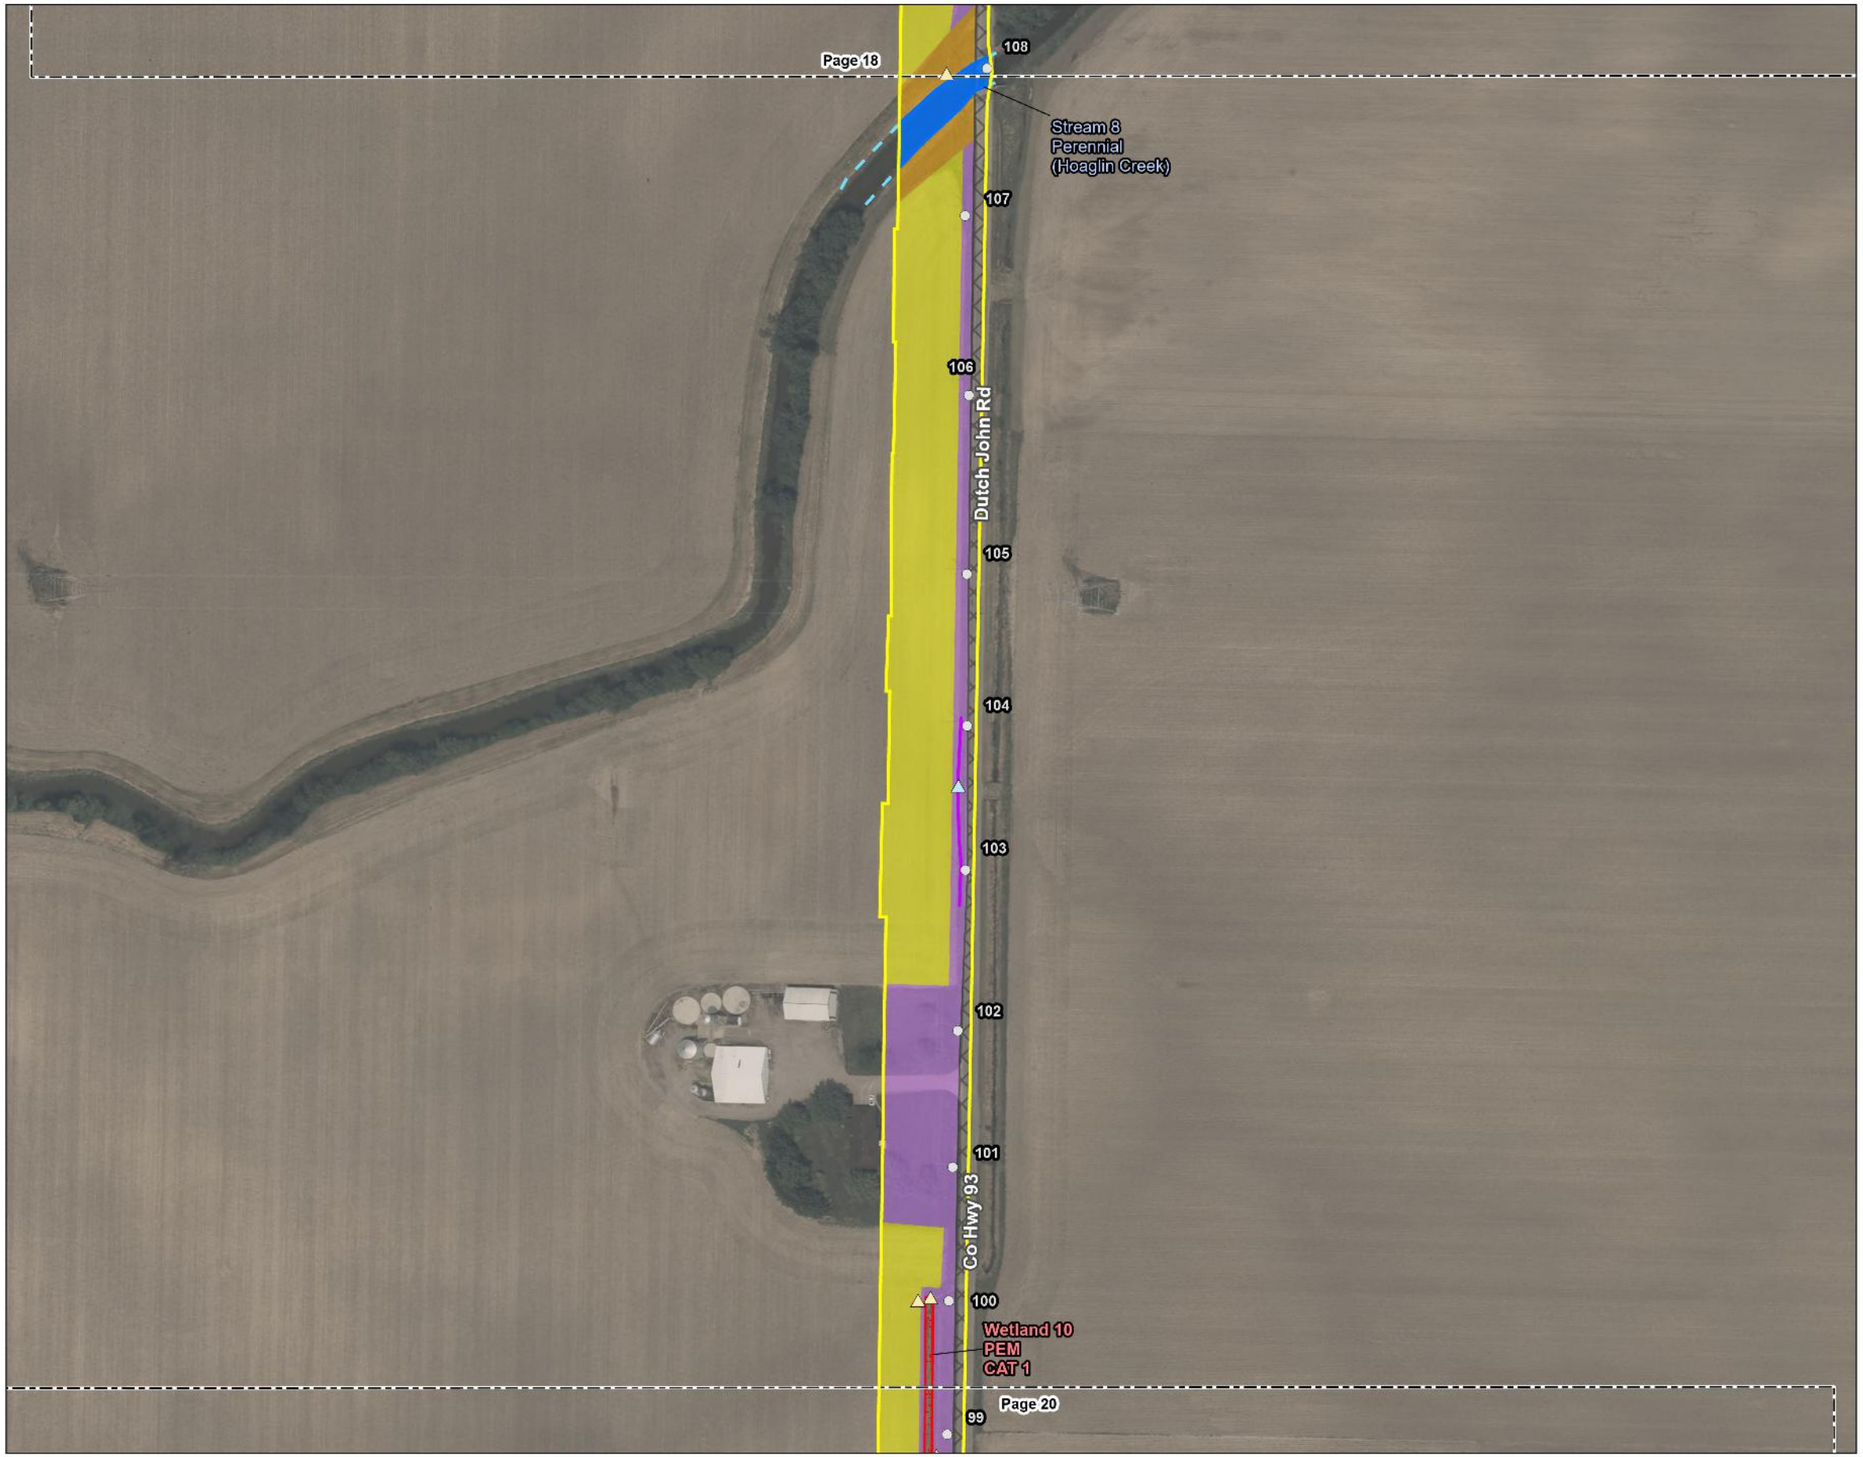

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

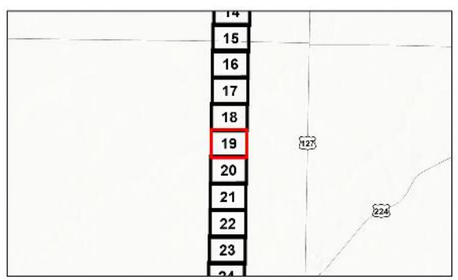

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

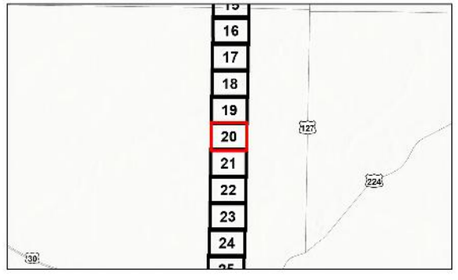

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

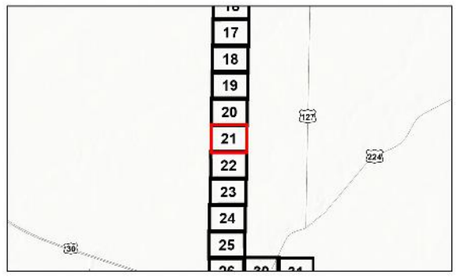

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

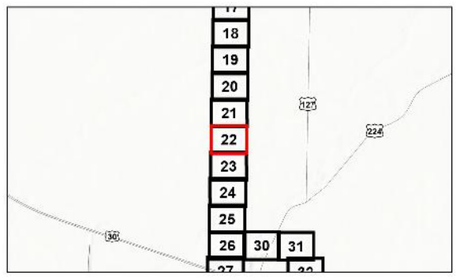

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

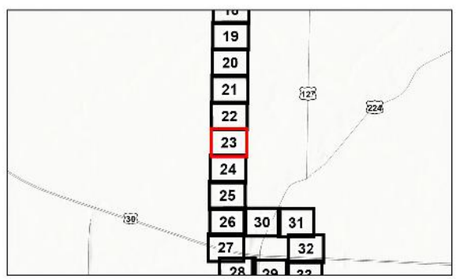

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_esri\gismxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

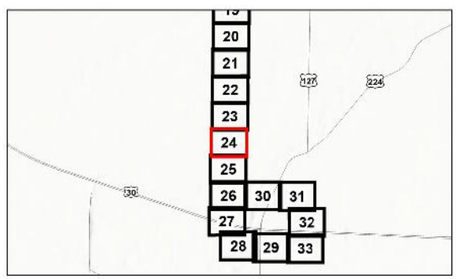

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_esri\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

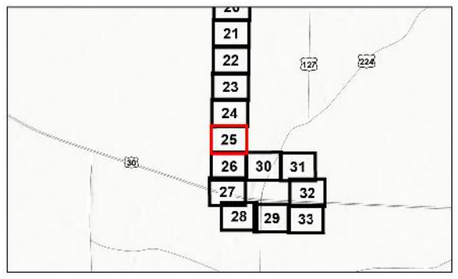

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

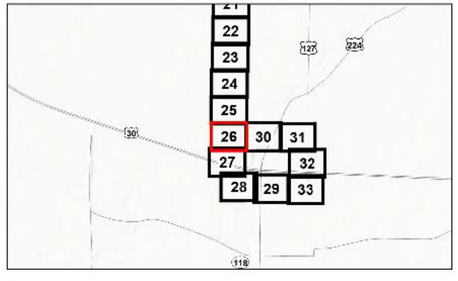

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

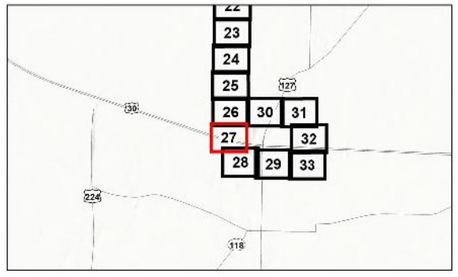

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gismxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mkanczewski

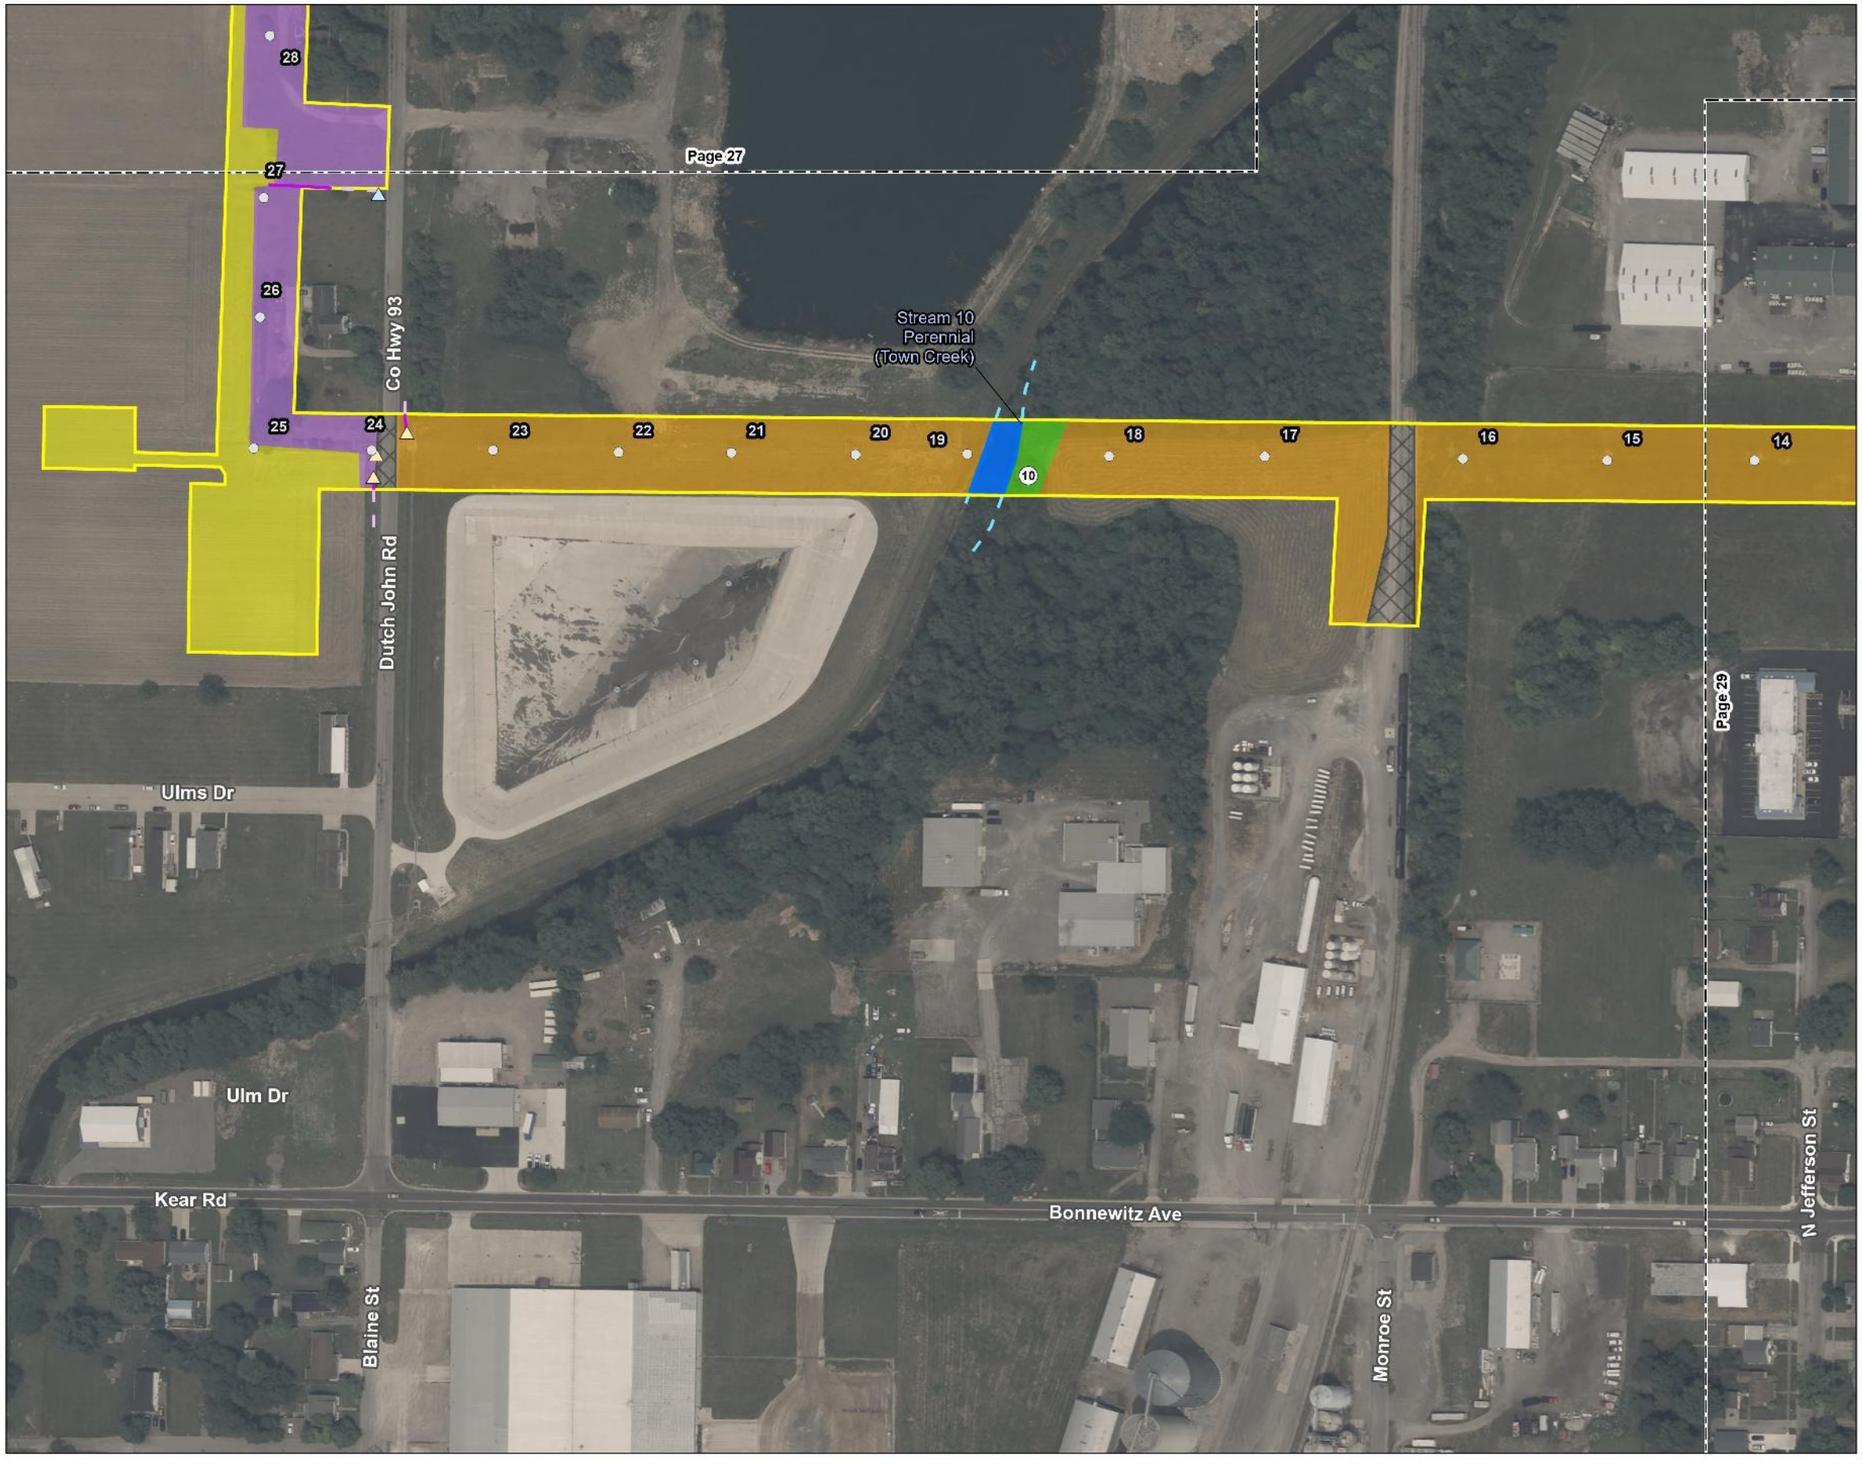

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

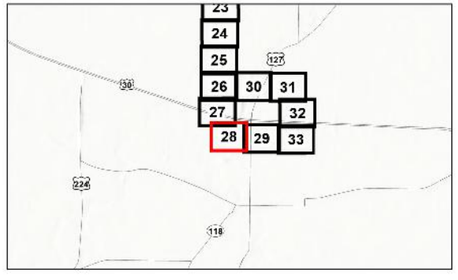

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert Paulding\03 data\gis_cad\gis\mxd\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

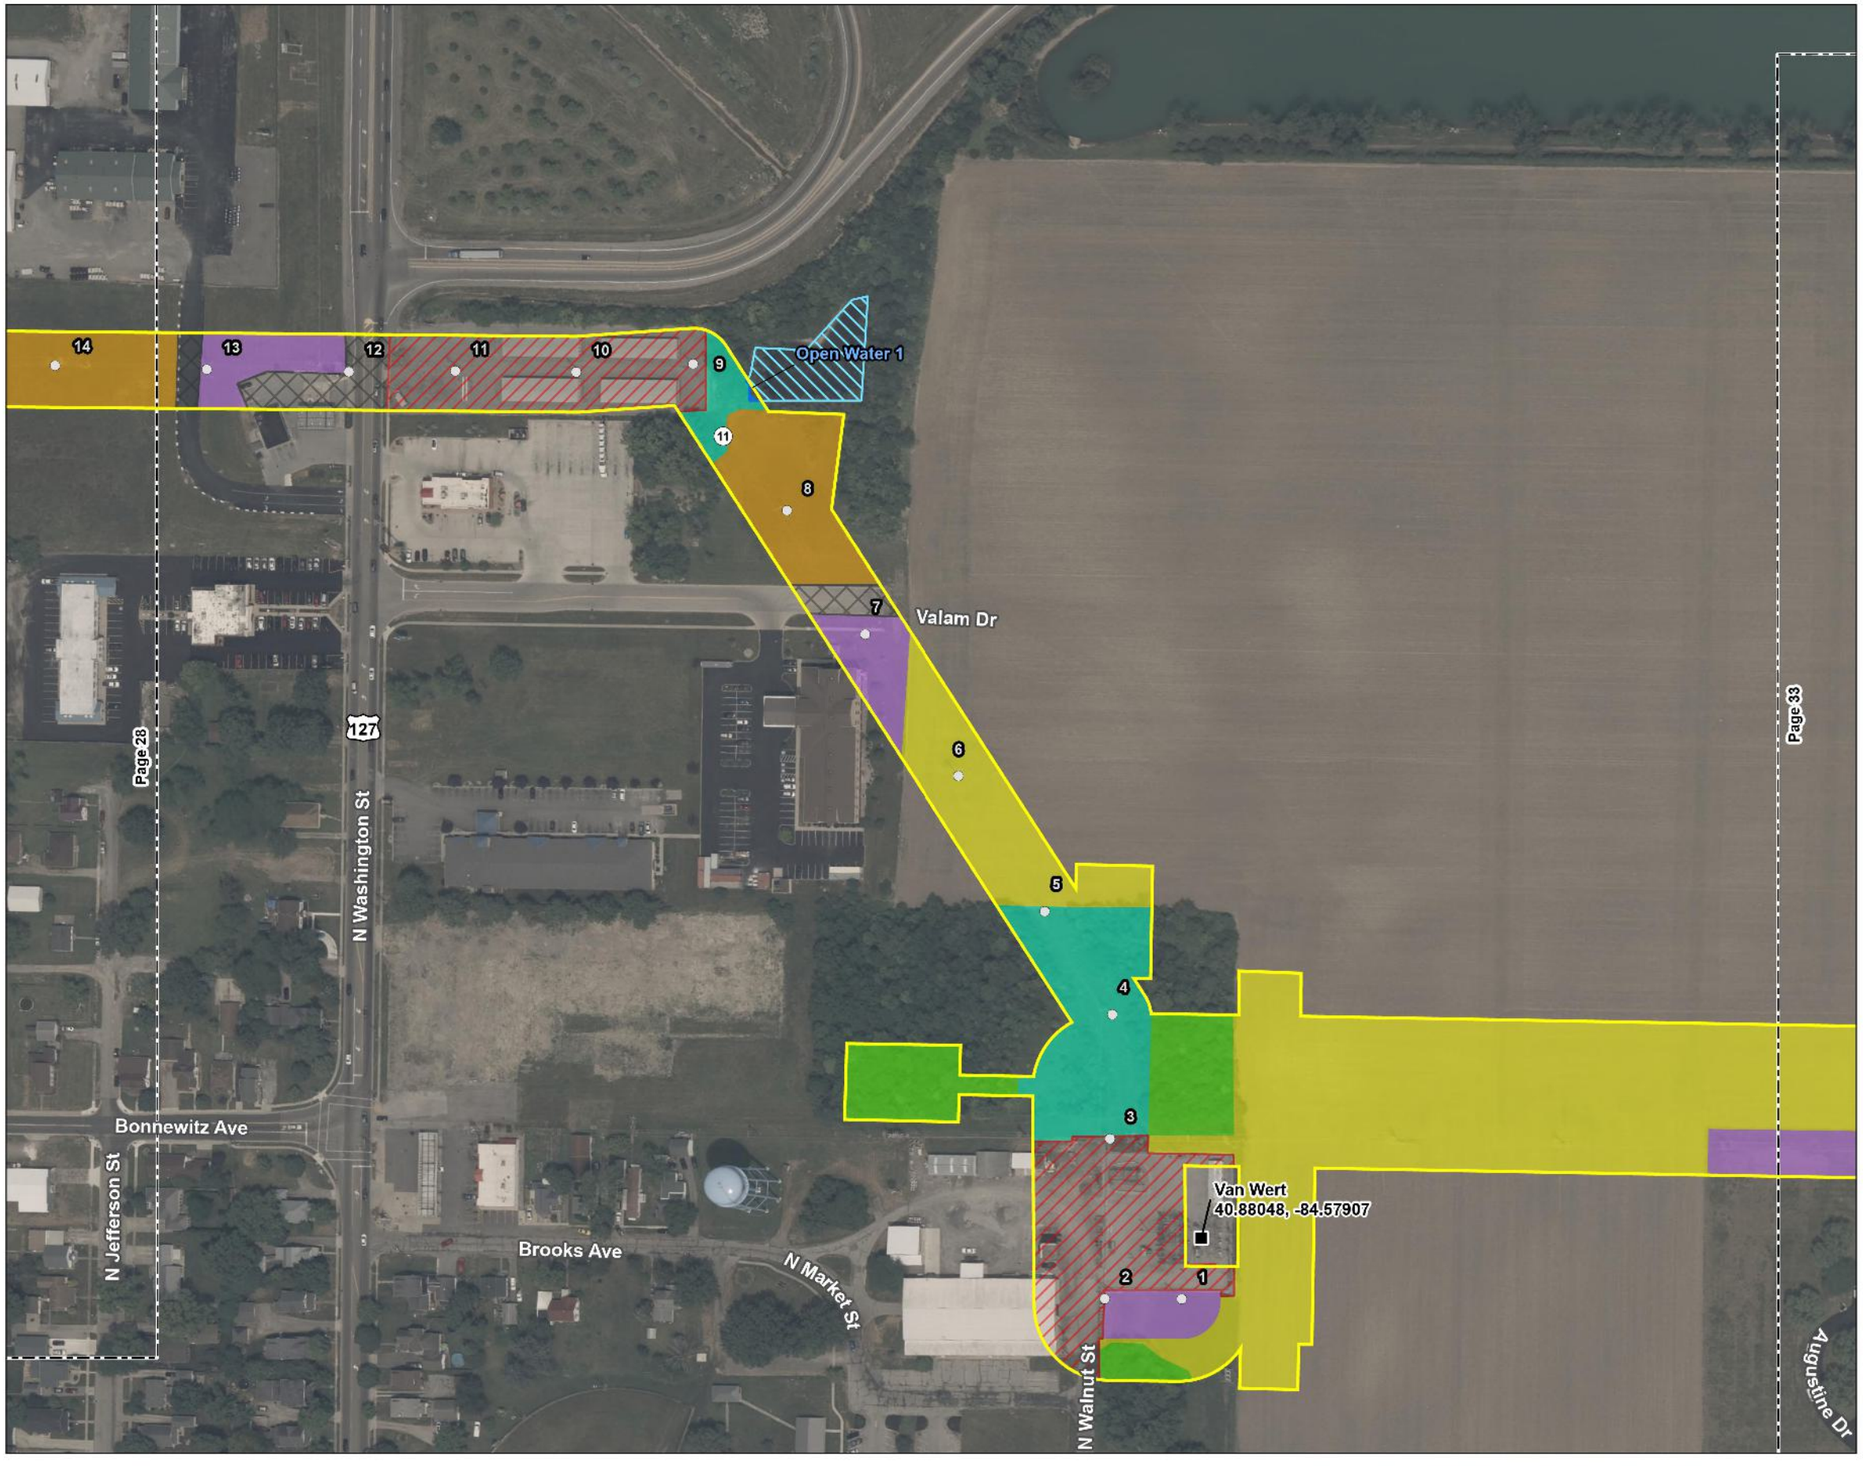

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

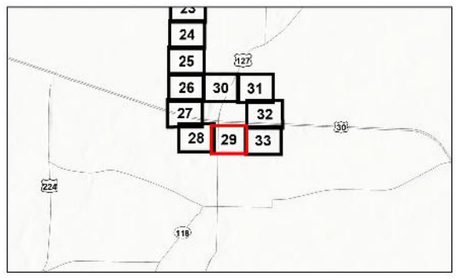

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

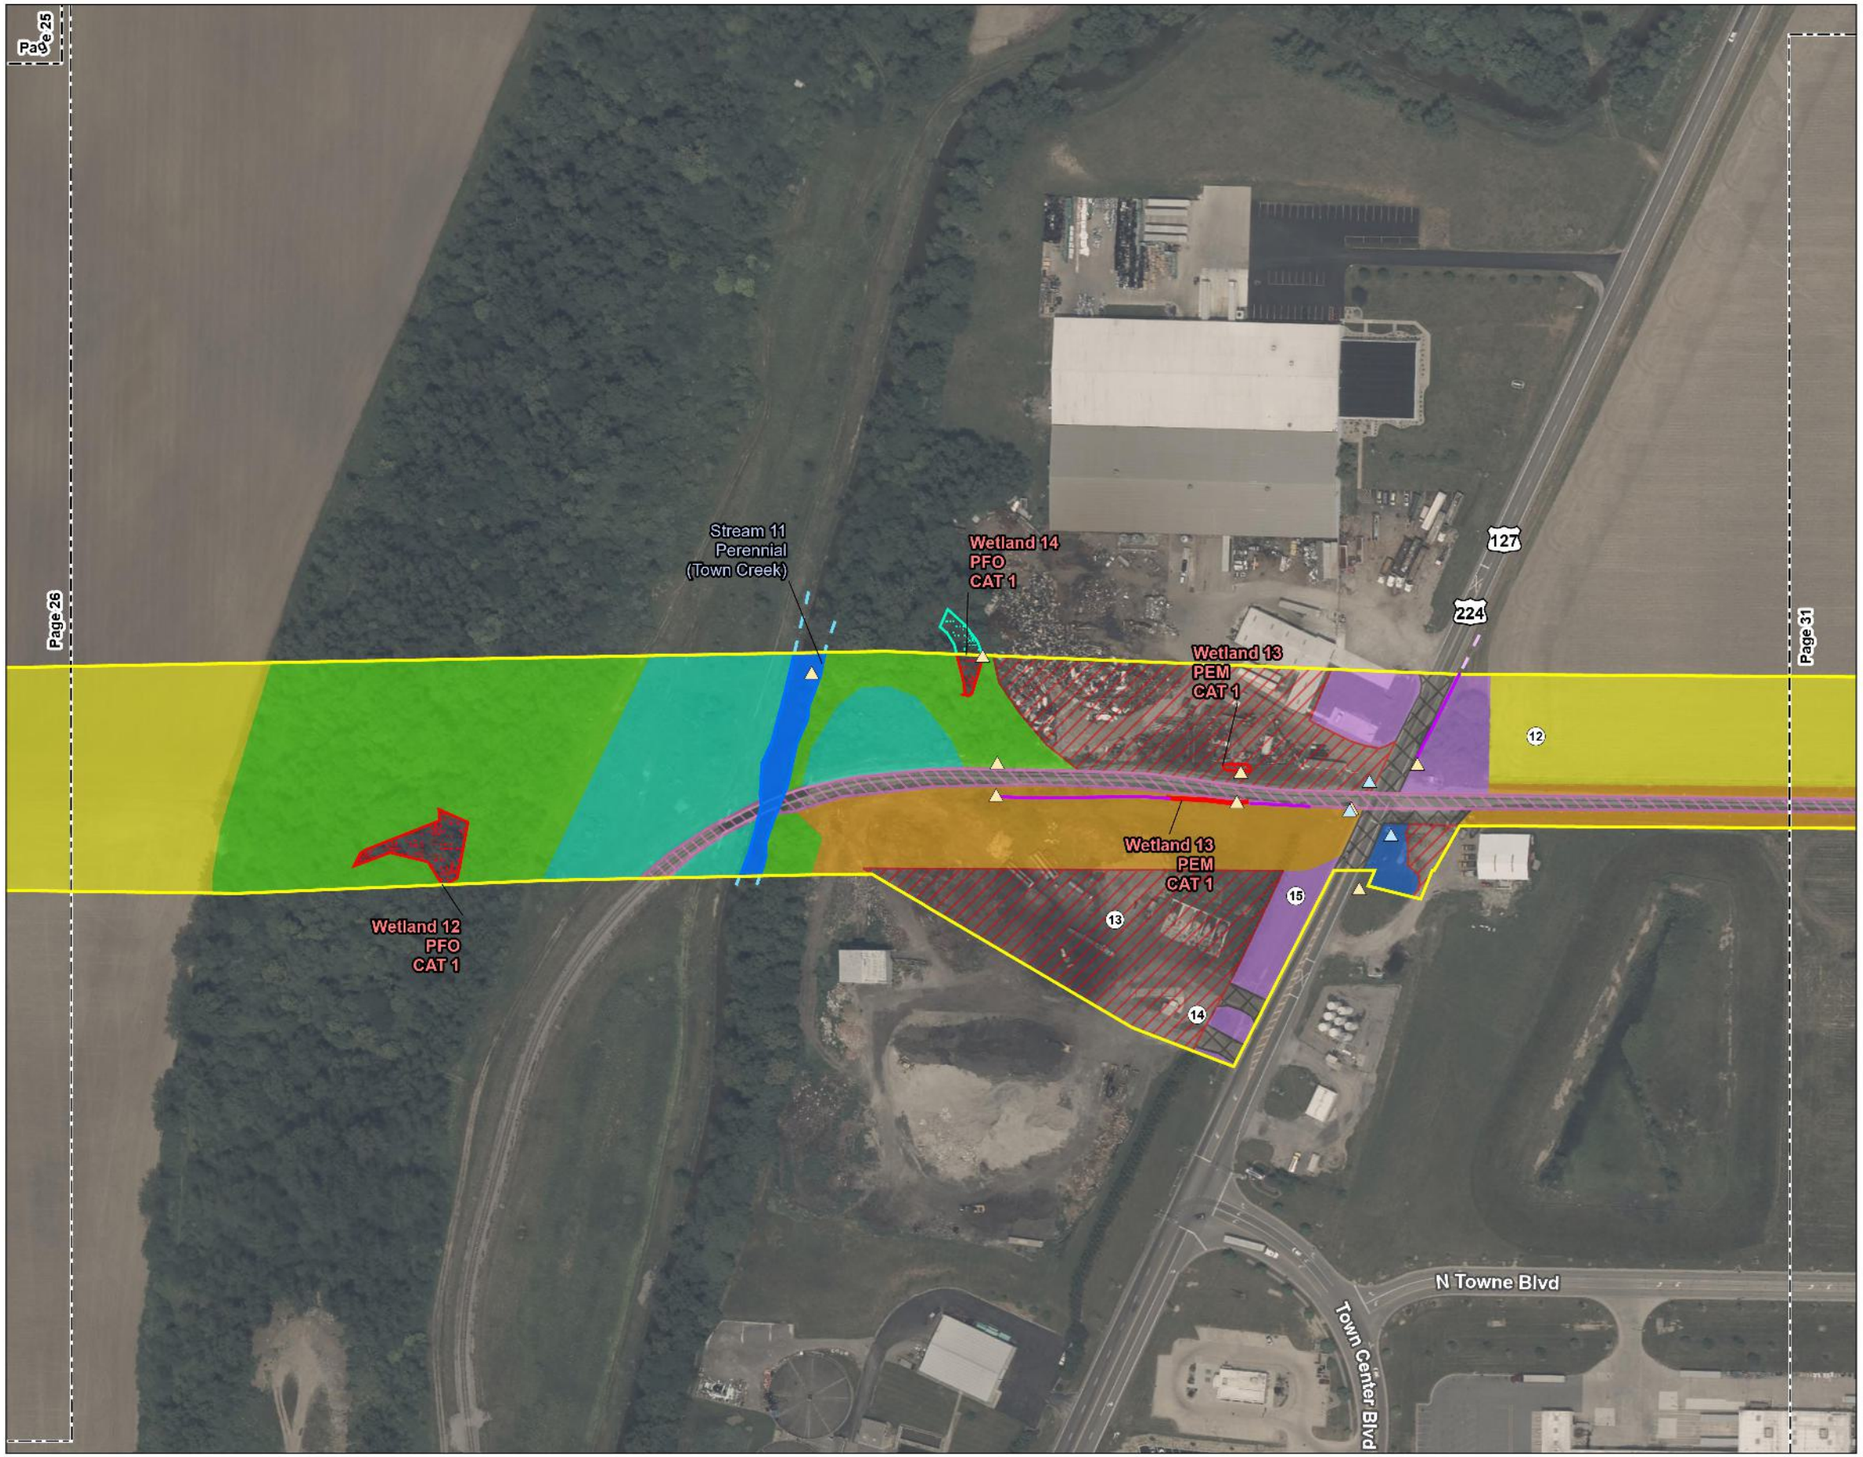

Figure No.

3

Title

Habitat Assessment Map

Client/Project 239000324

AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

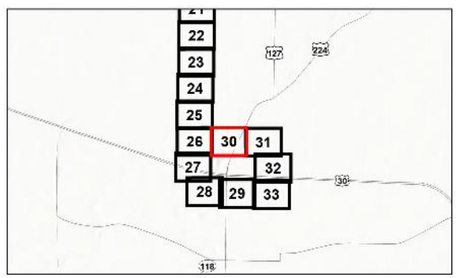

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325 Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxd\s239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczwski

Figure No.
3

Title
Habitat Assessment Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

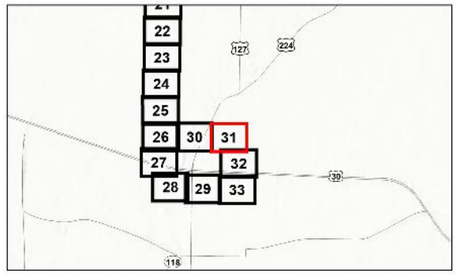

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

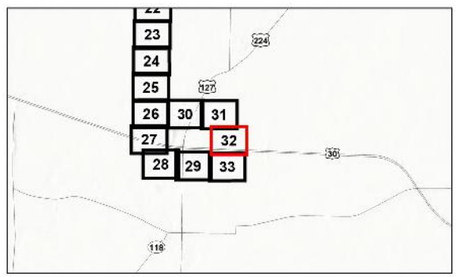

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

Figure No.
3

Title
Habitat Assessment Map

Client/Project
239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County, Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 100 200 Feet
(At original document size of 11x17)
1:2,400

Legend

- AEP Substation
- Existing Structure to Replace
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- Photo Location
- Existing Culvert
- Storm Drain
- Upland Drainage Feature
- Approximate Upland Drainage Feature
- Field Delineated Waterway
- Approximate Waterway
- Field Delineated Waterway Area
- Field Delineated Open Water
- Approximate Open Water
- Field Delineated Wetland Area
- Approximate Wetland Area

Habitat Area

- Agricultural Land
- Early Successional Deciduous Forest
- Maintained Lawn
- Maintained ROW
- New Field
- Old Field
- Existing Road
- Industrial Land
- Existing Railroad

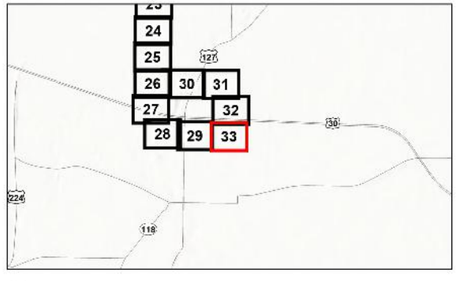

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio South FIPS 3402 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, OGRIP
3. Background: NAIP 2023

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxd\239000324_Haviland_VanWert239000324_Haviland_VanWert.aprx Revised: 2026-07-07 By: mlanczewski

A.4 FIGURE 4 – BAT HIBERNACULA DESKTOP STUDY MAP

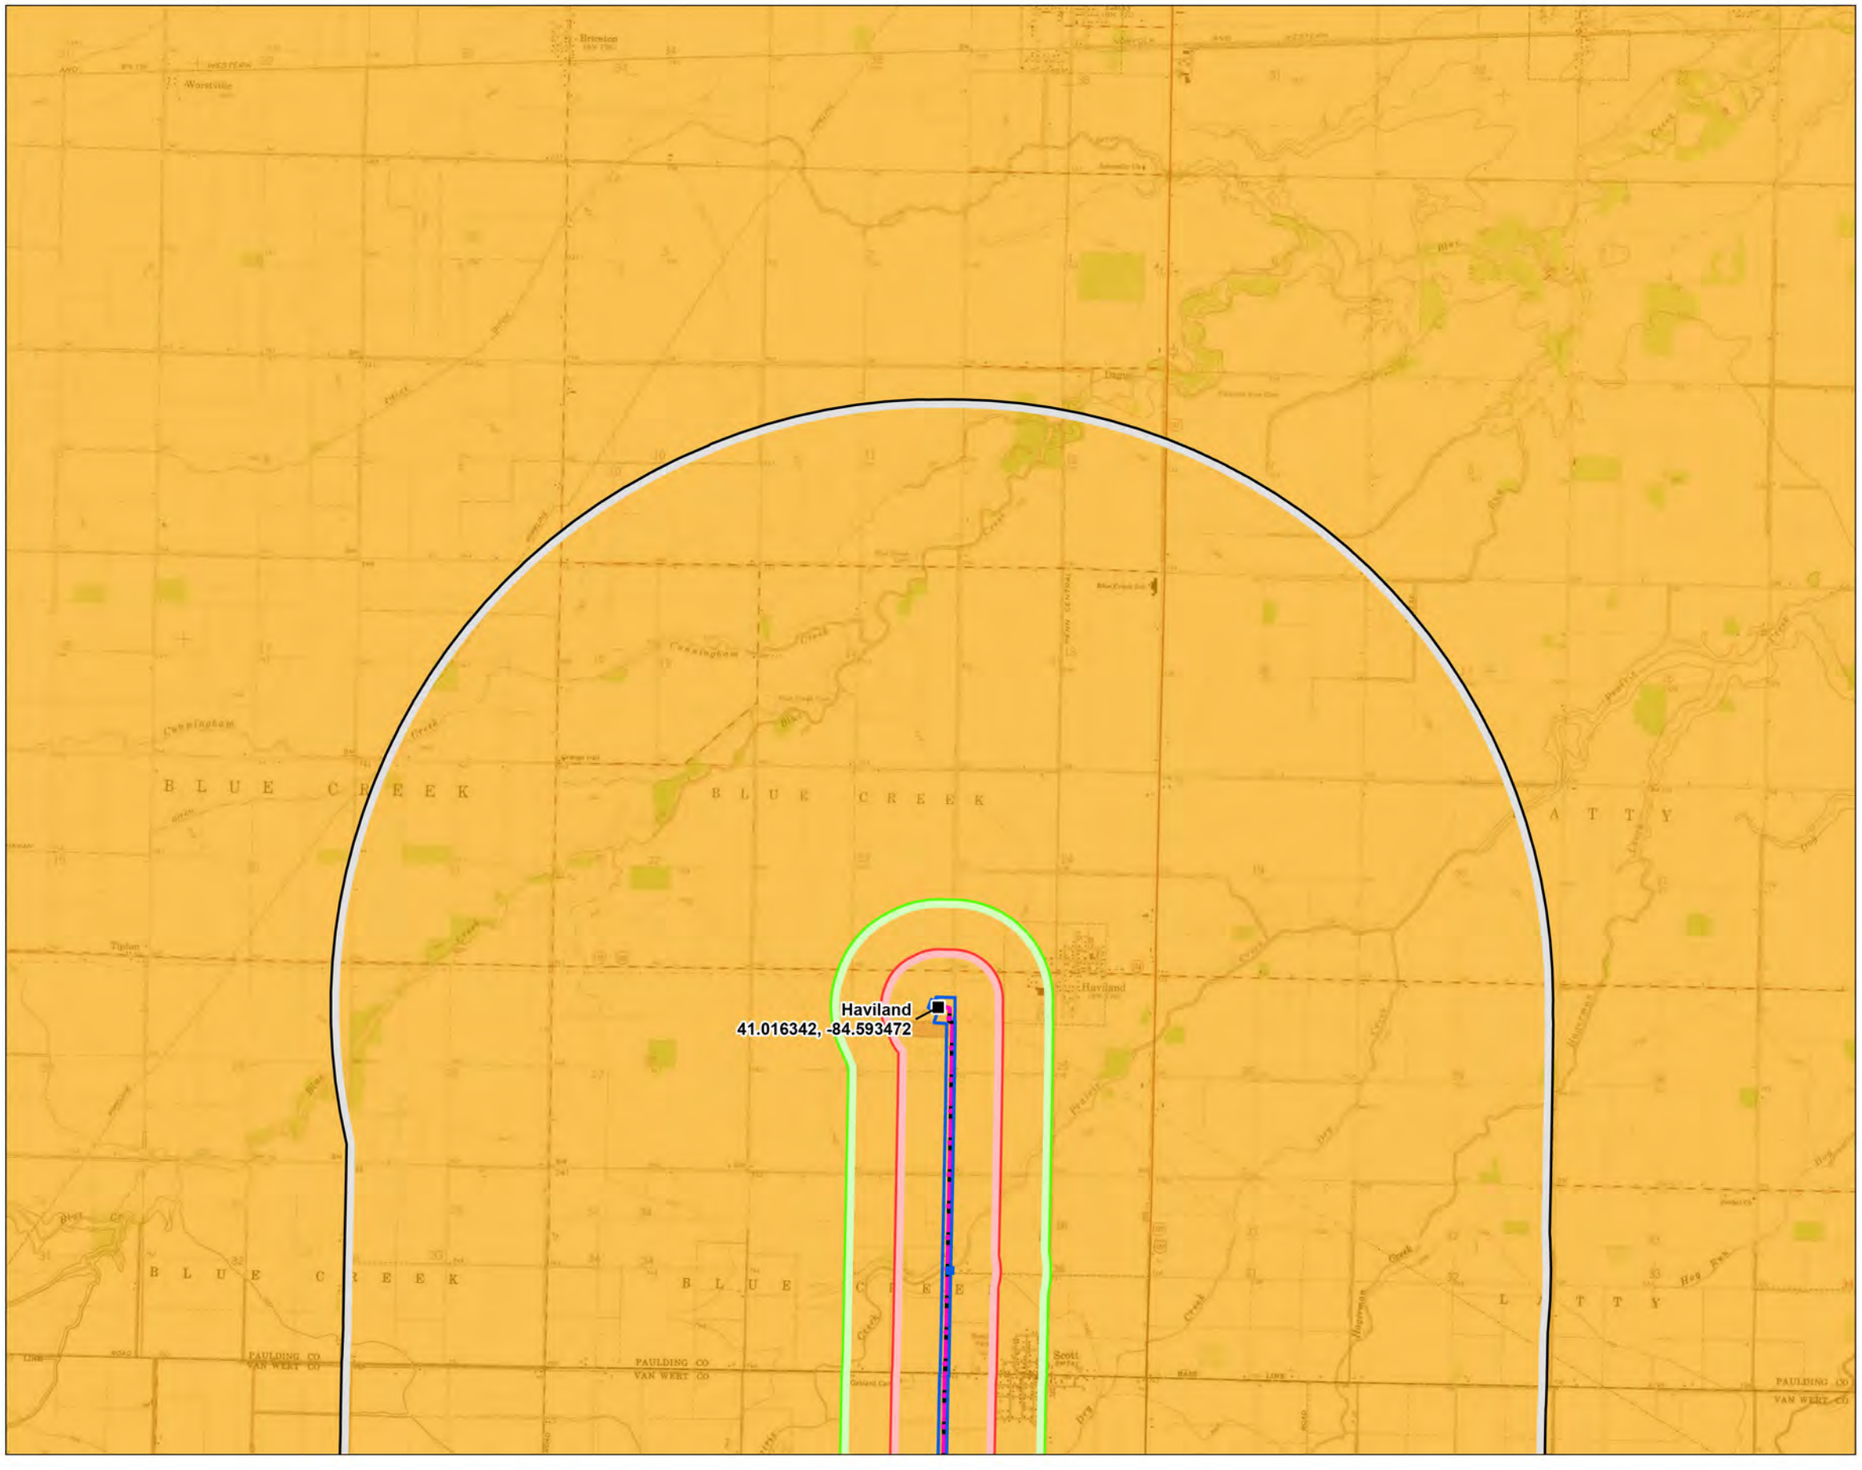

Figure No.
4

Title
Bat Hibernacula Desktop Study Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County
Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 2,000 4,000 Feet
(At original document size of 11x17)
1:48,000

Legend
- AEP Substation
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- 0.25 Mile Project Area Buffer
- 0.5 Mile Project Area Buffer
- 3 Mile Project Area Buffer
- Karst Feature*
- Area of Karst Geology
- Mine Opening*
- Underground Mine*

*No features within data frame

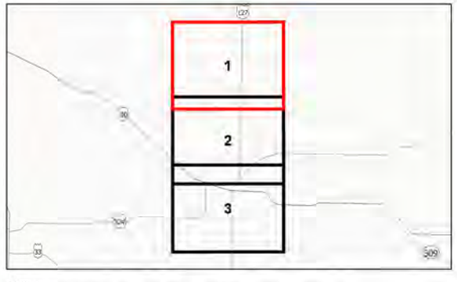

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio North FIPS 3401 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, ODNR
3. Background: USGS 30' x 60' Topographic Quadrangles: Lafty (1974), Scott (1983)

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert_239000324_Haviland_VanWert.aprx Revised: 2026-07-08 By: mkarczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-08 By: mkarczewski

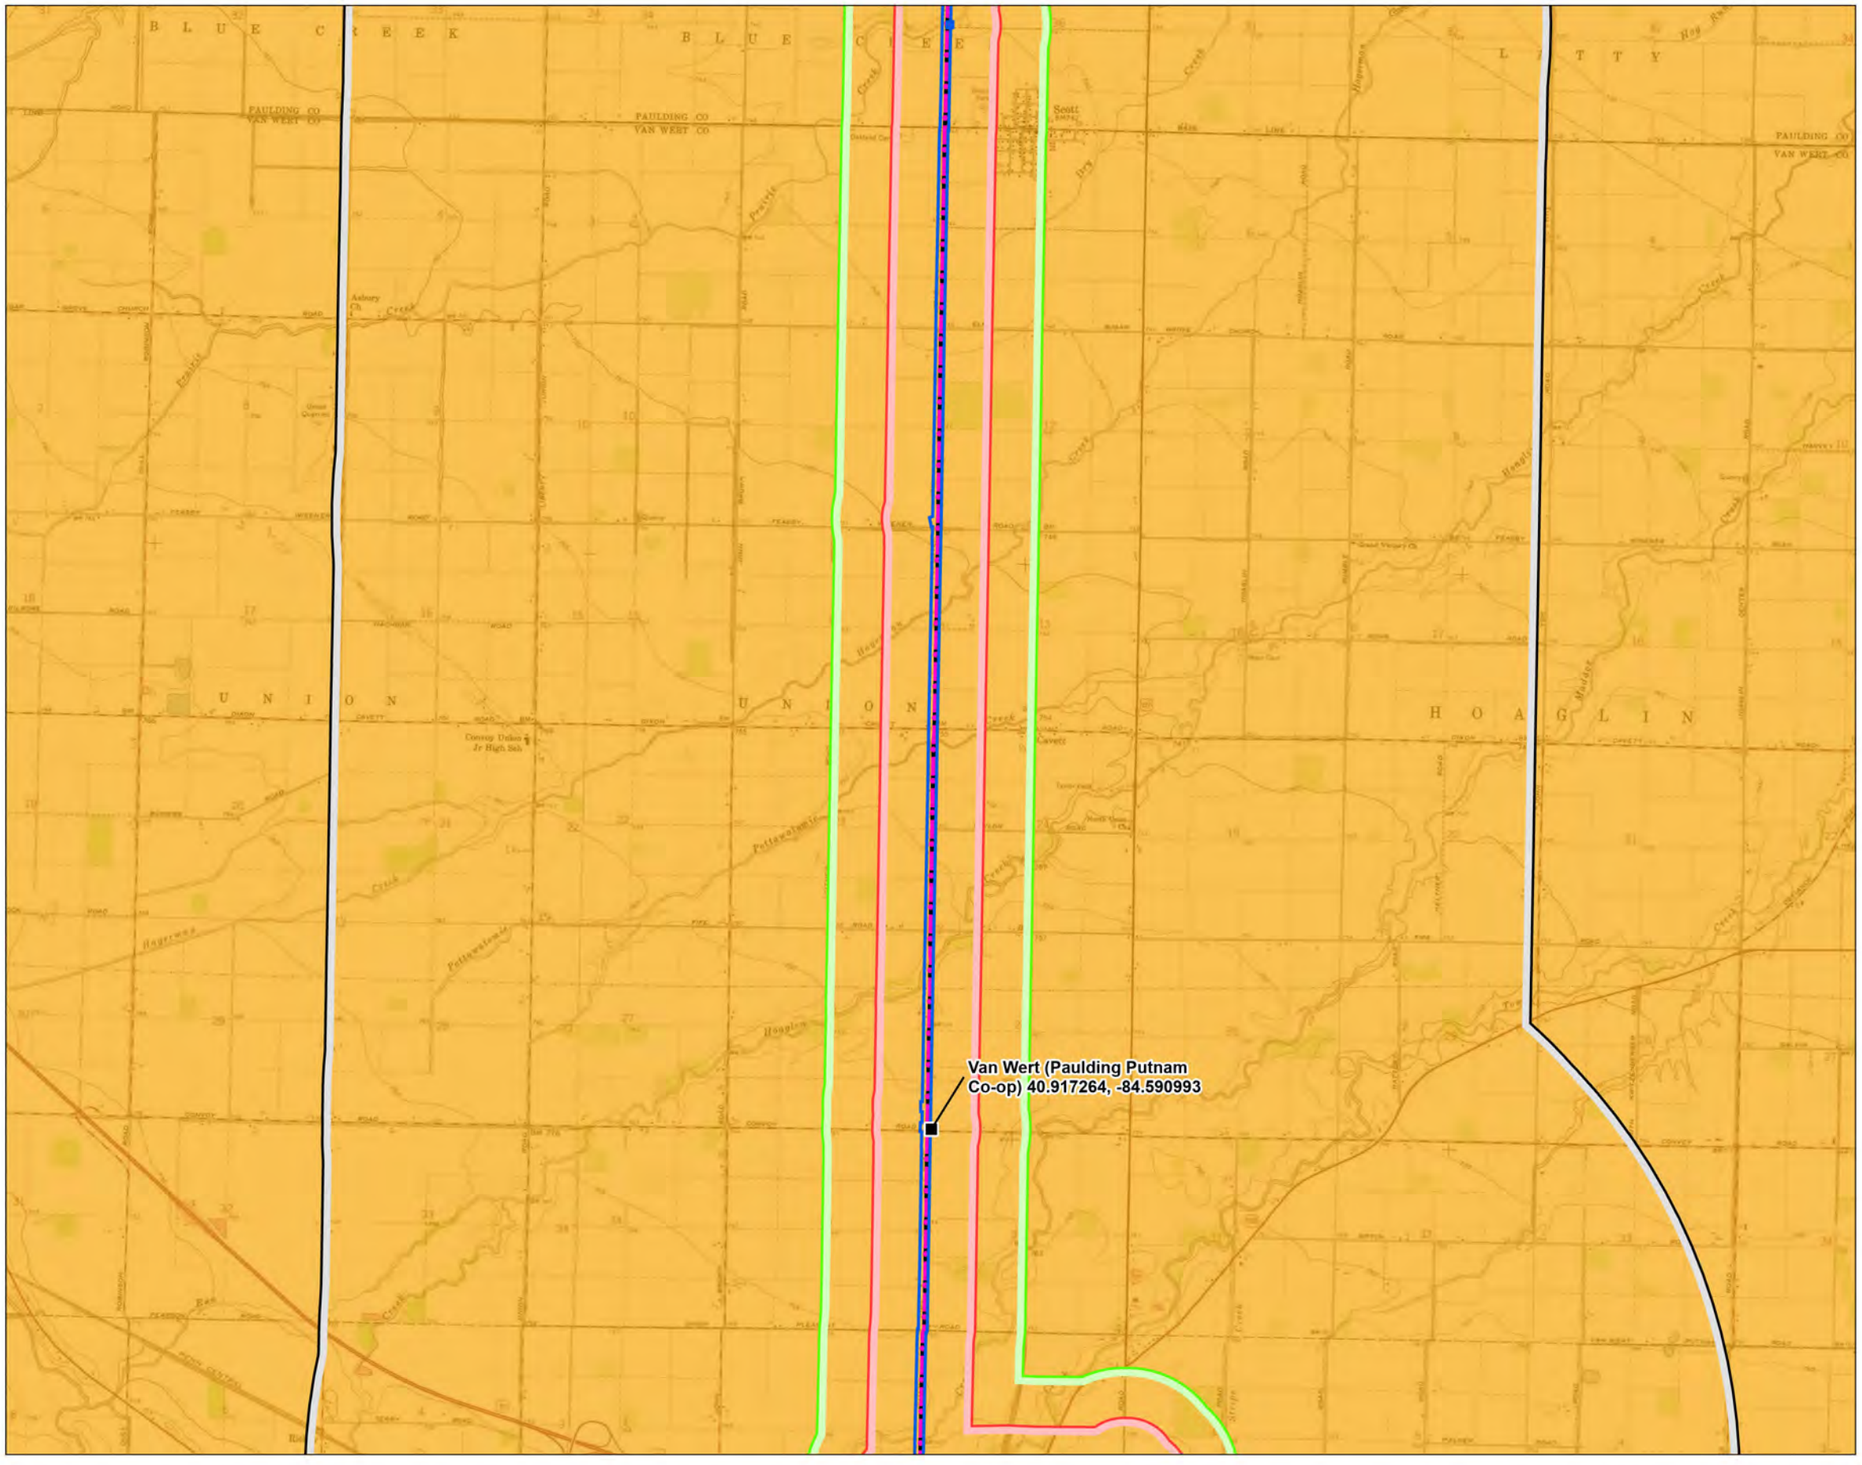

Figure No.
4

Title
Bat Hibernacula Desktop Study Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County
Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 2,000 4,000 Feet
(At original document size of 11x17)
1:48,000

Legend
- AEP Substation
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- 0.25 Mile Project Area Buffer
- 0.5 Mile Project Area Buffer
- 3 Mile Project Area Buffer
- Karst Feature*
- Area of Karst Geology
- Mine Opening*
- Underground Mine*

*No features within data frame

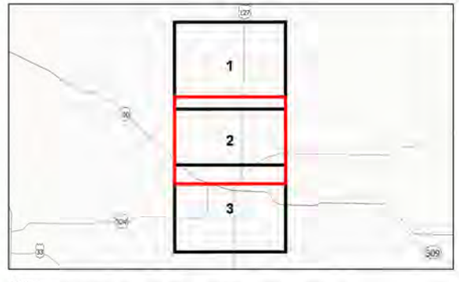

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio North FIPS 3401 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, ODNR
3. Background: USGS 30' x 60' Topographic Quadrangles: Lafty (1974), Scott (1983)

Stantec

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

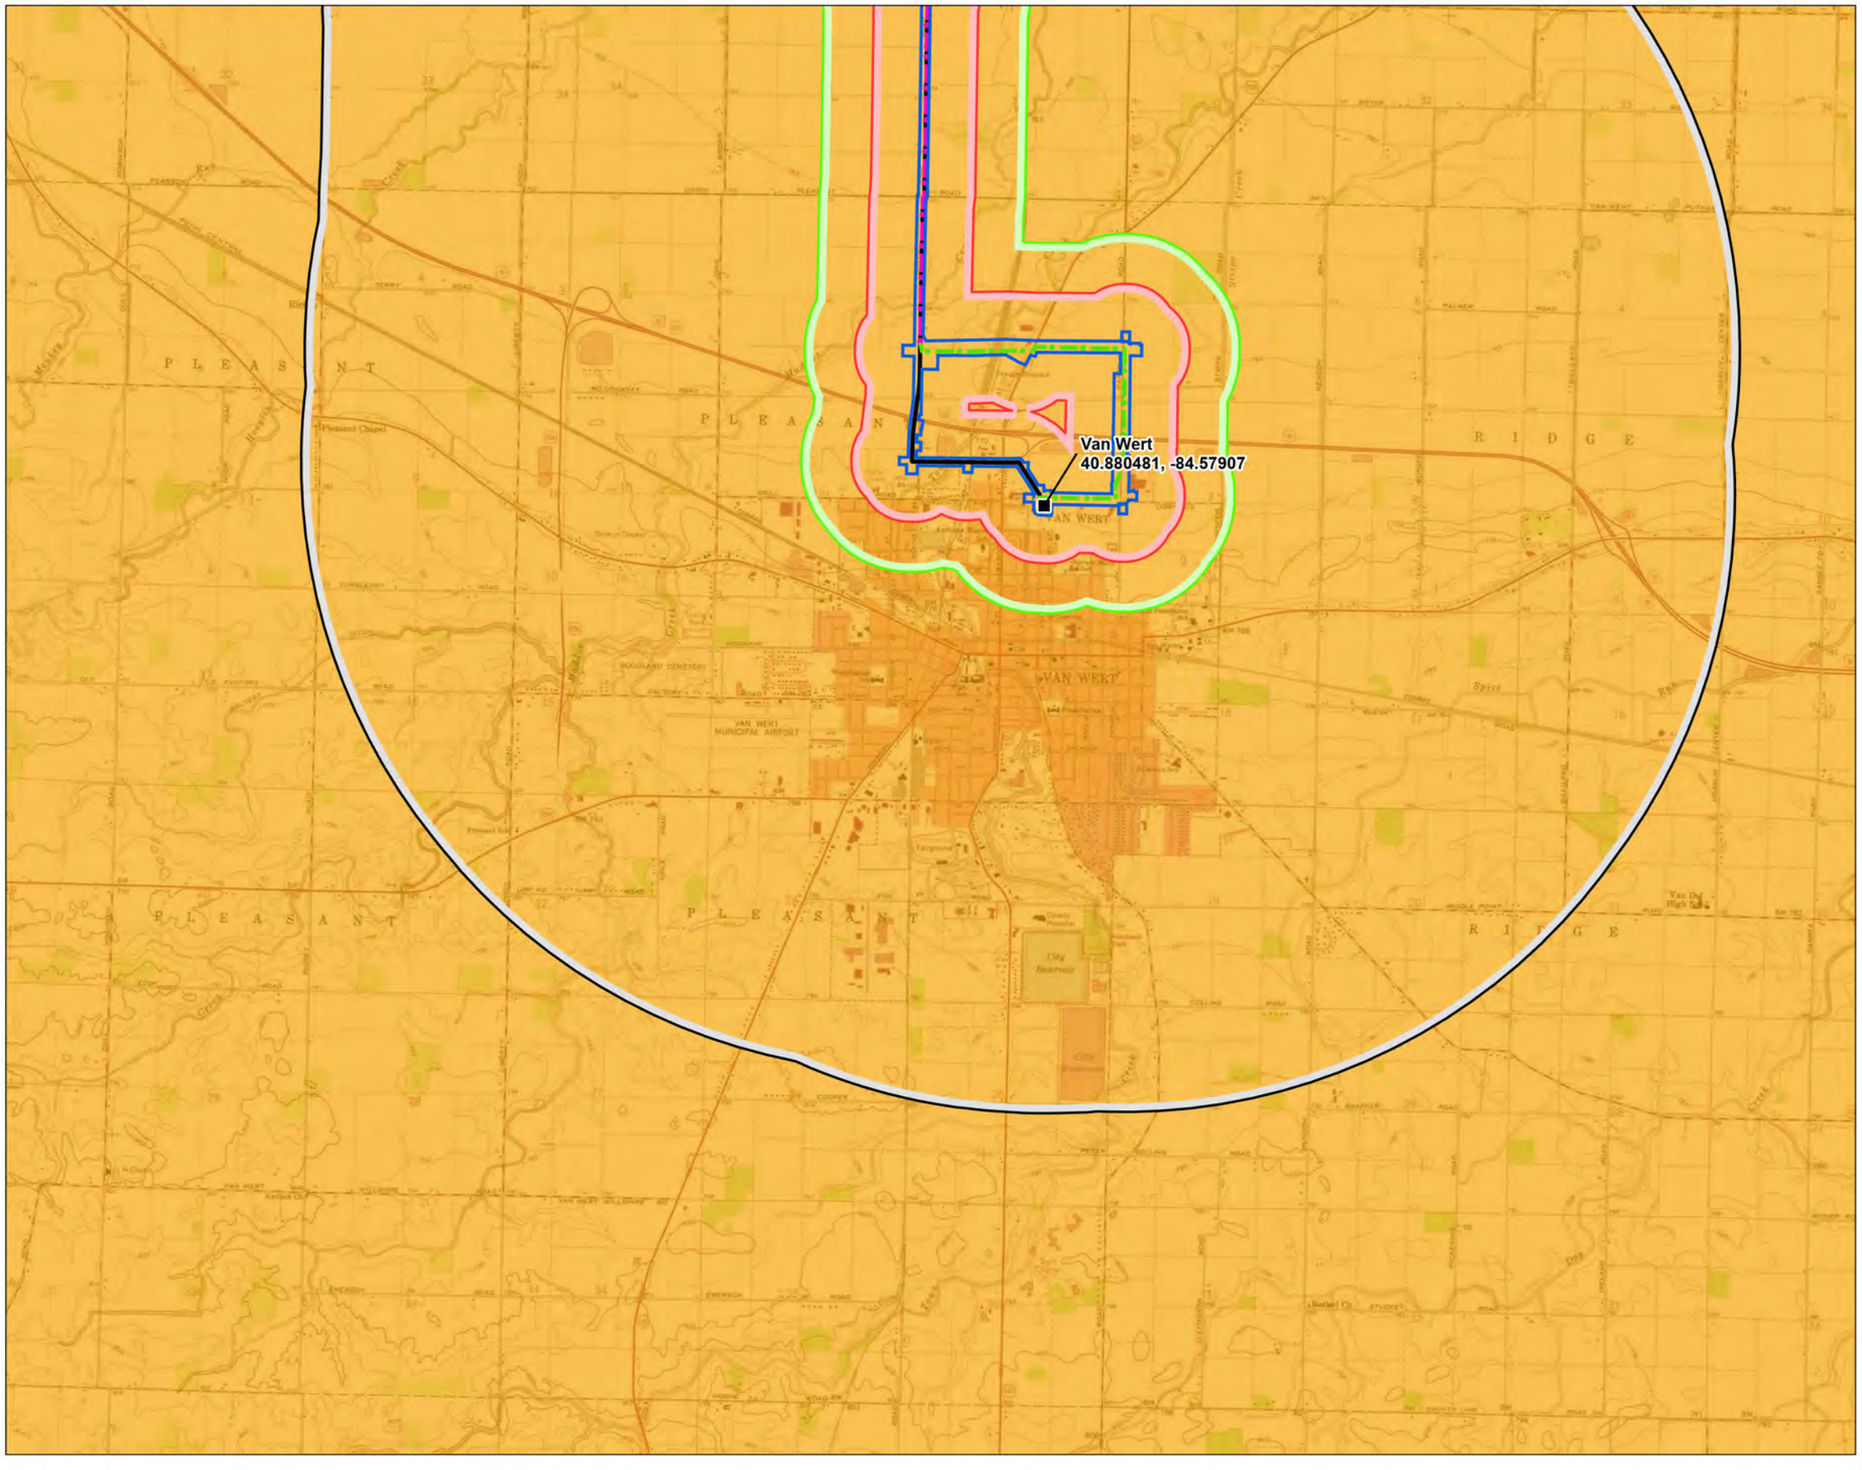

Figure No.
4

Title
Bat Hibernacula Desktop Study Map

Client/Project 239000324
AEP Ohio Transmission Company, Inc.
Van Wert - Haviland 138 kV Transmission Line Project

Project Location
Paulding County & Van Wert County
Ohio

Prepared by JDS on 2025-10-31
TR by KLB on 2025-10-31
IR by DG on 2025-10-31

N

0 2,000 4,000 Feet
(At original document size of 11x17)
1:48,000

Legend
- AEP Substation
- Existing Transmission Line
- Proposed 69kV Transmission Line
- Proposed 69kV Transmission Line Greenfield Reroute
- Project Area
- 0.25 Mile Project Area Buffer
- 0.5 Mile Project Area Buffer
- 3 Mile Project Area Buffer
- Karst Feature*
- Area of Karst Geology
- Mine Opening*
- Underground Mine*

*No features within data frame

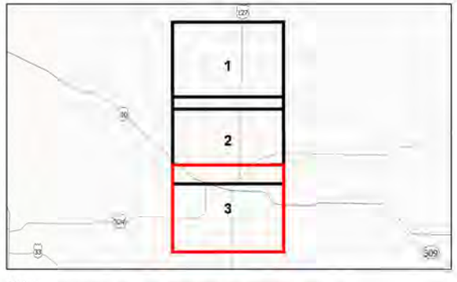

Notes
1. Coordinate System: NAD 1983 StatePlane Ohio North FIPS 3401 Feet
2. Data Sources: Stantec, AEP, Esri, USGS, USCB, ODNR
3. Background: USGS 30' x 60' Topographic Quadrangles: Lafty (1974), Scott (1983)

Stantec

U:\239\239000324_239000325_Haviland_VanWert_Paulding\03_data\gis_cad\gis\mxds\239000324_Haviland_VanWert\239000324_Haviland_VanWert.aprx Revised: 2026-07-08 By: mkarczewski

Disclaimer: This document has been prepared based on information provided by others as cited in the Notes section. Stantec has not verified the accuracy and/or completeness of this information and shall not be responsible for any errors or omissions which may be incorporated herein as a result. Stantec assumes no responsibility for data supplied in electronic format, and the recipient accepts full responsibility for verifying the accuracy and completeness of the data.

Appendix B AGENCY CORRESPONDENCE

Office of Real Estate
Tara Paciorek, Chief
2045 Morse Road – Bldg. E-2
Columbus, OH 43229
Phone: (614) 265-6661
Fax: (614) 267-4764

July 19, 2023

Daniel Godec
Stantec Consulting Services Inc.
11687 Lebanon Road
Cincinnati Ohio 45241

Re: 23-0710; Haviland-Van Wert 69 kV Line Rebuild

Project: The proposed project involves rebuilding approximately 10.1 miles of the existing Haviland-Van 69 kV transmission line.

Location: The proposed project is located in Blue Creek Township of Paulding County, and Pleasant, Ridge, & Union townships of Van Wert County, Ohio.

The Ohio Department of Natural Resources (ODNR) has completed a review of the above referenced project. These comments were generated by an inter-disciplinary review within the Department. These comments have been prepared under the authority of the Fish and Wildlife Coordination Act (48 Stat. 401, as amended; 16 U.S.C. 661 et seq.), the National Environmental Policy Act, the Coastal Zone Management Act, Ohio Revised Code and other applicable laws and regulations. These comments are also based on ODNR's experience as the state natural resource management agency and do not supersede or replace the regulatory authority of any local, state, or federal agency nor relieve the applicant of the obligation to comply with any local, state, or federal laws or regulations.

Natural Heritage Database: A review of the Ohio Natural Heritage Database indicates there are no records of state or federally listed plants or animals within one mile of the specified project area. Records searched date from 1980.

Please note that Ohio has not been completely surveyed and we rely on receiving information from many sources. Therefore, a lack of records for any particular area is not a statement that rare species or unique features are absent from that area.

Fish and Wildlife: The Division of Wildlife (DOW) has the following comments.

The DOW recommends that impacts to streams, wetlands and other water resources be avoided and minimized to the fullest extent possible, and that Best Management Practices be utilized to minimize erosion and sedimentation.

The portion of the project north of Fife Road is within the vicinity of records for the Indiana bat (*Myotis sodalis*), a state endangered and federally endangered species. Because presence of state endangered bat species has been established in this area, summer tree cutting is not recommended, and additional summer surveys would not constitute presence/absence in the area.

However, limited summer tree cutting inside this buffer may be acceptable after further consultation with DOW (contact Eileen Wyza at Eileen.Wyza@dnr.ohio.gov).

In addition, the entire state of Ohio is within the range of the Indiana bat (*Myotis sodalis*), a state endangered and federally endangered species, the northern long-eared bat (*Myotis septentrionalis*), a state endangered and federally endangered species, the little brown bat (*Myotis lucifugus*), a state endangered species, and the tricolored bat (*Perimyotis subflavus*), a state endangered species. During the spring and summer (April 1 through September 30), these bat species predominately roost in trees behind loose, exfoliating bark, in crevices and cavities, or in the leaves. The DOW recommends tree cutting only occur from October 1 through March 31, conserving trees with loose, shaggy bark and/or crevices, holes, or cavities, as well as trees with DBH ≥ 20 if possible. However, if trees are present within this area, (outside of the area delineated above) and trees must be cut during the summer months, the DOW recommends a mist net survey or acoustic survey be conducted from June 1 through August 15, prior to any cutting. Mist net and acoustic surveys should be conducted in accordance with the most recent version of the "*OHIO DIVISION OF WILDLIFE GUIDANCE FOR BAT SURVEYS AND TREE CLEARING*". If state listed bats are documented, DOW recommends cutting only occur from October 1 through March 31. However, limited summer tree cutting may be acceptable after consultation with the DOW.

The DOW also recommends that a desktop habitat assessment is conducted, followed by a field assessment if needed, to determine if a potential hibernaculum is present within the project area. Direction on how to conduct habitat assessments can be found in the current USFWS "*RANGE-WIDE INDIANA BAT & NORTHERN LONG-EARED BAT SURVEY GUIDELINES*." If a habitat assessment finds that a potential hibernaculum is present within 0.25 miles of the project area, please send this information to Eileen Wyza, for project recommendations. If a potential or known hibernaculum is found, the DOW recommends a 0.25-mile tree cutting and subsurface disturbance buffer around the hibernaculum entrance, however, limited summer or winter tree cutting may be acceptable after consultation with the DOW. If no tree cutting or subsurface impacts to a hibernaculum are proposed, this project is not likely to impact these species.

The project is within the range of the pondhorn *(Uniomerus tetralasmus*), a state threatened mussel. This project must not have an impact on native mussels. This applies to both listed and non-listed species, as all species of mussel are protected in Ohio. Per the Ohio Mussel Survey Protocol (2022), all Group 2, 3, and 4 streams (Appendix A) require a mussel survey. Per the Ohio Mussel Survey Protocol, Group 1 streams (Appendix A) and unlisted streams with a watershed of 5 square miles or larger above the point of impact should be assessed using the Reconnaissance Survey for Unionid Mussels (Appendix B) to determine if mussels are present. Mussel surveys may be recommended for these streams as well. Therefore, if in-water work is planned in any stream that meets any of the above criteria, the DOW recommends the applicant provide information to indicate no mussel impacts will occur. If this is not possible, the DOW recommends a professional malacologist conduct a mussel survey in the project area. If mussels that cannot be avoided are found in the project area, the DOW recommends a professional malacologist collect and relocate the mussels to suitable and similar habitat upstream of the project site. Mussel surveys and any subsequent mussel relocation should be done in accordance with the Ohio Mussel Survey Protocol. If there is no in-water work proposed, impacts to mussels are not likely.

The project is within the range of the pugnose minnow (*Opsopoeodus emiliae*), a state endangered fish. The DOW recommends no in-water work in perennial streams from March 15 through June 30 to reduce impacts to indigenous aquatic species and their habitat. If no in-water

work is proposed in a perennial stream, this project is not likely to impact this or other aquatic species.

The project is within the range of the northern harrier (*Circus hudsonius*), a state endangered bird. This is a common migrant and winter species. Nesters are much rarer, although they occasionally breed in large marshes and grasslands. Harriers often nest in loose colonies. The female builds a nest out of sticks on the ground, often on top of a mound. Harriers hunt over grasslands. If this type of habitat will be impacted, construction should be avoided in this habitat during the species' nesting period of April 15 through July 31. If this habitat will not be impacted, this project is not likely to impact this species.

The project is within the range of the upland sandpiper (*Bartramia longicauda*), a state endangered bird. Nesting upland sandpipers utilize dry grasslands including native grasslands, seeded grasslands, grazed and ungrazed pasture, hayfields, and grasslands established through the Conservation Reserve Program (CRP). If this type of habitat will be impacted, construction should be avoided in this habitat during the species' nesting period of April 15 through July 31. If this type of habitat will not be impacted, the project is not likely to impact this species.

Due to the potential of impacts to federally listed species, as well as to state listed species, we recommend that this project be coordinated with the US Fish & Wildlife Service.

Water Resources: The Division of Water Resources has the following comment.

The local floodplain administrator should be contacted concerning the possible need for any floodplain permits or approvals for this project.

ODNR appreciates the opportunity to provide these comments. Please contact Mike Pettegrew at mike.pettegrew@dnr.ohio.gov if you have questions about these comments or need additional information.

Mike Pettegrew
Environmental Services Administrator

United States Department of the Interior

FISH AND WILDLIFE SERVICE

Ecological Services
4625 Morse Road, Suite 104
Columbus, Ohio 43230
(614) 416-8993 / FAX (614) 416-8994

June 27, 2023

Project Code: 2023-0094841

Dear Mr. Daniel Godec:

The U.S Fish and Wildlife Service (Service) has received your recent correspondence requesting information about the subject proposal. We offer the following comments and recommendations to assist you in minimizing and avoiding adverse impacts to threatened, endangered, and proposed species pursuant to the Endangered Species Act of 1973 (16 U.S.C. 1531 et seq), as amended (ESA).

Federally Threatened and Endangered Species: The endangered Indiana bat (*Myotis sodalis*) and northern long-eared bat (*Myotis septentrionalis*) occur throughout the State of Ohio. The Indiana bat and northern long-eared bat may be found wherever suitable habitat occurs unless a presence/absence survey has been performed to document absence. Suitable summer habitat for Indiana bats and northern long-eared bats consists of a wide variety of forested/wooded habitats where they roost, forage, and breed that may also include adjacent and interspersed non-forested habitats such as emergent wetlands and adjacent edges of agricultural fields, woodlots, fallow fields, and pastures. Roost trees for both species include live and standing dead trees ≥3 inches diameter at breast height (dbh) that have any exfoliating bark, cracks, crevices, hollows and/or cavities. These roost trees may be located in forested habitats as well as linear features such as fencerows, riparian forests, and other wooded corridors. Individual trees may be considered suitable habitat when they exhibit the characteristics of a potential roost tree and are located within 1,000 feet of other forested/wooded habitat. Northern long-eared bats have also been observed roosting in human-made structures, such as buildings, barns, bridges, and bat houses; therefore, these structures should also be considered potential summer habitat. In the winter, Indiana bats and northern long-eared bats hibernate in caves, rock crevices and abandoned mines.

Federally Proposed Species: On September 14, 2022, the Service proposed to list the tricolored bat (*Perimyotis subflavus*) as endangered under the ESA. The bat faces extinction due to the impacts of white-nose syndrome, a deadly disease affecting cave-dwelling bats across the continent. During spring, summer, and fall, this species roosts primarily among leaf clusters of live or recently dead trees, emerging at dusk to hunt for insects over waterways and forest edges. While white-nose syndrome is by far the most serious threat to the tricolored bat, other threats now have an increased significance due to the dramatic decline in the species' population. These threats include disturbance to bats in roosting, foraging, commuting, and over-wintering habitats. Mortality due to collision with wind turbines, especially during migration, has also been documented across their range. Conservation measures for the Indiana bat and northern long-eared bat will also help to conserve the tricolored bat.

Seasonal Tree Clearing for Federally Listed Bat Species: Should the proposed project site contain trees ≥3 inches dbh, we recommend avoiding tree removal wherever possible. If any caves or abandoned mines may be disturbed, further coordination with this office is requested to determine if fall or spring portal surveys are warranted. If no caves or abandoned mines are present and trees ≥3 inches dbh cannot be avoided, we recommend removal of any trees ≥3 inches dbh only occur between October 1 and March 31. Seasonal clearing is recommended to avoid adverse effects to Indiana bats and northern long-eared bats.

If implementation of this seasonal tree cutting recommendation is not possible, a summer presence/absence survey may be conducted for Indiana bats and northern long-eared bats. If Indiana bats and northern long-eared bats are not detected during the survey, then tree clearing may occur at any time of the year. Surveys must be conducted by an approved surveyor and be designed and conducted in coordination with the Ohio Field Office. Surveyors must have a valid federal permit. Please note that in Ohio summer mist net surveys may only be conducted between June 1 and August 15.

Section 7 Coordination: If there is a federal nexus for the project (e.g., federal funding provided, federal permits required to construct), then no tree clearing should occur on any portion of the project area until consultation under section 7 of the ESA, between the Service and the federal action agency, is completed. We recommend the federal action agency submit a determination of effects to this office, relative to the Indiana bat and northern long-eared bat, for our review and concurrence. This letter provides technical assistance only and does not serve as a completed section 7 consultation document.

Stream and Wetland Avoidance: Over 90% of the wetlands in Ohio have been drained, filled, or modified by human activities, thus is it important to conserve the functions and values of the remaining wetlands in Ohio (https://epa.ohio.gov/portals/47/facts/ohio_wetlands.pdf). We recommend avoiding and minimizing project impacts to all wetland habitats (e.g., forests, streams, vernal pools) to the maximum extent possible in order to benefit water quality and fish and wildlife habitat. Additionally, natural buffers around streams and wetlands should be preserved to enhance beneficial functions. If streams or wetlands will be impacted, the U.S. Army Corps of Engineers should be contacted to determine whether a Clean Water Act section 404 permit is required. Best management practices should be used to minimize erosion, especially on slopes. Disturbed areas should be mulched and revegetated with native plant species. In addition, prevention of non-native, invasive plant establishment is critical in maintaining high quality habitats.

Due to the project type, size, and location, we do not anticipate adverse effects to any other federally endangered, threatened, or proposed species, or proposed or designated critical habitat. Should the project design change, or additional information on listed or proposed species or their critical habitat become available, or if new information reveals effects of the action that were not previously considered, coordination with the Service should be initiated to assess any potential impacts.

Thank you for your efforts to conserve listed species and sensitive habitats in Ohio. We recommend coordinating with the Ohio Department of Natural Resources due to the potential for the proposed project to affect state listed species and/or state lands. Contact Mike Pettegrew, Environmental Services Administrator, at (614) 265-6387 or at mike.pettegrew@dnr.ohio.gov.

If you have questions, or if we can be of further assistance in this matter, please contact our office at (614) 416-8993 or ohio@fws.gov.

Sincerely,

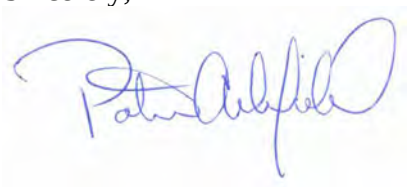

Patrice Ashfield
Field Office Supervisor

cc: Nathan Reardon, ODNR-DOW
Eileen Wyza, ODNR-DOW

Appendix C REPRESENTATIVE PHOTOGRAPHS

C.1 WETLAND AND WATERBODY PHOTOGRAPHS

Photograph Location 1. View of Stream 1. Photograph taken facing upstream/south.

Photograph Location 1. View of Stream 1. Photograph taken facing downstream/north.

Photograph Location 1. View of substrates of Stream 1.

Photograph Location 2. View of Stream 1. Photograph taken facing upstream/south.

Photograph Location 2. View of Stream 1. Photograph taken facing downstream/north.

Photograph Location 2. View of substrates of Stream 1.

Photograph Location 3. View of upland (maintained lawn) at wetland determination sample point location SP01. Photograph taken facing north.

Photograph Location 3. View of upland (maintained lawn) at wetland determination sample point location SP01. Photograph taken facing south.

Photograph Location 4. View of Wetland 1. Photograph taken facing north.

Photograph Location 4. View of Wetland 1. Photograph taken facing east.

Photograph Location 4. View of Wetland 1. Photograph taken facing south.

Photograph Location 4. View of Wetland 1. Photograph taken facing west.

Photograph Location 4. View of soil profile at wetland determination sample point location SP02.

Photograph Location 5. View of upland (new field habitat) at wetland determination sample point location SP03. Photograph taken facing north.

Photograph Location 5. View of upland (agricultural land) at wetland determination sample point location SP03. Photograph taken facing south.

Photograph Location 6. View of Wetland 2. Photograph taken facing north.

Photograph Location 6. View of Wetland 2. Photograph taken facing east.

Photograph Location 6. View of Wetland 2. Photograph taken facing south.

Photograph Location 6. View of Wetland 2. Photograph taken facing west.

Photograph Location 6. View of soil profile at wetland determination sample point location SP04.

Photograph Location 7. View of upland (maintained lawn) at wetland determination sample point location SP05. Photograph taken facing north.

Photograph Location 7. View of upland (maintained lawn) at wetland determination sample point location SP05. Photograph taken facing south.

Photograph Location 8. Representative view of a storm drain within the Project area.

Photograph Location 9. Representative view of an existing culvert within the Project area. Photograph taken facing south.

Photograph Location 10. View of Stream 2 (Prairie Creek). Photograph taken facing upstream/west.

Photograph Location 10. View of Stream 2 (Prairie Creek). Photograph taken facing downstream/east.

Photograph Location 10. View of substrates of Stream 2 (Prairie Creek).

Photograph Location 11. View of Stream 3. Photograph taken facing upstream/south.

Photograph Location 11. View of Stream 3. Photograph taken facing downstream/north.

Photograph Location 11. View of substrates of Stream 3.

Photograph Location 12. View of Wetland 3. Photograph taken facing north.

Photograph Location 12. View of Wetland 3. Photograph taken facing east.

Photograph Location 12. View of Wetland 3. Photograph taken facing south.

Photograph Location 12. View of Wetland 3. Photograph taken facing west.

Photograph Location 12. View of soil profile at wetland determination sample point location SP06.

Photograph Location 13. View of upland (maintained lawn) at wetland determination sample point location SP07. Photograph taken facing north.

Photograph Location 13. View of upland (maintained lawn) at wetland determination sample point location SP07. Photograph taken facing south.

Photograph Location 14. Representative view of an upland drainage feature within the Project area. Photograph taken facing west.

Photograph Location 15. View of Wetland 4. Photograph taken facing north.

Photograph Location 15. View of Wetland 4. Photograph taken facing east.

Photograph Location 15. View of Wetland 4. Photograph taken facing south.

Photograph Location 15. View of Wetland 4. Photograph taken facing west.

Photograph Location 15. View of soil profile at wetland determination sample point location SP08.

Photograph Location 16. View of upland (maintained lawn) at wetland determination sample point location SP09. Photograph taken facing north.

Photograph Location 16. View of upland (maintained lawn) at wetland determination sample point location SP09. Photograph taken facing south.

Photograph Location 17. View of Stream 4. Photograph taken facing upstream/south.

Photograph Location 17. View of Stream 4. Photograph taken facing downstream/north.

Photograph Location 17. View of substrates of Stream 4.

Photograph Location 18. View of Stream 4. Photograph taken facing upstream/south.

Photograph Location 18. View of Stream 4. Photograph taken facing downstream/north.

Photograph Location 18. View of substrates of Stream 4.

Photograph Location 19. Representative view of an upland drainage feature within the Project area. Photograph taken facing west.

Photograph Location 20. View of Wetland 5. Photograph taken facing north.

Photograph Location 20. View of Wetland 5. Photograph taken facing east.

Photograph Location 20. View of Wetland 5. Photograph taken facing south.

Photograph Location 20. View of Wetland 5. Photograph taken facing west.

Photograph Location 20. View of soil profile at wetland determination sample point location SP10.

Photograph Location 21. View of upland (maintained lawn) at wetland determination sample point location SP11. Photograph taken facing north.

Photograph Location 21. View of upland (maintained lawn) at wetland determination sample point location SP11. Photograph taken facing south.

Photograph Location 22. Representative view of an existing culvert within the Project area. Photograph taken facing south.

Photograph Location 23. View of Wetland 5. Photograph taken facing north.

Photograph Location 23. View of Wetland 5. Photograph taken facing east.

Photograph Location 23. View of Wetland 5. Photograph taken facing south.

Photograph Location 23. View of Wetland 5. Photograph taken facing west.

Photograph Location 23. View of soil profile at wetland determination sample point location SP12.

Photograph Location 24. View of upland (maintained lawn) at wetland determination sample point location SP13. Photograph taken facing north.

Photograph Location 24. View of upland (maintained lawn) at wetland determination sample point location SP13. Photograph taken facing south.

Photograph Location 25. View of Wetland 6. Photograph taken facing north.

Photograph Location 25. View of Wetland 6. Photograph taken facing east.

Photograph Location 25. View of Wetland 6. Photograph taken facing south.

Photograph Location 25. View of Wetland 6. Photograph taken facing west.

Photograph Location 25. View of soil profile at wetland determination sample point location SP14.

Photograph Location 26. View of upland (maintained lawn) at wetland determination sample point location SP15. Photograph taken facing north.

Photograph Location 26. View of upland (maintained lawn) at wetland determination sample point location SP15. Photograph taken facing south.

Photograph Location 27. View of Wetland 6. Photograph taken facing north.

Photograph Location 27. View of Wetland 6. Photograph taken facing east.

Photograph Location 27. View of Wetland 6. Photograph taken facing south.

Photograph Location 27. View of Wetland 6. Photograph taken facing west.

Photograph Location 27. View of soil profile at wetland determination sample point location SP16.

Photograph Location 28. View of upland (maintained lawn) at wetland determination sample point location SP17. Photograph taken facing north.

Photograph Location 28. View of upland (maintained lawn) at wetland determination sample point location SP17. Photograph taken facing south.

Photograph Location 29. View of Wetland 6. Photograph taken facing north.

Photograph Location 29. View of Wetland 6. Photograph taken facing east.

Photograph Location 29. View of Wetland 6. Photograph taken facing south.

Photograph Location 29. View of Wetland 6. Photograph taken facing west.

Photograph Location 29. View of soil profile at wetland determination sample point location SP18.

Photograph Location 30. View of upland (maintained lawn) at wetland determination sample point location SP19. Photograph taken facing north.

Photograph Location 30. View of upland (maintained lawn) at wetland determination sample point location SP19. Photograph taken facing south.

Photograph Location 31. View of Stream 5. Photograph taken facing upstream/west.

Photograph Location 31. View of Stream 5. Photograph taken facing downstream/east.

Photograph Location 31. View of substrates of Stream 5.

Photograph Location 32. View of Stream 6 (Hagerman Creek). Photograph taken facing upstream/west.

Photograph Location 32. View of Stream 6 (Hagerman Creek). Photograph taken facing downstream/east.

Photograph Location 32. View of substrates of Stream 6 (Hagerman Creek).

Photograph Location 33. View of Stream 7 (Pottawatomie Creek). Photograph taken facing upstream/west.

Photograph Location 33. View of Stream 7 (Pottawatomie Creek). Photograph taken facing downstream/east.

Photograph Location 33. View of substrates of Stream 7 (Pottawatomie Creek).

Photograph Location 34. View of Wetland 7. Photograph taken facing north.

Photograph Location 34. View of Wetland 7. Photograph taken facing east.

Photograph Location 34. View of Wetland 7. Photograph taken facing south.

Photograph Location 34. View of Wetland 7. Photograph taken facing west.

Photograph Location 34. View of soil profile at wetland determination sample point location SP20.

Photograph Location 35. View of upland (new field habitat) at wetland determination sample point location SP21. Photograph taken facing north.

Photograph Location 35. View of upland (new field habitat) at wetland determination sample point location SP21. Photograph taken facing south.

Photograph Location 36. View of Wetland 8. Photograph taken facing north.

Photograph Location 36. View of Wetland 8. Photograph taken facing east.

Photograph Location 36. View of Wetland 8. Photograph taken facing south.

Photograph Location 36. View of Wetland 8. Photograph taken facing west.

Photograph Location 36. View of soil profile at wetland determination sample point location SP22.

Photograph Location 37. View of upland (maintained lawn) at wetland determination sample point location SP23. Photograph taken facing north.

Photograph Location 37. View of upland (maintained lawn) at wetland determination sample point location SP23. Photograph taken facing south.

Photograph Location 38. View of Wetland 9. Photograph taken facing north.

Photograph Location 38. View of Wetland 9. Photograph taken facing east.

Photograph Location 38. View of Wetland 9. Photograph taken facing south.

Photograph Location 38. View of Wetland 9. Photograph taken facing west.

Photograph Location 38. View of soil profile at wetland determination sample point location SP24.

Photograph Location 39. View of upland (maintained lawn) at wetland determination sample point location SP25. Photograph taken facing north.

Photograph Location 39. View of upland (maintained lawn) at wetland determination sample point location SP25. Photograph taken facing south.

Photograph Location 40. View of Wetland 9. Photograph taken facing north.

Photograph Location 40. View of Wetland 9. Photograph taken facing east.

Photograph Location 40. View of Wetland 9. Photograph taken facing south.

Photograph Location 40. View of Wetland 9. Photograph taken facing west.

Photograph Location 40. View of soil profile at wetland determination sample point location SP26.

Photograph Location 41. View of upland (maintained lawn) at wetland determination sample point location SP27. Photograph taken facing north.

Photograph Location 41. View of upland (maintained lawn) at wetland determination sample point location SP27. Photograph taken facing south.

Photograph Location 42. View of Wetland 9. Photograph taken facing north.

Photograph Location 42. View of Wetland 9. Photograph taken facing east.

Photograph Location 42. View of Wetland 9. Photograph taken facing south.

Photograph Location 42. View of Wetland 9. Photograph taken facing west.

Photograph Location 42. View of soil profile at wetland determination sample point location SP28.

Photograph Location 43. View of upland (maintained lawn) at wetland determination sample point location SP29. Photograph taken facing north.

Photograph Location 43. View of upland (maintained lawn) at wetland determination sample point location SP29. Photograph taken facing south.

Photograph Location 44. View of Stream 8 (Hoaglin Creek). Photograph taken facing upstream/southwest

Photograph Location 44. View of Stream 8 (Hoaglin Creek). Photograph taken facing downstream/northeast.

Photograph Location 44. View of substrates of Stream 8 (Hoaglin Creek).

Photograph Location 45. View of Wetland 10. Photograph taken facing north.

Photograph Location 45. View of Wetland 10. Photograph taken facing east.

Photograph Location 45. View of Wetland 10. Photograph taken facing south.

Photograph Location 45. View of Wetland 10. Photograph taken facing west.

Photograph Location 45. View of soil profile at wetland determination sample point location SP30.

Photograph Location 46. View of upland (maintained lawn habitat) at wetland determination sample point SP31. Photograph taken facing north.

Photograph Location 46. View of upland (maintained lawn habitat) at wetland determination sample point SP31. Photograph taken facing east.

Photograph Location 47. View of Wetland 10. Photograph taken facing north.

Photograph Location 47. View of Wetland 10. Photograph taken facing east.

Photograph Location 47. View of Wetland 10. Photograph taken facing south.

Photograph Location 47. View of Wetland 10. Photograph taken facing west.

Photograph Location 47. View of soil profile at wetland determination sample point location SP32.

Photograph Location 48. View of upland (maintained lawn) at wetland determination sample point location SP33. Photograph taken facing north.

Photograph Location 48. View of upland (maintained lawn) at wetland determination sample point location SP33. Photograph taken facing south.

Photograph Location 49. View of upland (maintained lawn) at wetland determination sample point location SP34. Photograph taken facing north.

Photograph Location 49. View of upland (maintained lawn) at wetland determination sample point location SP34. Photograph taken facing south.

Photograph Location 50. View of upland (maintained lawn) at wetland determination sample point location SP35. Photograph taken facing north.

Photograph Location 50. View of upland (maintained lawn) at wetland determination sample point location SP35. Photograph taken facing south.

Photograph Location 51. View of Stream 9 (Maddox Creek). Photograph taken facing upstream/west.

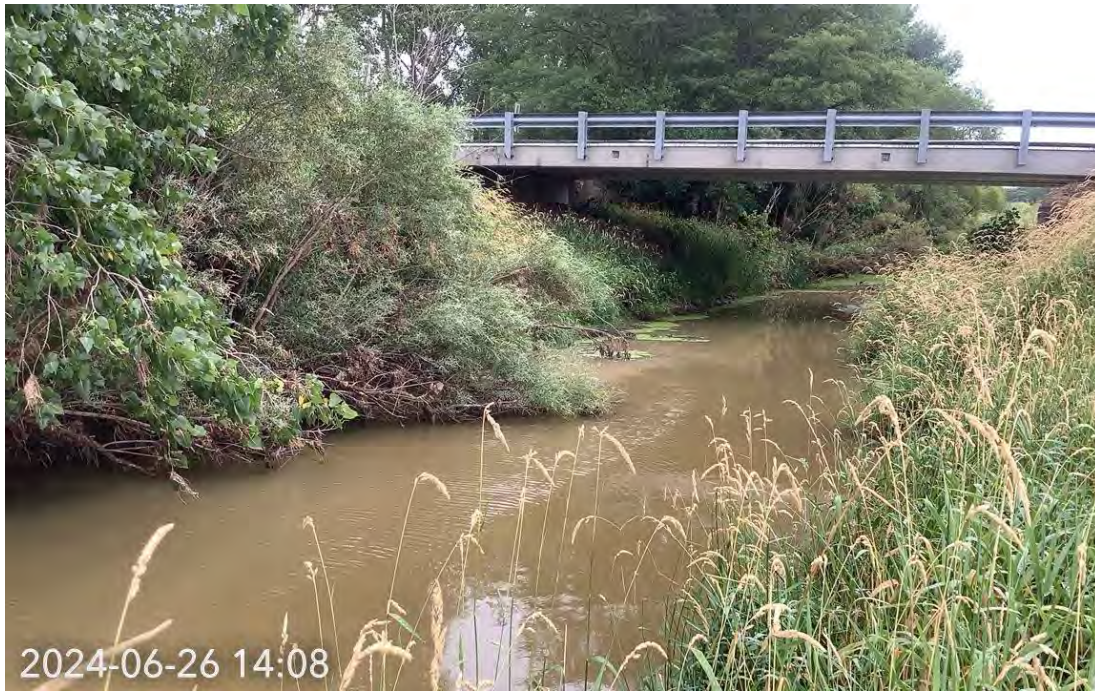

Photograph Location 51. View of Stream 9 (Maddox Creek). Photograph taken facing downstream/east.

Photograph Location 51. View of substrates at Stream 9 (Maddox Creek).

Photograph Location 52. View of upland (maintained lawn) at wetland determination sample point location SP36. Photograph taken facing north.

Photograph Location 52. View of upland (maintained lawn) at wetland determination sample point location SP36. Photograph taken facing south.

Photograph Location 53. View of upland (maintained lawn) at wetland determination sample point location SP37. Photograph taken facing north.

Photograph Location 53. View of upland (maintained lawn) at wetland determination sample point location SP37. Photograph taken facing south.

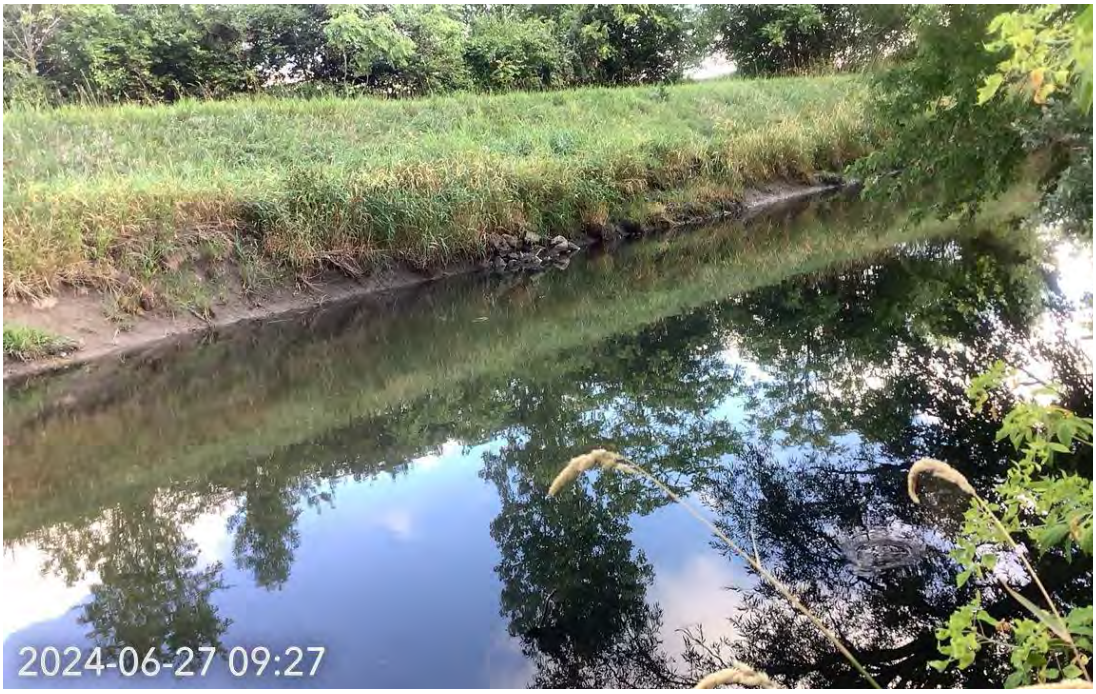

Photograph Location 54. View of Stream 10 (Town Creek). Photograph taken facing upstream/southwest.

Photograph Location 54. View of Stream 10 (Town Creek). Photograph taken facing downstream/north.

Photograph Location 54. View of substrates at Stream 10 (Town Creek).

Photograph Location 55. View of upland (maintained lawn) at wetland determination sample point location SP38. Photograph taken facing north.

Photograph Location 55. View of upland (maintained lawn) at wetland determination sample point location SP38. Photograph taken facing south.

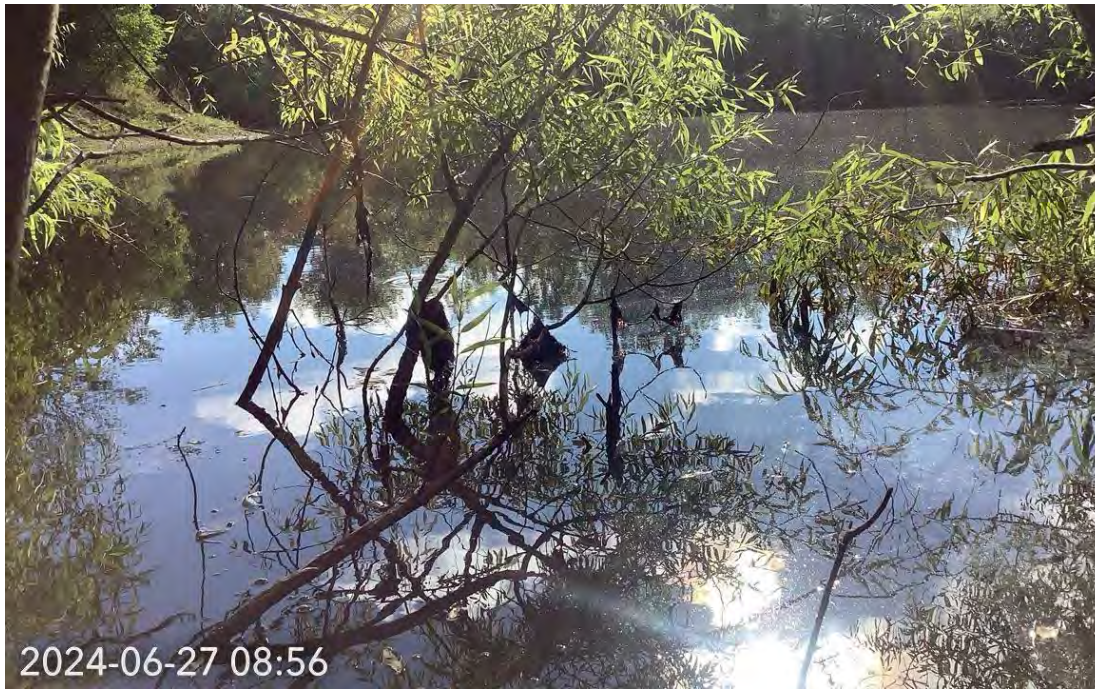

Photograph Location 56. View of Open Water 1. Photograph taken facing east.

Photograph Location 56. View of Open Water 1. Photograph taken facing south.

Photograph Location 57. View of Wetland 11. Photograph taken facing north.

Photograph Location 57. View of Wetland 11. Photograph taken facing east.

Photograph Location 57. View of Wetland 11. Photograph taken facing south.

Photograph Location 57. View of Wetland 11. Photograph taken facing west.

Photograph Location 57. View of soil profile at wetland determination sample point location SP40.

Photograph Location 58. View of upland (new field habitat) at wetland determination sample point location SP41. Photograph taken facing east.

Photograph Location 58. View of upland (new field habitat) at wetland determination sample point location SP41. Photograph taken facing west.

Photograph Location 59. View of Wetland 12. Photograph taken facing north.

Photograph Location 59. View of Wetland 12. Photograph taken facing east.

Photograph Location 59. View of Wetland 12. Photograph taken facing south.

Photograph Location 59. View of Wetland 12. Photograph taken facing west.

Photograph Location 59. View of soil profile at wetland determination sample point location SP42.

Photograph Location 60. View of upland (early successional deciduous forest habitat) at wetland determination sample point location SP43. Photograph taken facing north.

Photograph Location 60. View of upland (early successional deciduous forest habitat) at wetland determination sample point location SP43. Photograph taken facing east.

Photograph Location 61. View of Stream 11(Town Creek). Photograph taken facing upstream/south.

Photograph Location 61. View of Stream 11(Town Creek). Photograph taken facing downstream/north.

Photograph Location 61. View of substrates of Stream 11 (Town Creek).

Photograph Location 62. View of Stream 12. Photograph taken facing upstream/west.

Photograph Location 62. View of Stream 12. Photograph taken facing downstream/east.

Photograph Location 62. View of substrates of Stream 12.

Photograph Location 63. View of Stream 13. Photograph taken facing upstream/south.

Photograph Location 63. View of Stream 13. Photograph taken facing downstream/north.

Photograph Location 63. View of substrates of Stream 13.

Photograph Location 64. View of upland (new field habitat) at wetland determination sample point SP44. Photograph taken facing south.

Photograph Location 64. View of upland (new field habitat) at wetland determination sample point SP44. Photograph taken facing west.

Photograph Location 65. View of upland (new field habitat) at wetland determination sample point SP45. Photograph taken facing south.

Photograph Location 65. View of upland (new field habitat) at wetland determination sample point SP45. Photograph taken facing east.

Photograph Location 66. View of Wetland 13. Photograph taken facing north.

Photograph Location 66. View of Wetland 13. Photograph taken facing east.

Photograph Location 66. View of Wetland 13. Photograph taken facing south.

Photograph Location 66. View of Wetland 13. Photograph taken facing west.

Photograph Location 66. View of soil profile at wetland determination sample point SP46.

Photograph Location 67. View of upland (early successional deciduous forest habitat) at wetland determination sample point SP47. Photograph taken facing north.

Photograph Location 67. View of upland (early successional deciduous forest habitat) at wetland determination sample point SP47. Photograph taken facing south.

Photograph Location 68. View of upland (early successional deciduous forest habitat) at wetland determination sample point SP39. Photograph taken facing north.

Photograph Location 68. View of upland (early successional deciduous forest habitat) at wetland determination sample point SP39. Photograph taken facing south.

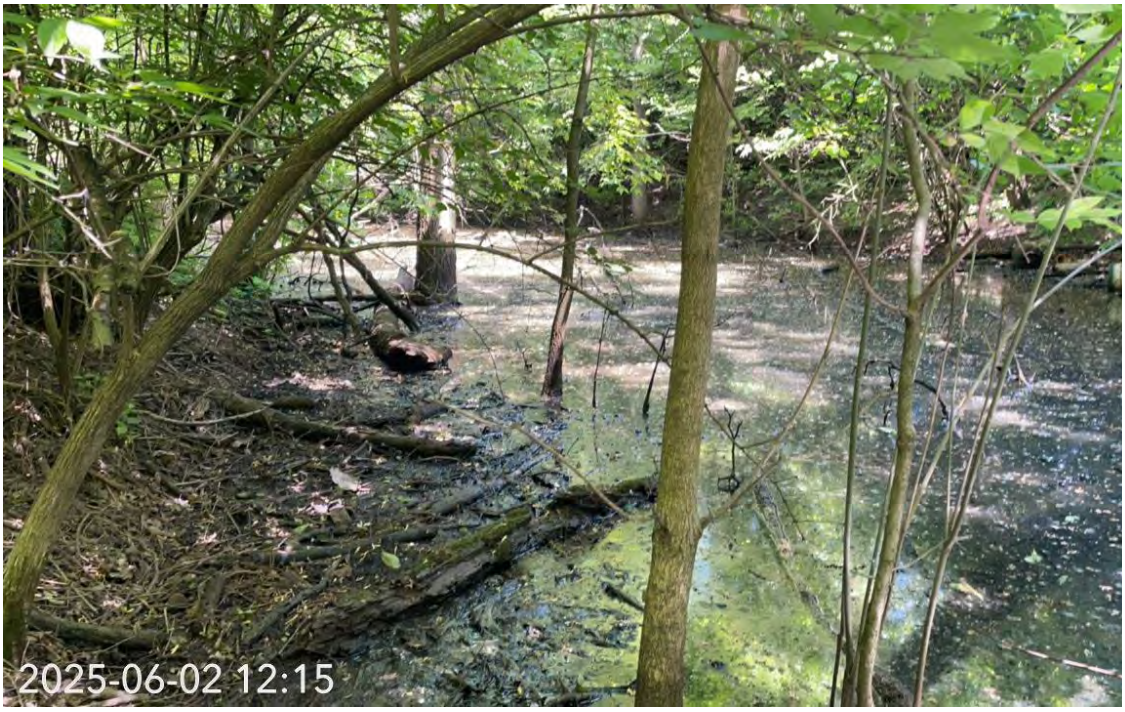

Photograph Location 69. View of Wetland 14. Photograph taken facing north.

Photograph Location 69. View of Wetland 14. Photograph taken facing east.

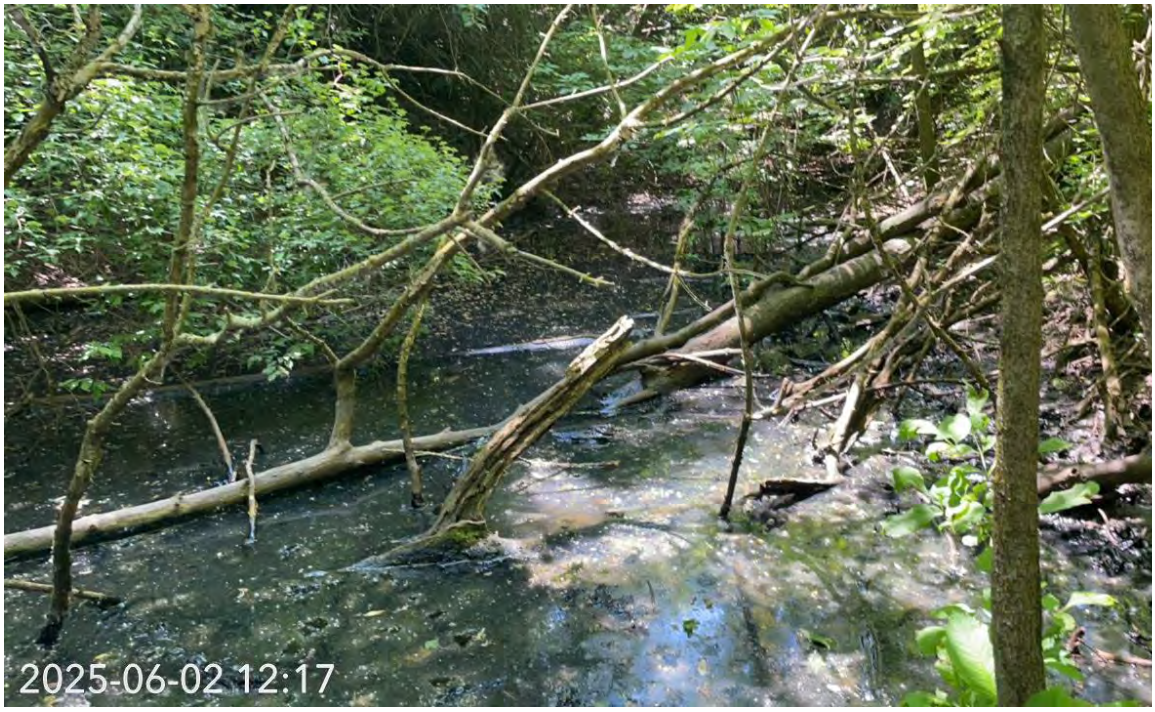

Photograph Location 69. View of Wetland 14. Photograph taken facing south.

Photograph Location 69. View of Wetland 14. Photograph taken facing west.

Photograph Location 69. View of soil profile at wetland determination sample point location SP48.

Photograph Location 70. View of upland (early successional deciduous forest habitat) at wetland determination sample point SP49. Photograph taken facing south.

Photograph Location 70. View of upland (early successional deciduous forest habitat) at wetland determination sample point SP49. Photograph taken facing south.

Photograph Location 71. View of upland (old field habitat) at wetland determination sample point SP50. Photograph taken facing north.

Photograph Location 71. View of upland (old field habitat) at wetland determination sample point SP50. Photograph taken facing east.

Photograph Location 72. Representative view of existing storm drain within the Project area.

Photograph Location 73. Representative view of culvert within the Project area. Photograph taken facing south.

C.2 HABITAT PHOTOGRAPHS

Photograph Location 1. Representative view of maintained lawn and industrial land within the Project area. Photograph taken facing west.

Photograph Location 2. Representative view of industrial land (Haviland Station) within the Project area. Photograph taken facing north.

Photograph Location 3. Representative view of maintained lawn within the Project area. Photograph taken facing north.

Photograph Location 4. Representative view of agricultural land within the Project area. Photograph taken facing south.

Photograph Location 5. Representative view of Stream 2 (Prairie Creek) and early successional deciduous forest habitat within the Project area. Photograph taken facing west.

Photograph Location 6. Representative view of maintained lawn and agricultural land within the Project area. Photograph taken facing south.

Photograph Location 7. Representative view of agricultural land within the Project area. Photograph taken facing south.

Photograph Location 8. Representative view of new field habitat within the Project area. Photograph taken facing west.

Photograph Location 9. Representative view of new field habitat within the Project area. Photograph taken facing south.

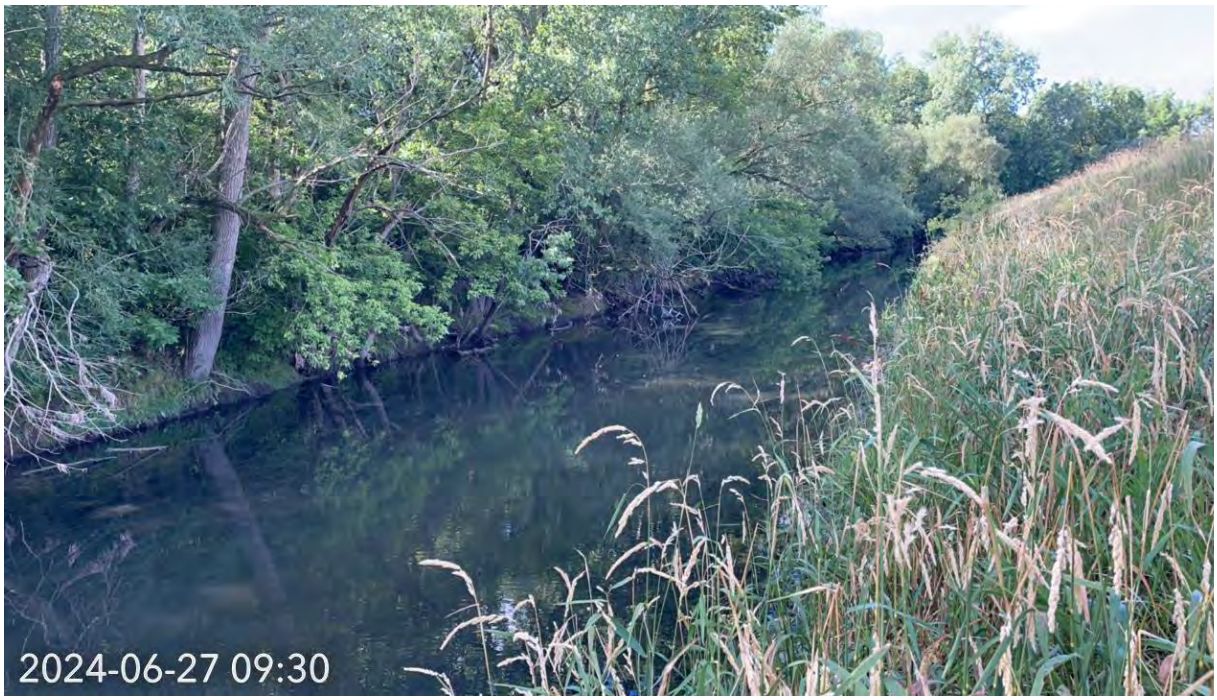

Photograph Location 10. Representative view of early successional deciduous forest habitat and Stream 10 (Town Creek) within the Project area. Photograph taken facing northwest.

Photograph Location 11. Representative view of old field habitat within the Project area. Photograph taken facing north.

Photograph Location 12. Representative view of agricultural land and existing railroad within the Project area. Photograph taken facing south.

Photograph Location 13. Representative view of industrial land within the Project area. Photograph taken facing west.

Photograph Location 14. Representative view of industrial land within the Project area. Photograph taken facing north.

Photograph Location 15. Representative view of maintained lawn within the Project area. Photograph taken facing south.

Appendix D DATA FORMS

D.1 WETLAND DETERMINATION DATA FORMS

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP01

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001N, R002E

Landform (hillside, terrace, etc.): Terrace Local relief (concave, convex, none): Linear Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 41.016245 Long: -84.592298 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ____ No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP01

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	35	Yes	FACU
2. *Trifolium pratense*	15	No	FACU
3. *Taraxacum officinale*	15	No	FACU
4. *Poa pratensis*	15	No	FACU
5. *Plantago lanceolata*	8	No	FACU
6. *Daucus carota*	5	No	UPL
7. *Symphyotrichum pilosum*	5	No	FACU
8.			
9.			
10.			
11.			
12.			
	98 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	93	x 4 =	372
UPL species	5	x 5 =	25
Column Totals:	98 (A)		397 (B)

Prevalence Index = B/A = 4.05

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP01

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-3	10YR 3/1	100					Silty Clay	
3-10	10YR 5/1	90	10YR 5/8	10			Silty Clay	Mixed fill material

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP02

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001N, R002E

Landform (hillside, terrace, etc.): Toeslope Local relief (concave, convex, none): Concave Slope %: 2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 41.011719 Long: -84.592112 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ____ No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 1

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- ____ High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- X Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 5
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 0

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP02

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Leersia oryzoides*	50	Yes	OBL
2. *Typha latifolia*	30	Yes	OBL
3. *Schoenoplectus tabernaemontani*	15	No	OBL
4. *Carex vulpinoidea*	3	No	OBL
5. *Lycopus americanus*	2	No	OBL
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	100	x 1 =	100
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		100 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP02

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-4	10YR 4/1	98	10R 3/6	2	C	PL	Mucky Loam	
4-16	10YR 4/1	90	10R 3/6	10	C	PL	Mucky Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP03

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001N, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Linear Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 41.011657 Long: -84.592139 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ____ No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP03

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	100	Yes	FACU
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species		x 1 =	
FACW species		x 2 =	
FAC species		x 3 =	
FACU species	100	x 4 =	400
UPL species		x 5 =	
Column Totals:	100 (A)		400 (B)

Prevalence Index = B/A = 4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP03

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 3/1	100					Silty Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP04

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001N, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0-2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 41.007354 Long: -84.592005 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: Wetland 2

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP04

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Carex lacustris*	85	Yes	OBL
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	85 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	85	x 1 =	85
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	85 (A)		85 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP04

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-6	10YR 4/1	95	10YR 5/8	5	C	M	Clay Loam	
6-16	10YR 4/1	85	10YR 5/8	15	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP05

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001N, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: ____

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 41.007356 Long: -84.592043 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification: ____

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ____ No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP05

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	65	Yes	FACU
2. *Trifolium pratense*	20	Yes	FACU
3. *Trifolium repens*	10	No	FACU
4. *Trifolium dubium*	3	No	FACU
5. *Taraxacum officinale*	2	No	FACU
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP05

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/3	100					Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP06

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S35, T001N, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.996387 Long: -84.592089 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes ____ No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 3

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP06

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Phalaris arundinacea*	50	Yes	FACW
2. *Lysimachia nummularia*	25	Yes	FACW
3. *Schoenoplectus fluviatilis*	10	No	OBL
4. *Lycopus americanus*	5	No	OBL
5. *Rumex crispus*	5	No	FAC
6. *Asclepias incarnata*	5	No	OBL
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	20	x 1 =	20
FACW species	75	x 2 =	150
FAC species	5	x 3 =	15
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		185 (B)

Prevalence Index = B/A = 1.85

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP06

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 5/1	85	10YR 5/8	15	D	M	Silty Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- X Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 12”

Depth (inches): ___

Hydric Soil Present? **Yes** X **No** ___

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Paulding County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP07

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S35, T001N, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 0-2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.996392 Long: -84.592167 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP07

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	95	Yes	FACU
2. *Daucus carota*	5	No	UPL
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	95	x 4 =	380
UPL species	5	x 5 =	25
Column Totals:	100 (A)		405 (B)
Prevalence Index = B/A =			4.05

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP07

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 3/1	100					Silty Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 12”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP08

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S2, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0-2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.988953 Long: -84.592044 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 4

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP08

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Leersia oryzoides*	60	Yes	OBL
2. *Carex vulpinoidea*	10	No	OBL
3. *Lycopus americanus*	10	No	OBL
4. *Asclepias incarnata*	5	No	OBL
5. *Rumex crispus*	5	No	FAC
6. *Solidago gigantea*	5	No	FACW
7. *Scirpus atrovirens*	5	No	OBL
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	90	x 1 =	90
FACW species	5	x 2 =	10
FAC species	5	x 3 =	15
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		115 (B)

Prevalence Index = B/A = 1.15

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP08

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 5/1	90	10YR 5/8	10	C	M	Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP09

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S2, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 0-2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.98897 Long: -84.592035 Datum: WGS84

Soil Map Unit Name: Latty silty clay, till substratum, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID:

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP09

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	100	Yes	FACU
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species		x 1 =	
FACW species		x 2 =	
FAC species		x 3 =	
FACU species	100	x 4 =	400
UPL species		x 5 =	
Column Totals:		(A)	(B)

Prevalence Index = B/A = 4.00

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP09

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-6	10YR 3/1	100					Clay Loam	6 inches before compaction

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Compacted after 6”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP10

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S2, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.978433 Long: -84.591983 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes ____ No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 5

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes X	No ____	Depth (inches): 10
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 10

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP10

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Leersia oryzoides*	60	Yes	OBL
2. *Carex vulpinoidea*	10	No	OBL
3. *Hordeum jubatum*	5	No	FAC
4. *Carex molesta*	5	No	FAC
5. *Panicum virgatum*	5	No	FAC
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	85 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	70	x 1 =	70
FACW species	0	x 2 =	0
FAC species	15	x 3 =	45
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	85 (A)		115 (B)

Prevalence Index = B/A = 1.35

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP10

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/2	95	10YR 5/8	5	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP11

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S2, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.978435 Long: -84.59195 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP11

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	65	Yes	FACU
2. *Dactylis glomerata*	20	Yes	FACU
3. *Poa pratensis*	15	No	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP11

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/2	100					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP12

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.974518 Long: -84.591922 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 5

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- X Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP12

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Scirpus atrovirens*	50	Yes	OBL
2. *Stachys palustris*	20	Yes	OBL
3. *Carex vulpinoidea*	15	No	OBL
4. *Asclepias incarnata*	10	No	OBL
5. *Ludwigia palustris*	5	No	OBL
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	100	x 1 =	100
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		100 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP12

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/2	90	10YR 5/8	10	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP13

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.974503 Long: -84.591921 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil X , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside shoulder- fill

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP13

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	80	Yes	FACU
2. *Bromus inermis*	20	Yes	UPL
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	80	x 4 =	320
UPL species	20	x 5 =	100
Column Totals:	100 (A)		420 (B)
Prevalence Index = B/A =			4.2

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP13

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/3	100					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP14

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.970004 Long: -84.591914 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 6

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 1
Water Table Present	Yes X	No ____	Depth (inches): 3
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 3

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP14

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schoenoplectus tabernaemontani*	60	Yes	OBL
2. *Scirpus atrovirens*	20	Yes	OBL
3. *Rumex crispus*	5	No	FAC
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	85 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	80	x 1 =	80
FACW species	0	x 2 =	0
FAC species	5	x 3 =	15
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	85 (A)		95 (B)

Prevalence Index = B/A = 1.12

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP14

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 5/2	90	10YR 5/8	8	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP15

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.970038 Long: -84.591878 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil X , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside shoulder with fill in soil

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP15

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	90	Yes	FACU
2. *Lolium perenne*	10	No	FACU
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP15

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-8	10YR 4/2	60					Silt Loam	Fill
0-8	10YR 5/2	40					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock

Depth (inches): 8

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP16

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.966939 Long: -84.591927 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 6

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- X Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- X Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP16

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Scirpus atrovirens*	75	Yes	OBL
2. *Leersia oryzoides*	15	No	OBL
3. *Carex vulpinoidea*	10	No	OBL
4. *Asclepias incarnata*	5	No	OBL
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	105 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	105	x 1 =	105
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	105 (A)		105 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP16

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	2.5Y 5/1	90	2.5Y 5/6	10	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP17

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.966984 Long: -84.591848 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP17

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	80	Yes	FACU
2. *Trifolium repens*	15	No	FACU
3. *Lolium perenne*	5	No	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP17

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/2	98	10YR 5/8	2	C	M	Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP18

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.96106 Long: -84.591856 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 6

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 1
Water Table Present	Yes X	No ____	Depth (inches): 10
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 10

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP18

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Scirpus atrovirens*	60	Yes	OBL
2. *Leersia oryzoides*	25	Yes	OBL
3. *Asclepias incarnata*	10	No	OBL
4. *Lemna minor*	5	No	OBL
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	100	x 1 =	100
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		100 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP18

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Redox Features Type[1]	Redox Features Loc[2]	Texture	Remarks
0-3	N 3/	100					Silty Clay	
3-16	10YR 5/1	95	10YR 5/8	5	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- X Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ___

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/25/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP19

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S11, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 1-2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.961113 Long: -84.591814 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: N/A

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil X , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)
Fill in soil

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP19

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	80	Yes	FACU
2. *Dactylis glomerata*	10	No	FACU
3. *Trifolium repens*	5	No	FACU
4. *Plantago lanceolata*	5	No	FACU
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP19

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-14	10YR 5/2	60	10YR 5/8	5	C	M	Silt Loam	
0-14	10YR 7/2	35					Silt Loam	Fill

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP20

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.9454 Long: -84.591813 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification: R5UBH

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 7

Remarks: (Explain alternative procedures here or in a separate report.)
Fed by ag drains

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- X Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP20

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Typha angustifolia*	50	Yes	OBL
2. *Phalaris arundinacea*	20	Yes	FACW
3. *Asclepias incarnata*	15	No	OBL
4. *Leersia oryzoides*	10	No	OBL
5. *Geum aleppicum*	5	No	FAC
6. *Schoenoplectus tabernaemontani*	5	No	OBL
7. *Carex molesta*	5	No	FAC
8.			
9.			
10.			
11.			
12.			
	110 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	80	x 1 =	80
FACW species	20	x 2 =	40
FAC species	10	x 3 =	30
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	110 (A)		150 (B)

Prevalence Index = B/A = 1.36

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP20

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 5/1	85	10YR 5/8	15	C	M	Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP21

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Hillside Local relief (concave, convex, none): Linear Slope %: 5

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.945424 Long: -84.591789 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification: R5UBH

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP21

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Bromus inermis*	70	Yes	UPL
2. *Poa pratensis*	20	Yes	FACU
3. *Asclepias syriaca*	10	No	UPL
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	20	x 4 =	80
UPL species	80	x 5 =	400
Column Totals:	100 (A)		480 (B)
Prevalence Index = B/A =			4.8

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP21

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/2	98	10YR 5/8	2	C	M	Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP22

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.94456 Long: -84.591758 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 8

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- X Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP22

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Scirpus atrovirens*	30	Yes	OBL
2. *Phalaris arundinacea*	30	Yes	FACW
3. *Leersia oryzoides*	20	Yes	OBL
4. *Asclepias syriaca*	15	No	UPL
5. *Geum aleppicum*	5	No	FAC
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 3 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	50	x 1 =	50
FACW species	30	x 2 =	60
FAC species	5	x 3 =	15
FACU species	0	x 4 =	0
UPL species	15	x 5 =	75
Column Totals:	100 (A)		200 (B)

Prevalence Index = B/A = 2

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP22

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-14	10YR 4/1	90	7.5YR 4/6	10	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP23

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Side slope Local relief (concave, convex, none): Convex Slope %: 4

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.944572 Long: -84.591698 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP23

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Bromus inermis*	80	Yes	UPL
2. *Schedonorus arundinaceus*	15	No	FACU
3. *Poa pratensis*	5	No	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	20	x 4 =	80
UPL species	80	x 5 =	400
Column Totals:	100 (A)		480 (B)
Prevalence Index = B/A =			4.8

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP23

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/2	95	7.5YR 4/6	5	C	M	Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP24

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.94059 Long: -84.591709 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 9

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes X	No ____	Depth (inches): 8
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 8

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP24

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Leersia oryzoides*	35	Yes	OBL
2. *Typha angustifolia*	30	Yes	OBL
3. *Scirpus atrovirens*	20	Yes	OBL
4. *Carex vulpinoidea*	10	No	OBL
5. *Carex granularis*	5	No	FACW
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 3 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	95	x 1 =	95
FACW species	5	x 2 =	10
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		105 (B)

Prevalence Index = B/A = 1.05

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP24

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-14	10YR 5/2	90	10YR 5/8	10	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP25

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.9406 Long: -84.591657 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP25

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Bromus inermis*	45	Yes	UPL
2. *Poa pratensis*	40	Yes	FACU
3. *Plantago lanceolata*	5	No	FACU
4. *Ambrosia artemisiifolia*	5	No	FACU
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	95 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	50	x 4 =	200
UPL species	45	x 5 =	225
Column Totals:	95 (A)		425 (B)

Prevalence Index = B/A = 4.47

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP25

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/2	95	10YR 5/8	5	C	M	Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP26

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.937343 Long: -84.59172 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 9

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch with ag field drains

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- X Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP26

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Typha angustifolia*	55	Yes	OBL
2. *Leersia oryzoides*	25	Yes	OBL
3. *Scirpus atrovirens*	20	Yes	OBL
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 3 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	100	x 1 =	100
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		100 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP26

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-14	10YR 5/2	85	10YR 5/8	15	C	M	Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP27

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: 3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.937329 Long: -84.591622 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP27

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Poa pratensis*	25	Yes	FACU
2. *Bromus inermis*	20	Yes	UPL
3. *Plantago lanceolata*	15	No	FACU
4. *Solidago altissima*	15	No	FACU
5. *Ambrosia artemisiifolia*	5	No	FACU
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	80 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	60	x 4 =	240
UPL species	20	x 5 =	100
Column Totals:	80 (A)		340 (B)

Prevalence Index = B/A = 4.25

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP27

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/1	95	10YR 5/8	5	C	M	Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP28

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.933862 Long: -84.591624 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: R4SBC

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 9

Remarks: (Explain alternative procedures here or in a separate report.)
Roadside wetland ditch with ag field drains

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- X Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP28

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Typha angustifolia*	75	Yes	OBL
2. *Carex vulpinoidea*	15	No	OBL
3. *Schoenoplectus fluviatilis*	10	No	OBL
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	100	x 1 =	100
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		100 (B)
Prevalence Index = B/A =			1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP28

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-14	10YR 5/1	90	10YR 5/8	10	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP29

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S23, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Linear Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.933862 Long: -84.591624 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP29

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Plantago lanceolata*	10	Yes	FACU
2. *Schedonorus arundinaceus*	10	Yes	FACU
3. *Poa pratensis*	10	Yes	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	30 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	30	x 4 =	120
UPL species	0	x 5 =	0
Column Totals:	30 (A)		120 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP29

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/2	100					Silt Loam	I'm

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP30

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.924666 Long: -84.591541 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID:

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 1
Water Table Present	Yes X	No ____	Depth (inches): 6
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 0

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP30

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Leersia oryzoides*	35	Yes	OBL
2. *Alisma subcordatum*	15	Yes	OBL
3. *Hordeum jubatum*	5	No	FAC
4. *Rumex crispus*	5	No	FAC
5. *Scirpus atrovirens*	5	No	OBL
6. *Lemna minor*	5	No	OBL
7. *Ranunculus sceleratus*	5	No	OBL
8.			
9.			
10.			
11.			
12.			
	75 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	65	x 1 =	65
FACW species	0	x 2 =	0
FAC species	10	x 3 =	30
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	75 (A)		95 (B)

Prevalence Index = B/A = 1.27

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- X 2 - Dominance Test is >50%
- X 3 - Prevalence Index is ≤3.0[1]
- ___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- ___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP30

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/2	75	10YR 5/6	25	D	M	Silty Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 12”

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP31

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Convex Slope %: ____

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.924668 Long: -84.591493 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: ____

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP31

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	90	Yes	FACU
2. *Trifolium repens*	10	No	FACU
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP31

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-10	10YR 3/2	100					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rocks at 10”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP32

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.917366 Long: -84.591451 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 10

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP32

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Leersia oryzoides*	50	Yes	OBL
2. *Hordeum jubatum*	20	Yes	FAC
3. *Ranunculus sceleratus*	20	Yes	OBL
4. *Poa palustris*	5	No	FACW
5. *Glyceria striata*	2	No	OBL
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	97 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 3 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	72	x 1 =	72
FACW species	5	x 2 =	10
FAC species	20	x 3 =	60
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	97 (A)		142 (B)

Prevalence Index = B/A = 1.46

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- X 2 - Dominance Test is >50%
- X 3 - Prevalence Index is ≤3.0[1]
- ___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- ___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP32

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-10	10YR 5/1	90	10YR 5/8	10	D	M	Silty Clay	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 10”

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP33

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Concave Slope %: 1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.91736 Long: -84.591416 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID:

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP33

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	100	Yes	FACU
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP33

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-12	10YR 4/3	100					Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 12

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP34

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S35, T001S, R002E

Landform (hillside, terrace, etc.): Summit Local relief (concave, convex, none): Linear Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.907582 Long: -84.591288 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID:

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP34

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	96	Yes	FACU
2. *Cirsium arvense*	2	No	FACU
3. *Trifolium repens*	2	No	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP34

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-8	10YR 3/2	100					Clay Loam	Compacted

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Compacted after 8”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP35

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S11, T002S, R002E

Landform (hillside, terrace, etc.): Dip Local relief (concave, convex, none): Concave Slope %: ____

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.886804 Long: -84.591515 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification: ____

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP35

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	70	Yes	FACU
2. *Cirsium arvense*	20	No	FACU
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	90 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	90	x 4 =	360
UPL species	0	x 5 =	0
Column Totals:	90 (A)		360 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP35

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-8	10YR 3/1	100						

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 8”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/26/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP36

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S26, T001S, R002E

Landform (hillside, terrace, etc.): Footslope Local relief (concave, convex, none): Concave Slope %: 2

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.91736 Long: -84.591416 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP36

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	70	Yes	FACU
2. *Trifolium pratense*	12	No	FACU
3. *Cichorium intybus*	8	No	FACU
4. *Plantago major*	5	No	FACU
5. *Plantago lanceolata*	5	No	FACU
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP36

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-10	10YR 3/2	95	10YR 5/8	5	D	M		

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 10”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/27/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP37

Investigator(s): Kate Bomar, Malea Casey Section, Township, Range: S12, T002S, R002E

Landform (hillside, terrace, etc.): Shoulder Local relief (concave, convex, none): Linear Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.883571 Long: -84.588433 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP37

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Poa pratensis*	50	Yes	FACU
2. *Cirsium arvense*	15	No	FACU
3. *Plantago lanceolata*	10	No	FACU
4. *Trifolium repens*	10	No	FACU
5. *Hypericum perforatum*	5	No	UPL
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	90 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	85	x 4 =	340
UPL species	5	x 5 =	25
Column Totals:	90 (A)		365 (B)

Prevalence Index = B/A = 4.06

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP37

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-10	10YR 4/1	100					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/27/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP38

Investigator(s): Aaron Kwolek, Daniel Sedlacek Section, Township, Range: S12, T002S, R002E

Landform (hillside, terrace, etc.): Rise Local relief (concave, convex, none): Linear Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.883488 Long: -84.587321 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____ No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____ No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____ No X	If yes, optional Wetland Site ID:

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP38

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	100	Yes	FACU
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP38

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-8	10YR 3/2	100					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Rock at 8”

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland-Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 12/09/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP39

Investigator(s): Malea Casey, Cyrus Chastain Section, Township, Range: S12, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.880055 Long: -84.579264 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay loam, 0 to 1 percent slopes NWI classification: none

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP39

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1. *Gleditsia triacanthos*	15	Yes	FAC
2. *Acer saccharum*	15	Yes	FACU
3. *Quercus alba*	5	No	FACU
4.			
5.			
6.			
7.			
	35 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1. *Lonicera maackii*	20	Yes	UPL
2.			
3.			
4.			
5.			
6.			
7.			
	20 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	0 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 33 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	15	x 3 =	45
FACU species	20	x 4 =	80
UPL species	20	x 5 =	100
Column Totals:	55 (A)		225 (B)

Prevalence Index = B/A = 4.09

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP39

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 3/1	100					Loamy/Clayey	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland-Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 12/09/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP40

Investigator(s): Malea Casey, Cyrus Chastain Section, Township, Range: S7, T002S, R003E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.88523 Long: -84.571363 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 11

Remarks: (Explain alternative procedures here or in a separate report.)

Recent rain in last 24 hours, flowing on surface

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 1
Water Table Present	Yes X	No ____	Depth (inches): 0
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 0

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP40

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Typha angustifolia*	100	Yes	OBL
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	100 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	100	x 1 =	100
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		100 (B)

Prevalence Index = B/A = 1

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1]
(Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP40

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	5GY 6/1	70	10YR 6/8	30	C	M	Loamy/Clayey	Prominent redox concentrations

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- X Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ___

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland-Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 12/09/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP41

Investigator(s): Malea Casey, Cyrus Chastain Section, Township, Range: S7, T002S, R003E

Landform (hillside, terrace, etc.): Terrace Local relief (concave, convex, none): Convex Slope %: 0-1

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.8852 Long: -84.571297 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID:

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP41

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	45	Yes	FACU
2. *Poa pratensis*	30	Yes	FACU
3. *Setaria faberi*	15	No	FACU
4. *Cirsium arvense*	15	No	FACU
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	105 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	100	x 4 =	400
UPL species	0	x 5 =	0
Column Totals:	100 (A)		400 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP41

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/1	100					Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland-Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 12/09/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP42

Investigator(s): Malea Casey, Cyrus Chastain Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891612 Long: -84.585114 Datum: WGS84

Soil Map Unit Name: Nappanee silty clay loam, 2 to 6 percent slopes, moderately eroded NWI classification: PSS1A

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X No ____	If yes, optional Wetland Site ID: W12

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- X Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- X Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP42

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1. *Acer saccharinum*	15	Yes	FACW
2. *Carya laciniosa*	15	Yes	FACW
3. *Populus deltoides*	10	Yes	FAC
4. *Ulmus americana*	5	No	FACW
5.			
6.			
7.			
	45 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1. *Cornus sericea*	35	Yes	FACW
2.			
3.			
4.			
5.			
6.			
7.			
	35 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Dulichium arundinaceum*	10	Yes	OBL
2. *Persicaria longiseta*	10	Yes	FAC
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	20 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 6 (A)

Total Number of Dominant Species Across All Strata: 6 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	10	x 1 =	10
FACW species	70	x 2 =	140
FAC species	20	x 3 =	60
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	100 (A)		210 (B)
Prevalence Index = B/A =			2.1

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- X 2 - Dominance Test is >50%
- X 3 - Prevalence Index is ≤3.0[1]
- ___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- ___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP42

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 2/1	90	7.5YR 5/6	10	C	M	Silt Loam	Prominent redox concentrations

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- X Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland-Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 12/09/2024

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP43

Investigator(s): Malea Casey, Cyrus Chastain Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Rise Local relief (concave, convex, none): Convex Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891685 Long: -84.585191 Datum: WGS84

Soil Map Unit Name: Nappanee silty clay loam, 2 to 6 percent slopes, moderately eroded NWI classification: PSS1A

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP43

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1. *Prunus serotina*	10	Yes	FACU
2.			
3.			
4.			
5.			
6.			
7.			
	10 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1. *Lonicera maackii*	50	Yes	UPL
2.			
3.			
4.			
5.			
6.			
7.			
	50 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Lonicera maackii*	35	Yes	UPL
2. *Geum canadense*	10	Yes	FAC
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	45 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 4 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 25 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	10	x 3 =	30
FACU species	10	x 4 =	40
UPL species	85	x 5 =	425
Column Totals:	105 (A)		495 (B)
Prevalence Index = B/A =			4.71

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP43

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix Color (moist)	Matrix %	Redox Features Color (moist)	Redox Features %	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/1	95	10YR 5/6	5	C	M	Clay Loam	Prominent redox concentrations

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ____

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 04/16/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP44

Investigator(s): C Chastain A Dunn Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 5

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891973 Long: -84.578331 Datum: WGS84

Soil Map Unit Name: Hoytville silty clay loam, 0 to 1 percent slopes NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil X , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes ____ No X

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 2

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP44

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	80	Yes	FACU
2. *Daucus carota*	5	No	UPL
3. *Symphyotrichum pilosum*	5	No	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	90 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	85	x 4 =	340
UPL species	5	x 5 =	25
Column Totals:	90 (A)		365 (B)
Prevalence Index = B/A =			4.06

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP44

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 5/2	40					Clay Loam	
0-16	10YR 5/8	20					Clay Loam	
0-16	10YR 3/6	40					Clay Loam	Fill

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 04/16/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP45

Investigator(s): C Chastain A Dunn Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891932 Long: -84.581211 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation X , Soil X , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes ____ No X

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 0

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants.

Sampling Point: SP45

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Typha angustifolia*	50	Yes	OBL
2. *Schedonorus arundinaceus*	45	Yes	FACU
3. *Symphyotrichum pilosum*	5	No	FACU
4. *Trifolium repens*	5	No	FACU
5. *Oenothera biennis*	5	No	FACU
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	110 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 1 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 50 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	50	x 1 =	50
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	60	x 4 =	240
UPL species	0	x 5 =	0
Column Totals:	110 (A)		290 (B)
Prevalence Index = B/A =			2.64

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- X 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No**

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP45

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 2/1	100					Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 04/16/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP46

Investigator(s): C Chastain A Dunn Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 5

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891844 Long: -84.581498 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation X , Soil X , or Hydrology X significantly disturbed? Are "Normal Circumstances" present? Yes ____ No X

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: CCADW01

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- X High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 3
Water Table Present	Yes X	No ____	Depth (inches): 0
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 0

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP46

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Panicum dichotomiflorum*	70	Yes	FACW
2. *Setaria faberi*	25	Yes	FACU
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	95 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 2 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	70	x 2 =	140
FAC species	0	x 3 =	0
FACU species	25	x 4 =	100
UPL species	0	x 5 =	0
Column Totals:	95 (A)		240 (B)
Prevalence Index = B/A =			2.53

Hydrophytic Vegetation Indicators:

X 1 - Rapid Test for Hydrophytic Vegetation

X 2 - Dominance Test is >50%

X 3 - Prevalence Index is ≤3.0[1]

___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)

___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP46

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-6	10YR 2/2	80					Silt Loam	
0-6	10YR 5/3	20					Clay Loam	Fill
6-16	10YR 3/2	95	10YR 4/6	5	C	M	Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- X Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ___

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland - Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 04/16/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP47

Investigator(s): C Chastain A Dunn Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Floodplain Local relief (concave, convex, none): Linear Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891888 Long: -84.583427 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil X , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes ____ No X

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP47

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1. *Populus deltoides*	20	Yes	FAC
2. *Acer negundo*	15	Yes	FAC
3.			
4.			
5.			
6.			
7.			
	35	= Total Cover	

Sapling/Shrub Stratum (Plot size: 15 ft)			
1. *Acer negundo*	20	Yes	FAC
2.			
3.			
4.			
5.			
6.			
7.			
	20	= Total Cover	

Herb Stratum (Plot size: 5 ft)			
1. *Elymus virginicus*	45	Yes	FACW
2. *Conium maculatum*	10	No	FACW
3. *Ficaria verna*	10	No	FACW
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	65	= Total Cover	

Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0	= Total Cover	

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 4 (A)

Total Number of Dominant Species Across All Strata: 4 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	65	x 2 =	130
FAC species	55	x 3 =	165
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	120 (A)		295 (B)
Prevalence Index = B/A =			2.46

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- X 2 - Dominance Test is >50%
- X 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No**

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP47

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 2/2	100					Silt Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland – Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/02/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc State: OH Sampling Point: SP48

Investigator(s): M Casey Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.892293 Long: -84.58258 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes X	No ____	**Is the Sampled Area**
Hydric Soil Present?	Yes X	No ____	**within a Wetland?** **Yes** X **No** ____
Wetland Hydrology Present?	Yes X	No ____	If yes, optional Wetland Site ID: Wetland 14

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- X Surface Water (A1)
- ____ High Water Table (A2)
- X Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- X Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- X FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes X	No ____	Depth (inches): 12
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes X	No ____	Depth (inches): 0

Wetland Hydrology Present? **Yes** X **No** ____

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP48

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1. *Celtis occidentalis*	20	Yes	FAC
2. *Salix nigra*	10	No	OBL
3.			
4.			
5.			
6.			
7.			
	30	= Total Cover	

Sapling/Shrub Stratum (Plot size: 15 ft)			
1. *Fraxinus pennsylvanica*	25	Yes	FACW
2. *Cornus racemosa*	5	No	FAC
3.			
4.			
5.			
6.			
7.			
	30	= Total Cover	

Herb Stratum (Plot size: 5 ft)			
1. *Toxicodendron radicans*	15	Yes	FAC
2.			
3.			
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	15	= Total Cover	

Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0	= Total Cover	

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 3 (A)

Total Number of Dominant Species Across All Strata: 3 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 100 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	10	x 1 =	10
FACW species	25	x 2 =	50
FAC species	40	x 3 =	120
FACU species	0	x 4 =	0
UPL species	0	x 5 =	0
Column Totals:	75 (A)		180 (B)
Prevalence Index = B/A =			2.4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- X 2 - Dominance Test is >50%
- X 3 - Prevalence Index is ≤3.0[1]
- ___ 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- ___ Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** X **No** ___

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP48

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-3	10YR 3/1	100					Mucky Loam	
3-16	10YR 4/1	90	5YR 5/8	10	C	M	Silty Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- X Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** X **No** ___

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland-Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/02/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc State: OH Sampling Point: SP49

Investigator(s): M Casey Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Side slope Local relief (concave, convex, none): Convex Slope %: 2-3

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.89225 Long: -84.582627 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: ____

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- ____ Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP49

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1. *Celtis occidentalis*	20	Yes	FAC
2. *Crataegus coccinea*	10	Yes	UPL
3.			
4.			
5.			
6.			
7.			
	30	= Total Cover	

Sapling/Shrub Stratum (Plot size: 15 ft)			
1. *Lonicera maackii*	80	Yes	UPL
2.			
3.			
4.			
5.			
6.			
7.			
	80	= Total Cover	

Herb Stratum (Plot size: 5 ft)			
1. *Circaea canadensis*	20	Yes	FACU
2. *Lonicera maackii*	15	Yes	UPL
3. *Sanicula odorata*	15	Yes	FAC
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	50	= Total Cover	

Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0	= Total Cover	

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 2 (A)

Total Number of Dominant Species Across All Strata: 6 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 33 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	35	x 3 =	105
FACU species	20	x 4 =	80
UPL species	105	x 5 =	525
Column Totals:	160 (A)		710 (B)
Prevalence Index = B/A =			4.44

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP49

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-16	10YR 4/1	100					Silty Clay Loam	

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____

Depth (inches): _____

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

WETLAND DETERMINATION DATA FORM – Northcentral and Northeast Region

Project/Site: Haviland – Van Wert 69 kV Line Rebuild Project City/County: Van Wert County Sampling Date: 06/02/2025

Applicant/Owner: AEP Ohio Transmission Company, Inc. State: OH Sampling Point: SP50

Investigator(s): M Casey Section, Township, Range: S1, T002S, R002E

Landform (hillside, terrace, etc.): Depression Local relief (concave, convex, none): Concave Slope %: 0

Subregion (LRR or MLRA): LRR L, MLRA 99 Lat: 40.891558 Long: -84.584015 Datum: WGS84

Soil Map Unit Name: Wabasha silty clay loam NWI classification:

Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No ____ (If no, explain in Remarks.)

Are Vegetation ____ , Soil ____ , or Hydrology ____ significantly disturbed? Are "Normal Circumstances" present? Yes X No ____

Are Vegetation ____ , Soil ____ , or Hydrology ____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes ____	No X	**Is the Sampled Area**
Hydric Soil Present?	Yes ____	No X	**within a Wetland?** **Yes** ____ **No** X
Wetland Hydrology Present?	Yes ____	No X	If yes, optional Wetland Site ID: NA

Remarks: (Explain alternative procedures here or in a separate report.)

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)

- ____ Surface Water (A1)
- ____ High Water Table (A2)
- ____ Saturation (A3)
- ____ Water Marks (B1)
- ____ Sediment Deposits (B2)
- ____ Drift Deposits (B3)
- ____ Algal Mat or Crust (B4)
- ____ Iron Deposits (B5)
- ____ Inundation Visible on Aerial Imagery (B7)
- ____ Sparsely Vegetated Concave Surface (B8)
- ____ Water-Stained Leaves (B9)
- ____ Aquatic Fauna (B13)
- ____ Marl Deposits (B15)
- ____ Hydrogen Sulfide Odor (C1)
- ____ Oxidized Rhizospheres on Living Roots (C3)
- ____ Presence of Reduced Iron (C4)
- ____ Recent Iron Reduction in Tilled Soils (C6)
- ____ Thin Muck Surface (C7)
- ____ Other (Explain in Remarks)

Secondary Indicators (minimum of two required)

- ____ Surface Soil Cracks (B6)
- ____ Drainage Patterns (B10)
- ____ Moss Trim Lines (B16)
- ____ Dry-Season Water Table (C2)
- ____ Crayfish Burrows (C8)
- ____ Saturation Visible on Aerial Imagery (C9)
- ____ Stunted or Stressed Plants (D1)
- X Geomorphic Position (D2)
- ____ Shallow Aquitard (D3)
- ____ Microtopographic Relief (D4)
- ____ FAC-Neutral Test (D5)

Field Observations:

Surface Water Present	Yes ____	No X	Depth (inches): ____
Water Table Present	Yes ____	No X	Depth (inches): ____
Saturation Present (includes capillary fringe)	Yes ____	No X	Depth (inches): ____

Wetland Hydrology Present? **Yes** ____ **No** X

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

Remarks:

VEGETATION – Use scientific names of plants. Sampling Point: SP50

Tree Stratum (Plot size: 30 ft)	Absolute % Cover	Dominant Species	Indicator Status
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Sapling/Shrub Stratum (Plot size: 15 ft)			
1.			
2.			
3.			
4.			
5.			
6.			
7.			
	0 = Total Cover		
Herb Stratum (Plot size: 5 ft)			
1. *Schedonorus arundinaceus*	75	Yes	FACU
2. *Dipsacus fullonum*	15	No	FACU
3. *Melilotus officinalis*	15	No	FACU
4.			
5.			
6.			
7.			
8.			
9.			
10.			
11.			
12.			
	105 = Total Cover		
Woody Vine Stratum (Plot size: 30 ft)			
1.			
2.			
3.			
4.			
	0 = Total Cover		

Dominance Test worksheet:

Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)

Total Number of Dominant Species Across All Strata: 1 (B)

Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:		Multiply by:	
OBL species	0	x 1 =	0
FACW species	0	x 2 =	0
FAC species	0	x 3 =	0
FACU species	105	x 4 =	420
UPL species	0	x 5 =	0
Column Totals:	105 (A)		420 (B)
Prevalence Index = B/A =			4

Hydrophytic Vegetation Indicators:

- 1 - Rapid Test for Hydrophytic Vegetation
- 2 - Dominance Test is >50%
- 3 - Prevalence Index is ≤3.0[1]
- 4 - Morphological Adaptations[1] (Provide supporting data in Remarks or on a separate sheet)
- Problematic Hydrophytic Vegetation[1] (Explain)

[1]Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Definitions of Vegetation Strata:

Tree – Woody plants 3 in. (7.6 cm) or more in diameter at breast height (DBH), regardless of height.

Sapling/shrub – Woody plants less than 3 in. DBH and greater than or equal to 3.28 ft (1 m) tall.

Herb – All herbaceous (non-woody) plants, regardless of size, and woody plants less than 3.28 ft tall.

Woody vines – All woody vines greater than 3.28 ft in height.

Hydrophytic Vegetation Present? **Yes** ____ **No** X

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: SP50

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth	Matrix		Redox Features					
(inches)	Color (moist)	%	Color (moist)	%	Type[1]	Loc[2]	Texture	Remarks
0-8	10YR 2/1	100					Silt Loam	Wood and snail shells mixed in

[1]Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. [2]Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

- ___ Histosol (A1)
- ___ Histic Epipedon (A2)
- ___ Black Histic (A3)
- ___ Hydrogen Sulfide (A4)
- ___ Stratified Layers (A5)
- ___ Depleted Below Dark Surface (A11)
- ___ Thick Dark Surface (A12)
- ___ Sandy Mucky Mineral (S1)
- ___ Sandy Gleyed Matrix (S4)
- ___ Sandy Redox (S5)
- ___ Stripped Matrix (S6)
- ___ Dark Surface (S7)
- ___ Polyvalue Below Surface (S8) (**LRR R, MLRA 149B**)
- ___ Thin Dark Surface (S9) (**LRR R, MLRA 149B**)
- ___ High Chroma Sands (S11) (**LRR K, L)**
- ___ Loamy Mucky Mineral (F1) (**LRR K, L**)
- ___ Loamy Gleyed Matrix (F2)
- ___ Depleted Matrix (F3)
- ___ Redox Dark Surface (F6)
- ___ Depleted Dark Surface (F7)
- ___ Redox Depressions (F8)
- ___ Marl (F10) (**LRR K, L**)

Indicators for Problematic Hydric Soils[3]:

- ___ 2 cm Muck (A10) (**LRR K, L, MLRA 149B**)
- ___ Coast Prairie Redox (A16) (**LRR K, L, R**)
- ___ 5 cm Mucky Peat or Peat (S3) (**LRR K, L, R**)
- ___ Polyvalue Below Surface (S8) (**LRR K, L**)
- ___ Thin Dark Surface (S9) (**LRR K, L**)
- ___ Iron-Manganese Masses (F12) (**LRR K, L, R**)
- ___ Piedmont Floodplain Soils (F19) (**MLRA 149B**)
- ___ Mesic Spodic (TA6) (**MLRA 144A, 145, 149B**)
- ___ Red Parent Material (F21)
- ___ Very Shallow Dark Surface (F22)
- ___ Other (Explain in Remarks)

[3]Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: Gravel

Depth (inches): 8

Hydric Soil Present? **Yes** ____ **No** X

Remarks:

I

D.2 ORAM DATA FORMS

Background Information

Name:	Aaron Kwolek
Date:	6/25/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Aaron.Kwolek@stantec.com
Name of Wetland:	Wetland 1
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

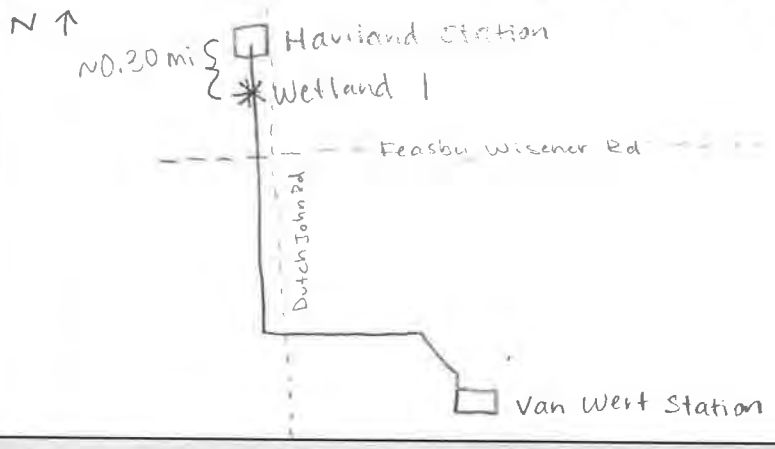

Lat/Long or UTM Coordinate	41.011701, -84.592212
USGS Quad Name	Latty
County	Paulding
Township	T1N R2E
Section and Subsection	S26
Hydrologic Unit Code	4100007070 3
Site Visit	6/25/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Latty silty clay, till substratum 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 1	
Wetland Size (acres, hectares): 0.01 ac within Project area	

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

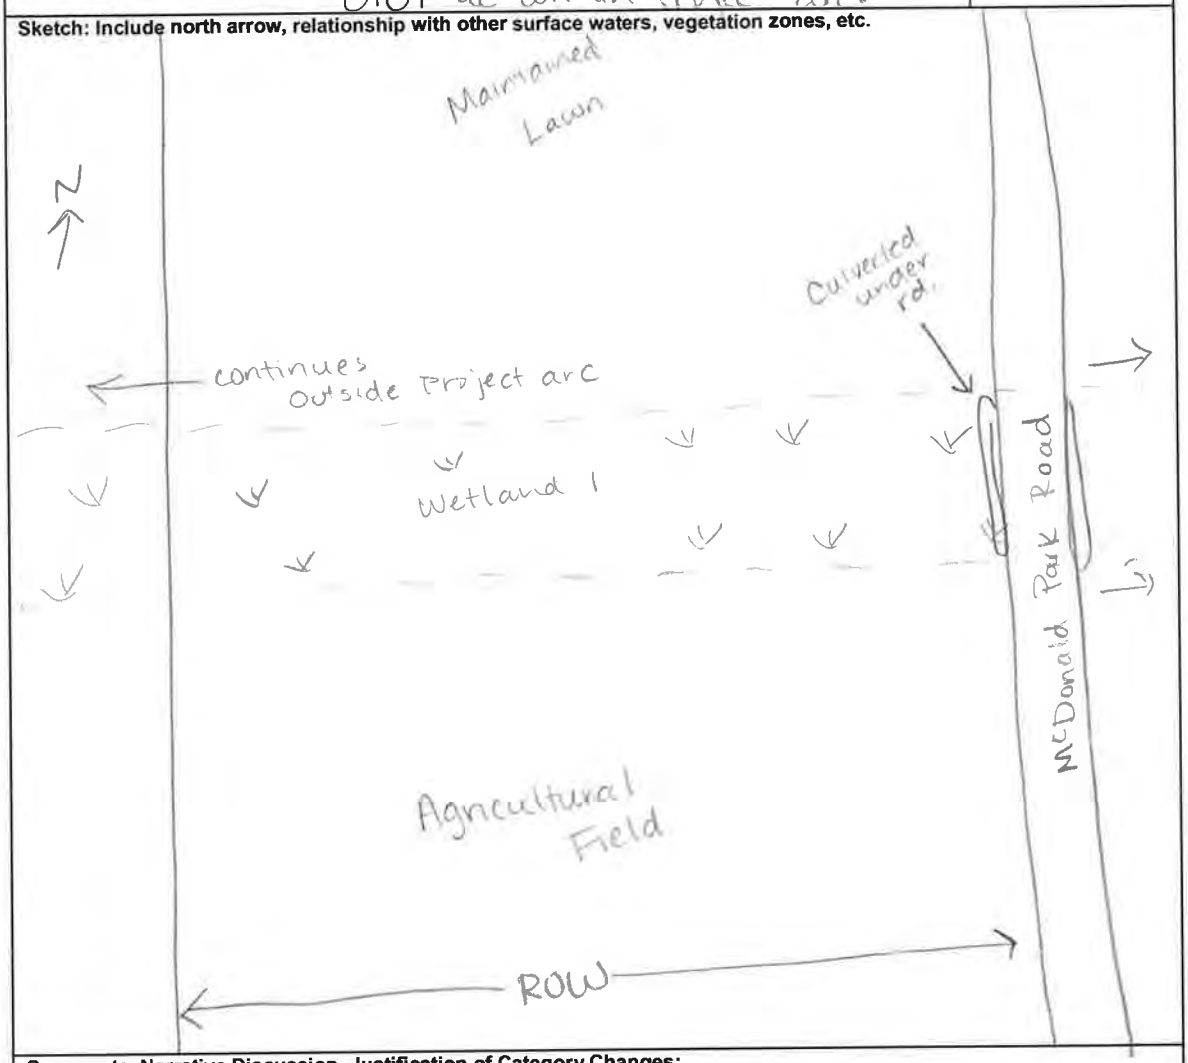

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 17	**Category:** 1

Wetland 1

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc , are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 1

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis,* or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland Go to Question 8b	NO Go to Question 8b

Wetland 1

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland 1

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

AKDS v01

ORAM v. 5.0 Field Form Quantitative Rating

Site: Wetland 1	Rater(s): AJK	Date: 6/25/24

Metric 1. Wetland Area (size).

max 6 pts. | subtotal: 2 | 2

Select one size class and assign score.

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [x] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts. | subtotal: 1 | 3

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [x] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts. | subtotal: 8 | 11

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [x] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [x] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [ ] <0.4m (<15.7in) (1)

3d Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [x] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [ ] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts. | subtotal: 3 | 14

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [x] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [x] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [x] dredging
- [ ] farming
- [ ] nutrient enrichment

subtotal this page: 14

last revised 1 February 2001 jjm

Site: Wetland 1	Rater(s): AJK	Date: 6/25/24

14
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts.) | 14 (subtotal)

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

3 (max 20 pts.) | 17 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [/] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [/] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

17

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 1

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	8	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	3	
	TOTAL SCORE	17	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Aaron Kwolek.
Date:	6/25/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Aaron.Kwolek@stantec.com
Name of Wetland:	Wetland 2
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

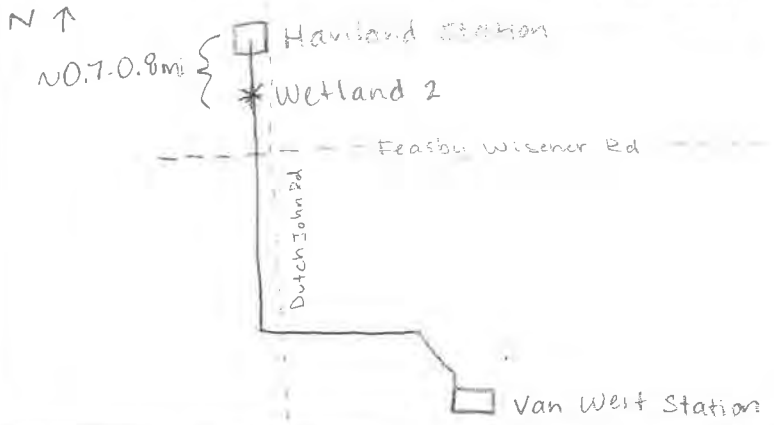

Lat/Long or UTM Coordinate	41.004334, -84.592153
USGS Quad Name	Latty
County	Paulding
Township	T1N R2E
Section and Subsection	S35 | S24
Hydrologic Unit Code	4100007070 3
Site Visit	6/25/2024
National Wetland Inventory Map	Adjacent to R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Latty silty clay, till substratum, 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 2

Wetland Size (acres, hectares): ~0.12 ac within Project area

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

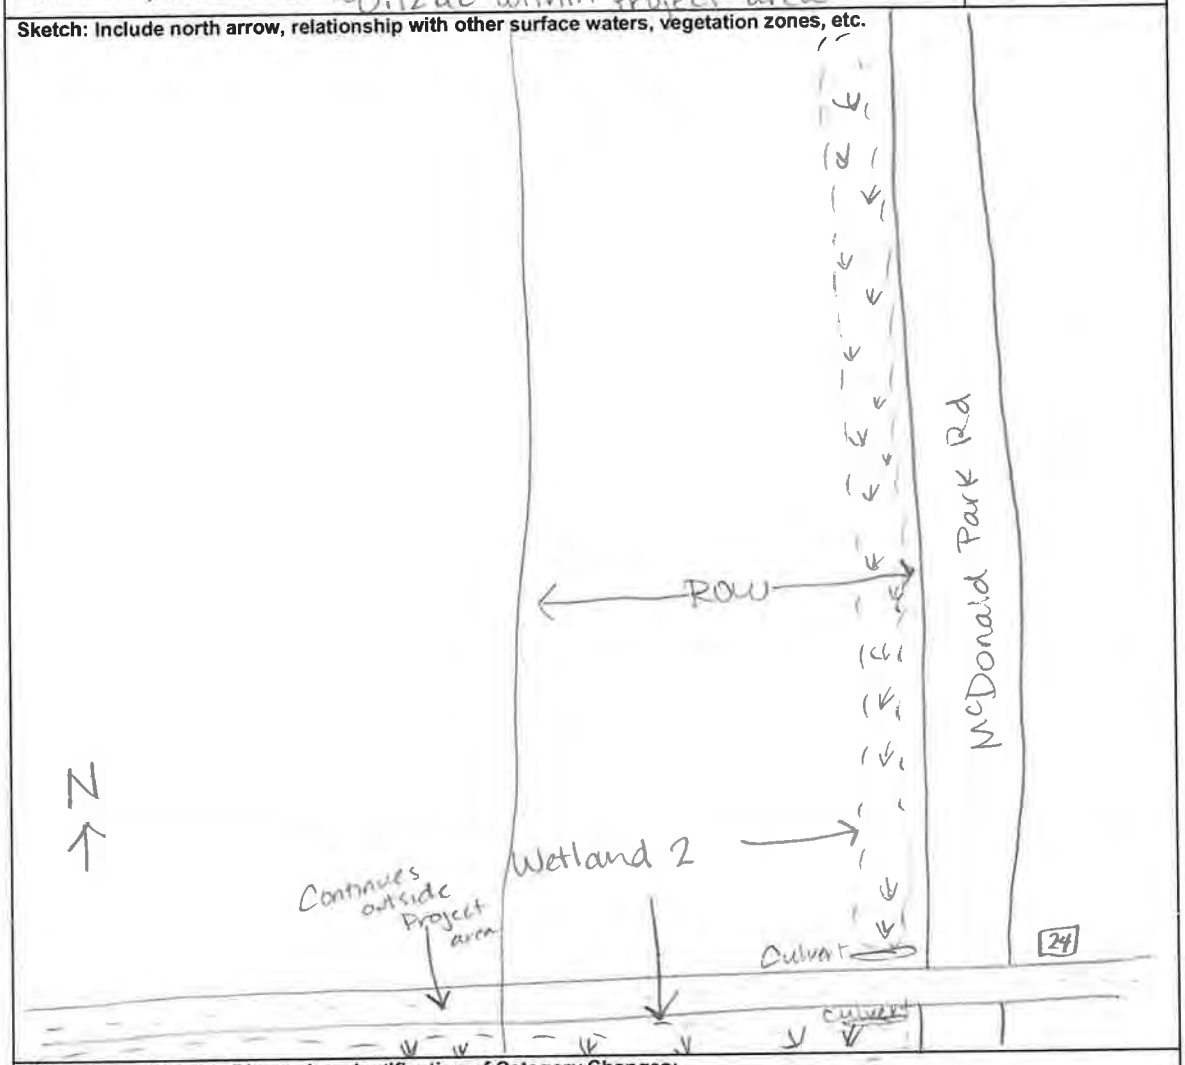

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 12 **Category:** 1

Wetland 2

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 2

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5 5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland Go to Question 8b	NO Go to Question 8b

Wetland 2

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland 2

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

AKDS WO2

Site: Wetland 2	Rater(s): A. Kwolek	Date: 6/25/24

Metric 1. Wetland Area (size).

max 6 pts: 1 | subtotal: 1

Select one size class and assign score
- [ ] >50 acres (>20 2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [ ] 0.3 to <3 acres (0.12 to <1 2ha) (2pts)
- [x] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts: 1 | subtotal: 2

2a. Calculate average buffer width. Select only one and assign score. Do not double check.
- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [x] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.
- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts: 6 | subtotal: 8

3a. Sources of Water. Score all that apply.
- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply
- [ ] 100 year floodplain (1)
- [x] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.
- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [x] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.
- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [x] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.
- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed
- [x] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [ ] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts: 3 | subtotal: 11

4a. Substrate disturbance. Score one or double check and average.
- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [x] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.
- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [x] Poor (1)

4c. Habitat alteration. Score one or double check and average.
- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed
- [x] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [x] sedimentation
- [x] dredging
- [ ] farming
- [ ] nutrient enrichment

11
subtotal this page

last revised 1 February 2001 jjm

Site: Wetland 2	Rater(s): A. Kwolek	Date: 6/25/24

11
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts) | 11 (subtotal)

Check all that apply and score as indicated

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

1 (max 20 pts) | 12 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [/] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [/] Nearly absent <5% cover (0)
- [ ] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [ ] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

12

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 2

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	1	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	6	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	1	
	TOTAL SCORE	12	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland 2

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category			
Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Aaron Kwolek
Date:	6/25/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Aaron.Kwolek@stantec.com
Name of Wetland:	Wetland 3
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

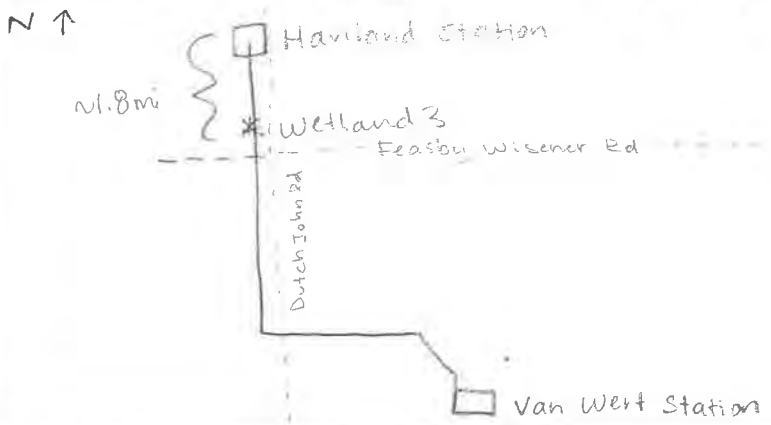

Lat/Long or UTM Coordinate	40.993481, -84.592012
USGS Quad Name	Scott
County	Paulding
Township	T1N R2E
Section and Subsection	S35
Hydrologic Unit Code	4100070703
Site Visit	6/25/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Latty silty clay, till substratum, 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 3	
Wetland Size (acres, hectares): 1.14 ac	

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

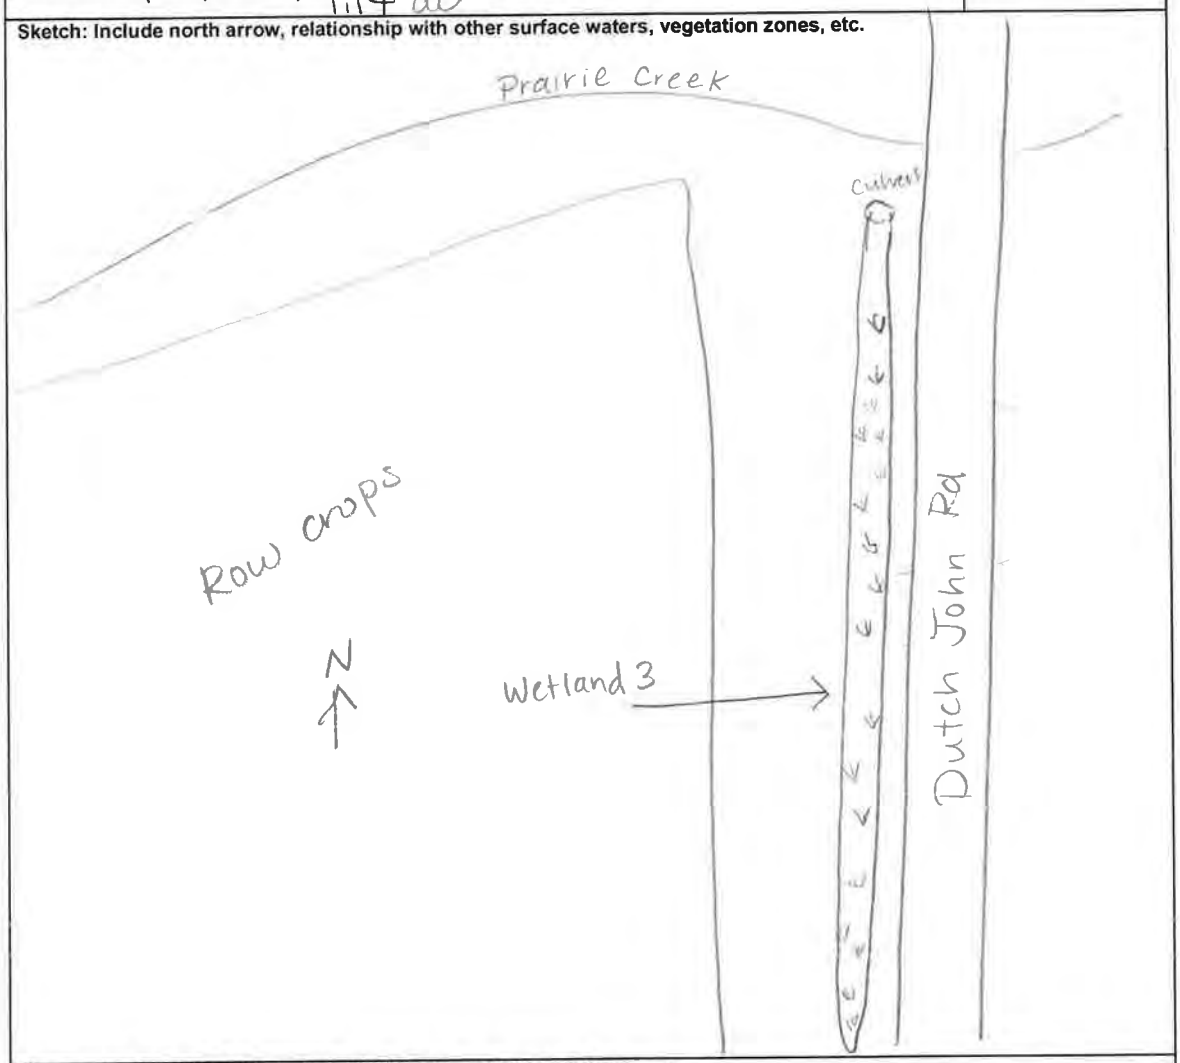

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 10	**Category:** 1

Wetland 3

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 3

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	NO Go to Question 8b

Wetland 3

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland 3

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

ORAM v. 5.0 Field Form Quantitative Rating

4KDS403

Site: Wetland 3	Rater(s): AJK	Date: 6/25/24

Metric 1. Wetland Area (size).

2 (max 6 pts) | 2 (subtotal)

Select one size class and assign score

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [x] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

1 (max 14 pts.) | 3 (subtotal)

2a. Calculate average buffer width. Select only one and assign score. Do not double check

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [x] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

7 (max 30 pts) | 10 (subtotal)

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b Connectivity. Score all that apply

- [ ] 100 year floodplain (1)
- [x] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [x] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [ ] <0.4m (<15.7in) (1)

3d Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [x] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [x] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [x] point source (nonstormwater)
- [x] filling/grading
- [x] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

3 (max 20 pts.) | 13 (subtotal)

4a. Substrate disturbance. Score one or double check and average

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [x] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [x] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [x] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [x] sedimentation
- [x] dredging
- [ ] farming
- [ ] nutrient enrichment

13 (subtotal this page)

last revised 1 February 2001 jjm

Site: Wetland 3 | **Rater(s):** A. Kwolek | **Date:** 10/25/24

13
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts) | 13 (subtotal)

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

-3 (max 20 pts) | 10 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [/] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [/] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [ ] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [1] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [ ] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

10

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 3

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	7	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	-3	
	TOTAL SCORE	10	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland 3

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category			
Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Kate Bomar
Date:	6/25/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	kate.bomar@stantec.com
Name of Wetland:	Wetland 4
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

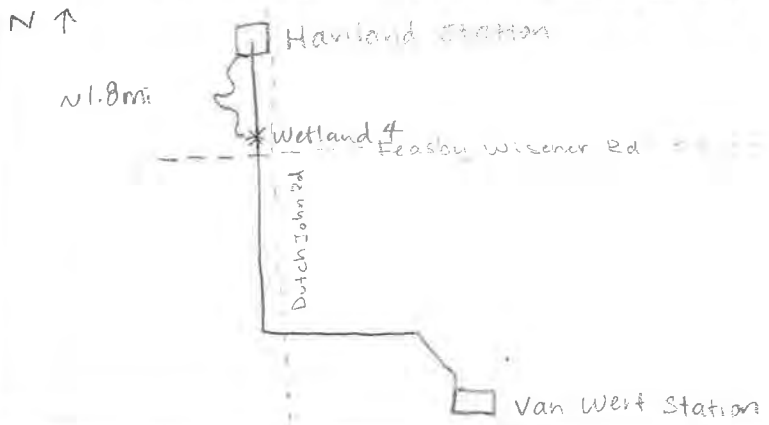

Lat/Long or UTM Coordinate	40.945328, -84.592030
USGS Quad Name	Scott
County	Van Wert
Township	T1S, R2E
Section and Subsection	S23, S24, S2
Hydrologic Unit Code	4100007073
Site Visit	6/25/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Latty silty clay, till substratum 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 4

Wetland Size (acres, hectares): 0.163 ac within project area

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

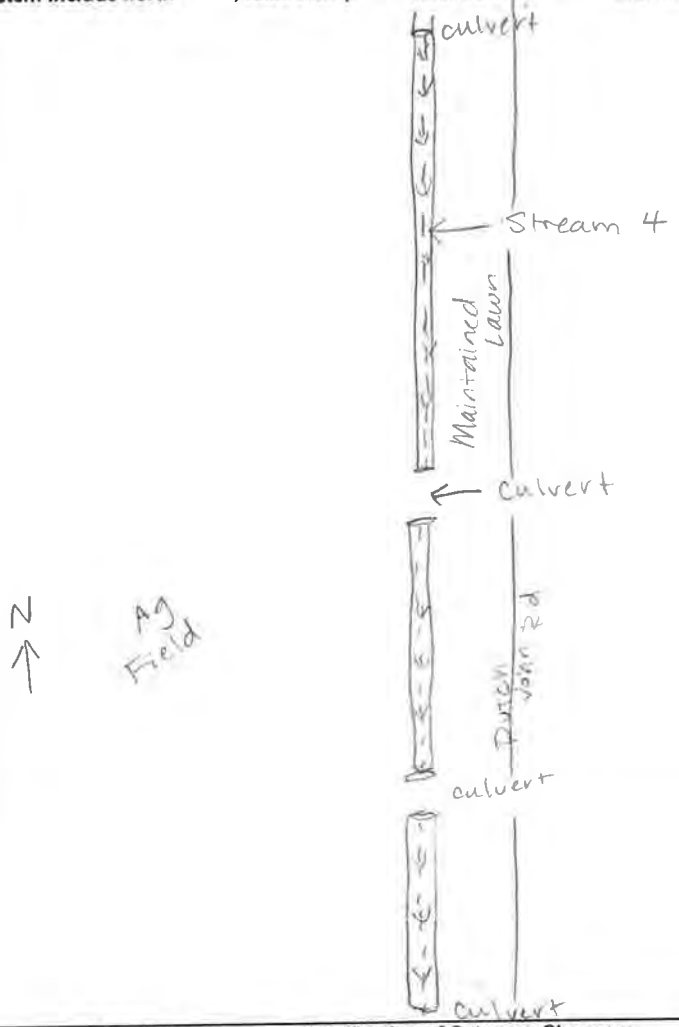

Comments, Narrative Discussion, Justification of Category Changes:

Wetland buffers Stream 4 (intermittent)

Final score : 17 **Category:** 1

Wetland 4

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 4

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	(NO) Go to Question 8b

Wetland 4

8b	**Mature forested wetlands** Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands** Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland 4

Table 1. Characteristic plant species

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

Site: Wetland 4	Rater(s): K. Bomar	Date: 6 25 2024

Metric 1. Wetland Area (size).

2 (max 6 pts) | 2 (subtotal)

Select one size class and assign score
- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10 1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [X] 0.3 to <3 acres (0.12 to <1 2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

1 (max 14 pts) | 3 (subtotal)

2a. Calculate average buffer width. Select only one and assign score. Do not double check
- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [X] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.
- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [X] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

9 (max 30 pts) | 12 (subtotal)

3a. Sources of Water. Score all that apply
- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [X] Precipitation (1) 4
- [X] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.
- [ ] 100 year floodplain (1)
- [X] Between stream/lake and other human use (1) 1
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score
- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [X] <0.4m (<15.7in) (1) 1

3d. Duration inundation/saturation. Score one or dbl check.
- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [X] Seasonally inundated (2) 2
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.
- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [X] Recent or no recovery (1) 1

Check all disturbances observed
- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [ ] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

3 (max 20 pts) | 15 (subtotal)

4a. Substrate disturbance. Score one or double check and average.
- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [X] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score
- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [X] Poor (1)

4c. Habitat alteration. Score one or double check and average.
- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [X] Recent or no recovery (1)

Check all disturbances observed
- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

15 subtotal this page

last revised 1 February 2001 jjm

Site: Wetland 4	Rater(s): K. Bomar	Date: 6/25/2024

15 subtotal first page

0 max 10 pts | 15 subtotal

Metric 5. Special Wetlands.

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

2 max 20 pts | 17 subtotal

Metric 6. Plant communities, interspersion, microtopography.

6a Wetland Vegetation Communities.
Score all present using 0 to 3 scale

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [X] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [X] Nearly absent <5% cover (0)
- [ ] Absent (1)

6d. Microtopography
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

17

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 4

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	9	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	2	
	TOTAL SCORE	17	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet

Wetland 4

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category			
Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name: Kate Bomar	
Date: 6/25/2024	
Affiliation: Stantec Consulting Services, Inc.	
Address: 10200 Alliance Rd, Cincinnati, OH	
Phone Number: 513-842-8200	
e-mail address: kate.bomar@stantec.com	
Name of Wetland: Wetland 5	
Vegetation Communit(ies): PEM	
HGM Class(es): depressional	
Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.	

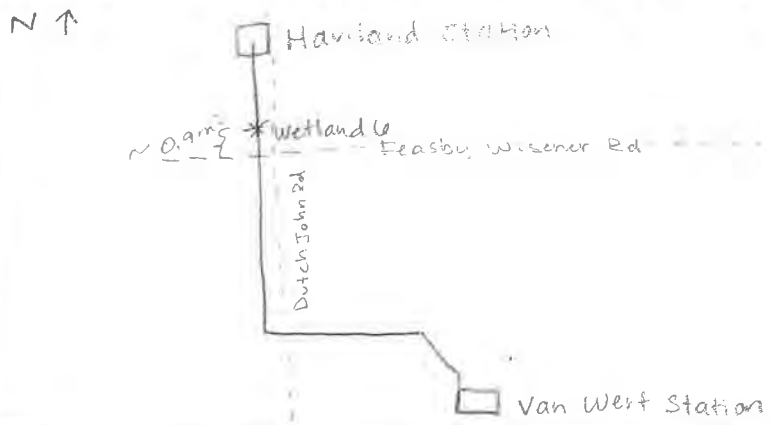

Lat/Long or UTM Coordinate 40.974789, -84.591960	
USGS Quad Name Scott	
County Van Wert	
Township T1S, R2E	
Section and Subsection S11, S2	
Hydrologic Unit Code 41000070703	
Site Visit 6/25/2024	
National Wetland Inventory Map R4SBC	
Ohio Wetland Inventory Map N/A	
Soil Survey Houtville silty clay, 0-1% slopes	
Delineation report/map See Ecological Survey Report	

Name of Wetland: Wetland 5

Wetland Size (acres, hectares): 0.47 ac

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

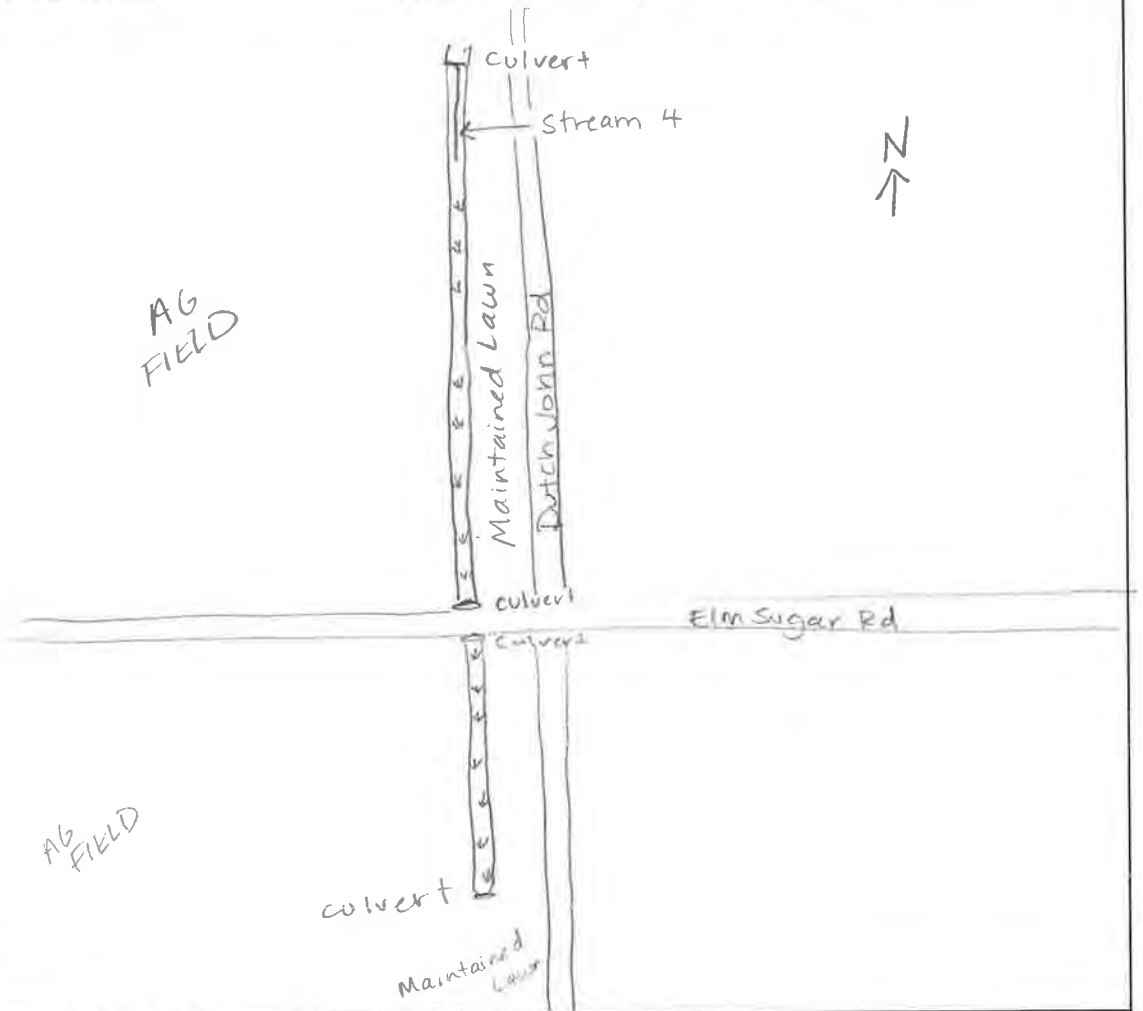

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 19 **Category:** 1

Wetland 5

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	✓	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 5

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	(NO) Go to Question 8b

Wetland 5

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	(NO) Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	(NO) Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	(NO) Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	(NO) Complete Quantitative Rating

Wetland 5

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	Oak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

ORAM v. 5.0 Field Form Quantitative Rating

KBMCW02

Site: Wetland 5	Rater(s): K. Bomar, M. Casey	Date: 6/25/2024

Metric 1. Wetland Area (size).

2 (max 6 pts) | 2 (subtotal)

Select one size class and assign score

- [ ] >50 acres (>20 2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20 2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10 1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [X] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

1 (max 14 pts) | 3 (subtotal)

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [X] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [X] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

10 (max 30 pts) | 13 (subtotal)

3a. Sources of Water Score all that apply

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [X] Precipitation (1)
- [X] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply

- [ ] 100 year floodplain (1)
- [X] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [X] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [X] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [X] Recent or no recovery (1)

Check all disturbances observed

- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [ ] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

3 (max 20 pts) | 10 (subtotal)

4a. Substrate disturbance Score one or double check and average

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [X] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [X] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [X] Recent or no recovery (1)

Check all disturbances observed

- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

10 (subtotal this page)

last revised 1 February 2001 jjm

Site: Wetland 5	Rater(s): K.Bomar M.Casey	Date: 10/25/2024

10
subtotal first page

Metric 5. Special Wetlands.

0	10
max 10 pts	subtotal

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

3	19
max 20 pts	subtotal

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [X] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [X] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

19

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 5

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	10	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	3	
	TOTAL SCORE	19	Category based on score breakpoints

Complete Wetland Categorization Worksheet.

Wetland 5

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category			
Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Kate Bomar
Date:	6/25/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	kate.bomar@stantec.com
Name of Wetland:	Wetland 6
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

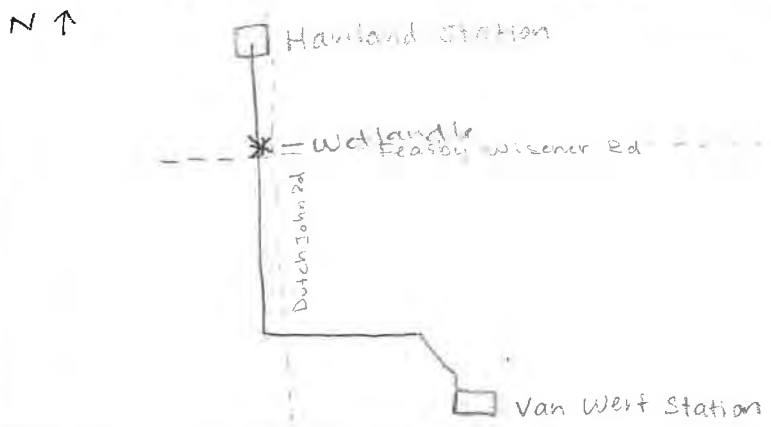

Lat/Long or UTM Coordinate	40.968053, -84.591908
USGS Quad Name	Scott
County	Van Wert
Township	T1S R2E
Section and Subsection	S11
Hydrologic Unit Code	41000070703
Site Visit	6/25/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Hoytville silty clay, 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 6	
Wetland Size (acres, hectares): 1.05 ac	

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

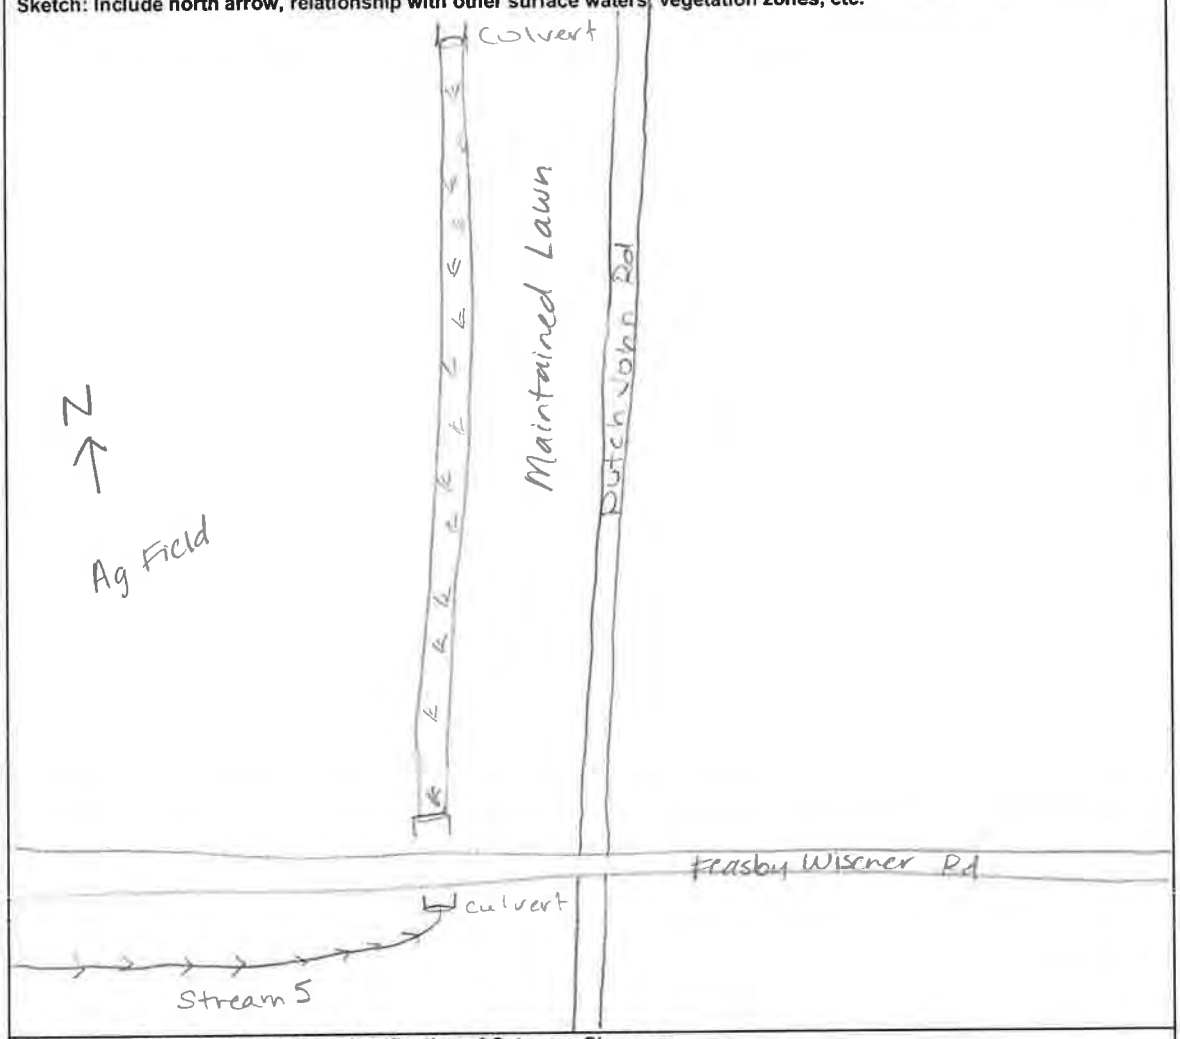

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 25	**Category:** 1

Wetland 6

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 6

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea*, *Lythrum salicaria*, or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland Go to Question 8b	NO Go to Question 8b

Wetland L

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland C

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

ORAM v. 5.0 Field Form Quantitative Rating

KBMCW01

Site: Wetland U	Rater(s): Kate Bomar, Malea Casey	Date: 6/25/2024

Metric 1. Wetland Area (size).

max 6 pts: 2 | subtotal: 2

Select one size class and assign score
- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [X] 0.3 to <3 acres (0.12 to <1 2ha) (2pts)
- [ ] 0.1 to <0 3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts: 1 | subtotal: 3

2a. Calculate average buffer width. Select only one and assign score. Do not double check
- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [X] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average
- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [X] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts: 11 | subtotal: 14

3a. Sources of Water. Score all that apply.
- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [X] Precipitation (1)
- [X] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.
- [ ] 100 year floodplain (1)
- [X] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.
- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [X] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.
- [X] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.
- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [X] Recent or no recovery (1)

Check all disturbances observed
- [X] ditch
- [X] tile
- [ ] dike
- [ ] weir
- [X] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [X] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts: 8 | subtotal: 22

4a. Substrate disturbance. Score one or double check and average.
- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [X] Recovering (2)
- [ ] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.
- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [X] Fair (3)
- [ ] Poor to fair (2)
- [ ] Poor (1)

Muskrats

4c. Habitat alteration. Score one or double check and average.
- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [X] Recovering (3)
- [ ] Recent or no recovery (1)

Check all disturbances observed
- [X] mowing - edges
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [X] sedimentation
- [ ] dredging
- [X] farming
- [ ] nutrient enrichment

22
subtotal this page

last revised 1 February 2001 jjm

Site: Wetland 16	Rater(s): Kate Bonar / Maiea Casey	Date: 5/15/2024

2 subtotal first page

Metric 5. Special Wetlands.

0 max 10 pts. | 22 subtotal

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

3 max 20 pts. | 25 subtotal

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [X] Low (1)
- [ ] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [X] Nearly absent <5% cover (0)
- [ ] Absent (1)

6d. Microtopography
Score all present using 0 to 3 scale

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

25

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland U

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	11	
	Metric 4. Habitat	8	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	3	
	TOTAL SCORE	25	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided

	Final Category		
Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Kate Bomar
Date:	6/26/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Kate.Bomar@stantec.com
Name of Wetland:	Wetland 7
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional, riverine

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

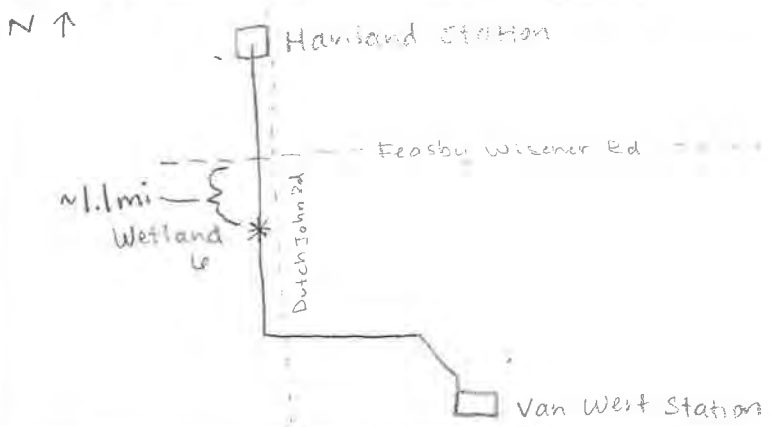

Lat/Long or UTM Coordinate	40.945413, -84.591601
USGS Quad Name	Scott
County	Van Wert
Township	T1S, R2E
Section and Subsection	S23, S24
Hydrologic Unit Code	4100070703
Site Visit	6/26/2024
National Wetland Inventory Map	R5UBH
Ohio Wetland Inventory Map	N/A
Soil Survey	Wabasha silty clay loam
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 7

Wetland Size (acres, hectares): 0.028 ac within Project area

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

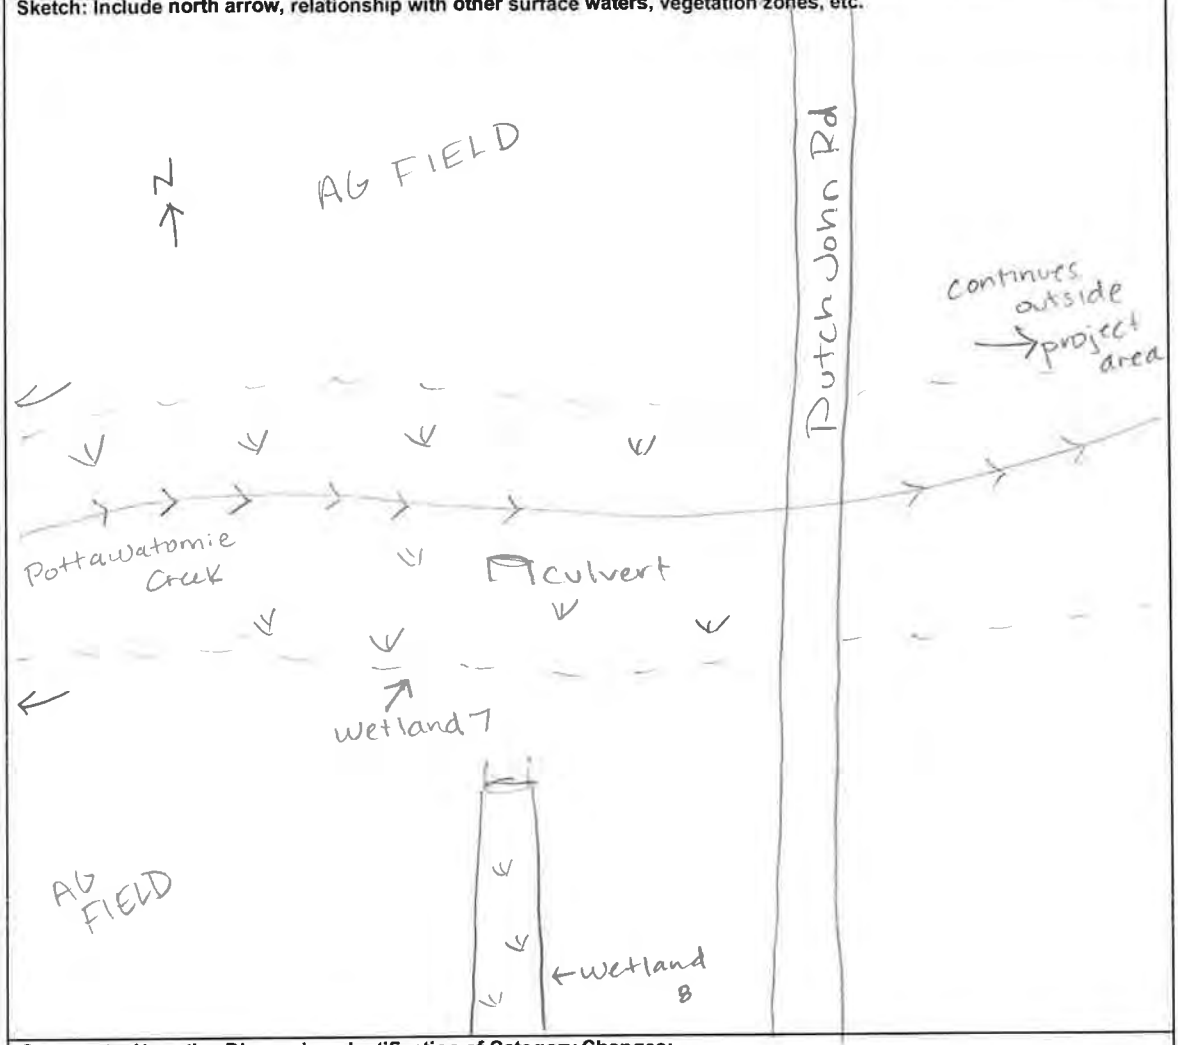

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 19 **Category:** 1

Wetland 7

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 7

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland Go to Question 8b	NO Go to Question 8b

Wetland 7

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.)	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

KBMCW03

Site: Wetland 7	Rater(s): Kate Bomar, Malea Casey	Date: 6/24/2024

Metric 1. Wetland Area (size).

max 6 pts. | subtotal: 1 | 1

Select one size class and assign score.

- [ ] >50 acres (>20 2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1 2 to <4ha) (3 pts)
- [ ] 0 3 to <3 acres (0.12 to <1.2ha) (2pts)
- [X] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0 1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts | subtotal: 1 | 2

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [X] VERY NARROW Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [X] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts. | subtotal: 10 | 12

3a. Sources of Water. Score all that apply

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [X] Precipitation (1)
- [X] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [X] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [X] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [X] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [X] Recent or no recovery (1)

Check all disturbances observed

- [X] ditch
- [X] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [X] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts. | subtotal: 7 | 19

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [X] Recovering (2)
- [ ] Recent or no recovery (1)

2

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [X] Poor to fair (2)
- [ ] Poor (1)

2

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [X] Recovering (3)
- [ ] Recent or no recovery (1)

3

Check all disturbances observed

- [X] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [X] sedimentation
- [ ] dredging
- [X] farming
- [ ] nutrient enrichment

subtotal this page: 19

last revised 1 February 2001 jjm

KBMCW03

Site: Wetland 7	Rater(s): K. Borrar, M. Casey	Date: 10/24/2024

19 subtotal first page

Metric 5. Special Wetlands.

0 max 10 pts | 19 subtotal

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

0 max 20 pts | 19 subtotal

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [X] Low (1)
- [ ] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [X] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [ ] Absent (1)

-3

6d. Microtopography
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

1

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present In moderate or greater amounts and of highest quality

19

End of Quantitative Rating. Complete Categorization Worksheets.

Wetland 7

ORAM Summary Worksheet

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	1	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	10	
	Metric 4. Habitat	7	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	0	
	TOTAL SCORE	19	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland 7

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

	Final Category		
Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Kate Bomar
Date:	6/26/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Kate.bomar@stantec.com
Name of Wetland:	Wetland 8
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

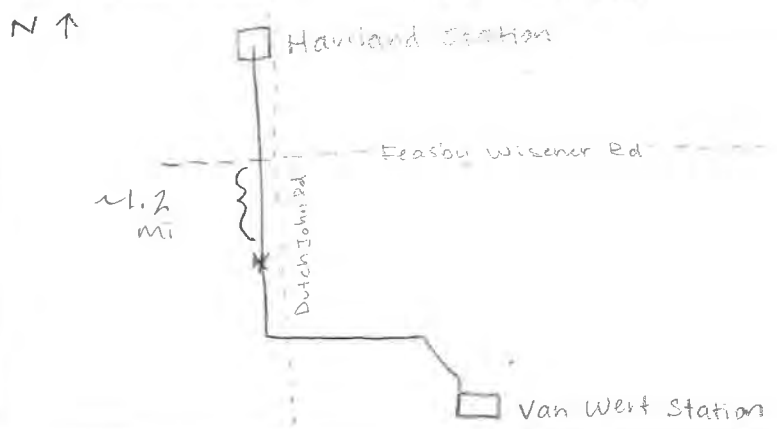

Lat/Long or UTM Coordinate	40.94245171, -84.59173939
USGS Quad Name	Scott
County	Van Wert
Township	T1S R2E
Section and Subsection	S23
Hydrologic Unit Code	41000070703
Site Visit	6/26/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Hoytville silty clay, 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 8

Wetland Size (acres, hectares): 0.25 ac

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

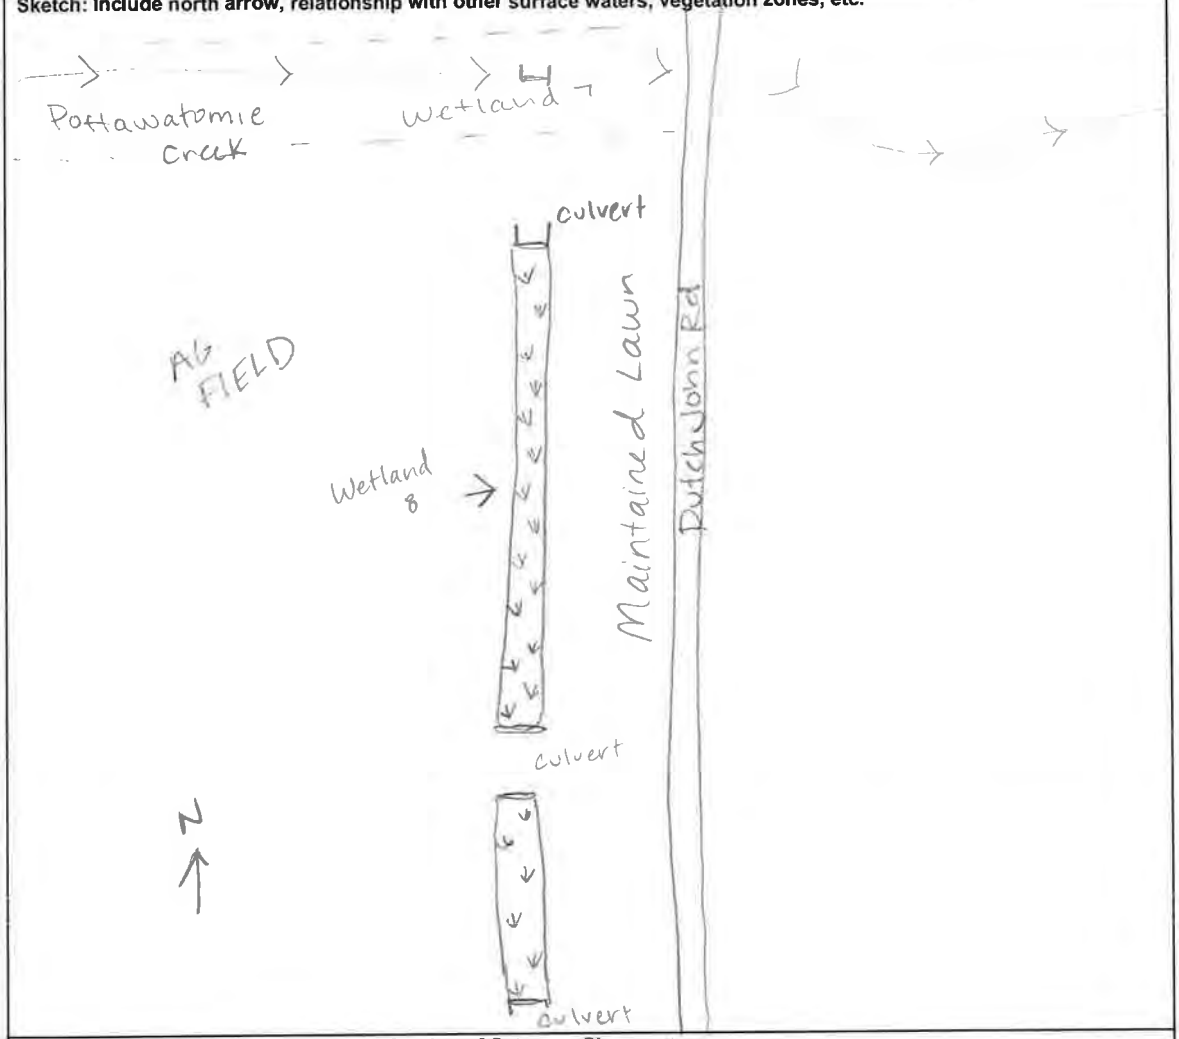

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 19 **Category:** 1

Wetland 8

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 8

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	NO Go to Question 8b

Wetland 8

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.)	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland 8

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

KBMCW04

ORAM v. 5.0 Field Form Quantitative Rating

Site: Wetland 8	Rater(s): K.Boman, M.Casey	Date: 6/24/2024

Metric 1. Wetland Area (size).

max 6 pts. | subtotal: 1 | 1

Select one size class and assign score.

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [ ] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [X] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts. | subtotal: 1 | 2

2a. Calculate average buffer width. Select only one and assign score. Do not double check

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [X] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [X] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts. | subtotal: 10 | 12

3a. Sources of Water. Score all that apply

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [X] Precipitation (1)
- [X] Seasonal/Intermittent surface water (3) — 4
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply

- [ ] 100 year floodplain (1)
- [X] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2) — 1
- [X] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check

- [ ] Semi- to permanently inundated/saturated (4)
- [X] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2) — 3
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [X] Recent or no recovery (1) — 1

Check all disturbances observed

- [X] ditch
- [X] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [X] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts. | subtotal: 7 | 19

4a. Substrate disturbance. Score one or double check and average

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [X] Recovering (2) — 2
- [ ] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3) — 2
- [X] Poor to fair (2)
- [ ] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [X] Recovering (3) — 3
- [ ] Recent or no recovery (1)

Check all disturbances observed

- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

subtotal this page: 19

last revised 1 February 2001 jjm

KBMCW04

Site: Wetland 8	Rater(s): Kate Bomar Makea Casey	Date: 10/20/2024

19 subtotal first page

Metric 5. Special Wetlands.

0 max 10 pts | 19 subtotal

Check all that apply and score as indicated

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

0 max 20 pts | 19 subtotal

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [X] Low (1)
- [ ] None (0)

1

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [X] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [ ] Absent (1)

-3

6d. Microtopography
Score all present using 0 to 3 scale

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale	
0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality	
low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality	
0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale	
0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

19

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 8

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES NO	If yes, Category 3.
	Question 4. Significant bird habitat	YES NO	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES NO	If yes, Category 1.
	Question 6. Bogs	YES NO	If yes, Category 3.
	Question 7. Fens	YES NO	If yes, Category 3.
	Question 8a. Old Growth Forest	YES NO	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES NO	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES NO	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES NO	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES NO	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES NO	If yes, Category 3
	Question 11. Relict Wet Prairies	YES NO	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	1	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	10	
	Metric 4. Habitat	7	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	0	
	TOTAL SCORE	19	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland 8

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	(NO)	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	(NO)	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	(YES) Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	(NO) **Wetland is assigned to category as determined by the ORAM.**	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Kate Bomar
Date:	6/24/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Kate.bomar@stantec.com
Name of Wetland:	Wetland 9
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

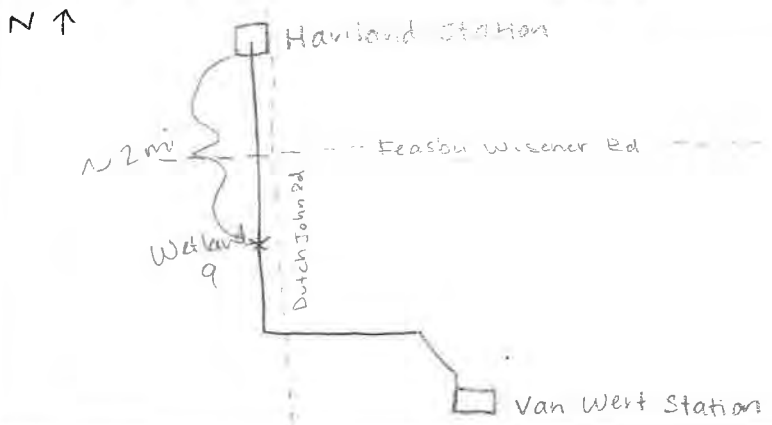

Lat/Long or UTM Coordinate	40.940919, -84.591727
USGS Quad Name	Scott
County	Van Wert
Township	T1S R2E
Section and Subsection	S23
Hydrologic Unit Code	4100070703
Site Visit	6/24/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Houtville silty clay, 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 9

Wetland Size (acres, hectares): 0.56 ac

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

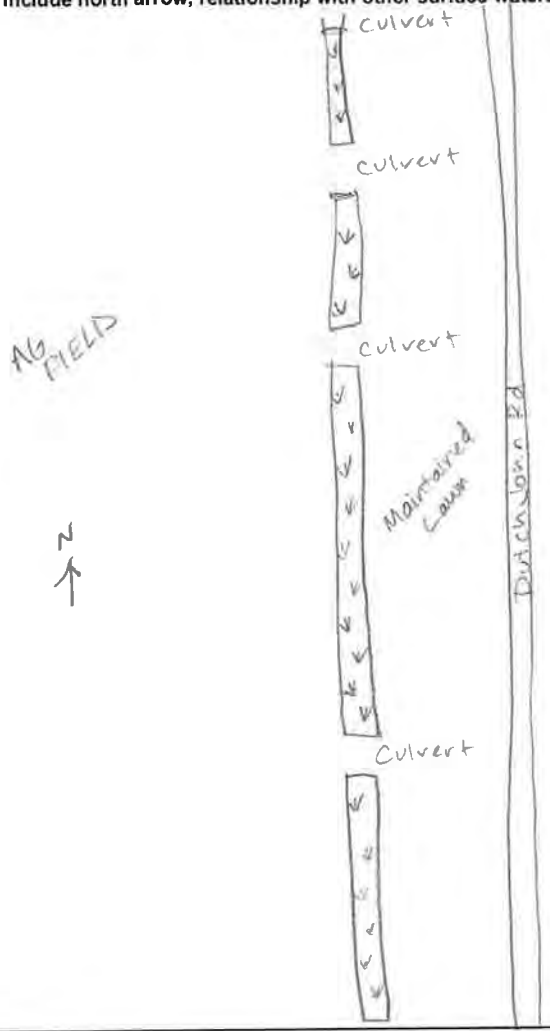

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 22 **Category:** 1

Wetland 9

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 9

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland Go to Question 8b	(NO) Go to Question 8b

Wetland 9

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Wetland 9

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	Oak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

KBMCW05

ORAM v. 5.0 Field Form Quantitative Rating

Site: Wetland 9	Rater(s): K. Bomar, M. Casey	Date: 4/24/2024

Metric 1. Wetland Area (size).

2 (max 6 pts.) | 2 (subtotal)

Select one size class and assign score

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10 1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [X] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

1 (max 14 pts.) | 3 (subtotal)

2a. Calculate average buffer width. Select only one and assign score. Do not double check

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [X] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field (3)
- [X] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

10 (max 30 pts.) | 13 (subtotal)

3a. Sources of Water. Score all that apply

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [X] Precipitation (1)
- [X] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

4

3b. Connectivity. Score all that apply

- [ ] 100 year floodplain (1)
- [X] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

1

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [X] <0.4m (<15.7in) (1)

1

3d. Duration inundation/saturation. Score one or dbl check

- [ ] Semi- to permanently inundated/saturated (4)
- [X] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [X] Recent or no recovery (1)

1

Check all disturbances observed

- [X] ditch
- [X] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [X] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

17 (max 20 pts.) | 20 (subtotal)

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [X] Recovering (2)
- [ ] Recent or no recovery (1)

2

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [X] Poor to fair (2)
- [ ] Poor (1)

2

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [X] Recovering (3)
- [ ] Recent or no recovery (1)

Check all disturbances observed

- [X] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [X] farming
- [ ] nutrient enrichment

20 subtotal this page

last revised 1 February 2001 jjm

Site: Wetland 9	Rater(s): K. Bomar, M. Casey	Date: 10/24/2024

20
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts) | 20 (subtotal)

Check all that apply and score as indicated

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

2 (max 20 pts) | 22 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [X] Low (1)
- [ ] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [X] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [ ] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

22

End of Quantitative Rating. Complete Categorization Worksheets.

Wetland 9

ORAM Summary Worksheet

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	10	
	Metric 4. Habitat	7	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	2	
	TOTAL SCORE	22	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Aaron Kwolek
Date:	6/26/2024
Affiliation:	Stantec Consulting Services, Inc.
Address:	10200 Alliance Rd, Cincinnati, OH
Phone Number:	513-842-8200
e-mail address:	Aaron.Kwolek@stantec.com
Name of Wetland:	Wetland 10
Vegetation Communit(ies):	PEM
HGM Class(es):	depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

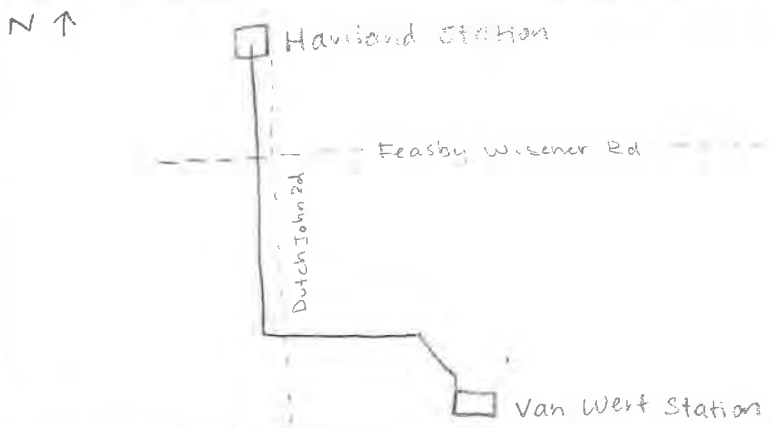

Lat/Long or UTM Coordinate	40.921069, -84.591477
USGS Quad Name	Scott
County	Van Wert
Township	T1S, R2E
Section and Subsection	S26
Hydrologic Unit Code	41000070703
Site Visit	6/26/2024
National Wetland Inventory Map	R4SBC
Ohio Wetland Inventory Map	N/A
Soil Survey	Houtville silty clay, 0-1% slopes
Delineation report/map	See Ecological Survey Report

Name of Wetland: Wetland 10

Wetland Size (acres, hectares): 0.164 ac

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

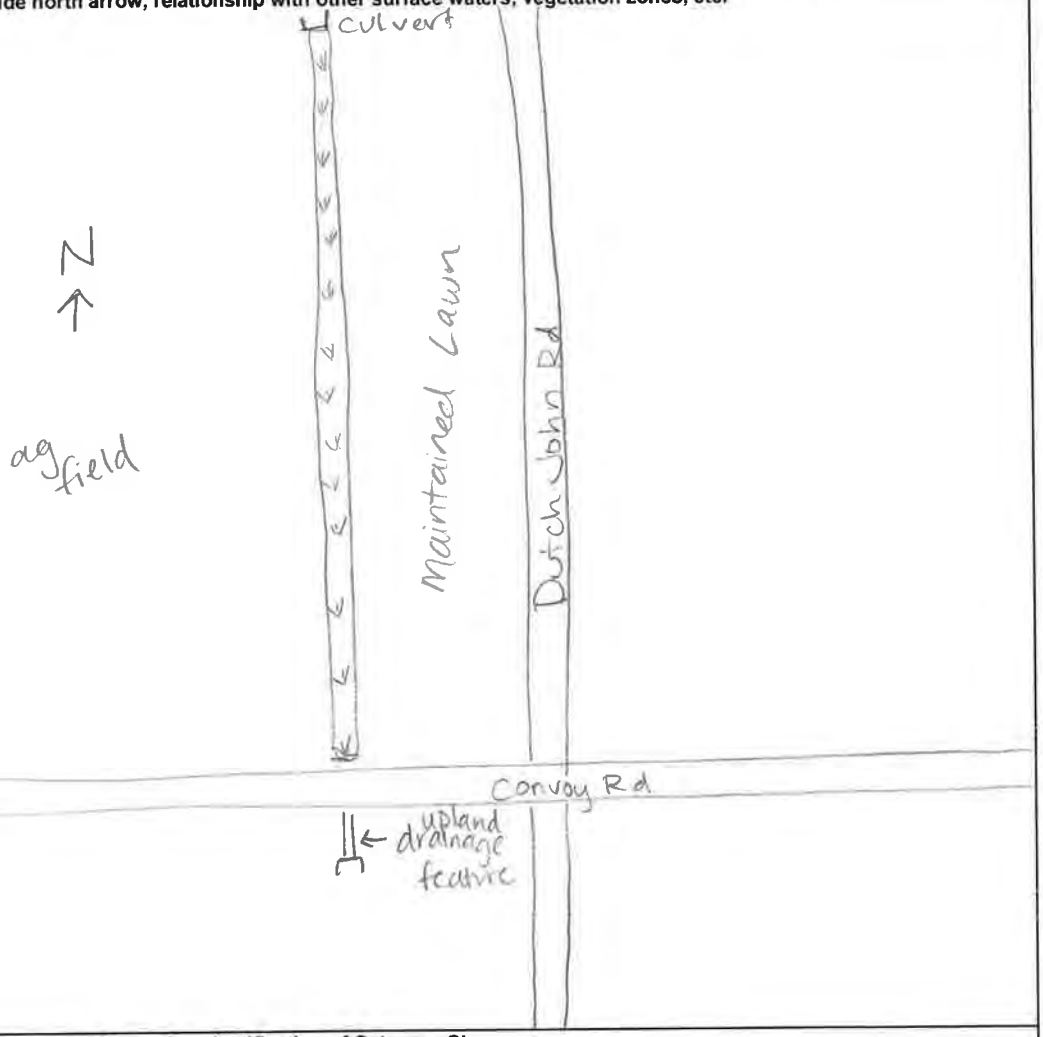

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 10 **Category:** 1

Wetland 10

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	X	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	X	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	X	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	X	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	X	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Wetland 10

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	NO Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland Go to Question 3	NO Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	NO Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	NO Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis,* or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	NO Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	NO Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	NO Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland Go to Question 8b	NO Go to Question 8b

Wetland 10

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	(NO) Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands** Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	(NO) Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	(NO) Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	(NO) Complete Quantitative Rating

Wetland 10

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

ORAM v. 5.0 Field Form Quantitative Rating

AKDSW041

Site: Wetland 10	Rater(s): AJK	Date: 6/26/24

Metric 1. Wetland Area (size).

max 6 pts. 2 | subtotal 2

Select one size class and assign score

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [x] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts. 1 | subtotal 3

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [x] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts. 7 | subtotal 10

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [x] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [x] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [ ] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [x] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [x] filling/grading
- [ ] road bed/RR track
- [x] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts. 3 | subtotal 13

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [x] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [x] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [x] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [x] dredging
- [ ] farming
- [ ] nutrient enrichment

13
subtotal this page

last revised 1 February 2001 jjm

Site: Wetland 10	Rater(s): A Kwolek	Date: 6/26/2024

13
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts.) | 13 (subtotal)

Check all that apply and score as indicated

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

3 (max 20 pts.) | 10 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [/] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [/] Absent (1)

6d. Microtopography
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [1] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

16

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

Wetland 10

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	2	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	7	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	3	
	TOTAL SCORE	16	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	(NO)	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	(NO)	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	(NO)	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	(YES) Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	(NO)	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	(NO) Wetland is assigned to category as determined by the ORAM	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name: Malea Casey

Date: 12/9/24

Affiliation: Stantec Consulting Services, Inc.

Address: 10200 Alliance Rd. Suite 300 Blue Ash, OH 45242

Phone Number: (513) 526-4084

e-mail address: malea.casey@stantec.com

Name of Wetland: Wetland 11

Vegetation Communit(ies): PEM

HGM Class(es): Depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

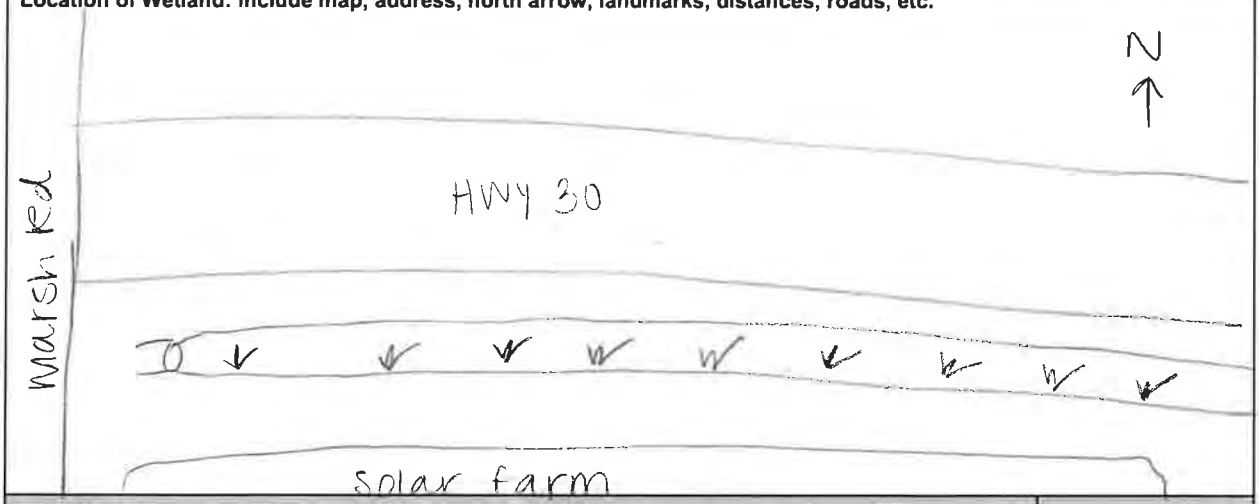

Lat/Long or UTM Coordinate	40.885247, -84.571431
USGS Quad Name	Scott
County	Van Wert
Township	T2S, R3E, S7
Section and Subsection	
Hydrologic Unit Code	04100007080 4
Site Visit	12/9/24
National Wetland Inventory Map	N/a
Ohio Wetland Inventory Map	N/a
Soil Survey	HtA: Hoytville silty clay, 0 to 1 percent slopes
Delineation report/map	See Ecological Resources Report

Name of Wetland: Wetland 11

Wetland Size (acres, hectares): 0.03ac (within project area)

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

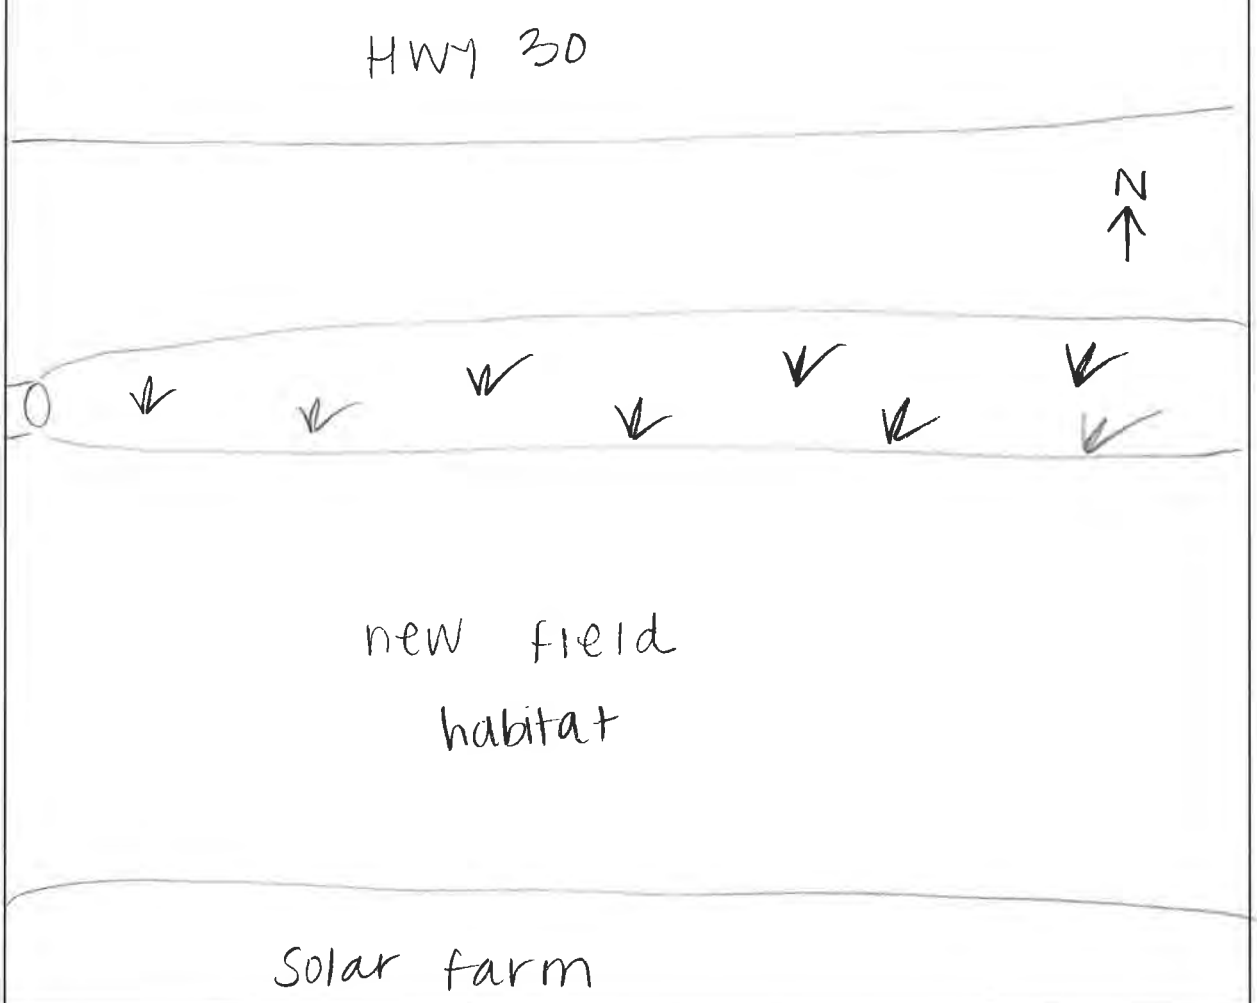

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 15	**Category:**	1

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	✓	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	✓	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	✓	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.		X
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	✓	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap. The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	(NO) Go to Question 8b

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

Site: Wetland 11	Rater(s): M Casey	Date: 12/9/24

Metric 1. Wetland Area (size).

0 (max 6 pts.) | 0 (subtotal)

Select one size class and assign score.

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [ ] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [x] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

1 (max 14 pts.) | 1 (subtotal)

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [x] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

6 (max 30 pts.) | 7 (subtotal)

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [x] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [x] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2)
- [x] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [x] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [x] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [ ] road bed/RR track
- [ ] dredging
- [ ] other

Metric 4. Habitat Alteration and Development.

6 (max 20 pts.) | 13 (subtotal)

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [x] Recovering (2)
- [ ] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [x] Poor to fair (2)
- [ ] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [x] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [x] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

13 (subtotal this page)

last revised 1 February 2001 jjm

Site: Wetland 11	Rater(s): M Casey	Date: 12/9/24

13
subtotal first page

Metric 5. Special Wetlands.

0 max 10 pts. | 13 subtotal

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

2 max 20 pts. | 15 subtotal

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [x] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [x] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [ ] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

15

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	0	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	6	
	Metric 4. Habitat	6	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	2	
	TOTAL SCORE	15	Category based on score breakpoints Category 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	(NO)	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	(NO)	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	(NO)	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	(YES) Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	(NO)	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	(NO) Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name: Malea Casey

Date: 12/9/24

Affiliation: Stantec Consulting Services, Inc.

Address: 10200 Alliance Rd. Suite 300 Blue Ash, OH 45242

Phone Number: (513) 526-4084

e-mail address: malea.casey@stantec.com

Name of Wetland: Wetland 12

Vegetation Communit(ies): PFO

HGM Class(es): Depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

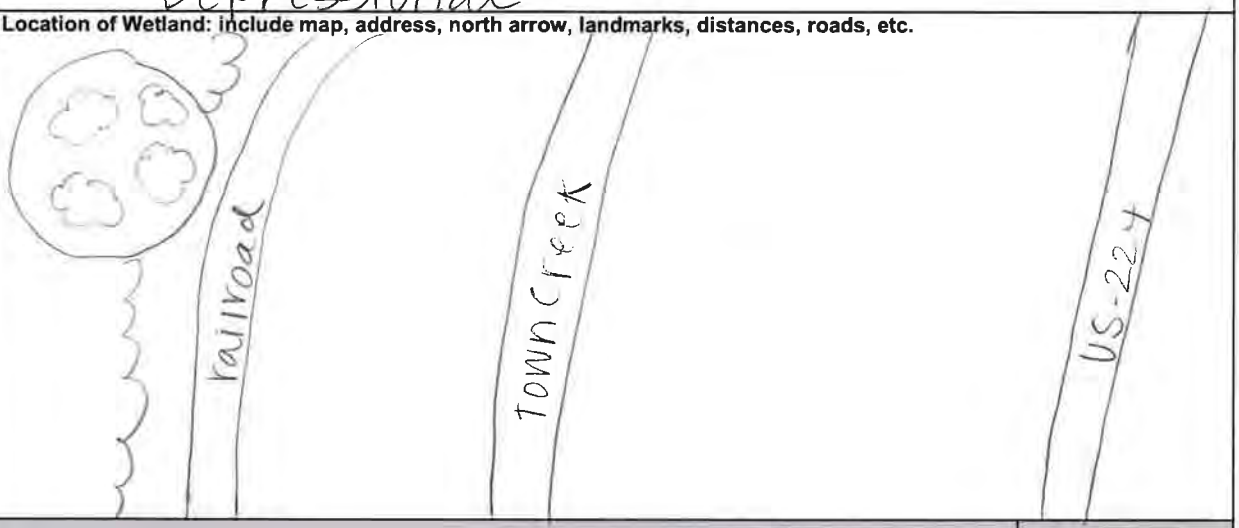

Lat/Long or UTM Coordinate	40.891594, -84.585148
USGS Quad Name	Scott
County	Van Wert
Township	T2S, R2E, S1
Section and Subsection	
Hydrologic Unit Code	041000070804
Site Visit	12/9/24
National Wetland Inventory Map	PSSIA
Ohio Wetland Inventory Map	N/a
Soil Survey	NtB2. Nappanee silty clay loam, 2 to 6 percent slopes, moderately eroded
Delineation report/map	See Ecological Resource Report

Name of Wetland: Wetland 12

Wetland Size (acres, hectares): 0.107 ac (within Project area)

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

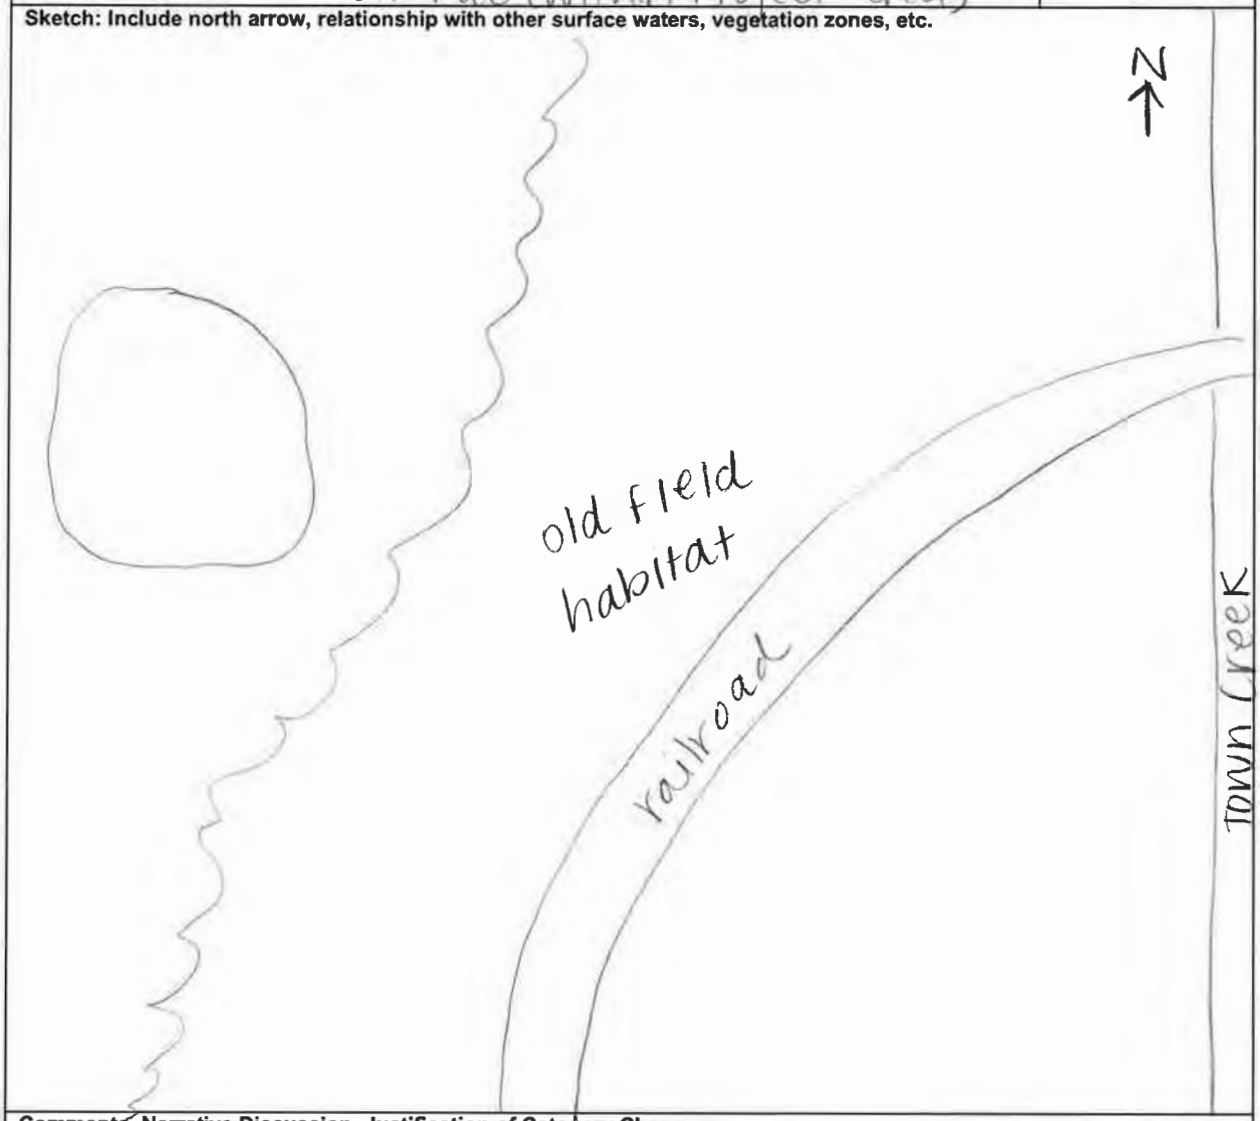

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 29 **Category:** 1

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	✓	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	✓	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	✓	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.		✗
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		✗
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	✓	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	(NO) Go to Question 8b

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

Site: WetHand 12	Rater(s): JM Casey	Date: 12/9/24

Metric 1. Wetland Area (size).

max 6 pts. 1 | subtotal 1

Select one size class and assign score.

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [ ] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [x] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts. 6 | subtotal 7

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [x] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [ ] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [x] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [ ] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

max 30 pts. 9 | subtotal 16

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [ ] Between stream/lake and other human use (1)
- [x] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [x] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [ ] Seasonally inundated (2)
- [x] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [x] Recovered (7)
- [x] Recovering (3)
- [ ] Recent or no recovery (1)

Check all disturbances observed

- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [x] filling/grading
- [x] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

max 20 pts. 8 | subtotal 24

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [x] Recovering (2)
- [ ] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [x] Fair (3)
- [ ] Poor to fair (2)
- [ ] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [x] Recovering (3)
- [ ] Recent or no recovery (1)

Check all disturbances observed

- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

24
subtotal this page

last revised 1 February 2001 jjm

Site: Wetland 12	Rater(s): M.Casey	Date: 12/9/24

24
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts.) | 24 (subtotal)

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

5 (max 20 pts.) | 29 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [ ] Emergent
- [ ] Shrub
- [1] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [x] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [ ] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [x] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [ ] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

29

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	1	
	Metric 2. Buffers and surrounding land use	6	
	Metric 3. Hydrology	9	
	Metric 4. Habitat	8	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	5	
	TOTAL SCORE	29	Category based on score breakpoints Category 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	(NO)	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	(NO)	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	(NO)	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	(YES) Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	(NO)	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name:	Cyms Chastain
Date:	4/16/25
Affiliation:	Stantec
Address:	10200 Alliance Rd. Suite 300 Cincinnati, OH 45242
Phone Number:	(513) 842-8200
e-mail address:	Cyms.Chastain@stantec.com
Name of Wetland:	Wetland 13
Vegetation Communit(ies):	PEM
HGM Class(es):	Depressional

Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc.

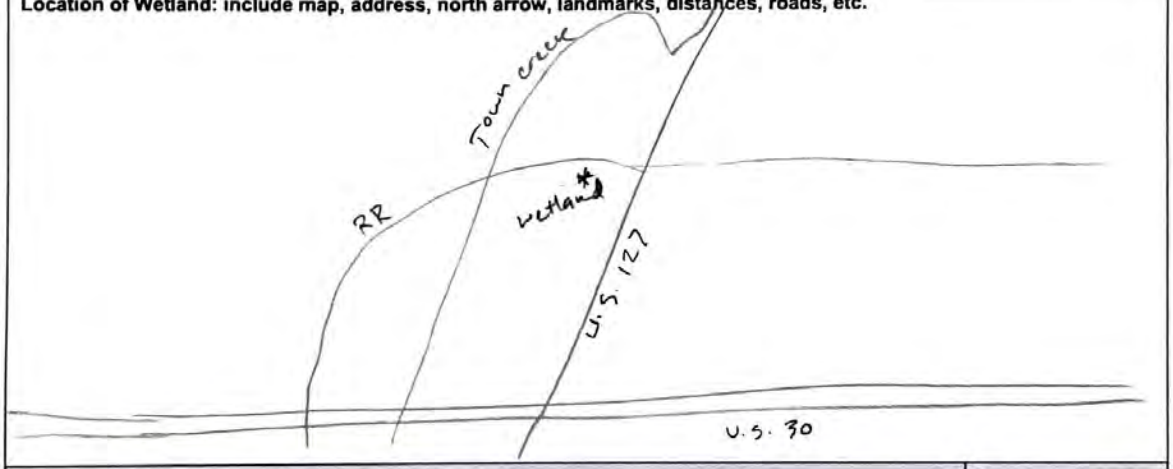

Lat/Long or UTM Coordinate	40.811604°N, -84.581248°W
USGS Quad Name	Scott, OH
County	Van Wert
Township	—
Section and Subsection	—
Hydrologic Unit Code	04100007040 4
Site Visit	4/16/25
National Wetland Inventory Map	N/A
Ohio Wetland Inventory Map	N/A
Soil Survey	Wabasha silty clay loam
Delineation report/map	See ecological survey report

Name of Wetland: Wetland 13

Wetland Size (acres, hectares): 0.01

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

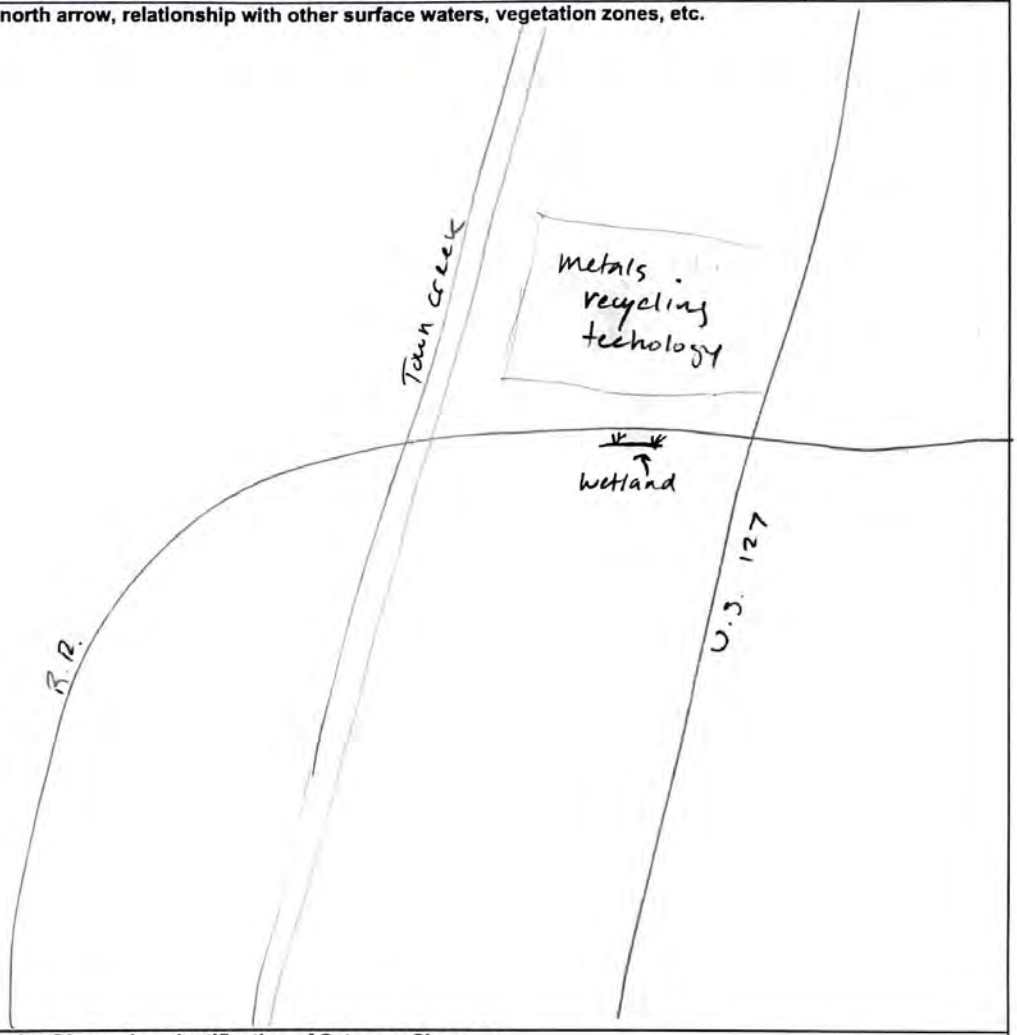

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 7 **Category:** 1

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	✓	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	✓	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	✓	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	✓	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		✓
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.		✓

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	(NO) Go to Question 8b

8b	**Mature forested wetlands**. Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	(NO) Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands**. Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	(NO) Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	(NO) Go to Question 11
11	**Relict Wet Prairies**. Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	(NO) Complete Quantitative Rating

Table 1. Characteristic plant species.

invasive/exotic spp	fen species	bog species	Oak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamogrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

CCADW01

ORAM v. 5.0 Field Form Quantitative Rating

Site: Wetland 13	Rater(s): C. Chastain	Date: 4/16/25

Metric 1. Wetland Area (size).

0 (max 6 pts.) | 0 (subtotal)

Select one size class and assign score.

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [ ] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [ ] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [x] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

1 (max 14 pts.) | 1 (subtotal)

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [ ] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [ ] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [x] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [ ] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

Metric 3. Hydrology.

5 (max 30 pts.) | 6 (subtotal)

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [ ] Perennial surface water (lake or stream) (5)

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [ ] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [x] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [x] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [ ] point source (nonstormwater)
- [ ] filling/grading
- [x] road bed/RR track
- [ ] dredging
- [ ] other_____

Metric 4. Habitat Alteration and Development.

3 (max 20 pts.) | 9 (subtotal)

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [ ] Recovering (2)
- [x] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [x] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [ ] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

9 (subtotal this page)

last revised 1 February 2001 jjm

CCADW07

ORAM v. 5.0 Field Form Quantitative Rating

Site: Wetland 13	Rater(s): C. Chastain	Date: 4/16/25

9
subtotal first page

0	9
max 10 pts.	subtotal

Metric 5. Special Wetlands.

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

-2	7
max 20 pts.	subtotal

Metric 6. Plant communities, interspersion, microtopography.

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [1] Emergent
- [ ] Shrub
- [ ] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [ ] Low (1)
- [/] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [/] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [ ] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [ ] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

7

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	0	
	Metric 2. Buffers and surrounding land use	1	
	Metric 3. Hydrology	5	
	Metric 4. Habitat	3	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	-2	
	TOTAL SCORE	7	Category based on score breakpoints 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	(NO)	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	(NO)	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	(NO)	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	(YES) Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	(NO)	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	(NO) Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

Background Information

Name: Malea Casey	
Date: 6/2/25	
Affiliation: Stantec Consulting Services, Inc.	
Address: 10200 Alliance Rd. Suite 300 Blue Ash, OH 45242	
Phone Number: (513) 526-4084	
e-mail address: malea.casey@stantec.com	
Name of Wetland: Wetland 14	
Vegetation Communit(ies): PFO	
HGM Class(es): Depressional	
Location of Wetland: include map, address, north arrow, landmarks, distances, roads, etc. 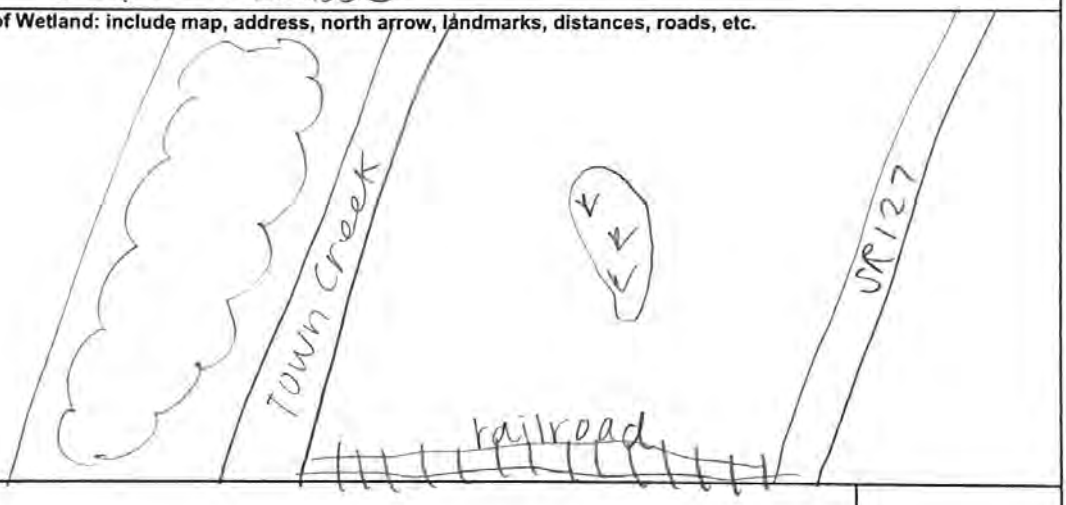	
Lat/Long or UTM Coordinate 40.892256, -84.582565	
USGS Quad Name Scott	
County Van Wert	
Township	
Section and Subsection	
Hydrologic Unit Code 04100007 0603	
Site Visit 6/2/25	
National Wetland Inventory Map N/a	
Ohio Wetland Inventory Map N/a	
Soil Survey Wa. Wabasha silty clay loam	
Delineation report/map See Ecological Resources Report	

Name of Wetland: Wetland 14

Wetland Size (acres, hectares): 0.06 ac (Within project area)

Sketch: Include north arrow, relationship with other surface waters, vegetation zones, etc.

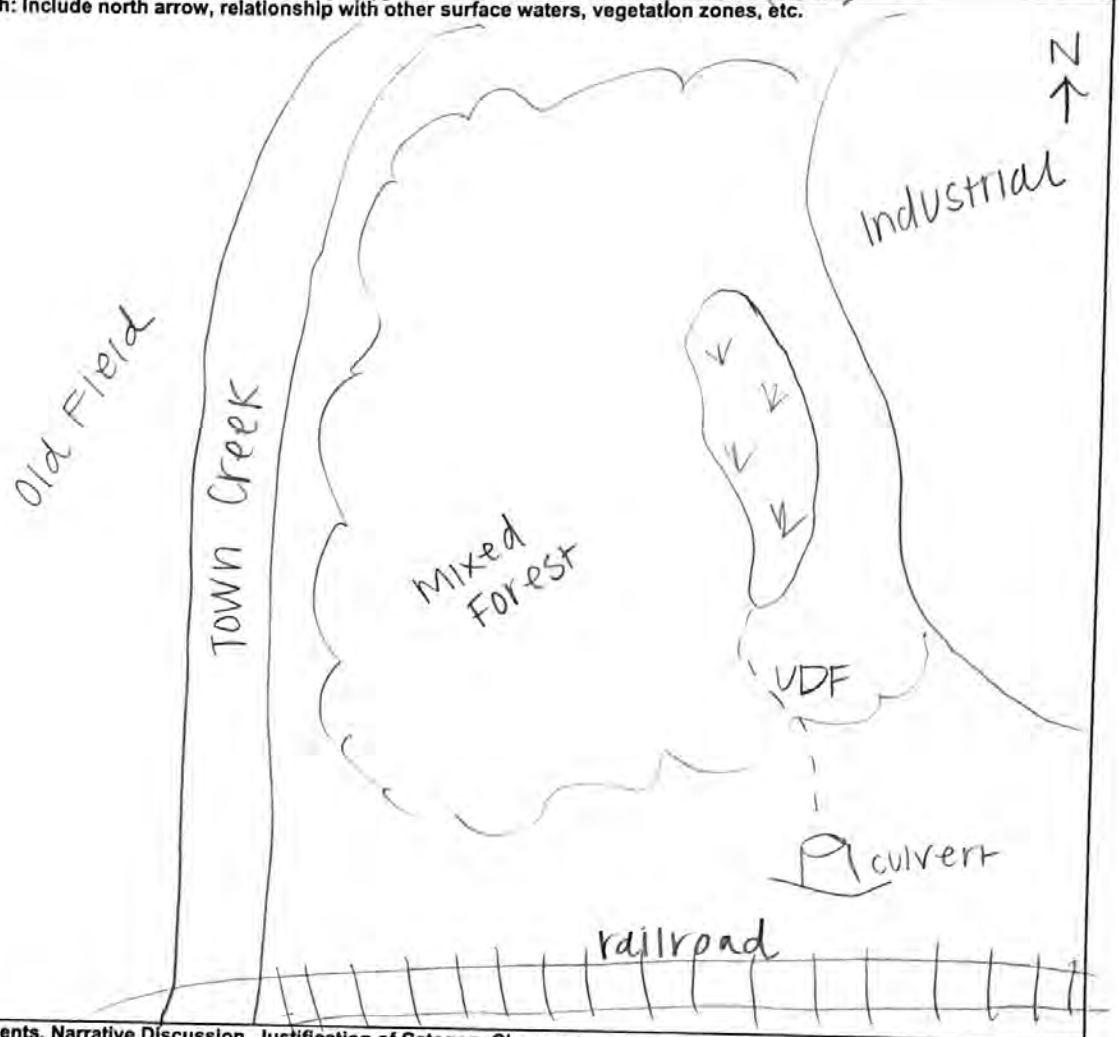

Comments, Narrative Discussion, Justification of Category Changes:

Final score : 28

Category: 1

Scoring Boundary Worksheet

INSTRUCTIONS. The initial step in completing the ORAM is to identify the "scoring boundaries" of the wetland being rated. In many instances this determination will be relatively easy and the scoring boundaries will coincide with the "jurisdictional boundaries." For example, the scoring boundary of an isolated cattail marsh located in the middle of a farm field will likely be the same as that wetland's jurisdictional boundaries. In other instances, however, the scoring boundary will not be as easily determined. Wetlands that are small or isolated from other surface waters often form large contiguous areas or heterogeneous complexes of wetland and upland. In separating wetlands for scoring purposes, the hydrologic regime of the wetland is the main criterion that should be used. Boundaries between contiguous or connected wetlands should be established where the volume, flow, or velocity of water moving through the wetland changes significantly. *Areas with a high degree of hydrologic interaction should be scored as a single wetland.* In determining a wetland's scoring boundaries, use the guidelines in the ORAM Manual Section 5.0. In certain instances, it may be difficult to establish the scoring boundary for the wetland being rated. These problem situations include wetlands that form a patchwork on the landscape, wetlands divided by artificial boundaries like property fences, roads, or railroad embankments, wetlands that are contiguous with streams, lakes, or rivers, and estuarine or coastal wetlands. These situations are discussed below, however, it is recommended that Rater contact Ohio EPA, Division of Surface Water, 401/Wetlands Section if there are additional questions or a need for further clarification of the appropriate scoring boundaries of a particular wetland.

#	Steps in properly establishing scoring boundaries	done?	not applicable
Step 1	Identify the wetland area of interest. This may be the site of a proposed impact, a reference site, conservation site, etc.	√	
Step 2	Identify the locations where there is physical evidence that hydrology changes rapidly. Such evidence includes both natural and human-induced changes including, constrictions caused by berms or dikes, points where the water velocity changes rapidly at rapids or falls, points where significant inflows occur at the confluence of rivers, or other factors that may restrict hydrologic interaction between the wetlands or parts of a single wetland.	√	
Step 3	Delineate the boundary of the wetland to be rated such that all areas of interest that are contiguous to and within the areas where the hydrology does not change significantly, i.e. areas that have a high degree of hydrologic interaction are included within the scoring boundary.	√	
Step 4	Determine if artificial boundaries, such as property lines, state lines, roads, railroad embankments, etc., are present. These should not be used to establish scoring boundaries unless they coincide with areas where the hydrologic regime changes.	√	
Step 5	In all instances, the Rater may enlarge the minimum scoring boundaries discussed here to score together wetlands that could be scored separately.		X
Step 6	Consult ORAM Manual Section 5.0 for how to establish scoring boundaries for wetlands that form a patchwork on the landscape, divided by artificial boundaries, contiguous to streams, lakes or rivers, or for dual classifications.	√	

End of Scoring Boundary Determination. Begin Narrative Rating on next page.

Narrative Rating

INSTRUCTIONS. Answer each of the following questions. Questions 1, 2, 3 and 4 should be answered based on information obtained from the site visit or the literature *and* by submitting a Data Services Request to the Ohio Department of Natural Resources, Division of Natural Areas and Preserves, Natural Heritage Data Services, 1889 Fountain Square Court, Building F-1, Columbus, Ohio 43224, 614-265-6453 (phone), 614-265-3096 (fax), http://www.dnr.state.oh.us/dnap . The remaining questions are designed to be answered primarily by the results of the site visit. Refer to the User's Manual for descriptions of these wetland types. Note: "Critical habitat" is legally defined in the Endangered Species Act and is the geographic area containing physical or biological features essential to the conservation of a listed species or as an area that may require special management considerations or protection. The Rater should contact the Region 3 Headquarters or the Columbus Ecological Services Office for updates as to whether critical habitat has been designated for other federally listed threatened or endangered species. "Documented" means the wetland is listed in the appropriate State of Ohio database.

#	Question	Circle one	
1	**Critical Habitat.** Is the wetland in a township, section, or subsection of a United States Geological Survey 7.5 minute Quadrangle that has been designated by the U.S. Fish and Wildlife Service as "critical habitat" for any threatened or endangered plant or animal species? Note: as of January 1, 2001, of the federally listed endangered or threatened species which can be found in Ohio, the Indiana Bat has had critical habitat designated (50 CFR 17.95(a)) and the piping plover has had critical habitat proposed (65 FR 41812 July 6, 2000).	YES Wetland should be evaluated for possible Category 3 status Go to Question 2	(NO) Go to Question 2
2	**Threatened or Endangered Species.** Is the wetland known to contain an individual of, or documented occurrences of federal or state-listed threatened or endangered plant or animal species?	YES Wetland is a Category 3 wetland. Go to Question 3	(NO) Go to Question 3
3	**Documented High Quality Wetland.** Is the wetland on record in Natural Heritage Database as a high quality wetland?	YES Wetland is a Category 3 wetland Go to Question 4	(NO) Go to Question 4
4	**Significant Breeding or Concentration Area.** Does the wetland contain documented regionally significant breeding or nonbreeding waterfowl, neotropical songbird, or shorebird concentration areas?	YES Wetland is a Category 3 wetland Go to Question 5	(NO) Go to Question 5
5	**Category 1 Wetlands.** Is the wetland less than 0.5 hectares (1 acre) in size and **hydrologically isolated** and either 1) comprised of vegetation that is dominated (greater than eighty per cent areal cover) by *Phalaris arundinacea, Lythrum salicaria,* or *Phragmites australis*, or 2) an acidic pond created or excavated on mined lands that has little or no vegetation?	YES Wetland is a Category 1 wetland Go to Question 6	(NO) Go to Question 6
6	**Bogs.** Is the wetland a peat-accumulating wetland that 1) has no significant inflows or outflows, 2) supports acidophilic mosses, particularly *Sphagnum* spp., 3) the acidophilic mosses have >30% cover, 4) at least one species from Table 1 is present, and 5) the cover of invasive species (see Table 1) is <25%?	YES Wetland is a Category 3 wetland Go to Question 7	(NO) Go to Question 7
7	**Fens.** Is the wetland a carbon accumulating (peat, muck) wetland that is saturated during most of the year, primarily by a discharge of free flowing, mineral rich, ground water with a circumneutral ph (5.5-9.0) and with one or more plant species listed in Table 1 and the cover of invasive species listed in Table 1 is <25%?	YES Wetland is a Category 3 wetland Go to Question 8a	(NO) Go to Question 8a
8a	**"Old Growth Forest."** Is the wetland a forested wetland and is the forest characterized by, but not limited to, the following characteristics: overstory canopy trees of great age (exceeding at least 50% of a projected maximum attainable age for a species); little or no evidence of human-caused understory disturbance during the past 80 to 100 years; an all-aged structure and multilayered canopies; aggregations of canopy trees interspersed with canopy gaps; and significant numbers of standing dead snags and downed logs?	YES Wetland is a Category 3 wetland. Go to Question 8b	(NO) Go to Question 8b

8b	**Mature forested wetlands.** Is the wetland a forested wetland with 50% or more of the cover of upper forest canopy consisting of deciduous trees with large diameters at breast height (dbh), generally diameters greater than 45cm (17.7in) dbh?	YES Wetland should be evaluated for possible Category 3 status. Go to Question 9a	NO Go to Question 9a
9a	**Lake Erie coastal and tributary wetlands.** Is the wetland located at an elevation less than 575 feet on the USGS map, adjacent to this elevation, or along a tributary to Lake Erie that is accessible to fish?	YES Go to Question 9b	NO Go to Question 10
9b	Does the wetland's hydrology result from measures designed to prevent erosion and the loss of aquatic plants, i.e. the wetland is partially hydrologically restricted from Lake Erie due to lakeward or landward dikes or other hydrological controls?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 9c
9c	Are Lake Erie water levels the wetland's primary hydrological influence, i.e. the wetland is hydrologically unrestricted (no lakeward or upland border alterations), or the wetland can be characterized as an "estuarine" wetland with lake and river influenced hydrology. These include sandbar deposition wetlands, estuarine wetlands, river mouth wetlands, or those dominated by submersed aquatic vegetation.	YES Go to Question 9d	NO Go to Question 10
9d	Does the wetland have a predominance of native species within its vegetation communities, although non-native or disturbance tolerant native species can also be present?	YES Wetland is a Category 3 wetland Go to Question 10	NO Go to Question 9e
9e	Does the wetland have a predominance of non-native or disturbance tolerant native plant species within its vegetation communities?	YES Wetland should be evaluated for possible Category 3 status Go to Question 10	NO Go to Question 10
10	**Lake Plain Sand Prairies (Oak Openings)** Is the wetland located in Lucas, Fulton, Henry, or Wood Counties and can the wetland be characterized by the following description: the wetland has a sandy substrate with interspersed organic matter, a water table often within several inches of the surface, and often with a dominance of the gramineous vegetation listed in Table 1 (woody species may also be present). The Ohio Department of Natural Resources Division of Natural Areas and Preserves can provide assistance in confirming this type of wetland and its quality.	YES Wetland is a Category 3 wetland. Go to Question 11	NO Go to Question 11
11	**Relict Wet Prairies.** Is the wetland a relict wet prairie community dominated by some or all of the species in Table 1. Extensive prairies were formerly located in the Darby Plains (Madison and Union Counties), Sandusky Plains (Wyandot, Crawford, and Marion Counties), northwest Ohio (e.g. Erie, Huron, Lucas, Wood Counties), and portions of western Ohio Counties (e.g. Darke, Mercer, Miami, Montgomery, Van Wert etc.).	YES Wetland should be evaluated for possible Category 3 status Complete Quantitative Rating	NO Complete Quantitative Rating

Table 1. Characteristic plant species.

Invasive/exotic spp	fen species	bog species	0ak Opening species	wet prairie species
Lythrum salicaria	*Zygadenus elegans var. glaucus*	*Calla palustris*	*Carex cryptolepis*	*Calamagrostis canadensis*
Myriophyllum spicatum	*Cacalia plantaginea*	*Carex atlantica var. capillacea*	*Carex lasiocarpa*	*Calamagrostis stricta*
Najas minor	*Carex flava*	*Carex echinata*	*Carex stricta*	*Carex atherodes*
Phalaris arundinacea	*Carex sterilis*	*Carex oligosperma*	*Cladium mariscoides*	*Carex buxbaumii*
Phragmites australis	*Carex stricta*	*Carex trisperma*	*Calamagrostis stricta*	*Carex pellita*
Potamogeton crispus	*Deschampsia caespitosa*	*Chamaedaphne calyculata*	*Calamagrostis canadensis*	*Carex sartwellii*
Ranunculus ficaria	*Eleocharis rostellata*	*Decodon verticillatus*	*Quercus palustris*	*Gentiana andrewsii*
Rhamnus frangula	*Eriophorum viridicarinatum*	*Eriophorum virginicum*		*Helianthus grosseserratus*
Typha angustifolia	*Gentianopsis spp.*	*Larix laricina*		*Liatris spicata*
Typha xglauca	*Lobelia kalmii*	*Nemopanthus mucronatus*		*Lysimachia quadriflora*
	Parnassia glauca	*Schechzeria palustris*		*Lythrum alatum*
	Potentilla fruticosa	*Sphagnum spp.*		*Pycnanthemum virginianum*
	Rhamnus alnifolia	*Vaccinium macrocarpon*		*Silphium terebinthinaceum*
	Rhynchospora capillacea	*Vaccinium corymbosum*		*Sorghastrum nutans*
	Salix candida	*Vaccinium oxycoccos*		*Spartina pectinata*
	Salix myricoides	*Woodwardia virginica*		*Solidago riddellii*
	Salix serissima	*Xyris difformis*		
	Solidago ohioensis			
	Tofieldia glutinosa			
	Triglochin maritimum			
	Triglochin palustre			

End of Narrative Rating. Begin Quantitative Rating on next page.

ORAM v. 5.0 Field Form Quantitative Rating

Site: Wetland 14	Rater(s): M. Casey	Date: 6/2/25

Metric 1. Wetland Area (size).

max 6 pts.	subtotal
1	1

Select one size class and assign score.

- [ ] >50 acres (>20.2ha) (6 pts)
- [ ] 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- [ ] 10 to <25 acres (4 to <10.1ha) (4 pts)
- [ ] 3 to <10 acres (1.2 to <4ha) (3 pts)
- [ ] 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- [x] 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- [ ] <0.1 acres (0.04ha) (0 pts)

Metric 2. Upland buffers and surrounding land use.

max 14 pts.	subtotal
7	8

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- [x] WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- [ ] MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- [x] NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- [ ] VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

4

2b. Intensity of surrounding land use. Select one or double check and average.

- [ ] VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- [x] LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- [ ] MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- [x] HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

3

Metric 3. Hydrology.

max 30 pts.	subtotal
13	21

3a. Sources of Water. Score all that apply.

- [ ] High pH groundwater (5)
- [ ] Other groundwater (3)
- [x] Precipitation (1)
- [ ] Seasonal/Intermittent surface water (3)
- [x] Perennial surface water (lake or stream) (5)

6

3b. Connectivity. Score all that apply.

- [ ] 100 year floodplain (1)
- [x] Between stream/lake and other human use (1)
- [ ] Part of wetland/upland (e.g. forest), complex (1)
- [ ] Part of riparian or upland corridor (1)

3c. Maximum water depth. Select only one and assign score.

- [ ] >0.7 (27.6in) (3)
- [ ] 0.4 to 0.7m (15.7 to 27.6in) (2)
- [x] <0.4m (<15.7in) (1)

3d. Duration inundation/saturation. Score one or dbl check.

- [ ] Semi- to permanently inundated/saturated (4)
- [ ] Regularly inundated/saturated (3)
- [x] Seasonally inundated (2)
- [ ] Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- [ ] None or none apparent (12)
- [ ] Recovered (7)
- [x] Recovering (3)
- [ ] Recent or no recovery (1)

Check all disturbances observed

- [ ] ditch
- [ ] tile
- [ ] dike
- [ ] weir
- [ ] stormwater input
- [x] point source (nonstormwater)
- [ ] filling/grading
- [ ] road bed/RR track
- [ ] dredging
- [ ] other _____

Metric 4. Habitat Alteration and Development.

max 20 pts.	subtotal
4	25

4a. Substrate disturbance. Score one or double check and average.

- [ ] None or none apparent (4)
- [ ] Recovered (3)
- [x] Recovering (2)
- [ ] Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- [ ] Excellent (7)
- [ ] Very good (6)
- [ ] Good (5)
- [ ] Moderately good (4)
- [ ] Fair (3)
- [ ] Poor to fair (2)
- [x] Poor (1)

4c. Habitat alteration. Score one or double check and average.

- [ ] None or none apparent (9)
- [ ] Recovered (6)
- [ ] Recovering (3)
- [x] Recent or no recovery (1)

Check all disturbances observed

- [ ] mowing
- [ ] grazing
- [ ] clearcutting
- [x] selective cutting
- [ ] woody debris removal
- [ ] toxic pollutants
- [ ] shrub/sapling removal
- [ ] herbaceous/aquatic bed removal
- [ ] sedimentation
- [ ] dredging
- [ ] farming
- [ ] nutrient enrichment

subtotal this page
25

last revised 1 February 2001 jjm

Site: Wetland 14	Rater(s): M. Casey	Date: 6/2/25

25
subtotal first page

Metric 5. Special Wetlands.

0 (max 10 pts) | 25 (subtotal)

Check all that apply and score as indicated.

- [ ] Bog (10)
- [ ] Fen (10)
- [ ] Old growth forest (10)
- [ ] Mature forested wetland (5)
- [ ] Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- [ ] Lake Erie coastal/tributary wetland-restricted hydrology (5)
- [ ] Lake Plain Sand Prairies (Oak Openings) (10)
- [ ] Relict Wet Prairies (10)
- [ ] Known occurrence state/federal threatened or endangered species (10)
- [ ] Significant migratory songbird/water fowl habitat or usage (10)
- [ ] Category 1 Wetland. See Question 1 Qualitative Rating (-10)

Metric 6. Plant communities, interspersion, microtopography.

3 (max 20 pts) | 28 (subtotal)

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- [ ] Aquatic bed
- [ ] Emergent
- [ ] Shrub
- [1] Forest
- [ ] Mudflats
- [ ] Open water
- [ ] Other_____

6b. horizontal (plan view) Interspersion.
Select only one.

- [ ] High (5)
- [ ] Moderately high(4)
- [ ] Moderate (3)
- [ ] Moderately low (2)
- [x] Low (1)
- [ ] None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- [ ] Extensive >75% cover (-5)
- [ ] Moderate 25-75% cover (-3)
- [ ] Sparse 5-25% cover (-1)
- [ ] Nearly absent <5% cover (0)
- [x] Absent (1)

6d. Microtopography.
Score all present using 0 to 3 scale.

- [ ] Vegetated hummucks/tussucks
- [ ] Coarse woody debris >15cm (6in)
- [ ] Standing dead >25cm (10in) dbh
- [ ] Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

28

End of Quantitative Rating. Complete Categorization Worksheets.

ORAM Summary Worksheet

		circle answer or insert score	Result
Narrative Rating	Question 1 Critical Habitat	YES (NO)	If yes, Category 3.
	Question 2. Threatened or Endangered Species	YES (NO)	If yes, Category 3.
	Question 3. High Quality Natural Wetland	YES (NO)	If yes, Category 3.
	Question 4. Significant bird habitat	YES (NO)	If yes, Category 3.
	Question 5. Category 1 Wetlands	YES (NO)	If yes, Category 1.
	Question 6. Bogs	YES (NO)	If yes, Category 3.
	Question 7. Fens	YES (NO)	If yes, Category 3.
	Question 8a. Old Growth Forest	YES (NO)	If yes, Category 3.
	Question 8b. Mature Forested Wetland	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9b. Lake Erie Wetlands - Restricted	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 9d. Lake Erie Wetlands – Unrestricted with native plants	YES (NO)	If yes, Category 3
	Question 9e. Lake Erie Wetlands - Unrestricted with invasive plants	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
	Question 10. Oak Openings	YES (NO)	If yes, Category 3
	Question 11. Relict Wet Prairies	YES (NO)	If yes, evaluate for Category 3; may also be 1 or 2.
Quantitative Rating	Metric 1. Size	1	
	Metric 2. Buffers and surrounding land use	7	
	Metric 3. Hydrology	13	
	Metric 4. Habitat	4	
	Metric 5. Special Wetland Communities	0	
	Metric 6. Plant communities, interspersion, microtopography	3	
	TOTAL SCORE	28	Category based on score breakpoints Category 1

Complete Wetland Categorization Worksheet.

Wetland Categorization Worksheet

Choices	Circle one		Evaluation of Categorization Result of ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 2, 3, 4, 6, 7, 8a, 9d, 10	YES Wetland is categorized as a Category 3 wetland	NO	Is quantitative rating score *less* than the Category 2 scoring threshold (*excluding* gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been over-categorized by the ORAM
Did you answer "Yes" to any of the following questions: Narrative Rating Nos. 1, 8b, 9b, 9e, 11	YES Wetland should be evaluated for possible Category 3 status	NO	Evaluate the wetland using the 1) narrative criteria in OAC Rule 3745-1-54(C) and 2) the quantitative rating score. If the wetland is determined to be a Category 3 wetland using either of these, it should be categorized as a Category 3 wetland. Detailed biological and/or functional assessments may also be used to determine the wetland's category.
Did you answer "Yes" to Narrative Rating No. 5	YES Wetland is categorized as a Category 1 wetland	NO	Is quantitative rating score *greater* than the Category 2 scoring threshold *(including* any gray zone)? If yes, reevaluate the category of the wetland using the narrative criteria in OAC Rule 3745-1-54(C) and biological and/or functional assessments to determine if the wetland has been under-categorized by the ORAM
Does the quantitative score fall within the scoring range of a Category 1, 2, or 3 wetland?	YES Wetland is assigned to the appropriate category based on the scoring range	NO	If the score of the wetland is located within the scoring range for a particular category, the wetland should be assigned to that category. In all instances however, the narrative criteria described in OAC Rule 3745-1-54(C) can be used to clarify or change a categorization based on a quantitative score.
Does the quantitative score fall with the *"gray zone"* for Category 1 or 2 or Category 2 or 3 wetlands?	YES Wetland is assigned to the higher of the two categories or assigned to a category based on detailed assessments and the narrative criteria	NO	Rater has the option of assigning the wetland to the higher of the two categories or to assign a category based on the results of a nonrapid wetland assessment method, e.g. functional assessment, biological assessment, etc, and a consideration of the narrative criteria in OAC rule 3745-1-54(C).
Does the wetland otherwise exhibit *moderate OR superior* hydrologic OR habitat, OR recreational functions AND the wetland was *not* categorized as a Category 2 wetland (in the case of moderate functions) or a Category 3 wetland (in the case of superior functions) by this method?	YES Wetland was undercategorized by this method. A written justification for recategorization should be provided on Background Information Form	NO Wetland is assigned to category as determined by the ORAM.	A wetland may be undercategorized using this method, but still exhibit one or more superior functions, e.g. a wetland's biotic communities may be degraded by human activities, but the wetland may still exhibit superior hydrologic functions because of its type, landscape position, size, local or regional significance, etc. In this circumstance, the narrative criteria in OAC Rule 3745-1-54(C)(2) and (3) are controlling, and the under-categorization should be corrected. A written justification with supporting reasons or information for this determination should be provided.

Final Category

Choose one	Category 1	Category 2	Category 3

End of Ohio Rapid Assessment Method for Wetlands.

D.3 HHEI/QHEI DATA FORMS

AkDS501

Headwater Habitat Evaluation Index Field Form

HHEI Score (sum of metrics 1+2+3) 42

SITE NAME/LOCATION Haviland - Van Wert 69 kV Line Rebuild Project

SITE NUMBER Stream1 RIVER BASIN Maumee RIVER CODE / DRAINAGE AREA (mi²) <1 sq. ft

LENGTH OF STREAM REACH (ft) 200 LAT 41.016576°N LONG -84.592147°W RIVER MILE /

DATE 6/25/24 SCORER AJK COMMENTS Road side, ditched

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE - NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☒ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY* two predominant substrate *TYPE* boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐	BLDR SLABS [16 pts]		☒	SILT [3 pt]	45
☐	BOULDER (>256 mm) [16 pts]		☐	LEAF PACK/WOODY DEBRIS [3 pts]	
☐	BEDROCK [16 pts]		☐	FINE DETRITUS [3 pts]	
☐	COBBLE (65-256 mm) [12 pts]		☒	CLAY or HARDPAN [0 pt]	30
☐	GRAVEL (2-64 mm) [9 pts]		☐	MUCK [0 pts]	15
☐	SAND (<2 mm) [6 pts]	10	☐	ARTIFICIAL [3 pts]	

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 0 (A)

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: 3 TOTAL NUMBER OF SUBSTRATE TYPES: (B) 4

HHEI Metric Points Substrate Max = 40: 7 — A + B

2. Maximum Pool Depth (*Measure the maximum pool depth within the 61 meter (200 feet)* evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

- ☐ > 30 centimeters [20 pts]
- ☐ > 22.5 - 30 cm [30 pts]
- ☐ > 10 - 22.5 cm [25 pts]
- ☒ 5 cm - 10 cm [15 pts]
- ☐ < 5 cm [5pts]
- ☐ NO WATER OR MOIST CHANNEL [0pts]

COMMENTS MAXIMUM POOL DEPTH (centimeters): 8

Pool Depth Max = 30: 15

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

- ☐ > 4.0 meters (> 13') [30 pts]
- ☐ > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]
- ☒ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") [20 pts] ON: 5 40.75
- ☐ > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
- ☐ ≤ 1.0 m (≤ 3' 3") [5 pts]

COMMENTS TOB: 6 P: 1 AVERAGE BANKFULL WIDTH (meters): 2.1

Bankfull Width Max=30: 20

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ★ NOTE: River Left (L) and Right (R) as looking downstream ★

RIPARIAN WIDTH (Per Bank) L	R		FLOODPLAIN QUALITY (Most Predominant per Bank) L	R		L	R	
☐	☐	Wide >10m	☐	☐	Mature Forest, Wetland	☐	☐	Conservation Tillage
☐	☐	Moderate 5-10m	☐	☐	Immature Forest, Shrub or Old Field	☐	☐	Urban or Industrial
☐	☐	Narrow <5m	☒	☒	Residential, Park, New Field	☐	☐	Open Pasture, Row Crop
☒	☒	None	☐	☐	Fenced Pasture	☐	☐	Mining or Construction

COMMENTS

FLOW REGIME (*At Time of Evaluation*) (Check *ONLY* one box):

- ☒ Stream Flowing
- ☐ Subsurface flow with isolated pools (interstitial)
- ☐ Moist Channel, isolated pools, no flow (intermittent)
- ☐ Dry channel, no water (ephemeral)

COMMENTS Eph

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☒ None	☐ 1.0	☐ 2.0	☐ 3.0
☐ 0.5	☐ 1.5	☐ 2.5	☐ >3

STREAM GRADIENT ESTIMATE

☒ Flat (0.5 ft/100 ft) ☐ Flat to Moderate ☐ Moderate (2 ft/100 ft) ☐ Moderate to Severe ☐ Severe (10 ft/100 ft)

Stream 1

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☐ Yes ☒ No QHEI Score _____ (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S)

☐ ~~WWH~~ Name: MWH: Prairie Creek Distance from Evaluated Stream ~5000'

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Latty NRCS Soil Map Page: / NRCS Soil Map Stream Order: /

County: Paulding Co. Township/City: /

MISCELLANEOUS

Base Flow Conditions? (Y/N): N Date of last precipitation: 6/25/24 Quantity: 0.17"

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): Y Canopy (% open): 10C

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): /

Field Measures: Temp (°C) 22.8 Dissolved Oxygen (mg/l) / pH (S.U.) 8.8 Conductivity (umhos/cm) _____

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) N Species observed (if known): _____

Frogs or Tadpoles Observed? (Y/N) N Species observed (if known): _____

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

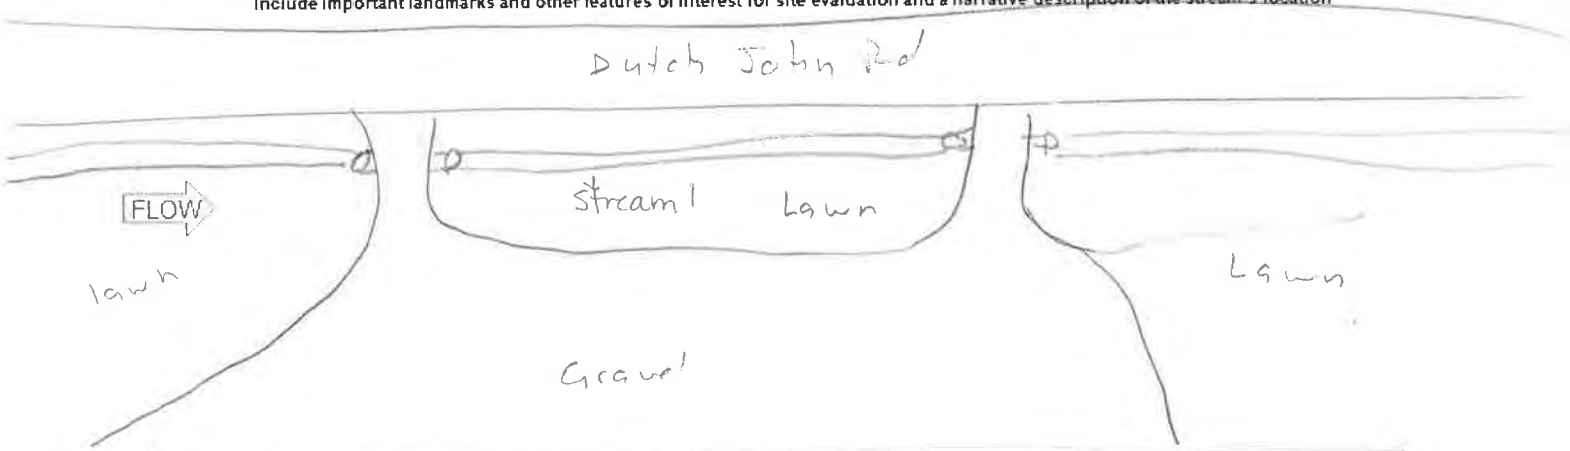

AKDS502

Ohio EPA — Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

QHEI Score: 33.5

Stream & Location: Stream 2 / Prairie Creek / Haviland - Van Wert 138 kV Line Rebuild Project RM: ___ Date: 06/25/06 24

Scorers Full Name & Affiliation: Akwolele / Stantec

River Code: ___-___-___ STORET #: ___ Lat./Long.: (NAD 83 - decimal °) 40.997387 / 84.592405 Office verified location ☐

1] SUBSTRATE Check ONLY Two substrate TYPE BOXES; estimate % or note every type present

Check ONE (Or 2 & average)

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐ ☐ BLDR /SLABS [10]			☐ ☐ HARDPAN [4]		
☐ ☐ BOULDER [9]	2		☐ ☐ DETRITUS [3]		
☐ ☐ COBBLE [8]			☐ ☐ MUCK [2]		2
☐ ☐ GRAVEL [7]	2		☒ ☐ SILT [2]		2
☐ ☒ SAND [6]	2		☐ ☐ ARTIFICIAL [0]		
☐ ☐ BEDROCK [5]			(Score natural substrates; ignore sludge from point-sources)		

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

ORIGIN	QUALITY	
☐ LIMESTONE [1]	☒ HEAVY [-2]	
☒ TILLS [1]	☐ MODERATE [-1]	
☐ WETLANDS [0]	SILT ☐ NORMAL [0]	
☐ HARDPAN [0]	☐ FREE [1]	
☐ SANDSTONE [0]	☒ EXTENSIVE [-2]	
☐ RIP/RAP [0]	EMBEDDEDNESS ☐ MODERATE [-1]	
☐ LACUSTURINE [0]	☐ NORMAL [0]	
☐ SHALE [-1]	☐ NONE [1]	
☐ COAL FINES [-2]		

Substrate: 5 (Maximum 20)

Comments

2] INSTREAM COVER Indicate presence 0 to 3: 0-Absent; 1-Very small amounts or if more common of marginal quality; 2-Moderate amounts, but not of highest quality or in small amounts of highest quality; 3-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

___ UNDERCUT BANKS [1]	___ POOLS > 70cm [2]	___ OXBOWS, BACKWATERS [1]
1 OVERHANGING VEGETATION [1]	___ ROOTWADS [1]	___ AQUATIC MACROPHYTES [1]
___ SHALLOWS (IN SLOW WATER) [1]	___ BOULDERS [1]	1 LOGS OR WOODY DEBRIS [1]
___ ROOTMATS [1]		

AMOUNT Check ONE (Or 2 & average)

☐ EXTENSIVE >75% [11]
☐ MODERATE 25-75% [7]
☒ SPARSE 5-<25% [3]
☐ NEARLY ABSENT <5% [1]

Comments

Cover Maximum 20: 5

3] CHANNEL MORPHOLOGY Check ONE in each category (Or 2 & average)

SINUOSITY	DEVELOPMENT	CHANNELIZATION	STABILITY
☐ HIGH [4]	☐ EXCELLENT [7]	☐ NONE [6]	☐ HIGH [3]
☐ MODERATE [3]	☒ GOOD [5]	☐ RECOVERED [4]	☒ MODERATE [2]
☒ LOW [2]	☐ FAIR [3]	☒ RECOVERING [3] 2	☐ LOW [1]
☐ NONE [1]	☐ POOR [1]	☒ RECENT OR NO RECOVERY [1]	

Comments

Channel Maximum 20: 11

4] BANK EROSION AND RIPARIAN ZONE Check ONE in each category for EACH BANK (Or 2 per bank & average)

River right looking downstream

EROSION (L R)	RIPARIAN WIDTH (L R)	FLOOD PLAIN QUALITY (L R)	(L R)
☒ ☒ NONE / LITTLE [3]	☐ ☐ WIDE > 50m [4]	☐ ☐ FOREST, SWAMP [3]	☐ ☐ CONSERVATION TILLAGE [1]
☐ ☐ MODERATE [2]	☐ ☐ MODERATE 10-50m [3]	☐ ☐ SHRUB OR OLD FIELD [2]	☐ ☐ URBAN OR INDUSTRIAL [0]
☐ ☐ HEAVY / SEVERE [1]	☐ ☐ NARROW 5-10m [2]	☒ ☒ RESIDENTIAL, PARK, NEW FIELD [1]	☐ ☐ MINING / CONSTRUCTION [0]
	☐ ☐ VERY NARROW < 5m [1]	☐ ☐ FENCED PASTURE [1]	
	☒ ☒ NONE [0]	☒ ☒ OPEN PASTURE, ROWCROP [0] 0.5	

Indicate predominant land use(s) past 100m riparian

Comments

Riparian Maximum 10: 3.5

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH Check ONE (ONLY!)

☐ > 1m [6]
☐ 0.7-<1m [4]
☐ 0.4-<0.7m [2]
☒ 0.2-<0.4m [1]
☐ < 0.2m [0]

CHANNEL WIDTH Check ONE (Or 2 & average)

☐ POOL WIDTH > RIFFLE WIDTH [2]
☒ POOL WIDTH = RIFFLE WIDTH [1]
☐ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY Check ALL that apply

☐ TORRENTIAL [-1] ☐ SLOW [1]
☐ VERY FAST [1] ☐ INTERSTITIAL [-1]
☐ FAST [1] ☐ INTERMITTENT [-2]
☒ MODERATE [1] ☐ EDDIES [1]

Indicate for reach - pools and riffles

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments

Pool / Current Maximum 12: 3

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (Or 2 & average).

☒ NO RIFFLE [metric=0]

RIFFLE DEPTH	RUN DEPTH	RIFFLE / RUN SUBSTRATE	RIFFLE / RUN EMBEDDEDNESS
☐ BEST AREAS > 10cm [2]	☐ MAXIMUM > 50cm [2]	☐ STABLE (e.g., Cobble, Boulder) [2]	☐ NONE [2]
☐ BEST AREAS 5-10cm [1]	☐ MAXIMUM < 50cm [1]	☐ MOD. STABLE (e.g., Large Gravel) [1]	☐ LOW [1]
☐ BEST AREAS < 5cm [metric=0]		☐ UNSTABLE (e.g., Fine Gravel, Sand) [0]	☐ MODERATE [0]
			☐ EXTENSIVE [-1]

Comments

Riffle / Run Maximum 8: 0

6] GRADIENT (4.01 ft/mi) DRAINAGE AREA (17 mi²)

☒ VERY LOW - LOW [2-4]
☒ MODERATE [6-10]
☐ HIGH - VERY HIGH [10-6]

%POOL: 0 %GLIDE: 0
%RUN: 100 %RIFFLE: 0

Gradient Maximum 10: 6

Stream 2 / Prairie Creek

A] SAMPLED REACH

Check ALL that apply

METHOD

- ☐ BOAT
- ☑ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE

1st -sample pass-	2nd
☐ HIGH	☐
☑ UP	☑
☐ NORMAL	☐
☐ LOW	☐
☐ DRY	☐

DISTANCE

- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☐ OTHER

6 / meters

CLARITY

1st -sample pass-	2nd
☑ < 20 cm	☑
☐ 20-<40 cm	☐
☐ 40-70 cm	☐
☐ > 70 cm/ CTB	☐
☐ SECCHI DEPTH	☐

CANOPY

- ☑ > 85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

1st pass _____ cm

2nd _____ cm

Comment RE: Reach consistency/ Is reach typical of steam?, *Recreation/* Observed - Inferred, *Other/* Sampling observations, Concerns, Access directions, etc.

B] AESTHETICS

- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☑ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☐ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

C] RECREATION

POOL: ☐ AREA >100ft² ☐ DEPTH >3ft

D] MAINTENANCE

Circle some & COMMENT

PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

Ag channelized

E] ISSUES

WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS

- $\bar{x}$ width
- $\bar{x}$ depth
- max. depth
- $\bar{x}$ bankfull width
- bankfull $\bar{x}$ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree.

Stream Drawing:

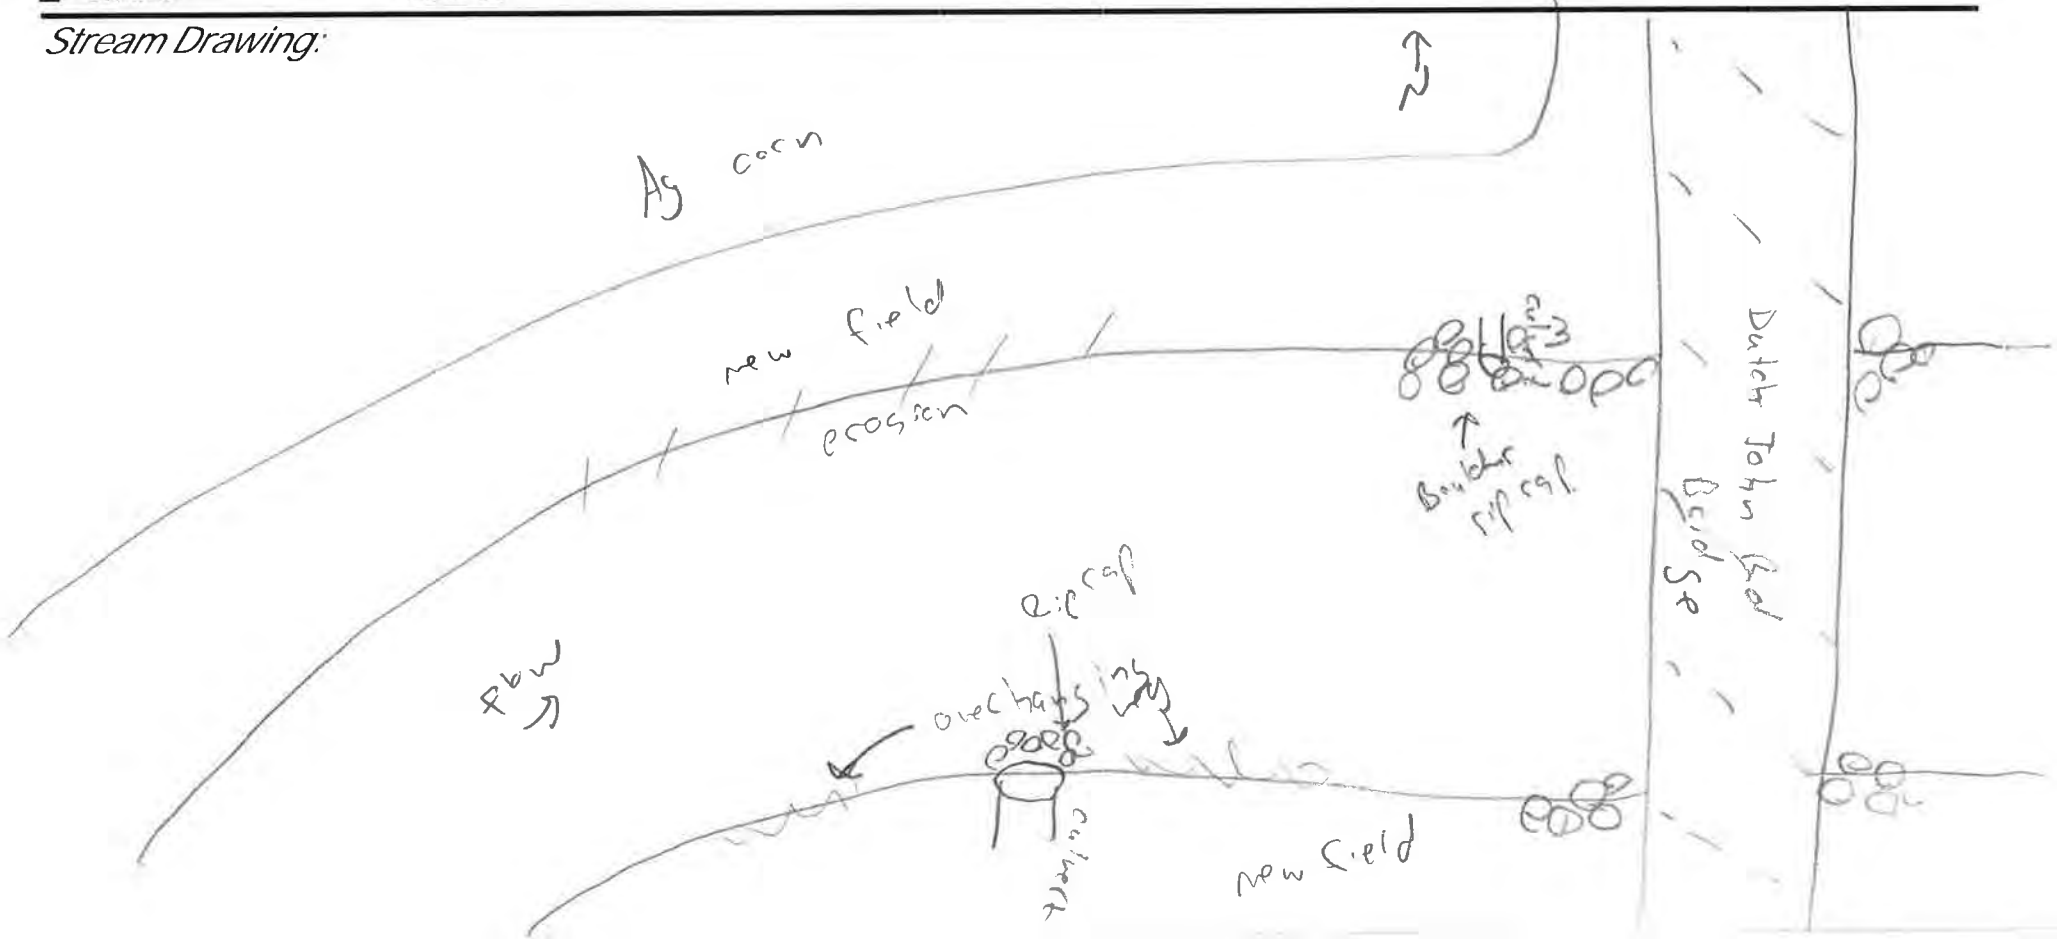

AKDS503 upstream

Headwater Habitat Evaluation Index Field Form

HHEI Score (sum of metrics 1+2+3) 40

SITE NAME/LOCATION Haviland-Van Wert 138kV Line Rebuild Project

SITE NUMBER Stream 3 RIVER BASIN Maumee RIVER CODE _____ DRAINAGE AREA (mi²) <1 mi²

LENGTH OF STREAM REACH (ft) 200 LAT 40.98679° N LONG -84.59273° W RIVER MILE _____

DATE 6/25/24 SCORER AJK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE / NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☒ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY* two predominant substrate *TYPE* boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐☐	BLDR SLABS [16 pts]		☒☐	SILT [3 pt]	90
☐☐	BOULDER (>256 mm) [16 pts]		☐☐	LEAF PACK/WOODY DEBRIS [3 pts]	
☐☐	BEDROCK [16 pts]		☐☐	FINE DETRITUS [3 pts]	
☐☐	COBBLE (65-256 mm) [12 pts]		☐☐	CLAY or HARDPAN [0 pt]	
☐☐	GRAVEL (2-64 mm) [9 pts]		☐☒	MUCK [0 pts]	10
☐☐	SAND (<2 mm) [6 pts]		☐☐	ARTIFICIAL [3 pts]	

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 0 (A) 3 (B) 2

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: 3 TOTAL NUMBER OF SUBSTRATE TYPES: 2

HHEI Metric Points Substrate Max = 40: 5 — A + B

2. Maximum Pool Depth (*Measure the maximum pool depth within the 61 meter (200 feet)* evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

☐ > 30 centimeters [20 pts]
☐ > 22.5 - 30 cm [30 pts]
☐ > 10 - 22.5 cm [25 pts]
☒ 5 cm - 10 cm [15 pts]
☐ < 5 cm [5pts]
☐ NO WATER OR MOIST CHANNEL [0pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 9

Pool Depth Max = 30: 15

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

☐ > 4.0 meters (> 13') [30 pts]
☐ > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]
☒ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") [20 pts]
☐ > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
☐ ≤ 1.0 m (≤ 3' 3") [5 pts]

OH = 6
TOB = 8

COMMENTS _____ AVERAGE BANKFULL WIDTH (meters): 7.6

Bankfull Width Max=30: 20

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ★ NOTE: River Left (L) and Right (R) as looking downstream ★

RIPARIAN WIDTH (Per Bank) L	R		FLOODPLAIN QUALITY (Most Predominant per Bank) L	R		L	R	
☐	☐	Wide >10m	☐	☐	Mature Forest, Wetland	☐	☐	Conservation Tillage
☐	☐	Moderate 5-10m	☐	☐	Immature Forest, Shrub or Old Field	☐	☐	Urban or Industrial
☐	☐	Narrow <5m	☒	☒	Residential, Park, New Field	☐	☐	Open Pasture, Row Crop
☒	☒	None	☐	☐	Fenced Pasture	☐	☐	Mining or Construction

COMMENTS _____

FLOW REGIME (*At Time of Evaluation*) (Check *ONLY* one box):

☒ Stream Flowing
☐ Subsurface flow with isolated pools (interstitial)
☐ Moist Channel, isolated pools, no flow (intermittent)
☐ Dry channel, no water (ephemeral)

COMMENTS INT

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☒ None ☐ 0.5 ☐ 1.0 ☐ 1.5 ☐ 2.0 ☐ 2.5 ☐ 3.0 ☐ >3

STREAM GRADIENT ESTIMATE

☒ Flat (0.5 %/100 ft) ☐ Flat to Moderate ☐ Moderate (2.5/100 ft) ☐ Moderate to Severe ☐ Severe (10.5/100 ft)

Stream 3

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☐ Yes ☒ No QHEI Score _____ (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S)

☒ WWH Name: MWH Hagerman Creek Distance from Evaluated Stream ~2500'

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Scott NRCS Soil Map Page: / NRCS Soil Map Stream Order: /

County: Van Wert Township/City: _____

MISCELLANEOUS

Base Flow Conditions? (Y/N): N Date of last precipitation: 6/25/24 Quantity: 0.17"

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 100

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): /

Field Measures: Temp (°C) 28.2 Dissolved Oxygen (mg/l) / pH (S.U.) 8.5 Conductivity (umhos/cm) /

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) Y Species observed (if known): _____

Frogs or Tadpoles Observed? (Y/N) Y Species observed (if known): green frog

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

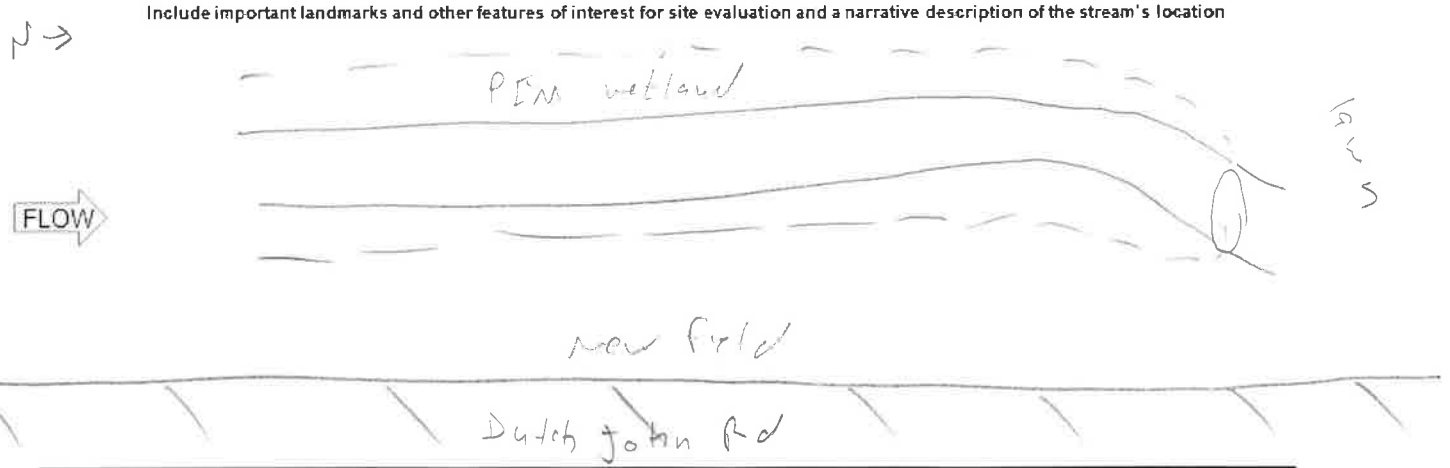

AKDSS03 downstream

Ohio Headwater Habitat Evaluation Index Field Form

HHEI Score (sum of metrics 1+2+3) 40

SITE NAME/LOCATION Haviland-Van Wert 69 kV Line Rebuild Project
SITE NUMBER Stream 4 RIVER BASIN Maumee RIVER CODE _____ DRAINAGE AREA (mi²) <1mi2
LENGTH OF STREAM REACH (ft) 200 LAT 40.980057°N LONG -84.592017°W RIVER MILE _____
DATE 6/25/24 SCORER ASK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE / NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☒ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY* two predominant substrate *TYPE* boxes (Max of 32) Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐	BLDR SLABS [16 pts]		☒	SILT [3 pt]	90
☐	BOULDER (>256 mm) [16 pts]		☐	LEAF PACK/WOODY DEBRIS [3 pts]	
☐	BEDROCK [16 pts]		☐	FINE DETRITUS [3 pts]	
☐	COBBLE (65-256 mm) [12 pts]		☒	CLAY or HARDPAN [0 pt]	10
☐	GRAVEL (2-64 mm) [9 pts]		☐	MUCK [0 pts]	
☐	SAND (<2 mm) [6 pts]		☐	ARTIFICIAL [3 pts]	

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock _____ (A)

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: 3 TOTAL NUMBER OF SUBSTRATE TYPES: (B) 2

HHEI Metric Points Substrate Max = 40: 5 A + B

2. Maximum Pool Depth ***(Measure the maximum pool depth within the 61 meter (200 feet)*** evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

- ☐ > 30 centimeters [20 pts]
- ☐ > 22.5 - 30 cm [30 pts]
- ☐ > 10 - 22.5 cm [25 pts]
- ☒ 5 cm - 10 cm [15 pts]
- ☐ < 5 cm [5pts]
- ☐ NO WATER OR MOIST CHANNEL [0pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 8

Pool Depth Max = 30: 15

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

- ☐ > 4.0 meters (> 13') [30 pts]
- ☐ > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]
- ☒ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") [20 pts]
- ☐ > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
- ☐ ≤ 1.0 m (≤ 3' 3") [5 pts]

BH: 3 R0.5
COMMENTS TOB: 8 A 1.25 AVERAGE BANKFULL WIDTH (meters): 2.7

Bankfull Width Max=30: 20

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY * NOTE: River Left (L) and Right (R) as looking downstream*

RIPARIAN WIDTH (Per Bank) L	R		FLOODPLAIN QUALITY (Most Predominant per Bank) L	R		L	R	
☐	☐	Wide >10m	☐	☐	Mature Forest, Wetland	☐	☐	Conservation Tillage
☐	☐	Moderate 5-10m	☐	☐	Immature Forest, Shrub or Old Field	☐	☐	Urban or Industrial
☐	☐	Narrow <5m	☒	☒	Residential, Park, New Field	☐	☐	Open Pasture, Row Crop
☒	☒	None	☐	☐	Fenced Pasture	☐	☐	Mining or Construction

COMMENTS _____

FLOW REGIME *(At Time of Evaluation)* (Check *ONLY* one box):

- ☒ Stream Flowing
- ☐ Subsurface flow with isolated pools (interstitial)
- ☐ Moist Channel, isolated pools, no flow (intermittent)
- ☐ Dry channel, no water (ephemeral)

COMMENTS INT

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☒ None	☐ 1.0	☐ 2.0	☐ 3.0
☐ 0.5	☐ 1.5	☐ 2.5	☐ >3

STREAM GRADIENT ESTIMATE

☒ Flat (0.5 ft/100 ft) ☐ Flat to Moderate ☐ Moderate (2 ft/100 ft) ☐ Moderate to Severe ☐ Severe (10 ft/100 ft)

Stream 4

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☐ Yes ☒ No QHEI Score _____ (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S)

☒ ~~WWH~~ Name: MWH: Hagerman Creek Distance from Evaluated Stream ~2560'

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Scott NRCS Soil Map Page: / NRCS Soil Map Stream Order: /

County: Van Wert Township/City: /

MISCELLANEOUS

Base Flow Conditions? (Y/N): N Date of last precipitation: 6/25/24 Quantity: 0.17"

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): Y Canopy (% open): 100

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): _____

Field Measures: Temp (°C) 22.4 Dissolved Oxygen (mg/l) _____ pH (S.U.) 8.2 Conductivity (umhos/cm) _____

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) N Species observed (if known): _____

Frogs or Tadpoles Observed? (Y/N) N Species observed (if known): _____

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

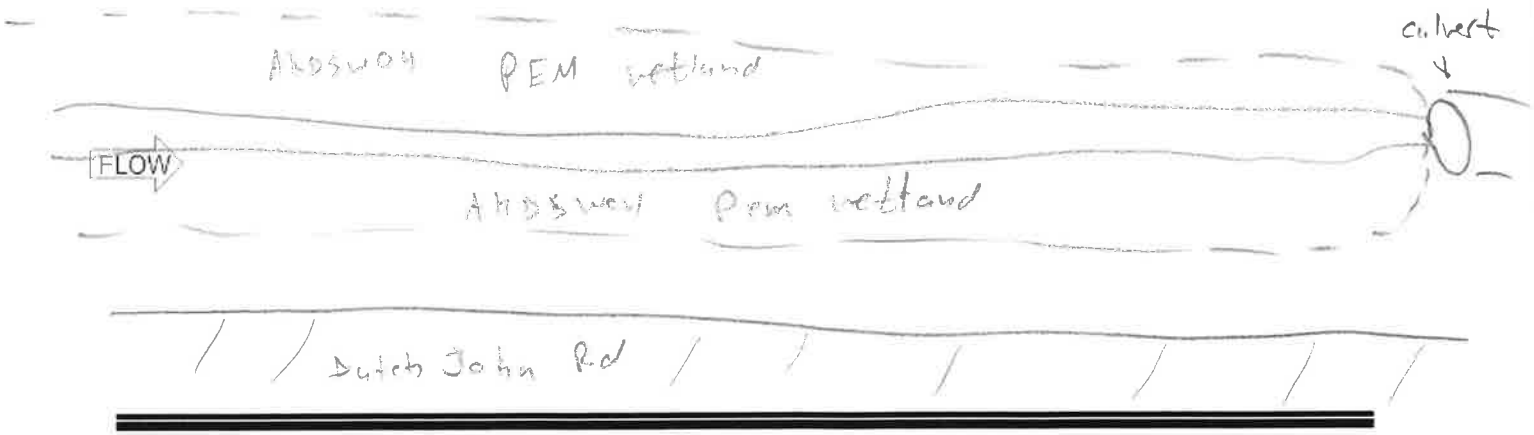

24.1.1

KBMCS01

Headwater Habitat Evaluation Index Field Form

HHEI Score (sum of metrics 1+2+3) 47

SITE NAME/LOCATION Haviland-Van Wert 69 kV Line Rebuild Project

SITE NUMBER Stream 5 RIVER BASIN Maumee RIVER CODE / DRAINAGE AREA (mi²) 4mi²

LENGTH OF STREAM REACH (ft) 67 LAT 40.960677 °N LONG -84.592196 °W RIVER MILE /

DATE 6/25/24 SCORER KLB COMMENTS

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE / NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☒ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY* two predominant substrate *TYPE* boxes. (Max of 32) Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐	BLDR SLABS [16 pts]		☒	SILT [3 pt]	100
☐	BOULDER (>256 mm) [16 pts]		☐	LEAF PACK/WOODY DEBRIS [3 pts]	
☐	BEDROCK [16 pts]		☐	FINE DETRITUS [3 pts]	
☐	COBBLE (65-256 mm) [12 pts]		☐	CLAY or HARDPAN [0 pt]	
☐	GRAVEL (2-64 mm) [9 pts]		☐	MUCK [0 pts]	
☐	SAND (<2 mm) [6 pts]		☐	ARTIFICIAL [3 pts]	

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 0 (A)

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: 6 TOTAL NUMBER OF SUBSTRATE TYPES: 1 (B)

HHEI Metric Points Substrate Max = 40: 7 — A + B

2. Maximum Pool Depth (*Measure the maximum pool depth within the 61 meter (200 feet)* evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

- ☐ > 30 centimeters [20 pts]
- ☐ > 22.5 - 30 cm [30 pts]
- ☒ > 10 - 22.5 cm [25 pts]
- ☐ 5 cm - 10 cm [15 pts]
- ☐ < 5 cm [5pts]
- ☐ NO WATER OR MOIST CHANNEL [0pts]

5" 13

COMMENTS MAXIMUM POOL DEPTH (centimeters):

Pool Depth Max = 30: 25

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

- ☐ > 4.0 meters (> 13') [30 pts]
- ☐ > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]
- ☐ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") [20 pts]
- ☒ > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
- ☐ ≤ 1.0 m (≤ 3' 3") [5 pts]

4'

COMMENTS AVERAGE BANKFULL WIDTH (meters)

Bankfull Width Max=30: 15

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY * NOTE: River Left (L) and Right (R) as looking downstream *

RIPARIAN WIDTH (Per Bank) L	R	FLOODPLAIN QUALITY (Most Predominant per Bank) L	R	L	R
☐	☐ Wide >10m	☐	☐ Mature Forest, Wetland	☐	☐ Conservation Tillage
☐	☐ Moderate 5-10m	☐	☐ Immature Forest, Shrub or Old Field	☐	☐ Urban or Industrial
☐	☐ Narrow <5m	☐	☐ Residential, Park, New Field	☒	☒ Open Pasture, Row Crop
☐	☐ None	☐	☐ Fenced Pasture	☐	☐ Mining or Construction

COMMENTS

FLOW REGIME (*At Time of Evaluation*) (Check *ONLY* one box):

- ☒ Stream Flowing
- ☐ Subsurface flow with isolated pools (interstitial)
- ☐ Moist Channel, isolated pools, no flow (intermittent)
- ☐ Dry channel, no water (ephemeral)

COMMENTS Intermittent

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☒ None	☐ 1.0	☐ 2.0	☐ 3.0
☐ 0.5	☐ 1.5	☐ 2.5	☐ >3

STREAM GRADIENT ESTIMATE

☒ Flat (0.5 % 100 ft) ☐ Flat to Moderate ☐ Moderate (2 % 100 ft) ☐ Moderate to Severe ☐ Severe (10 % 100 ft)

Stream 5

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☐ Yes ☒ No QHEI Score _____ (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S)

☒ MWH Name: MWH: Prairie Creek Distance from Evaluated Stream ~13,500'

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Scott NRCS Soil Map Page: / NRCS Soil Map Stream Order: /

County: Paulding Township/City: /

MISCELLANEOUS

Base Flow Conditions? (Y/N): N Date of last precipitation: 10/25/2024 Quantity: 0.17"

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 100

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): /

Field Measures: Temp (°C) / Dissolved Oxygen (mg/l) / pH (S.U.) 7.9 Conductivity (umhos/cm) /

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) N Species observed (if known): _____

Frogs or Tadpoles Observed? (Y/N) Y Species observed (if known): _____

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

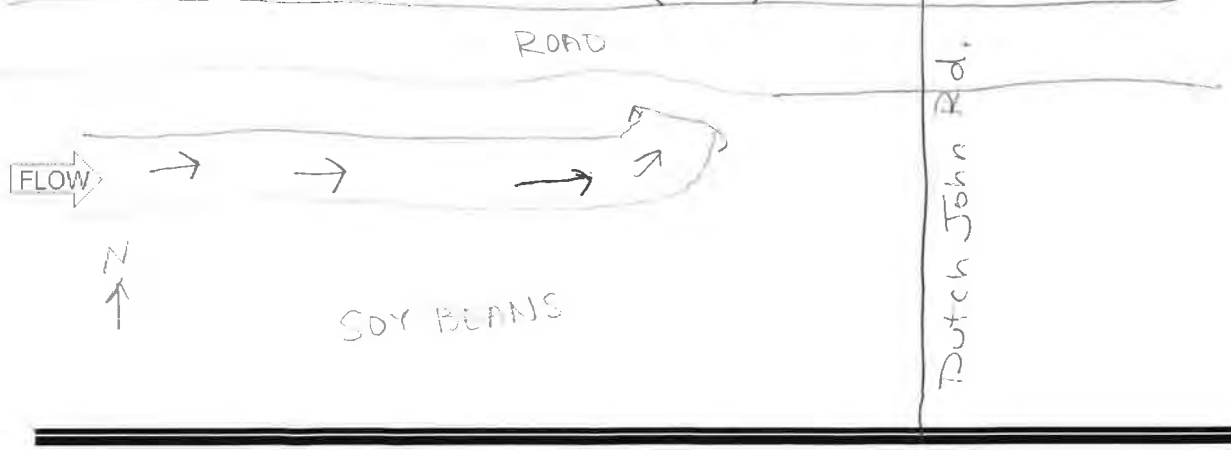

KBMCS02

OhioEPA Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

QHEI Score: 30.5

Stream & Location: Hagerman Creek / Stream 6 / Haviland - Van Wert 49 kV Line Rebuild Project **RM:** _/_._ **Date:** 6/21/24

Scorers Full Name & Affiliation: Kate Bomar / Stantec

River Code: _-_-_ **STORET #:** _____ **Lat./Long.:** (NAD 83 - decimal °) 40.954664 -84.591943 W **Office verified location** ☐

1] SUBSTRATE

Check *ONLY* Two substrate *TYPE BOXES*; estimate % or note every type present

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐☐ BLDR /SLABS [10]			☐☐ HARDPAN [4]		
☐☐ BOULDER [9]			☐☐ DETRITUS [3]		
☐☒ COBBLE [8]	X	X	☐☐ MUCK [2]		
☐☐ GRAVEL [7]			☒☐ SILT [2]	X	X
☐☐ SAND [6]			☐☐ ARTIFICIAL [0]		
☐☐ BEDROCK [5]			(Score natural substrates; ignore sludge from point-sources)		

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

Check ONE (*Or 2 & average*)

ORIGIN	QUALITY	
☐ LIMESTONE [1]	☒ HEAVY [-2]	
☐ TILLS [1]	☐ MODERATE [-1]	
☐ WETLANDS [0]	SILT ☐ NORMAL [0]	
☐ HARDPAN [0]	☐ FREE [1]	
☐ SANDSTONE [0]	☒ EXTENSIVE [-2]	
☒ RIP/RAP [0]	EMBEDDEDNESS ☐ MODERATE [-1]	
☐ LACUSTURINE [0]	☐ NORMAL [0]	
☐ SHALE [-1]	☐ NONE [1]	
☐ COAL FINES [-2]		

Substrate 6 *Maximum 20*

Comments

2] INSTREAM COVER

Indicate presence 0 to 3: **0**-Absent; **1**-Very small amounts or if more common of marginal quality; **2**-Moderate amounts, but not of highest quality or in small amounts of highest quality; **3**-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

____ UNDERCUT BANKS [1]	____ POOLS > 70cm [2]	____ OXBOWS, BACKWATERS [1]
1 OVERHANGING VEGETATION [1]	____ ROOTWADS [1]	____ AQUATIC MACROPHYTES [1]
____ SHALLOWS (IN SLOW WATER) [1]	____ BOULDERS [1]	1 LOGS OR WOODY DEBRIS [1]
____ ROOTMATS [1]		

AMOUNT Check ONE (*Or 2 & average*)

☐ EXTENSIVE >75% [11]
☐ MODERATE 25-75% [7]
☒ SPARSE 5-<25% [3]
☐ NEARLY ABSENT <5% [1]

Comments

Cover 5 *Maximum 20*

3] CHANNEL MORPHOLOGY

Check ONE in each category (*Or 2 & average*)

SINUOSITY	DEVELOPMENT	CHANNELIZATION	STABILITY
☐ HIGH [4]	☐ EXCELLENT [7]	☐ NONE [6]	☐ HIGH [3]
☐ MODERATE [3]	☐ GOOD [5]	☐ RECOVERED [4]	☒ MODERATE [2]
☐ LOW [2]	☐ FAIR [3]	☐ RECOVERING [3]	☐ LOW [1]
☒ NONE [1]	☒ POOR [1]	☒ RECENT OR NO RECOVERY [1]	

Comments 2

Channel 5 *Maximum 20*

4] BANK EROSION AND RIPARIAN ZONE

Check ONE in each category for *EACH BANK* (*Or 2 per bank & average*)

River right looking downstream

EROSION (L / R)	RIPARIAN WIDTH (L / R)	FLOOD PLAIN QUALITY (L / R)
☐☐ NONE / LITTLE [3]	☐☐ WIDE > 50m [4]	☐☐ FOREST, SWAMP [3]
☒☒ MODERATE [2]	☐☐ MODERATE 10-50m [3]	☐☐ SHRUB OR OLD FIELD [2]
☐☐ HEAVY / SEVERE [1]	☐☐ NARROW 5-10m [2]	☐☐ RESIDENTIAL, PARK, NEW FIELD [1]
	☒☒ VERY NARROW < 5m [1]	☐☐ FENCED PASTURE [1]
	☐☐ NONE [0]	☒☒ OPEN PASTURE, ROWCROP [0]

☐☐ CONSERVATION TILLAGE [1]
☐☐ URBAN OR INDUSTRIAL [0]
☐☐ MINING / CONSTRUCTION [0]

Indicate predominant land use(s) past 100m riparian.

Comments 2 1

Riparian 3 *Maximum 10*

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH Check ONE (*ONLY!*)

☐ > 1m [6]
☐ 0.7-<1m [4]
☒ 0.4-<0.7m [2]
☐ 0.2-<0.4m [1]
☐ < 0.2m [0]

CHANNEL WIDTH Check ONE (*Or 2 & average*)

☐ POOL WIDTH > RIFFLE WIDTH [2]
☐ POOL WIDTH = RIFFLE WIDTH [1]
☒ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY Check ALL that apply

☐ TORRENTIAL [-1]
☒ SLOW [1]
☐ VERY FAST [1]
☐ INTERSTITIAL [-1]
☐ FAST [1]
☐ INTERMITTENT [-2]
☒ MODERATE [1]
☐ EDDIES [1]

Indicate for reach - pools and riffles.

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments 2 0 2

Pool / Current 4 *Maximum 12*

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (*Or 2 & average*) ☐ NO RIFFLE [metric=0]

RIFFLE DEPTH	RUN DEPTH	RIFFLE / RUN SUBSTRATE	RIFFLE / RUN EMBEDDEDNESS
☐ BEST AREAS > 10cm [2]	☒ MAXIMUM > 50cm [2]	☒ STABLE (e.g., Cobble, Boulder) [2]	☐ NONE [2]
☒ BEST AREAS 5-10cm [1]	☐ MAXIMUM < 50cm [1]	☒ MOD. STABLE (e.g., Large Gravel) [1]	☐ LOW [1]
☐ BEST AREAS < 5cm [metric=0]		☐ UNSTABLE (e.g., Fine Gravel, Sand) [0]	☐ MODERATE [0]
			☒ EXTENSIVE [-1]

Comments 1 2 1.5 -1

Riffle / Run 3.5 *Maximum 8*

6] GRADIENT (3.99 ft/mi) DRAINAGE AREA (8.23 mi²)

☒ VERY LOW - LOW [2-4]
☐ MODERATE [6-10]
☐ HIGH - VERY HIGH [10-6]

%POOL: 30 %GLIDE: 30
%RUN: 30 %RIFFLE: 10

Gradient 4 *Maximum 10*

Stream 6 / Hagerman Creek

A] SAMPLED REACH

Check ALL that apply

Comment RE: Reach consistency/ Is reach typical of steam?, *Recreation/* Observed - Inferred, *Other/* Sampling observations, Concerns, Access directions, etc.

METHOD

- ☐ BOAT
- ☒ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE

1st -sample pass-	2nd
☐ HIGH	☐
☐ UP	☐
☒ NORMAL	☐
☐ LOW	☐
☐ DRY	☐

DISTANCE

- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☐ OTHER

10 meters

CLARITY

1st --sample pass--	2nd
☐ < 20 cm	☐
☐ 20-<40 cm	☐
☐ 40-70 cm	☐
☐ > 70 cm/ CTB	☐
☐ SECCHI DEPTH	☐

CANOPY

- ☒ > 85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

1st pass _____ cm

2nd _____ cm

B] AESTHETICS

- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☒ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☒ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

C] RECREATION

AREA DEPTH

POOL: ☐ >100ft² ☐ >3ft

D] MAINTENANCE

Circle some & *COMMENT*

PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

E] ISSUES

WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS

- $\bar{x}$ width
- $\bar{x}$ depth
- max. depth
- $\bar{x}$ bankfull width
- bankfull $\bar{x}$ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree:

Stream Drawing:

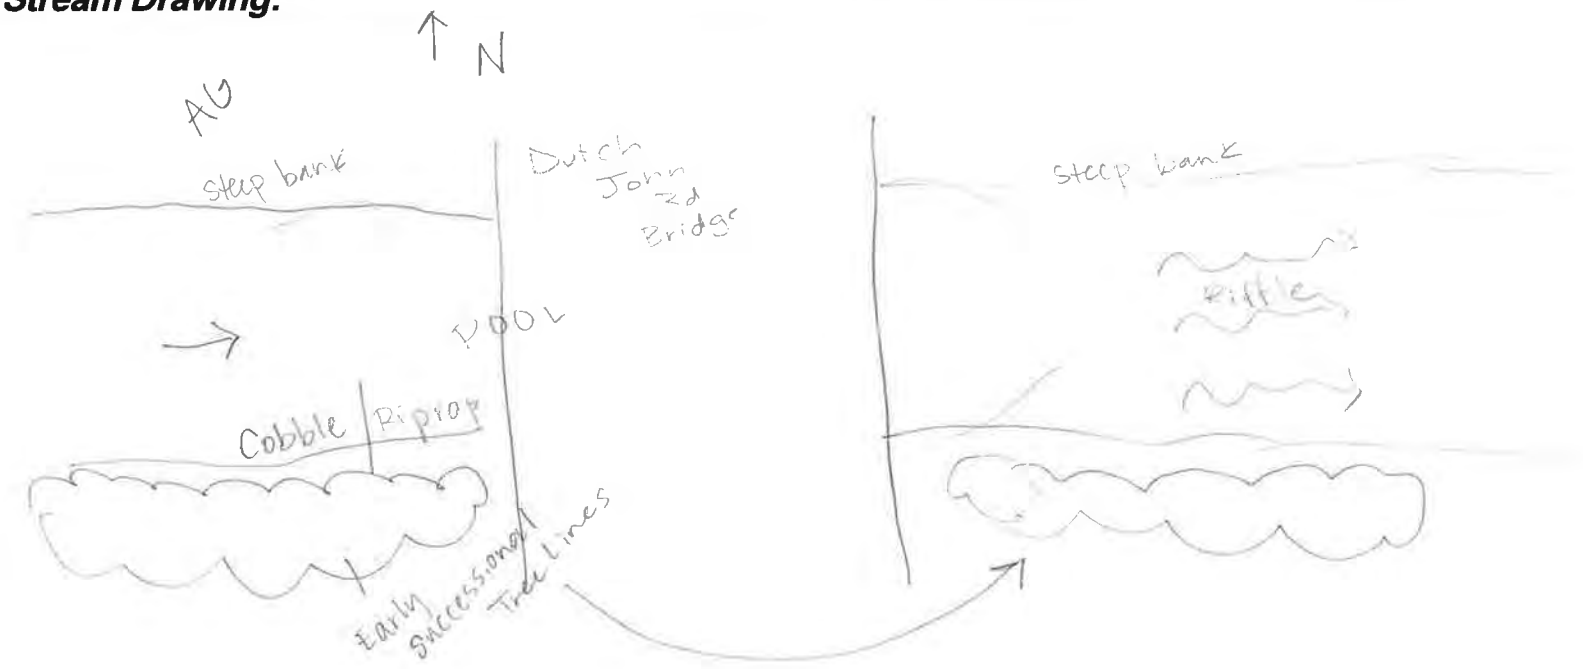

Pottawatomie Creek

KBMCS03

Headwater Habitat Evaluation Index Field Form

HHEI Score (sum of metrics 1+2+3) 62

SITE NAME/LOCATION Pottawatomie Creek/Haviland-Van Wert 69 KV Line Rebuild Project

SITE NUMBER Stream 7 RIVER BASIN Maumee RIVER CODE ____ DRAINAGE AREA (mi²) 2.38 mi²

LENGTH OF STREAM REACH (ft) 200' LAT 40, 945381°N LONG -84.5978 1°W RIVER MILE ____

DATE 10/26/24 SCORER KLB COMMENTS ____

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE / NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☒ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY two* predominant substrate *TYPE* boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐	BLDR SLABS [16 pts]	____	☒	SILT [3 pt]	90
☐	BOULDER (>256 mm) [16 pts]	____	☐	LEAF PACK/WOODY DEBRIS [3 pts]	____
☐	BEDROCK [16 pts]	____	☐	FINE DETRITUS [3 pts]	____
☒	COBBLE (65-256 mm) [12 pts]	10	☐	CLAY or HARDPAN [0 pt]	____
☐	GRAVEL (2-64 mm) [9 pts]	____	☐	MUCK [0 pts]	____
☐	SAND (<2 mm) [6 pts]	____	☐	ARTIFICIAL [3 pts]	____

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 10 (A) 15

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: 15 TOTAL NUMBER OF SUBSTRATE TYPES: (B) 2

HHEI Metric Points Substrate Max = 40: 17 — A + B

2. Maximum Pool Depth (*Measure the maximum pool depth within the 61 meter (200 feet)* evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

- ☐ > 30 centimeters [20 pts]
- ☐ > 22.5 - 30 cm [30 pts]
- ☒ > 10 - 22.5 cm [25 pts]
- ☐ 5 cm - 10 cm [15 pts]
- ☐ < 5 cm [5pts]
- ☐ NO WATER OR MOIST CHANNEL [0pts]

COMMENTS ____ MAXIMUM POOL DEPTH (centimeters): 12

Pool Depth Max = 30: 25

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

- ☐ > 4.0 meters (> 13') [30 pts]
- ☐ > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]
- ☒ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") [20 pts]
- ☐ > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
- ☐ ≤ 1.0 m (≤ 3' 3") [5 pts]

COMMENTS OHWM = 4.5' AVERAGE BANKFULL WIDTH (meters): 1.6

Bankfull Width Max=30: 20

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY * NOTE: River Left (L) and Right (R) as looking downstream *

RIPARIAN WIDTH (Per Bank) L	R		FLOODPLAIN QUALITY (Most Predominant per Bank) L	R		FLOODPLAIN QUALITY (Most Predominant per Bank) L	R	
☐	☐	Wide >10m	☐	☐	Mature Forest, Wetland	☐	☐	Conservation Tillage
☐	☐	Moderate 5-10m	☐	☐	Immature Forest, Shrub or Old Field	☐	☐	Urban or Industrial
☒	☒	Narrow <5m	☐	☐	Residential, Park, New Field	☒	☒	Open Pasture, Row Crop
☐	☐	None	☐	☐	Fenced Pasture	☐	☐	Mining or Construction

COMMENTS ____

FLOW REGIME (*At Time of Evaluation*) (Check *ONLY* one box):

- ☒ Stream Flowing
- ☐ Subsurface flow with isolated pools (interstitial)
- ☐ Moist Channel, isolated pools, no flow (intermittent)
- ☐ Dry channel, no water (ephemeral)

COMMENTS ____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☒ None	☐ 1.0	☐ 2.0	☐ 3.0
☐ 0.5	☐ 1.5	☐ 2.5	☐ >3

STREAM GRADIENT ESTIMATE

☒ Flat (0.5 ft/100 ft) ☐ Flat to Moderate ☐ Moderate (2 ft/100 ft) ☐ Moderate to Severe ☐ Severe (10 ft/100 ft)

Stream 7 Pottawatomie Creek

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☒ Yes ☐ No QHEI Score 33.5 (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S)

☒ WWH Name: MWH Hoaglin Creek Distance from Evaluated Stream ~7400'

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Scott NRCS Soil Map Page: / NRCS Soil Map Stream Order: /

County: Van Wert Co Township/City: Van Wert

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 6/25/2024 Quantity: 0.17"

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 100

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): /

Field Measures: Temp (°C) 22.4 Dissolved Oxygen (mg/l) / pH (S.U.) 8.2 Conductivity (umhos/cm) /

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) Y Species observed (if known): unknown

Frogs or Tadpoles Observed? (Y/N) Y Species observed (if known): American bullfrog

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

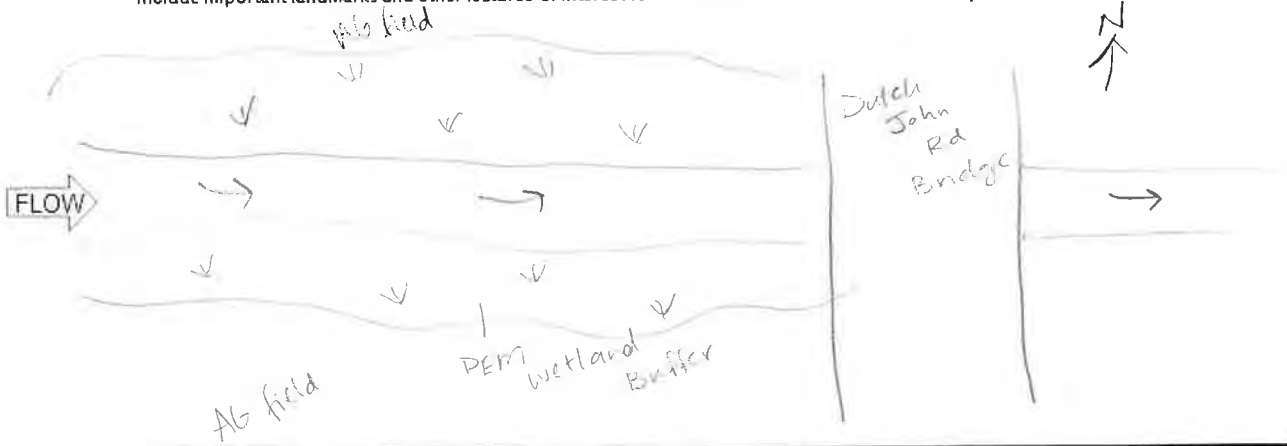

OhioEPA Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

QHEI Score: 33.5

Stream & Location: Stream 7 / Pottawatomie Creek / Haviland-Van Wert **RM:** ___.__ **Date:** 10/24/24

69 kV Line Rebuild Project

Scorers Full Name & Affiliation: Kate Bomar / Stantec

River Code: ___-___-___ **STORET #:** _____ **Lat./ Long.:** 40.945381 / 84.591781 (NAD 83 - decimal °) **Office verified location** ☐

1] SUBSTRATE
Check *ONLY* Two substrate *TYPE BOXES*; estimate % or note every type present

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐☐ BLDR /SLABS [10]	____	____	☐☐ HARDPAN [4]	____	____
☐☐ BOULDER [9]	____	____	☐☐ DETRITUS [3]	____	____
☒☒ COBBLE [8]	____	____	☐☐ MUCK [2]	____	____
☐☐ GRAVEL [7]	____	____	☒☒ SILT [2]	____	____
☐☐ SAND [6]	____	____	☐☐ ARTIFICIAL [0]	____	____
☐☐ BEDROCK [5]	____	____	(Score natural substrates; ignore sludge from point-sources)		

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

Check ONE (*Or 2 & average*)

ORIGIN
- ☐ LIMESTONE [1]
- ☒ TILLS [1]
- ☐ WETLANDS [0]
- ☐ HARDPAN [0]
- ☐ SANDSTONE [0]
- ☐ RIP/RAP [0]
- ☐ LACUSTURINE [0]
- ☐ SHALE [-1]
- ☐ COAL FINES [-2]

QUALITY

SILT
- ☒ HEAVY [-2]
- ☐ MODERATE [-1]
- ☐ NORMAL [0]
- ☐ FREE [1]

EMBEDDEDNESS
- ☐ EXTENSIVE [-2]
- ☒ MODERATE [-1]
- ☐ NORMAL [0]
- ☐ NONE [1]

Substrate 7 *Maximum 20*

Comments

2] INSTREAM COVER
Indicate presence 0 to 3: **0**-Absent; **1**-Very small amounts or if more common of marginal quality; **2**-Moderate amounts, but not of highest quality or in small amounts of highest quality; **3**-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

- ____ UNDERCUT BANKS [1]
- 1 OVERHANGING VEGETATION [1]
- ____ SHALLOWS (IN SLOW WATER) [1]
- ____ ROOTMATS [1]
- ____ POOLS > 70cm [2]
- ____ ROOTWADS [1]
- ____ BOULDERS [1]
- ____ OXBOWS, BACKWATERS [1]
- ____ AQUATIC MACROPHYTES [1]
- 1 LOGS OR WOODY DEBRIS [1]

AMOUNT
Check ONE (*Or 2 & average*)
- ☐ EXTENSIVE >75% [11]
- ☐ MODERATE 25-75% [7]
- ☒ SPARSE 5-<25% [3]
- ☐ NEARLY ABSENT <5% [1]

Comments

Cover 5 *Maximum 20*

3] CHANNEL MORPHOLOGY
Check ONE in each category (*Or 2 & average*)

SINUOSITY
- ☐ HIGH [4]
- ☐ MODERATE [3]
- ☒ LOW [2]
- ☐ NONE [1]

DEVELOPMENT
- ☐ EXCELLENT [7]
- ☒ GOOD [5]
- ☐ FAIR [3]
- ☐ POOR [1]

CHANNELIZATION
- ☐ NONE [6]
- ☐ RECOVERED [4]
- ☒ RECOVERING [3]
- ☒ RECENT OR NO RECOVERY [1]

STABILITY
- ☐ HIGH [3]
- ☒ MODERATE [2]
- ☐ LOW [1]

2 5 2 2

Comments

Channel 11 *Maximum 20*

4] BANK EROSION AND RIPARIAN ZONE
Check ONE in each category for *EACH BANK* (*Or 2 per bank & average*)

River right looking downstream

EROSION (L / R)
- ☒ ☐ NONE / LITTLE [3]
- ☐ ☐ MODERATE [2]
- ☐ ☐ HEAVY / SEVERE [1]

RIPARIAN WIDTH (L / R)
- ☐ ☐ WIDE > 50m [4]
- ☐ ☐ MODERATE 10-50m [3]
- ☐ ☐ NARROW 5-10m [2]
- ☐ ☐ VERY NARROW < 5m [1]
- ☒ ☒ NONE [0]

FLOOD PLAIN QUALITY (L / R)
- ☐ ☐ FOREST, SWAMP [3]
- ☐ ☐ SHRUB OR OLD FIELD [2]
- ☒ ☒ RESIDENTIAL, PARK, NEW FIELD [1]
- ☐ ☐ FENCED PASTURE [1]
- ☒ ☒ OPEN PASTURE, ROWCROP [0]

(L / R)
- ☐ ☐ CONSERVATION TILLAGE [1]
- ☐ ☐ URBAN OR INDUSTRIAL [0]
- ☐ ☐ MINING / CONSTRUCTION [0]

Indicate predominant land use(s) past 100m riparian.

0.5

Comments

Riparian 3.5 *Maximum 10*

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH
Check ONE (*ONLY!*)
- ☐ > 1m [6]
- ☐ 0.7-<1m [4]
- ☐ 0.4-<0.7m [2]
- ☒ 0.2-<0.4m [1]
- ☐ < 0.2m [0]

CHANNEL WIDTH
Check ONE (*Or 2 & average*)
- ☐ POOL WIDTH > RIFFLE WIDTH [2]
- ☒ POOL WIDTH = RIFFLE WIDTH [1]
- ☐ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY
Check ALL that apply
- ☐ TORRENTIAL [-1]
- ☐ SLOW [1]
- ☐ VERY FAST [1]
- ☐ INTERSTITIAL [-1]
- ☐ FAST [1]
- ☐ INTERMITTENT [-2]
- ☒ MODERATE [1]
- ☐ EDDIES [1]

Indicate for reach - pools and riffles.

1 1

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments

Pool / Current 3 *Maximum 12*

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (*Or 2 & average*).

☒ NO RIFFLE [metric=0]

RIFFLE DEPTH
- ☐ BEST AREAS > 10cm [2]
- ☐ BEST AREAS 5-10cm [1]
- ☐ BEST AREAS < 5cm [metric=0]

RUN DEPTH
- ☐ MAXIMUM > 50cm [2]
- ☐ MAXIMUM < 50cm [1]

RIFFLE / RUN SUBSTRATE
- ☐ STABLE (e.g., Cobble, Boulder) [2]
- ☐ MOD. STABLE (e.g., Large Gravel) [1]
- ☐ UNSTABLE (e.g., Fine Gravel, Sand) [0]

RIFFLE / RUN EMBEDDEDNESS
- ☐ NONE [2]
- ☐ LOW [1]
- ☐ MODERATE [0]
- ☐ EXTENSIVE [-1]

Comments

Riffle / Run 0 *Maximum 8*

6] GRADIENT
(4.3 ft/mi)

DRAINAGE AREA
(2.38 mi²)

- ☒ VERY LOW - LOW [2-4]
- ☐ MODERATE [6-10]
- ☐ HIGH - VERY HIGH [10-6]

%POOL: 0 %GLIDE: 0

%RUN: 100 %RIFFLE: 0

Gradient 4 *Maximum 10*

A] SAMPLED REACH

Check ALL that apply

METHOD

- ☐ BOAT
- ☒ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE

1st -sample pass-	2nd
☐ HIGH	☐
☐ UP	☒
☐ NORMAL	☐
☐ LOW	☐
☐ DRY	☐

DISTANCE

- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☒ OTHER

1el meters

CLARITY

1st --sample pass--	2nd
☒ < 20 cm	☐
☐ 20-<40 cm	☐
☐ 40-70 cm	☐
☐ > 70 cm/ CTB	☐
☐ SECCHI DEPTH	☐

CANOPY

- ☒ >85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

1st pass: 1st_____ cm

2nd_____ cm

Comment RE: Reach consistency/ Is reach typical of steam?, *Recreation/* Observed - Inferred, *Other/* Sampling observations, Concerns, Access directions, etc.

B] AESTHETICS

- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☒ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☐ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

C] RECREATION

AREA DEPTH

POOL: ☐ >100ft² ☐ >3ft

D] MAINTENANCE

Circle some & *COMMENT*

PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

Channelized agricultural ditch

E] ISSUES

WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS

- $\bar{x}$ width
- $\bar{x}$ depth
- max. depth
- $\bar{x}$ bankfull width
- bankfull $\bar{x}$ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree:

Stream Drawing:

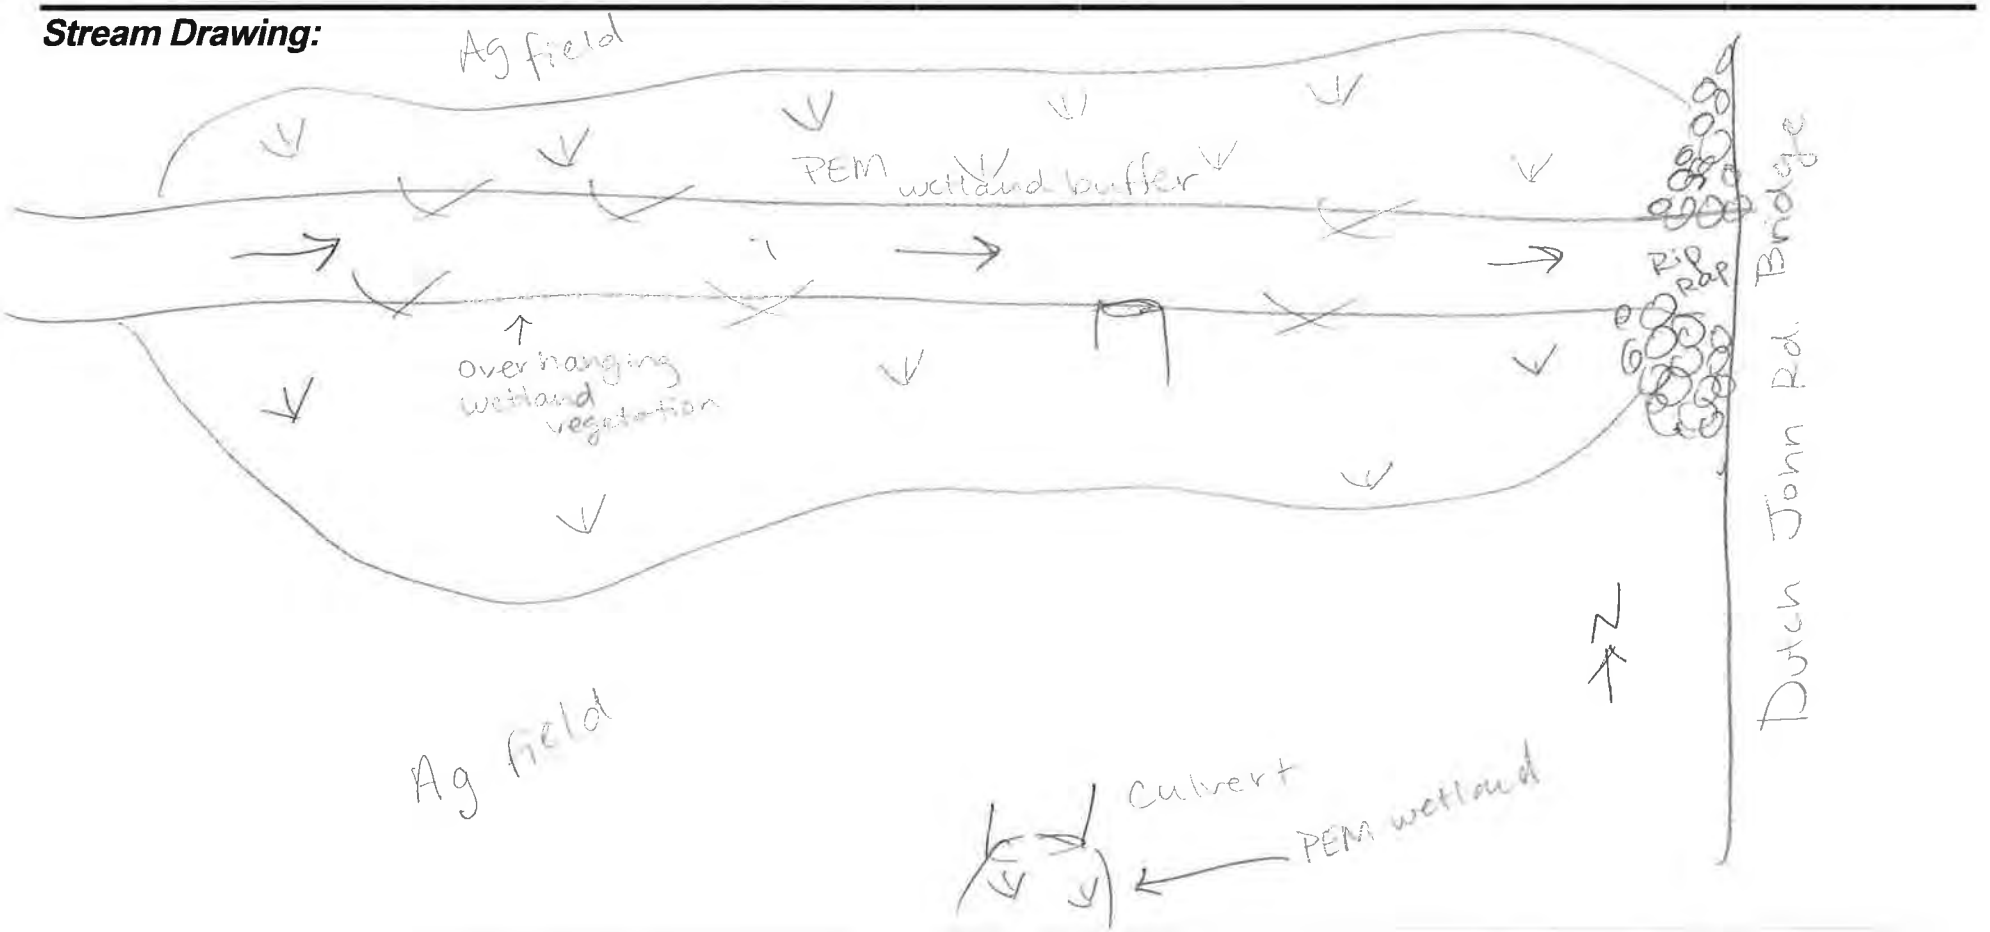

OhioEPA Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

4kds504

QHEI Score: 28.5

Stream & Location: Stream B / Hoaglin Creek / Haviland- Van Wert 138 kV Line Rebuild Project RM: ___ Date: 06/26/06 24

Scorers Full Name & Affiliation: Kwolek/Stantec

River Code: ___-___-___ STORET #: ___ Lat./Long.: 40.929110 / 84.591671 (NAD 83 - decimal °) Office verified location ☐

1] SUBSTRATE Check *ONLY* Two substrate *TYPE BOXES*; estimate % or note every type present

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐ ☐ BLDR /SLABS [10]	___	___	☐ ☐ HARDPAN [4]	/	___
☐ ☐ BOULDER [9]	___	___	☐ ☐ DETRITUS [3]	___	___
☐ ☐ COBBLE [8]	/	___	☐ ☐ MUCK [2]	/	___
☐ ☐ GRAVEL [7]	/	___	☒ ☐ SILT [2]	/	___
☐ ☒ SAND [6]	/	___	☐ ☐ ARTIFICIAL [0]	___	___
☐ ☐ BEDROCK [5]	___	___			

(Score natural substrates; ignore sludge from point-sources)

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

Check ONE (*Or 2 & average*)

ORIGIN	QUALITY	
☐ LIMESTONE [1]	☒ HEAVY [-2]	
☒ TILLS [1]	☐ MODERATE [-1]	
☐ WETLANDS [0]	SILT ☐ NORMAL [0]	
☐ HARDPAN [0]	☐ FREE [1]	
☐ SANDSTONE [0]	EMBEDDEDNESS ☒ EXTENSIVE [-2]	
☐ RIP/RAP [0]	☐ MODERATE [-1]	
☐ LACUSTURINE [0]	☐ NORMAL [0]	
☐ SHALE [-1]	☐ NONE [1]	
☐ COAL FINES [-2]		

Comments

Substrate 5 Maximum 20

2] INSTREAM COVER Indicate presence 0 to 3: **0**-Absent; **1**-Very small amounts or if more common of marginal quality; **2**-Moderate amounts, but not of highest quality or in small amounts of highest quality; **3**-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

___ UNDERCUT BANKS [1]	___ POOLS > 70cm [2]	___ OXBOWS, BACKWATERS [1]
1 OVERHANGING VEGETATION [1]	___ ROOTWADS [1]	___ AQUATIC MACROPHYTES [1]
___ SHALLOWS (IN SLOW WATER) [1]	___ BOULDERS [1]	___ LOGS OR WOODY DEBRIS [1]
___ ROOTMATS [1]		

AMOUNT Check ONE (*Or 2 & average*)

☐ EXTENSIVE >75% [11]
☐ MODERATE 25-75% [7]
☐ SPARSE 5-<25% [3]
☒ NEARLY ABSENT <5% [1]

Comments

Cover Maximum 20: 2

3] CHANNEL MORPHOLOGY Check ONE in each category (*Or 2 & average*)

SINUOSITY	DEVELOPMENT	CHANNELIZATION	STABILITY
☐ HIGH [4]	☐ EXCELLENT [7]	☐ NONE [6]	☐ HIGH [3]
☐ MODERATE [3]	☐ GOOD [5]	☐ RECOVERED [4]	☒ MODERATE [2]
☒ LOW [2]	☒ FAIR [3]	☒ RECOVERING [3] 2	☐ LOW [1]
☐ NONE [1]	☐ POOR [1]	☐ RECENT OR NO RECOVERY [1]	

Comments

Channel Maximum 20: 9

4] BANK EROSION AND RIPARIAN ZONE Check ONE in each category for *EACH BANK* (*Or 2 per bank & average*)

River right looking downstream

EROSION (L R)	RIPARIAN WIDTH (L R)	FLOOD PLAIN QUALITY (L R)
☐ ☐ NONE / LITTLE [3]	☐ ☐ WIDE > 50m [4]	☐ ☐ FOREST, SWAMP [3]
☒ ☒ MODERATE [2]	☐ ☐ MODERATE 10-50m [3]	☐ ☐ SHRUB OR OLD FIELD [2]
☐ ☐ HEAVY / SEVERE [1]	☐ ☐ NARROW 5-10m [2]	☒ ☒ RESIDENTIAL, PARK, NEW FIELD [1]
	☐ ☐ VERY NARROW < 5m [1]	☐ ☐ FENCED PASTURE [1]
	☒ ☒ NONE [0]	☒ ☒ OPEN PASTURE, ROWCROP [0]

(L R)	
☐ ☐	CONSERVATION TILLAGE [1]
☐ ☐	URBAN OR INDUSTRIAL [0]
☐ ☐	MINING / CONSTRUCTION [0]

Indicate predominant land use(s) past 100m riparian.

Comments

Riparian Maximum 10: 2.5

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH Check ONE (*ONLY!*)

☐ > 1m [6]
☐ 0.7-<1m [4]
☒ 0.4-<0.7m [2]
☐ 0.2-<0.4m [1]
☐ < 0.2m [0]

CHANNEL WIDTH Check ONE (*Or 2 & average*)

☐ POOL WIDTH > RIFFLE WIDTH [2]
☒ POOL WIDTH = RIFFLE WIDTH [1]
☐ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY Check ALL that apply

☐ TORRENTIAL [-1] ☐ SLOW [1]
☐ VERY FAST [1] ☐ INTERSTITIAL [-1]
☐ FAST [1] ☐ INTERMITTENT [-2]
☒ MODERATE [1] ☐ EDDIES [1]

Indicate for reach - pools and riffles.

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments

Pool / Current Maximum 12: 4

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (*Or 2 & average*). ☒ NO RIFFLE [metric=0]

RIFFLE DEPTH	RUN DEPTH	RIFFLE / RUN SUBSTRATE	RIFFLE / RUN EMBEDDEDNESS
☐ BEST AREAS > 10cm [2]	☐ MAXIMUM > 50cm [2]	☐ STABLE (e.g., Cobble, Boulder) [2]	☐ NONE [2]
☐ BEST AREAS 5-10cm [1]	☐ MAXIMUM < 50cm [1]	☐ MOD. STABLE (e.g., Large Gravel) [1]	☐ LOW [1]
☐ BEST AREAS < 5cm [metric=0]		☐ UNSTABLE (e.g., Fine Gravel, Sand) [0]	☐ MODERATE [0]
			☐ EXTENSIVE [-1]

Comments

Riffle / Run Maximum 8: 0

6] GRADIENT (4.5 ft/mi) ☒ VERY LOW - LOW [2-4] ☒ MODERATE [6-10] ☐ HIGH - VERY HIGH [10-6]

DRAINAGE AREA (32.5 mi²)

%POOL: ___ %GLIDE: ___ %RUN: 100 %RIFFLE: ___

Gradient Maximum 10: 6

Stream 8/ Hoaglin Creek

A] SAMPLED REACH
Check ALL that apply

METHOD
- ☐ BOAT
- ☒ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE (1st -sample pass- 2nd)
- ☐ HIGH ☐
- ☐ UP ☐
- ☒ NORMAL ☐
- ☐ LOW ☐
- ☐ DRY ☐

DISTANCE
- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☐ OTHER

61 meters

CLARITY (1st --sample pass-- 2nd)
- ☐ < 20 cm ☐
- ☒ 20-<40 cm ☒
- ☐ 40-70 cm ☐
- ☐ > 70 cm/ CTB ☐
- ☐ SECCHI DEPTH ☐

CANOPY
- ☒ > 85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

1st pass _____ cm
2nd _____ cm

C] RECREATION POOL: AREA ☐ >100ft² DEPTH ☐ >3ft

Comment RE: Reach consistency/ Is reach typical of steam?, *Recreation/* Observed - Inferred, *Other/* Sampling observations, Concerns, Access directions, etc.

Fish, frogs, Corbicula present

pH: 8.3 temp = 22.9

B] AESTHETICS
- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☒ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☐ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

D] MAINTENANCE
PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

Circle some & *COMMENT*

channelized

Ag

E] ISSUES
WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS
- x̄ width
- x̄ depth
- max. depth
- x̄ bankfull width
- bankfull x̄ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree:

Stream Drawing:

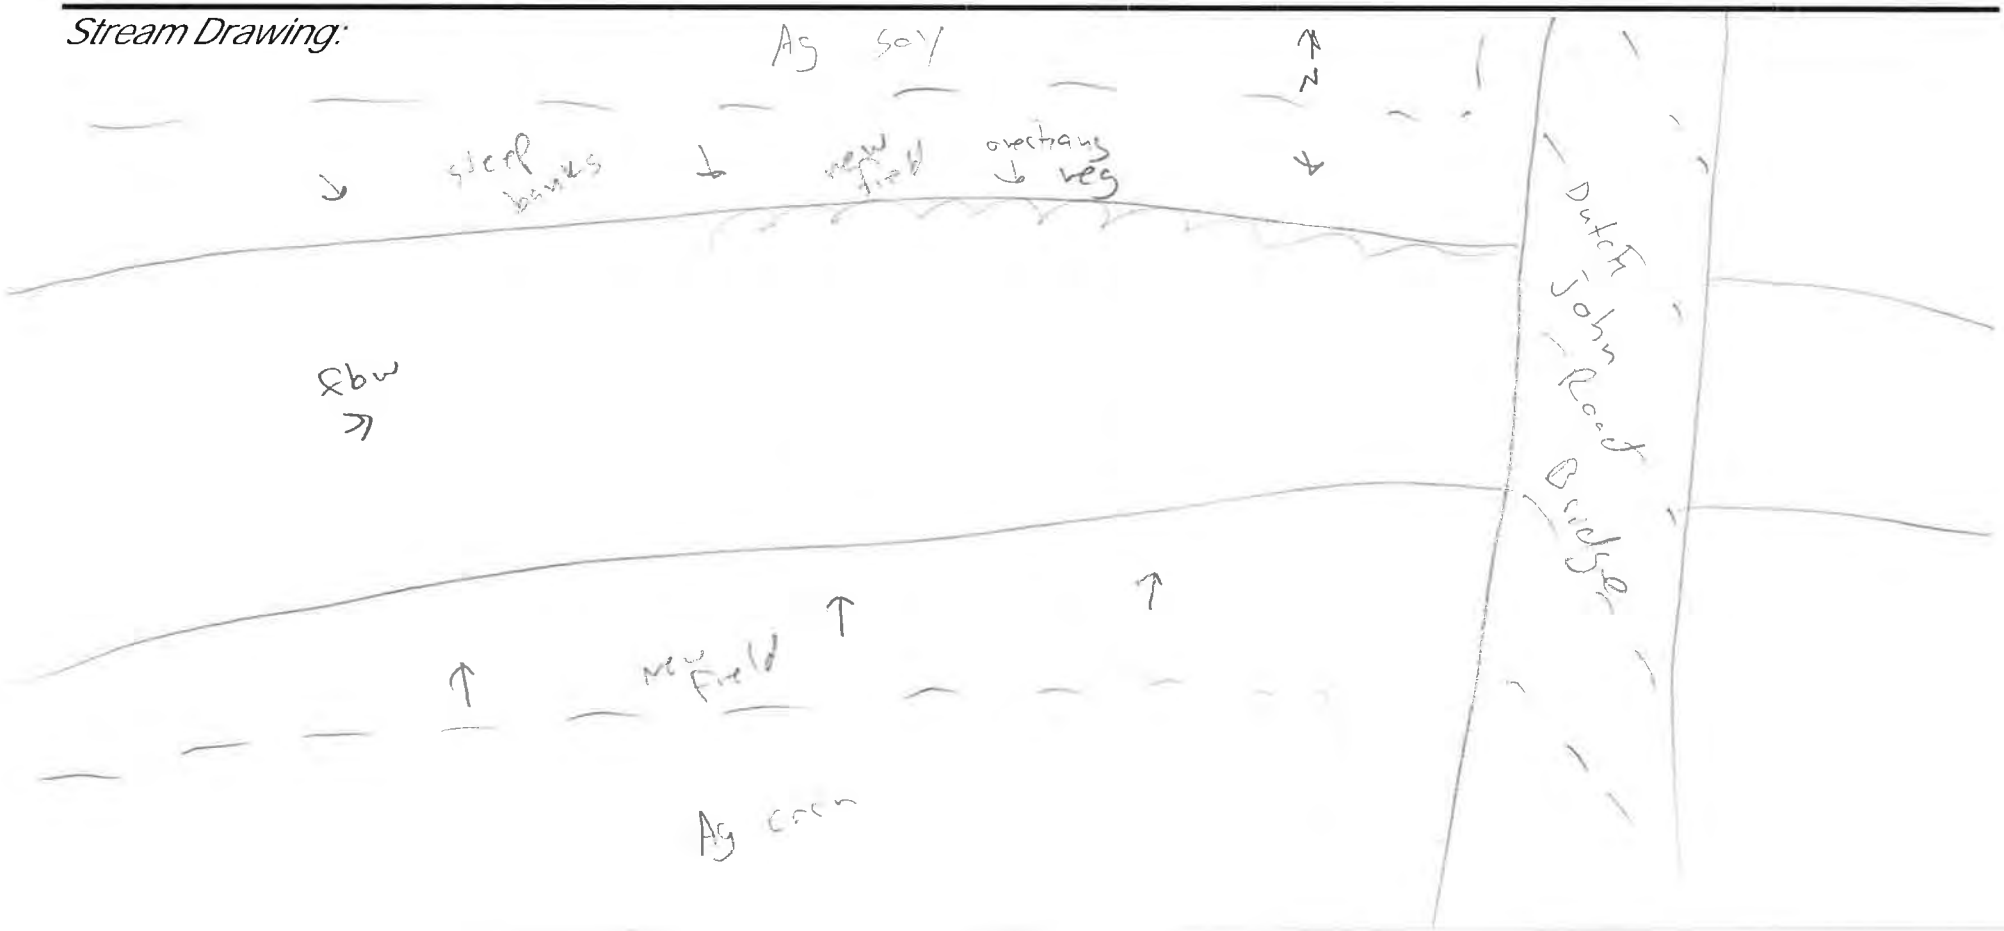

AkDSS05

OhioEPA Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

QHEI Score: 31.5

Stream & Location: Stream 9/Maddox Creek/ Haviland-Van Wert 69kV Line **RM:** ___.__ **Date:** 06/26/25

Rebuild Project **Scorers Full Name & Affiliation:** Aaron Kwolek/Slantec

River Code: ___-___-___ **STORET #:** _____ **Lat./Long.:** 40.89482 / 84.591472 (NAD 83 - decimal °) **Office verified location** ☐

1] SUBSTRATE

Check **ONLY Two** substrate *TYPE BOXES*; estimate % or note every type present

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐ ☐ BLDR /SLABS [10]			☐ ☐ HARDPAN [4]		
☐ ☐ BOULDER [9]			☐ ☐ DETRITUS [3]		
☐ ☐ COBBLE [8]			☐ ☐ MUCK [2]		
☐ ☐ GRAVEL [7]			☒ ☐ SILT [2]		
☐ ☒ SAND [6]			☐ ☐ ARTIFICIAL [0]		
☐ ☐ BEDROCK [5]			(Score natural substrates; ignore sludge from point-sources)		

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

Check ONE (*Or 2 & average*)

ORIGIN
- ☐ LIMESTONE [1]
- ☒ TILLS [1]
- ☐ WETLANDS [0]
- ☐ HARDPAN [0]
- ☐ SANDSTONE [0]
- ☐ RIP/RAP [0]
- ☐ LACUSTURINE [0]
- ☐ SHALE [-1]
- ☐ COAL FINES [-2]

QUALITY

SILT
- ☒ HEAVY [-2]
- ☐ MODERATE [-1]
- ☐ NORMAL [0]
- ☐ FREE [1]

EMBEDDEDNESS
- ☒ EXTENSIVE [-2]
- ☐ MODERATE [-1]
- ☐ NORMAL [0]
- ☐ NONE [1]

Substrate 5 *Maximum 20*

Comments

2] INSTREAM COVER

Indicate presence 0 to 3: **0**-Absent; **1**-Very small amounts or if more common of marginal quality; **2**-Moderate amounts, but not of highest quality or in small amounts of highest quality; **3**-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

- ___ UNDERCUT BANKS [1]
- 1 OVERHANGING VEGETATION [1]
- ___ SHALLOWS (IN SLOW WATER) [1]
- ___ ROOTMATS [1]
- ___ POOLS > 70cm [2]
- ___ ROOTWADS [1]
- 1 BOULDERS [1]
- ___ OXBOWS, BACKWATERS [1]
- ___ AQUATIC MACROPHYTES [1]
- ___ LOGS OR WOODY DEBRIS [1]

AMOUNT Check ONE (*Or 2 & average*)
- ☐ EXTENSIVE >75% [11]
- ☐ MODERATE 25-75% [7]
- ☒ SPARSE 5-<25% [3]
- ☐ NEARLY ABSENT <5% [1]

Comments

Cover 5 *Maximum 20*

3] CHANNEL MORPHOLOGY

Check ONE in each category (*Or 2 & average*)

SINUOSITY
- ☐ HIGH [4]
- ☐ MODERATE [3]
- ☒ LOW [2]
- ☐ NONE [1]

DEVELOPMENT
- ☐ EXCELLENT [7]
- ☐ GOOD [5]
- ☒ FAIR [3]
- ☐ POOR [1]

CHANNELIZATION
- ☐ NONE [6]
- ☐ RECOVERED [4]
- ☐ RECOVERING [3]
- ☒ RECENT OR NO RECOVERY [1]

STABILITY
- ☐ HIGH [3]
- ☒ MODERATE [2]
- ☐ LOW [1]

Comments

Channel 8 *Maximum 20*

4] BANK EROSION AND RIPARIAN ZONE

Check **ONE** in each category for ***EACH BANK*** (*Or 2 per bank & average*)

River right looking downstream

EROSION (L R)
- ☒ ☒ NONE / LITTLE [3]
- ☐ ☐ MODERATE [2]
- ☐ ☐ HEAVY / SEVERE [1]

RIPARIAN WIDTH (L R)
- ☐ ☐ WIDE > 50m [4]
- ☐ ☐ MODERATE 10-50m [3]
- ☐ ☐ NARROW 5-10m [2]
- ☐ ☐ VERY NARROW < 5m [1]
- ☒ ☒ NONE [0]

FLOOD PLAIN QUALITY (L R)
- ☐ ☐ FOREST, SWAMP [3]
- ☐ ☐ SHRUB OR OLD FIELD [2]
- ☒ ☒ RESIDENTIAL, PARK, NEW FIELD [1]
- ☐ ☐ FENCED PASTURE [1]
- ☒ ☒ OPEN PASTURE, ROWCROP [0]

(L R)
- ☐ ☐ CONSERVATION TILLAGE [1]
- ☐ ☐ URBAN OR INDUSTRIAL [0]
- ☐ ☐ MINING / CONSTRUCTION [0]

Indicate predominant land use(s) past 100m riparian.

Comments

Riparian 3.5 *Maximum 10*

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH Check **ONE** (*ONLY!*)
- ☐ > 1m [6]
- ☐ 0.7-<1m [4]
- ☒ 0.4-<0.7m [2]
- ☐ 0.2-<0.4m [1]
- ☐ < 0.2m [0]

CHANNEL WIDTH Check ONE (*Or 2 & average*)
- ☐ POOL WIDTH > RIFFLE WIDTH [2]
- ☒ POOL WIDTH = RIFFLE WIDTH [1]
- ☐ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY Check ALL that apply
- ☐ TORRENTIAL [-1]
- ☐ VERY FAST [1]
- ☐ FAST [1]
- ☒ MODERATE [1]
- ☐ SLOW [1]
- ☐ INTERSTITIAL [-1]
- ☐ INTERMITTENT [-2]
- ☐ EDDIES [1]

Indicate for reach - pools and riffles.

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments

Pool / Current 4 *Maximum 12*

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (*Or 2 & average*). ☒ NO RIFFLE [metric=0]

RIFFLE DEPTH
- ☐ BEST AREAS > 10cm [2]
- ☐ BEST AREAS 5-10cm [1]
- ☐ BEST AREAS < 5cm [metric=0]

RUN DEPTH
- ☐ MAXIMUM > 50cm [2]
- ☐ MAXIMUM < 50cm [1]

RIFFLE / RUN SUBSTRATE
- ☐ STABLE (e.g., Cobble, Boulder) [2]
- ☐ MOD. STABLE (e.g., Large Gravel) [1]
- ☐ UNSTABLE (e.g., Fine Gravel, Sand) [0]

RIFFLE / RUN EMBEDDEDNESS
- ☐ NONE [2]
- ☐ LOW [1]
- ☐ MODERATE [0]
- ☐ EXTENSIVE [-1]

Comments

Riffle / Run 0 *Maximum 8*

6] GRADIENT

(4.39 ft/mi) ☒ VERY LOW - LOW [2-4] ☐ MODERATE [6-10] ☐ HIGH - VERY HIGH [10-6]

DRAINAGE AREA (23.0 mi²)

%POOL: ___ %GLIDE: ___ %RUN: 100 %RIFFLE: ___

Gradient 6 *Maximum 10*

Stream 9 - Maddox Creek

A] SAMPLED REACH

Check ALL that apply

METHOD

- ☐ BOAT
- ☑ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE

1st -sample pass-		2nd
☐	HIGH	☐
☐	UP	☐
☑	NORMAL	☑
☐	LOW	☐
☐	DRY	☐

DISTANCE

- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☐ OTHER

61 meters

CLARITY

1st --sample pass--		2nd
☑	< 20 cm	☑
☐	20-<40 cm	☐
☐	40-70 cm	☐
☐	> 70 cm/ CTB	☐
☐	SECCHI DEPTH	☐

CANOPY

- ☑ > 85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

1st pass _____ cm

2nd _____ cm

C] RECREATION AREA DEPTH

POOL: ☐ >100ft² ☐ >3ft

Comment RE: Reach consistency/ Is reach typical of steam?, Recreation/ Observed - Inferred, Other/ Sampling observations, Concerns, Access directions, etc.

Fish, frogs, corbiculs

pH = 8.9 temp = 23.4°C

B] AESTHETICS

- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☑ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☐ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

D] MAINTENANCE

Circle some & COMMENT

PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

Ag channelization
Turbid from recent rain

E] ISSUES

WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS

- x̄ width
- x̄ depth
- max. depth
- x̄ bankfull width
- bankfull x̄ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree:

Stream Drawing:

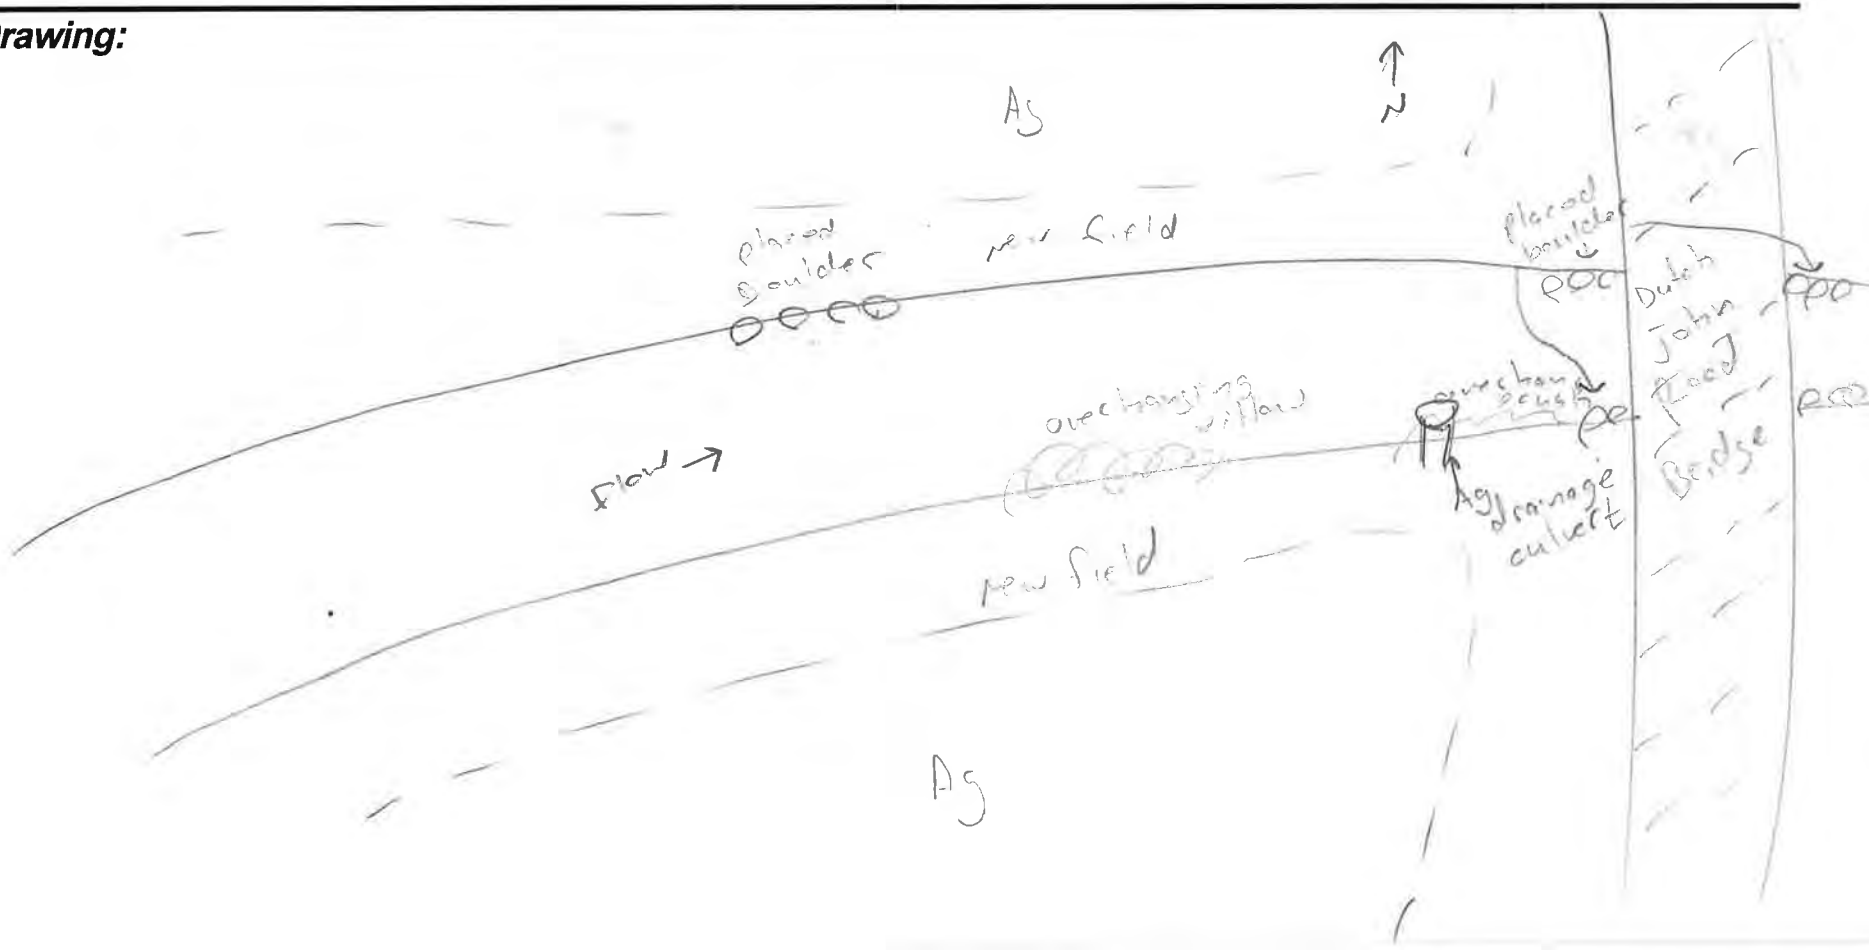

AkDSS06

OhioEPA Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

QHEI Score: 30.5

Stream & Location: Stream 10 / Haviland - Van Wert 69 kV Line Rebuild Project Town Creek **RM:** ___.__ **Date:** 06/27/24

Scorers Full Name & Affiliation: Aaron Kwolek / Stantec

River Code: ___-___-___ **STORET #:** _____ **Lat./ Long.:** (NAD 83 - decimal °) 40.883629 / 84.588255 Office verified location ☐

1] SUBSTRATE

Check ONLY Two substrate TYPE BOXES; estimate % or note every type present

Check ONE (Or 2 & average)

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐☐ BLDR /SLABS [10]	___	___	☐☐ HARDPAN [4]	/	___
☐☐ BOULDER [9]	___	___	☐☐ DETRITUS [3]	___	___
☐☐ COBBLE [8]	___	___	☐☐ MUCK [2]	/	___
☐☐ GRAVEL [7]	/	___	☒☐ SILT [2]	/	___
☐☒ SAND [6]	/	___	☐☐ ARTIFICIAL [0]	___	___
☐☐ BEDROCK [5]	___	___	(Score natural substrates; ignore sludge from point-sources)		

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

ORIGIN	QUALITY	
☐ LIMESTONE [1]	☒ HEAVY [-2]	
☒ TILLS [1]	☐ MODERATE [-1]	
☐ WETLANDS [0]	SILT ☐ NORMAL [0]	
☐ HARDPAN [0]	☐ FREE [1]	
☐ SANDSTONE [0]	☒ EXTENSIVE [-2]	
☐ RIP/RAP [0]	EMBEDDEDNESS ☐ MODERATE [-1]	
☐ LACUSTURINE [0]	☐ NORMAL [0]	
☐ SHALE [-1]	☐ NONE [1]	
☐ COAL FINES [-2]		

Comments

Substrate 5 / Maximum 20

2] INSTREAM COVER

Indicate presence 0 to 3: 0-Absent; 1-Very small amounts or if more common of marginal quality; 2-Moderate amounts, but not of highest quality or in small amounts of highest quality; 3-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

___ UNDERCUT BANKS [1]	___ POOLS > 70cm [2]	___ OXBOWS, BACKWATERS [1]
1 OVERHANGING VEGETATION [1]	___ ROOTWADS [1]	___ AQUATIC MACROPHYTES [1]
___ SHALLOWS (IN SLOW WATER) [1]	___ BOULDERS [1]	1 LOGS OR WOODY DEBRIS [1]
___ ROOTMATS [1]		

AMOUNT Check ONE (Or 2 & average)

☐ EXTENSIVE >75% [11]
☐ MODERATE 25-75% [7]
☒ SPARSE 5-<25% [3]
☐ NEARLY ABSENT <5% [1]

Comments

Cover 5 / Maximum 20

3] CHANNEL MORPHOLOGY

Check ONE in each category (Or 2 & average)

SINUOSITY	DEVELOPMENT	CHANNELIZATION	STABILITY
☐ HIGH [4]	☐ EXCELLENT [7]	☐ NONE [6]	☐ HIGH [3]
☐ MODERATE [3]	☐ GOOD [5]	☐ RECOVERED [4]	☐ MODERATE [2]
☐ LOW [2]	☒ FAIR [3]	☐ RECOVERING [3]	☒ LOW [1]
☒ NONE [1]	☐ POOR [1]	☒ RECENT OR NO RECOVERY [1]	

Comments

Channel 6 / Maximum 20

4] BANK EROSION AND RIPARIAN ZONE

Check ONE in each category for EACH BANK (Or 2 per bank & average)

River right looking downstream

EROSION (L / R)	RIPARIAN WIDTH (L / R)	FLOOD PLAIN QUALITY (L / R)	
☐ ☐ NONE / LITTLE [3]	☐ ☐ WIDE > 50m [4]	☐ ☒ FOREST, SWAMP [3]	☐ ☐ CONSERVATION TILLAGE [1]
☒ ☒ MODERATE [2]	☐ ☒ MODERATE 10-50m [3]	☐ ☐ SHRUB OR OLD FIELD [2]	☐ ☐ URBAN OR INDUSTRIAL [0]
☐ ☐ HEAVY / SEVERE [1]	☐ ☐ NARROW 5-10m [2]	☒ ☐ RESIDENTIAL, PARK, NEW FIELD [1]	☐ ☐ MINING / CONSTRUCTION [0]
2	☐ ☐ VERY NARROW < 5m [1]	☐ ☐ FENCED PASTURE [1]	
	☒ ☐ NONE [0]	☐ ☐ OPEN PASTURE, ROWCROP [0]	
	1.5	2	

Indicate predominant land use(s) past 100m riparian.

Comments

Riparian 5.5 / Maximum 10

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH Check ONE (ONLY!)

☐ > 1m [6]
☐ 0.7-<1m [4]
☐ 0.4-<0.7m [2]
☒ 0.2-<0.4m [1]
☐ < 0.2m [0]

CHANNEL WIDTH Check ONE (Or 2 & average)

☐ POOL WIDTH > RIFFLE WIDTH [2]
☒ POOL WIDTH = RIFFLE WIDTH [1]
☐ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY Check ALL that apply

☐ TORRENTIAL [-1] ☒ SLOW [1]
☐ VERY FAST [1] ☐ INTERSTITIAL [-1]
☐ FAST [1] ☐ INTERMITTENT [-2]
☐ MODERATE [1] ☐ EDDIES [1]

Indicate for reach - pools and riffles.

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments

Pool / Current 3 / Maximum 12

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (Or 2 & average)

☒ NO RIFFLE [metric=0]

RIFFLE DEPTH	RUN DEPTH	RIFFLE / RUN SUBSTRATE	RIFFLE / RUN EMBEDDEDNESS
☐ BEST AREAS > 10cm [2]	☐ MAXIMUM > 50cm [2]	☐ STABLE (e.g., Cobble, Boulder) [2]	☐ NONE [2]
☐ BEST AREAS 5-10cm [1]	☐ MAXIMUM < 50cm [1]	☐ MOD. STABLE (e.g., Large Gravel) [1]	☐ LOW [1]
☐ BEST AREAS < 5cm [metric=0]		☐ UNSTABLE (e.g., Fine Gravel, Sand) [0]	☐ MODERATE [0] ☐ EXTENSIVE [-1]

Comments

Riffle / Run 0 / Maximum 8

6] GRADIENT

(3.05 ft/mi) ☒ VERY LOW - LOW [2-4] ☐ MODERATE [6-10] ☐ HIGH - VERY HIGH [10-6]

DRAINAGE AREA (29.0 mi²)

%POOL: 0 %GLIDE: 0 %RUN: 100 %RIFFLE: 0

Gradient 10 / Maximum 10

Stream 10 / Town Creek

A] SAMPLED REACH

Check ALL that apply

METHOD

- ☐ BOAT
- ☒ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE

1st -sample pass-		2nd
☐	HIGH	☐
☐	UP	☐
☒	NORMAL	☐
☐	LOW	☐
☐	DRY	☐

DISTANCE

- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☐ OTHER

6 / meters

CLARITY

1st --sample pass--		2nd
☐	< 20 cm	☐
☒	20-<40 cm	☐
☐	40-70 cm	☐
☐	> 70 cm/ CTB	☐
☐	SECCHI DEPTH	☐

CANOPY

- ☒ > 85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

pass: 1st _____ cm; 2nd _____ cm

C] RECREATION AREA DEPTH

POOL: ☐ >100ft² ☐ >3ft

Comment RE: Reach consistency/ Is reach typical of steam?, *Recreation/* Observed - Inferred, *Other/* Sampling observations, Concerns, Access directions, etc.

pH = 8.3 Temp = 22.8

B] AESTHETICS

- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☐ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☐ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

D] MAINTENANCE

Circle some & *COMMENT*

PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

channelized for flood control

highly incized

E] ISSUES

WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS

- $\bar{x}$ width
- $\bar{x}$ depth
- max. depth
- $\bar{x}$ bankfull width
- bankfull $\bar{x}$ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree:

Stream Drawing:

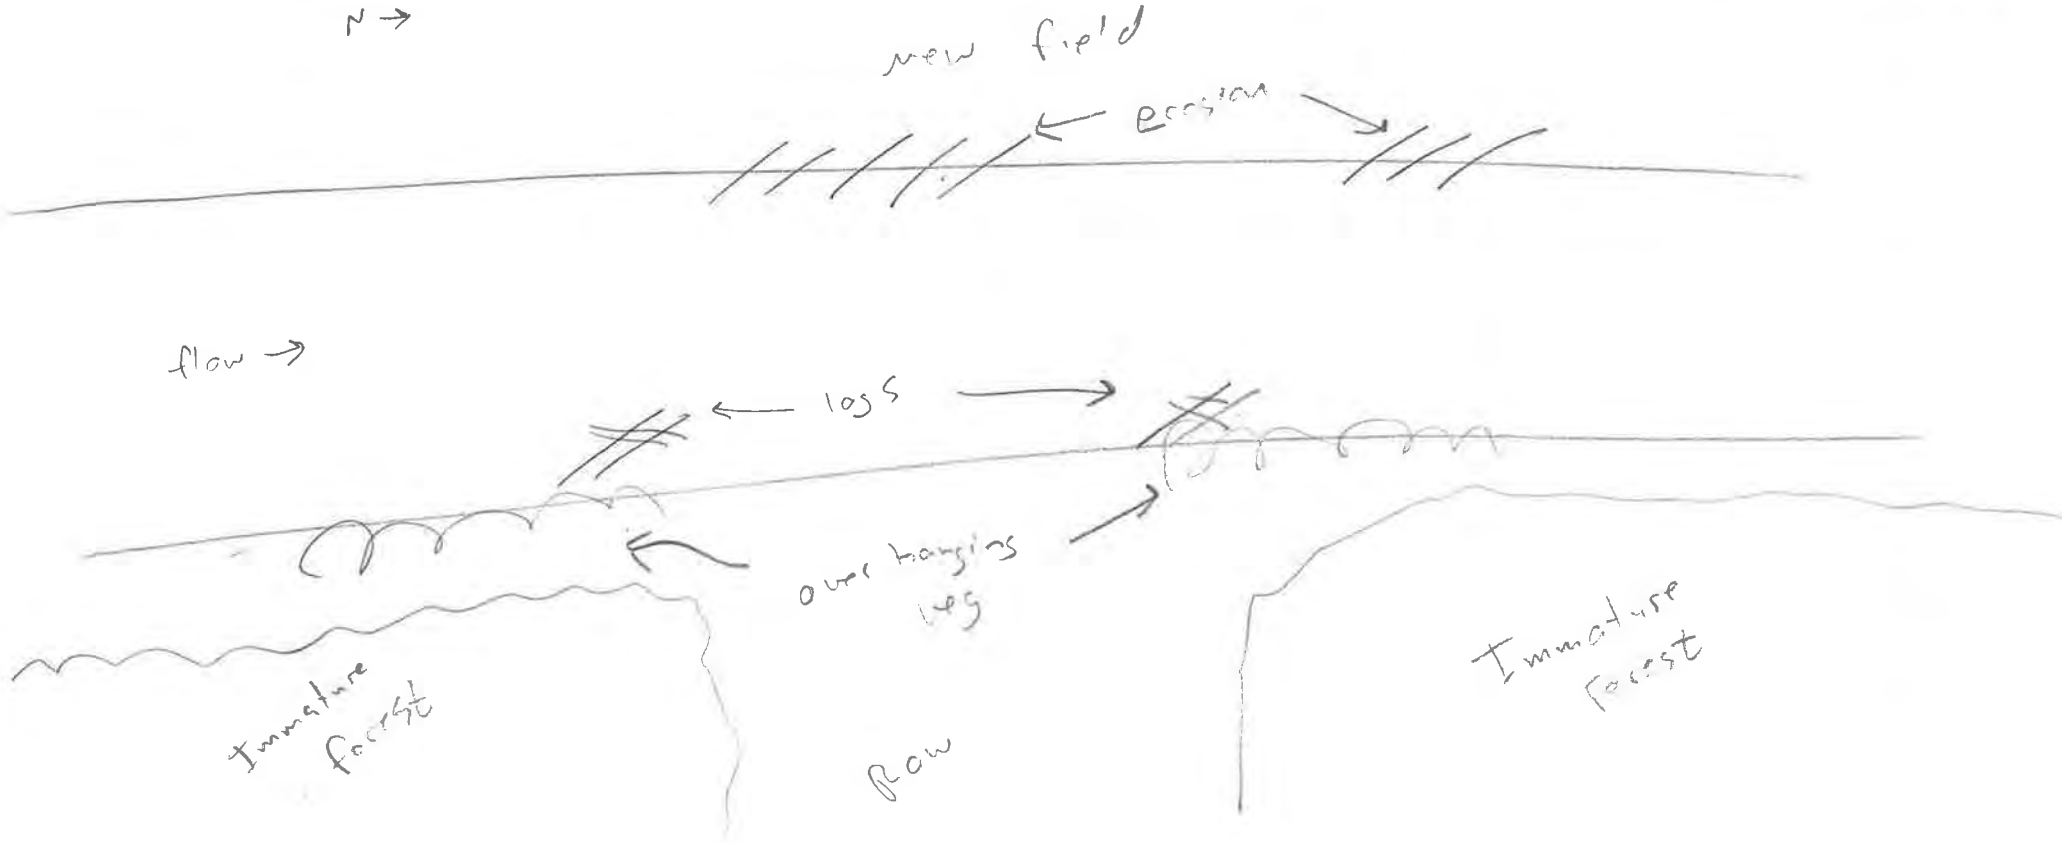

OhioEPA Qualitative Habitat Evaluation Index and Use Assessment Field Sheet

QHEI Score: 41

Stream & Location: Haviland-Van Wert 69kV Line Rebuild Proj RM: ___ Date: 12/09/06

Stream 11 / Town Creek

Scorers Full Name & Affiliation: M. Casey

River Code: ___-___-___ STORET #: _____ Lat/Long: (NAD 83 - decimal °) 40.892102 -84.582467 Office verified location ☐

1] SUBSTRATE Check *ONLY* **Two** substrate *TYPE BOXES*; estimate % or note every type present

Check ONE (*Or 2 & average*)

BEST TYPES	POOL	RIFFLE	OTHER TYPES	POOL	RIFFLE
☐☐ BLDR /SLABS [10]	___	___	☐☐ HARDPAN [4]	___	___
☐☐ BOULDER [9]	___	___	☐☐ DETRITUS [3]	5	___
☐☐ COBBLE [8]	___	___	☐☐ MUCK [2]	___	___
☐☒ GRAVEL [7]	35	___	☒☐ SILT [2]	45	___
☐☐ SAND [6]	15	___	☐☐ ARTIFICIAL [0]	___	___
☐☐ BEDROCK [5]	___	___	(Score natural substrates; ignore sludge from point-sources)		

NUMBER OF BEST TYPES: ☐ 4 or more [2] ☒ 3 or less [0]

ORIGIN: ☐ LIMESTONE [1] ☒ TILLS [1] ☐ WETLANDS [0] ☐ HARDPAN [0] ☐ SANDSTONE [0] ☐ RIP/RAP [0] ☐ LACUSTURINE [0] ☐ SHALE [-1] ☐ COAL FINES [-2]

QUALITY: SILT: ☒ HEAVY [-2] ☐ MODERATE [-1] ☐ NORMAL [0] ☐ FREE [1]; EMBEDDEDNESS: ☒ EXTENSIVE [-2] ☐ MODERATE [-1] ☐ NORMAL [0] ☐ NONE [1]

Comments

Substrate: 6 (Maximum 20)

2] INSTREAM COVER Indicate presence 0 to 3: **0**-Absent; **1**-Very small amounts or if more common of marginal quality; **2**-Moderate amounts, but not of highest quality or in small amounts of highest quality; **3**-Highest quality in moderate or greater amounts (e.g., very large boulders in deep or fast water, large diameter log that is stable, well developed rootwad in deep / fast water, or deep, well-defined, functional pools.

___ UNDERCUT BANKS [1]	___ POOLS > 70cm [2]	___ OXBOWS, BACKWATERS [1]
___ OVERHANGING VEGETATION [1]	___ ROOTWADS [1]	___ AQUATIC MACROPHYTES [1]
___ SHALLOWS (IN SLOW WATER) [1]	___ BOULDERS [1]	___ LOGS OR WOODY DEBRIS [1]
___ ROOTMATS [1]		

AMOUNT (Check ONE (*Or 2 & average*)): ☐ EXTENSIVE >75% [11] ☐ MODERATE 25-75% [7] ☒ SPARSE 5-<25% [3] ☐ NEARLY ABSENT <5% [1]

Comments

Cover Maximum 20: 6

3] CHANNEL MORPHOLOGY Check ONE in each category (*Or 2 & average*)

SINUOSITY	DEVELOPMENT	CHANNELIZATION	STABILITY
☐ HIGH [4]	☐ EXCELLENT [7]	☐ NONE [6]	☐ HIGH [3]
☐ MODERATE [3]	☐ GOOD [5]	☒ RECOVERED [4]	☒ MODERATE [2]
☒ LOW [2]	☐ FAIR [3]	☒ RECOVERING [3]	☐ LOW [1]
☐ NONE [1]	☒ POOR [1]	☐ RECENT OR NO RECOVERY [1]	

Comments

Channel Maximum 20: 8.5

4] BANK EROSION AND RIPARIAN ZONE Check **ONE** in each category for *EACH BANK* (*Or 2 per bank & average*)

River right looking downstream

EROSION L	EROSION R	RIPARIAN WIDTH L	RIPARIAN WIDTH R
☒ NONE / LITTLE [3]	☒ NONE / LITTLE [3]	☐ WIDE > 50m [4]	☐ WIDE > 50m [4]
☒ MODERATE [2]	☒ MODERATE [2]	☐ MODERATE 10-50m [3]	☐ MODERATE 10-50m [3]
☐ HEAVY / SEVERE [1]	☐ HEAVY / SEVERE [1]	☒ NARROW 5-10m [2]	☐ NARROW 5-10m [2]
		☐ VERY NARROW < 5m [1]	☐ VERY NARROW < 5m [1]
		☐ NONE [0]	☒ NONE [0]

FLOOD PLAIN QUALITY L	FLOOD PLAIN QUALITY R	
☐ FOREST, SWAMP [3]	☒ FOREST, SWAMP [3]	☐ CONSERVATION TILLAGE [1]
☒ SHRUB OR OLD FIELD [2]	☒ SHRUB OR OLD FIELD [2]	☐ URBAN OR INDUSTRIAL [0]
☐ RESIDENTIAL, PARK, NEW FIELD [1]	☐ RESIDENTIAL, PARK, NEW FIELD [1]	☐ MINING / CONSTRUCTION [0]
☐ FENCED PASTURE [1]	☐ FENCED PASTURE [1]	
☐ OPEN PASTURE, ROWCROP [0]	☐ OPEN PASTURE, ROWCROP [0]	

Indicate predominant land use(s) past 100m riparian.

Comments

Riparian Maximum 10: 5.5

5] POOL / GLIDE AND RIFFLE / RUN QUALITY

MAXIMUM DEPTH Check **ONE** (*ONLY!*)
☐ > 1m [6] ☒ 0.7-<1m [4] ☐ 0.4-<0.7m [2] ☐ 0.2-<0.4m [1] ☐ < 0.2m [0]

CHANNEL WIDTH Check ONE (*Or 2 & average*)
☐ POOL WIDTH > RIFFLE WIDTH [2] ☒ POOL WIDTH = RIFFLE WIDTH [1] ☐ POOL WIDTH > RIFFLE WIDTH [0]

CURRENT VELOCITY Check ALL that apply
☐ TORRENTIAL [-1] ☒ SLOW [1] ☐ VERY FAST [1] ☐ INTERSTITIAL [-1] ☐ FAST [1] ☐ INTERMITTENT [-2] ☐ MODERATE [1] ☐ EDDIES [1]
Indicate for reach - pools and riffles.

Recreation Potential
Primary Contact
Secondary Contact
(circle one and comment on back)

Comments

Pool / Current Maximum 12: 6

Indicate for functional riffles; Best areas must be large enough to support a population of riffle-obligate species: Check ONE (*Or 2 & average*). ☐ NO RIFFLE [metric=0]

RIFFLE DEPTH	RUN DEPTH	RIFFLE / RUN SUBSTRATE	RIFFLE / RUN EMBEDDEDNESS
☒ BEST AREAS > 10cm [2]	☒ MAXIMUM > 50cm [2]	☐ STABLE (e.g., Cobble, Boulder) [2]	☐ NONE [2]
☐ BEST AREAS 5-10cm [1]	☐ MAXIMUM < 50cm [1]	☐ MOD. STABLE (e.g., Large Gravel) [1]	☐ LOW [1]
☐ BEST AREAS < 5cm [metric=0]		☒ UNSTABLE (e.g., Fine Gravel, Sand) [0]	☐ MODERATE [0] ☒ EXTENSIVE [-1]

Comments

Riffle / Run Maximum 8: 3

6] GRADIENT (3.27 ft/mi) **DRAINAGE AREA** (30.5 mi²)

☐ VERY LOW - LOW [2-4] ☒ MODERATE [6-10] ☐ HIGH - VERY HIGH [10-6]

%POOL: ___ %GLIDE: 100 %RUN: ___ %RIFFLE: ___

Gradient Maximum 10: 6

A] SAMPLED REACH

Check ALL that apply

METHOD

- ☐ BOAT
- ☐ WADE
- ☐ L. LINE
- ☐ OTHER

STAGE

1st -sample pass-	2nd
☐ HIGH	☐
☐ UP	☐
☐ NORMAL	☐
☐ LOW	☐
☐ DRY	☐

DISTANCE

- ☐ 0.5 Km
- ☐ 0.2 Km
- ☐ 0.15 Km
- ☐ 0.12 Km
- ☐ OTHER

_____ meters

CLARITY

1st --sample pass--	2nd
☐ < 20 cm	☐
☐ 20-<40 cm	☐
☐ 40-70 cm	☐
☐ > 70 cm/ CTB	☐
☐ SECCHI DEPTH	☐

1st pass _____ cm

2nd _____ cm

CANOPY

- ☐ > 85%- OPEN
- ☐ 55%-<85%
- ☐ 30%-<55%
- ☐ 10%-<30%
- ☐ <10%- CLOSED

Comment RE: Reach consistency/ Is reach typical of steam?, *Recreation/* Observed - Inferred, *Other/* Sampling observations, Concerns, Access directions, etc.

OHWM: 34ft W, 3ft D

BF: 37ft W, 10ft D

B] AESTHETICS

- ☐ NUISANCE ALGAE
- ☐ INVASIVE MACROPHYTES
- ☐ EXCESS TURBIDITY
- ☐ DISCOLORATION
- ☐ FOAM / SCUM
- ☐ OIL SHEEN
- ☐ TRASH / LITTER
- ☐ NUISANCE ODOR
- ☐ SLUDGE DEPOSITS
- ☐ CSOs/SSOs/OUTFALLS

C] RECREATION

POOL: AREA ☐ >100ft² DEPTH ☐ >3ft

D] MAINTENANCE

Circle some & *COMMENT*

PUBLIC / PRIVATE / BOTH / NA
ACTIVE / HISTORIC / BOTH / NA
YOUNG-SUCCESSION-OLD
SPRAY / SNAG / REMOVED
MODIFIED / DIPPED OUT / NA
LEVEED / ONE SIDED
RELOCATED / CUTOFFS
MOVING-BEDLOAD-STABLE
ARMOURED / SLUMPS
ISLANDS / SCOURED
IMPOUNDED / DESICCATED
FLOOD CONTROL / DRAINAGE

E] ISSUES

WWTP / CSO / NPDES / INDUSTRY
HARDENED / URBAN / DIRT&GRIME
CONTAMINATED / LANDFILL
BMPs-CONSTRUCTION-SEDIMENT
LOGGING / IRRIGATION / COOLING
BANK / EROSION / SURFACE
FALSE BANK / MANURE / LAGOON
WASH H_20 / TILE / H_20 TABLE
ACID / MINE / QUARRY / FLOW
NATURAL / WETLAND / STAGNANT
PARK / GOLF / LAWN / HOME
ATMOSPHERE / DATA PAUCITY

F] MEASUREMENTS

- $\bar{x}$ width
- $\bar{x}$ depth
- max. depth
- $\bar{x}$ bankfull width
- bankfull $\bar{x}$ depth
- W/D ratio
- bankfull max. depth
- floodprone x^2 width
- entrench. ratio

Legacy Tree:

Stream Drawing:

Headwater Habitat Evaluation Index Field Form

Ohio Environmental Protection Agency

HHEI Score (sum of metrics 1+2+3) 45

SITE NAME/LOCATION Haviland - Van Wert 69 KV Line rebuild project

SITE NUMBER Stream 12 RIVER BASIN Auglaize RIVER CODE _____ DRAINAGE AREA (mi²) 0.16

LENGTH OF STREAM REACH (ft) 163 LAT 40.855229 LONG -84.572269 RIVER MILE _____

DATE 4/16/25 SCORER C. Chastain COMMENTS Intermittent

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE / NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☑ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY* two predominant substrate *TYPE* boxes. (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐	BLDR SLABS **[16 pts]**		☑	SILT **[3 pt]**	40
☐	BOULDER (>256 mm)**[16 pts]**		☐	LEAF PACK/WOODY DEBRIS**[3 pts]**	5
☐	BEDROCK **[16 pts]**		☐	FINE DETRITUS **[3 pts]**	10
☐	COBBLE (65-256 mm)**[12 pts]**	5	☐	CLAY or HARDPAN **[0 pt]**	
☐	GRAVEL (2-64 mm)**[9 pts]**	10	☐	MUCK **[0 pts]**	
☑	SAND (<2 mm) **[6 pts]**	30	☐	ARTIFICIAL **[3 pts]**	

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 5 (A) 9

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES:

(B) 6 **TOTAL NUMBER OF SUBSTRATE TYPES:**

HHEI Metric Points

Substrate Max = 40 15

A + B

2. Maximum Pool Depth (*Measure the maximum pool depth within the 61 meter (200 feet)* evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

- ☐ > 30 centimeters **[20 pts]**
- ☐ > 22.5 - 30 cm **[30 pts]**
- ☐ > 10 - 22.5 cm **[25 pts]**
- ☑ 5 cm - 10 cm **[15 pts]**
- ☐ < 5 cm **[5pts]**
- ☐ NO WATER OR MOIST CHANNEL **[0pts]**

COMMENTS _____ **MAXIMUM POOL DEPTH (centimeters):** 7.5

Pool Depth Max = 30 15

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

- ☐ > 4.0 meters (> 13') **[30 pts]**
- ☐ > 3.0 m - 4.0 m (> 9' 7"- 13') **[25 pts]**
- ☐ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") **[20 pts]**
- ☑ > 1.0 m - 1.5 m (> 3' 3" - 4' 8")**[15 pts]**
- ☐ ≤ 1.0 m (≤ 3' 3")**[5 pts]**

COMMENTS _____ **AVERAGE BANKFULL WIDTH (meters)** 1.2

Bankfull Width Max=30 15

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ★NOTE: River Left (L) and Right (R) as looking downstream★

RIPARIAN WIDTH (Per Bank)

L	R	
☐	☐	Wide >10m
☐	☐	Moderate 5-10m
☑	☐	Narrow <5m
☐	☑	None

FLOODPLAIN QUALITY (Most Predominant per Bank)

L	R		L	R	
☐	☐	Mature Forest, Wetland	☐	☐	Conservation Tillage
☐	☐	Immature Forest, Shrub or Old Field	☐	☑	Urban or Industrial
☑	☐	Residential, Park, New Field	☐	☐	Open Pasture, Row Crop
☐	☐	Fenced Pasture	☐	☐	Mining or Construction

COMMENTS _____

FLOW REGIME *(At Time of Evaluation)* (Check *ONLY* one box):

- ☑ Stream Flowing
- ☐ Subsurface flow with isolated pools (interstitial)
- ☐ Moist Channel, isolated pools, no flow (intermittent)
- ☐ Dry channel, no water (ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☑ None	☐ 1.0	☐ 2.0	☐ 3.0
☐ 0.5	☐ 1.5	☐ 2.5	☐ >3

STREAM GRADIENT ESTIMATE

☐ Flat (0.5 ft/100 ft) ☑ Flat to Moderate ☐ Moderate (2 ft/100 ft) ☐ Moderate to Severe ☐ Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☐ Yes ☑ No QHEI Score _____ (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S)

☑ WWH Name: Little Auglaize River Distance from Evaluated Stream ~15mi

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Scott, OH NRCS Soil Map Page: ✓ NRCS Soil Map Stream Order: ✓

County: Van Wert Township/City: Van Wert

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 4/10/25 Quantity: 0.05in

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 100

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): _____

Field Measures: Temp (°C) 10 Dissolved Oxygen (mg/l) ✓ pH (S.U.) 9.4 Conductivity (umhos/cm) ✓

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) N Species observed (if known): _____

Frogs or Tadpoles Observed? (Y/N) N Species observed (if known): _____

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

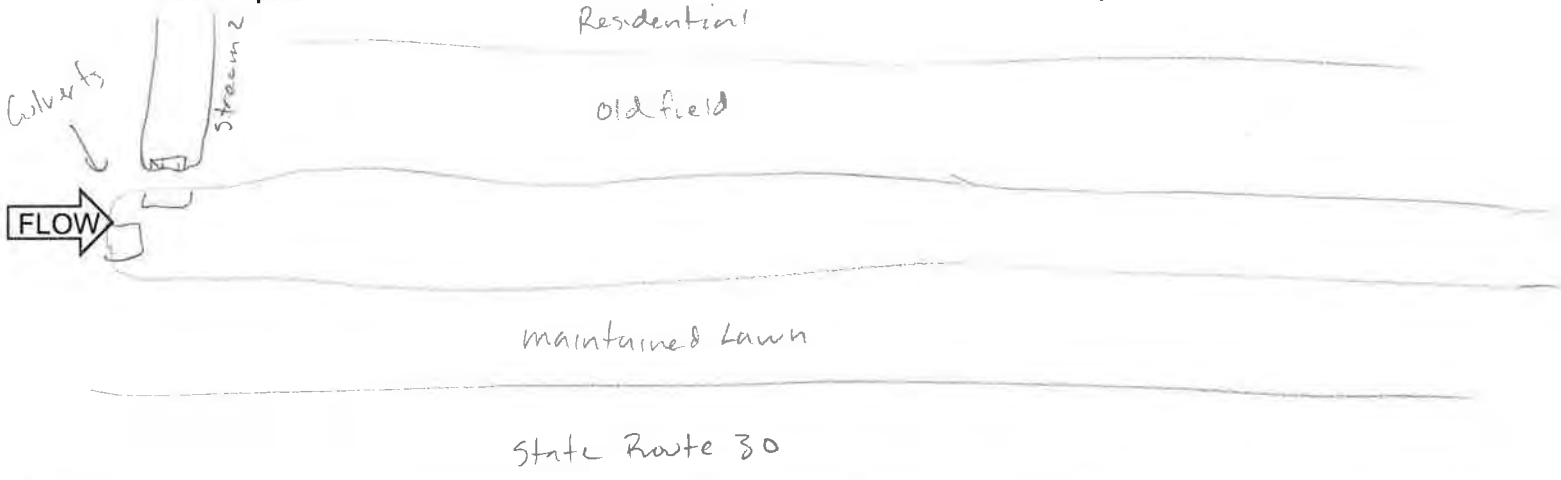

Headwater Habitat Evaluation Index Field Form

HHEI Score (sum of metrics 1+2+3) 18

SITE NAME/LOCATION Haviland - Van Wert 69 kV Line rebuild Project

SITE NUMBER stream 13 RIVER BASIN Auglaize RIVER CODE _____ DRAINAGE AREA (mi²) <1

LENGTH OF STREAM REACH (ft) 246 LAT 40.195146 LONG -84.572164 RIVER MILE _____

DATE 4/16/25 SCORER C. Chastain COMMENTS ephemeral

NOTE: Complete All Items On This Form - Refer to "Headwater Habitat Evaluation Index Field Manual" for Instructions

STREAM CHANNEL MODIFICATIONS: ☐ NONE / NATURAL CHANNEL ☐ RECOVERED ☐ RECOVERING ☑ RECENT OR NO RECOVERY

1. SUBSTRATE (Estimate percent of every type present). Check *ONLY* two predominant substrate *TYPE* boxes. (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B

TYPE		PERCENT	TYPE		PERCENT
☐☐	BLDR SLABS **[16 pts]**		☐☑	SILT **[3 pt]**	80
☐☐	BOULDER (>256 mm)**[16 pts]**		☐☐	LEAF PACK/WOODY DEBRIS **[3 pts]**	5
☐☐	BEDROCK **[16 pts]**		☐☐	FINE DETRITUS **[3 pts]**	
☐☐	COBBLE (65-256 mm)**[12 pts]**		☐☐	CLAY or HARDPAN **[0 pt]**	
☐☑	GRAVEL (2-64 mm)**[9 pts]**	5	☐☐	MUCK **[0 pts]**	
☑☐	SAND (<2 mm) **[6 pts]**	10	☐☐	ARTIFICIAL **[3 pts]**	

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock _____ **(A)** 9

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES:

(B) 4 **TOTAL NUMBER OF SUBSTRATE TYPES:**

HHEI Metric Points

Substrate Max = 40

13

A + B

2. Maximum Pool Depth (*Measure the maximum pool depth within the 61 meter (200 feet)* evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check *ONLY* one box):

- ☐ > 30 centimeters **[20 pts]**
- ☐ > 22.5 - 30 cm **[30 pts]**
- ☐ > 10 - 22.5 cm **[25 pts]**
- ☐ 5 cm - 10 cm **[15 pts]**
- ☐ < 5 cm **[5pts]**
- ☑ NO WATER OR MOIST CHANNEL **[0pts]**

COMMENTS _____ **MAXIMUM POOL DEPTH (centimeters):** 0

Pool Depth Max = 30

0

3. BANK FULL WIDTH (Measured as the average of 3 - 4 measurements) (Check *ONLY* one box):

- ☐ > 4.0 meters (> 13') **[30 pts]**
- ☐ > 3.0 m - 4.0 m (> 9' 7"- 13') **[25 pts]**
- ☐ > 1.5 m - 3.0 m (> 4' 8" - 9' 7") **[20 pts]**
- ☐ > 1.0 m - 1.5 m (> 3' 3" - 4' 8") **[15 pts]**
- ☑ ≤ 1.0 m (≤ 3' 3") **[5 pts]**

COMMENTS _____ **AVERAGE BANKFULL WIDTH (meters)** 0.3

Bankfull Width Max=30

5

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ★ NOTE: River Left (L) and Right (R) as looking downstream ★

RIPARIAN WIDTH (Per Bank)

L	R	
☐	☐	Wide >10m
☐	☐	Moderate 5-10m
☐	☐	Narrow <5m
☑	☑	None

FLOODPLAIN QUALITY (Most Predominant per Bank)

L	R		L	R	
☐	☐	Mature Forest, Wetland	☐	☐	Conservation Tillage
☐	☐	Immature Forest, Shrub or Old Field	☐	☐	Urban or Industrial
☑	☑	Residential, Park, New Field	☐	☐	Open Pasture, Row Crop
☐	☐	Fenced Pasture	☐	☐	Mining or Construction

COMMENTS _____

FLOW REGIME *(At Time of Evaluation)* (Check *ONLY* one box):

- ☐ Stream Flowing
- ☐ Subsurface flow with isolated pools (interstitial)
- ☐ Moist Channel, isolated pools, no flow (intermittent)
- ☑ Dry channel, no water (ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

☐ None	☐ 1.0	☐ 2.0	☐ 3.0
☑ 0.5	☐ 1.5	☐ 2.5	☐ >3

STREAM GRADIENT ESTIMATE

☐ Flat (0.5 ft/100 ft) ☐ Flat to Moderate ☑ Moderate (2 ft/100 ft) ☐ Moderate to Severe ☐ Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? ☐ Yes ☑ No QHEI Score _____ (If Yes, Attach Completed QHEI form)

DOWNSTREAM DESIGNATED USE(S),

☑ WWH Name: Little Auglaize River Distance from Evaluated Stream ~15mi

☐ CWH Name: _____ Distance from Evaluated Stream _____

☐ EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION.

USGS Quadrangle Name: Scott, OH NRCS Soil Map Page: _____ NRCS Soil Map Stream Order: _____

County: Van Wert Township/City: Van Wert

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 4/10/25 Quantity: 0.05in

Photo-documentation Notes: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 100

Were samples collected for water chemistry? (Y/N): N Lab Sample # or ID (attach results): /

Field Measures: Temp (°C) / Dissolved Oxygen (mg/l) / pH (S.U.) / Conductivity (umhos/cm) /

Is the sampling reach representative of the stream (Y/N) Y If not, explain: _____

Additional comments/description of pollution impacts: _____

BIOLOGICAL OBSERVATIONS

(Record all observations below)

Fish Observed? (Y/N) N Species observed (if known): _____

Frogs or Tadpoles Observed? (Y/N) N Species observed (if known): _____

Salamanders Observed? (Y/N) N Species observed (if known): _____

Aquatic Macroinvertebrates Observed? (Y/N) N Species observed (if known): _____

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed)

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location